

TECHNICAL DATA SHEET

Extra universal adhesive

Art. no. 0893 100 022

P. Qty.: 1 / 12

Neoprene-based contact adhesive


For bonding coatings and other surface bonding on materials such as wood, chipboard, wood fibre and hard veneer panels, cork, laminate boards (Resopal, Ultrataps), many plastics (such as hard PVC, PMMA*, polyester, polyamide, polycarbonate*, hard foams consisting of phenolic resin and polyurethane), metals (such as lead, steel, iron, copper, aluminium, brass), rubber, felt, textiles, leather, glass, fibreglass, concrete, aerated concrete, plaster, gypsum plaster-board, together and layered.

*Risk of stress crack formation!



Contents	185 ml
Container	Tube
Chemical basis	Solvent neoprene
Colour	Amber
Density/conditions	0.86 g/cm ³ /prior to hardening, DIN 53479
Viscosity	3200 mPas
Viscosity conditions	Brookfield
Min./max. application quantity in surface bonding/conditions	250-300 g/m ² /bilateral application
Min./max. pressing pressure	7-8 N/mm ²
Min./max. flash-off time/conditions	10 min-15 min/at 20 °C and 50% relative humidity
Max. open time	45 min
Conditions for open time	at 20 °C and 50% humidity
Max. final strength	24 h
Min./max. processing temperature	12 to 30 °C
Min./max. temperature resistance	-20 to 125 °C
Resistance against	Alcohol, Diluted acids and lyes, Water
Shelf life from production/conditions	18 Month/at 18 °C, no exposure to sunlight
Silicone-free	Yes
Solvent-free	No

TECHNICAL DATA SHEET

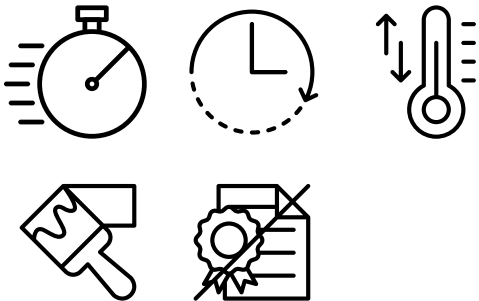

Application area

For applying coatings and other surface bonding.

Application information

Prior to use, the contact points must be dry and clean, and free of dust and grease. Processing temperature must not be below +12 °C.

A generous, uniform layer of the adhesive can be applied to both surfaces with a brush or fine-tooth spatula (tooth depth approx. 1 mm). The flash-off time must be at least 10 to 15 minutes, depending on the ambient temperature. The open time of the adhesive is approx. 45 minutes. Using your knuckles, test until the adhesive no longer exhibits stringing at the thickest point of application (see note).

Press the parts to be bonded together briefly with pressure. Sufficient pressing force is essential to ensure positive adhesion. Tension-free bonds can be processed further immediately. The adhesive is fully cured after approx. 24 hours depending on the ambient temperature. For this reason, bonds under tension must remain fixed this long.

Note:

Using your knuckles, test to ensure that the adhesive no longer exhibits stringing at the thickest point of application. Testing with your fingertips can lead to contamination with grease, dirt or similar contaminants in the adhesive surface. If adhesive sticks to your knuckles, the adhesive is still too wet. If the adhesive does not stick to your knuckles, the components can be joined.

Notice

- Not to be used on polystyrene, soft PVC, PVC films, PE and PP
- Smooth surfaces should be sanded
- Limited resistance to moisture

The usage instructions are recommendations based on the tests we have conducted and on our experience; carry out your own tests before each application. Due to the large number of applications and storage and processing conditions, we do not assume any liability for a specific application result. Insofar as our free customer service provides technical information or acts as an advisory service, no responsibility is assumed by this service except where the advice or information given falls within the scope of our specified, contractually agreed service or the advisor was acting with deliberate intent. We ensure the consistent quality of our products. We reserve the right to make technical changes and further develop products. Please observe the technical data sheet!