
How To Clear an SSPM Coin Jam

This task topic discusses how to clear a coin jam from the IPS Group, Inc. SSPM.

When a coin jam occurs in the SSPM, the meter maintenance staff is notified via email or text message. Coin jams typically occur from intentionally actions, when foreign material is inserted, and / or when multiple coins are simultaneously inserted, into the coin slot. But the design of the meter is such that coin jams will happen very infrequently.

To clear a coin jam from the SSPM:

- 1. Remove the meter mechanism from the meter base housing.
- 2. Remove the validator screw from the front of the meter mechanism.
- 3. Pull the validator from the rear of the meter mechanism by squeezing the spring loaded retention clip. The jam will be visible due to the design of the clear validator cover.

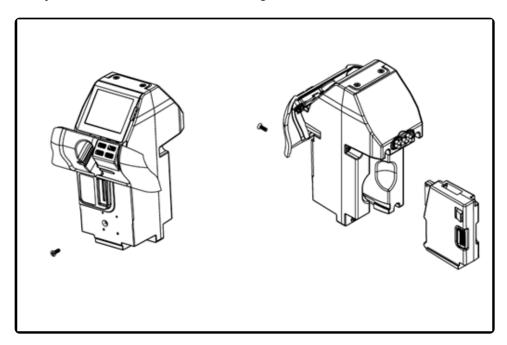

- 4. Insert a thin object (such as a screwdriver) to remove the jam. If necessary, disassemble the validator completely by removing the screws at the corners of the validator assembly.
- 5. Return the cleared validator to the rear of the meter housing, clipping it into its original position.
- 6. Replace the validator screw to the front of the meter mechanism.
- Reinstall the meter mechanism into the meter housing.