

ZOOM ® View™	Report Created 05 Aug 2020
--------------	----------------------------

Combined Follow-up Report

Date of Birth N/R N/R N/R

Device ACCOLADE MRI L311/269927 Last Office Interrogation

03 Apr 2019 Implant Date N/R

My Alerts

There are no alerts to display.

Events Since Last Reset (23 Mar 2017)

25 Jul 2020 12:06 RYTHMIQ at 45 min⁻¹ 25 Jul 2020 11:48 RYTHMIQ at 64 min⁻¹ See last page for full list of Events Since Last Reset.

OK

Approximate time to explant: 6 years Magnet Rate 100 min⁻¹

One Year Remaining Explant

		—	
Leads Data Implant N/R N/R N/R		Previous Session	Most Recent
Atrial			
Intrinsic Amplitude	N/R mV	2.4 mV	3.2 mV
Pace Impedance	N/R Ω	740 Ω	$765~\Omega$
Pace Threshold	N/R V @ N/R ms	Auto 0.9 V @ 0.4 ms	Test Failed
Ventricular			
Intrinsic Amplitude	N/R mV	15.4 mV	8.4 mV @ 38 min ⁻¹
Pace Impedance	N/R Ω	$660~\Omega$	632 Ω
Pace Threshold	N/R V @ N/R ms	Auto 0.5 V @ 0.4 ms	Auto 1.0 V @ 0.4 ms
Settings			

Ventricular Tachy Settings

Atrial Tachy Settings

Ventricular Tachy EGM Storage ATR Mode Switch 170 min⁻¹ DDI On 160 min⁻¹

Brady Settings

Detection Rate

DDDR Pacing Output Mode Auto 2.0 V @ 0.4 ms RYTHMIQ™ **AAIR With** Atrial Trend 2.5 V @ 0.4 ms VVI Backup Ventricular Lower Rate Limit Sensitivity 55 min⁻¹ Maximum Tracking Rate 130 min⁻¹ Atrial Fixed 0.5 mV Maximum Sensor Rate 130 min⁻¹ Fixed 2.0 mV Ventricular Paced AV Delay 80 - 180 ms Leads Configuration (Pace/Sense) Sensed AV Delay 65 - 150 ms Atrial **Bipolar** A-Refractory (PVARP) 240 - 280 ms Ventricular **Bipolar** V-Refractory (VRP) 230 - 250 ms

Rate Adaptive Pacing


Minute Ventilation On Accelerometer **Passive**

2869 Software Version: 2.06

L311 Firmware Version: F_v1.00.00(1.10)

© 2014 Boston Scientific Corporation or its affiliates. All rights reserved. Page 1 of 8

Clinician Signature:

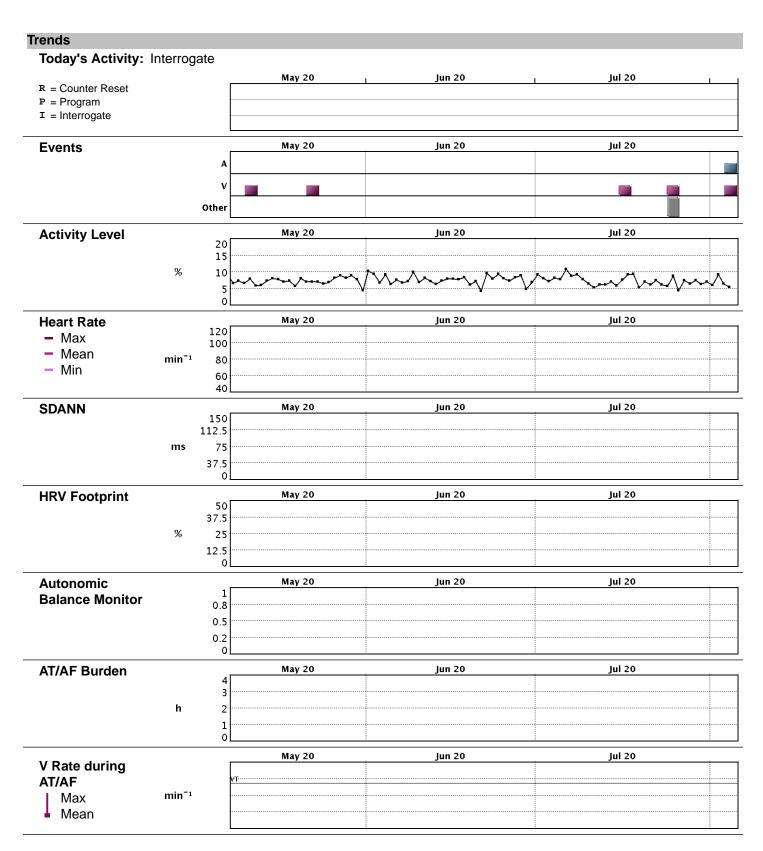



2869 Software Version: 2.06 L311 Firmware Version: F_v1.00.00(1.10) © 2014

Boston Scientific Corporation
or its affiliates. All rights reserved.

Page 2 of 8

Clinician Signature:		

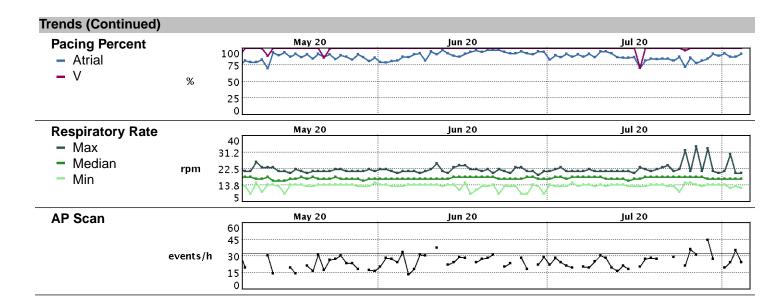

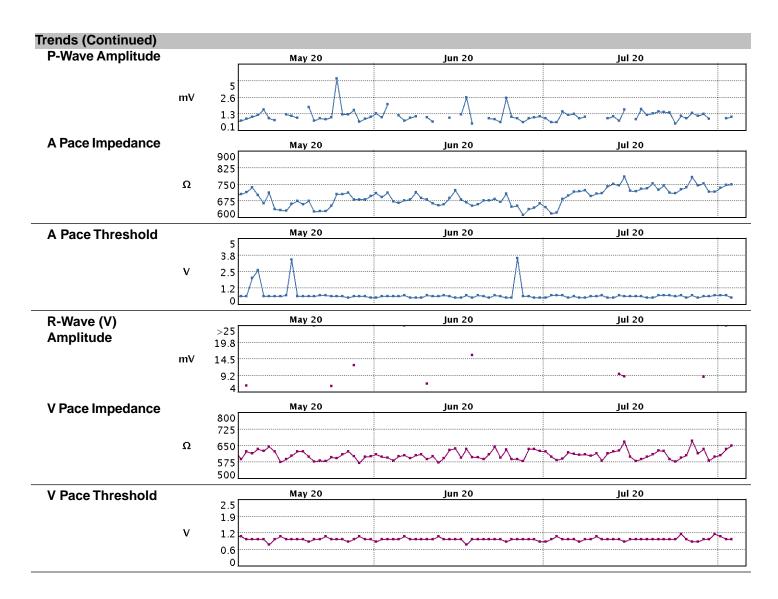

Ventricular Tachy Counters	Since Last Reset 23 Mar 2017	Device Totals	
Ventricular Episode Counters			
Total Episodes	0	0	
VT Episodes (V>A)	0	0	
SVT Episodes (V<=A)	0	0	
Nonsustained Episodes	0	0	
Brady Counters	Reset Before Last N/R day(s) N/R to 23 Mar 2017	Since Last Reset 1231 day(s) 23 Mar 2017 to Today	
Counters			
% A Paced	0	86	
% V Paced	0	52	
Intrinsic Promotion			
AV Search +			
% Successful	0	4	
Rate Hysteresis			
% Successful	0	0	
Atrial Arrhythmia			
% AT/AF	N/R	0	
(One Year of Data)			
Total Time in AT/AF (min)	N/R	0.0	
(One Year of Data)			
Episodes by Duration			
< 1 minute	0	0	
1 min - < 1 hr	0	0	
1 hr - < 24 hr	0	0	
24 hr - < 48 hr	0	0	
> 48 hr	0	0	
Total PACs	0	9.4K	
Ventricular Counters			
Total PVCs	0	39.5K	
Three or More PVCs	0	6	
AT/AF Overview: Since Last Reset (23 Mar 2017 to Today)			

AT/AF Events: 0


Total Time in AT/AF (min): 0.0 (One Year of Data)


ATR Episodes initiated within 2 hours of lead attach are not stored in Arrhythmia Logbook.


AT/AF Overview: Reset Before Last (N/R to 23 Mar 2017)

ATR Episodes initiated within 2 hours of lead attach are not stored in Arrhythmia Logbook.


Histograms Reset Before Last (N/R)

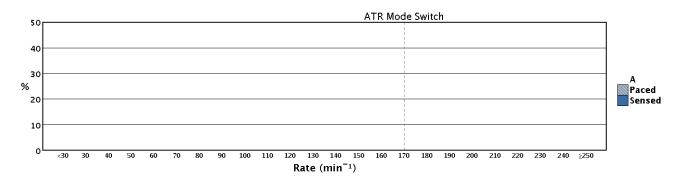

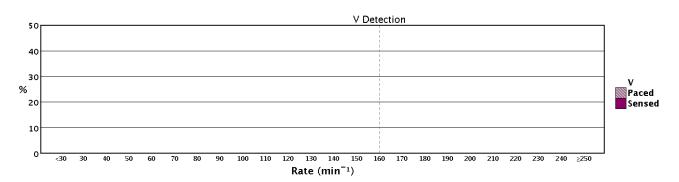

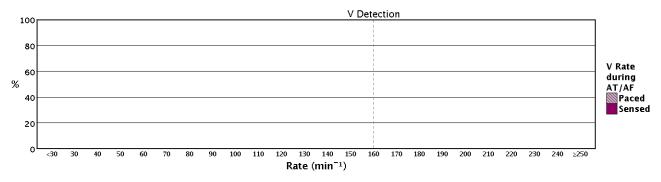

Histograms Since Last Reset (23 Mar 2017)

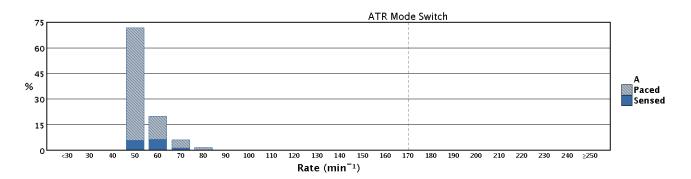


2869 Software Version: 2.06 L311 Firmware Version: F_v1.00.00(1.10) © 2014


Boston Scientific Corporation
or its affiliates. All rights reserved.

Page 6 of 8

Clinician Signature:		

Histograms Since Last Reset (23 Mar 2017) (Continued)

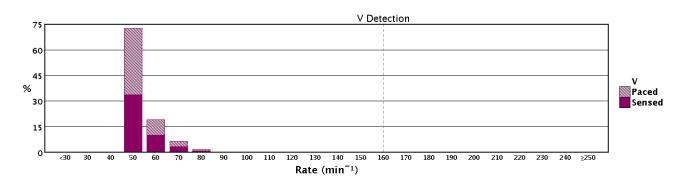


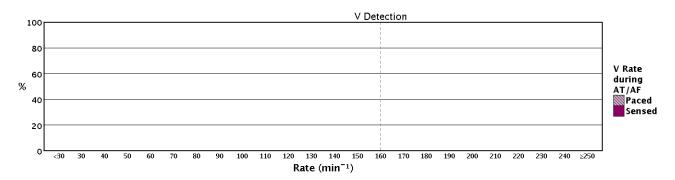

Heart Rate Variability

Last Measure for 24-hour period ending 13 Apr 2020 15:15

% of Time Used	67	Mode	AAIR
Footprint	43 %	Sensed AV Delay	65 - 150 ms
SDANN	133 ms	•	

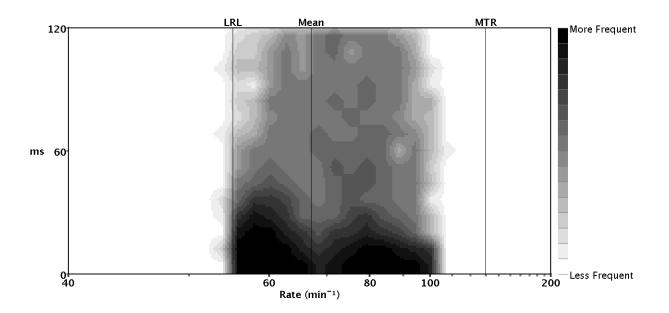

2869 Software Version: 2.06 L311 Firmware Version: F_v1.00.00(1.10) © 2014

Boston Scientific Corporation
or its affiliates. All rights reserved.


Page 7 of 8

Clinician Signature:

Heart Rate Variability (Continued)

Reference-measured for 24-hour period ending 06 Jul 2017 15:08

% of Time Used 73 Mode AAIR
Footprint 26 % Sensed AV Delay 65 - 150 ms
SDANN 116 ms

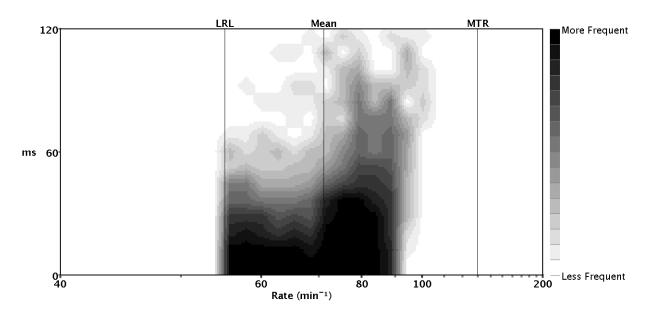

All Events Since Last Reset (23 Mar 2017)

LVCIII3 OIIICC Last Neset (2	Jilla Zuiij
04 Aug 2020 15:24	RA Auto
04 Aug 2020 15:23	RV Auto
25 Jul 2020 12:06	RYTHMIQ at 45 min ⁻¹
25 Jul 2020 11:50	PMT at 130 min ⁻¹
25 Jul 2020 11:48	RYTHMIQ at 64 min ⁻¹
25 Jul 2020 11:44	PMT at 130 min ⁻¹
25 Jul 2020 11:43	PMT at 130 min ⁻¹
25 Jul 2020 11:42	RYTHMIQ at 62 min ⁻¹
25 Jul 2020 11:20	PMT at 130 min ⁻¹
25 Jul 2020 11:16	PMT at 130 min ⁻¹
25 Jul 2020 11:03	RYTHMIQ at 63 min ⁻¹
17 Jul 2020 11:04	RYTHMIQ at 47 min ⁻¹
17 Jul 2020 10:40	RYTHMIQ at 46 min ⁻¹
16 Jul 2020 22:18	RYTHMIQ at 45 min ⁻¹
22 May 2020 15:09	RYTHMIQ at 56 min ⁻¹
11 May 2020 17:53	RYTHMIQ at 62 min ⁻¹
07 May 2020 02:14	RYTHMIQ at 44 min ⁻¹
05 May 2020 10:01	RYTHMIQ at 57 min ⁻¹

2869 Software Version: 2.06 L311 Firmware Version: F_v1.00.00(1.10) © 2014

Boston Scientific Corporation
or its affiliates. All rights reserved.

Page 8 of 8

Clinician Signature: