Callahan Auto & Diesel
255 W Main St.
Mesa AZ - 85201
Phone# (480) 969-3332

Complete Multi Point Check
Invoice No# 13317
Report Date: 03/16/2026
by Autoflow

1990 Isuzu NPR

Report URL: Click here

Customer Name	Dan S	Phone No.	(xxx)-xxx-x945
Submodel	Base	Engine Size	
2WD or 4WD	4 X 2	VIN	JALB4B1H6L7008336
License	Ch.58976	Mileage	080367
ABS		Transmission	U/K
Est/Invoice#	13317	Oil Filters	
Notes	I am pulling tires and having problems with the lugnuts coming off I know they are left and right Threads		

Reason vehicle is here

#	Type	Details	Notes	Acknowledged
1	Concern	clutch replacement is needed. please try to identify ANYTHING that may be needed when doing a clutch so we can put a good estimate together. and any part numbers you can find for part identification		✓
2	Concern	pm service. need all filter numbers please		✓
3	Concern	replace brakes. try to find any numbers on casting etc if you can		✓
4	Concern	Complete DVI to determine what it all needs. record any part numbers you can on filters, transmission brakes etc.		✓

Complete Multi Point Check

✓ 14 Requires Urgent Attention

#	Insp Item	Notes
✗	Warning Lights	Brake light is on
✗	Wipers	The wipers have reached the end of their service life and are no longer providing optimal visibility during inclement weather. Upgrading to new wipers will enhance your safety and driving experience.
✗	Headlights	Driver side light broken

✗ Tail Lights	Rear tail lights are broken

✗ Transmission Fluid	The transmission is experiencing significant issues, resulting in limited movement of the vehicle. It appears that the clutch has failed, leading to a lack of proper engagement and performance.

✗ Filter / Air Intake	The air filter shows signs of significant dirt and debris accumulation, which may affect engine performance. Regular maintenance of the air intake system is essential to ensure optimal vehicle efficiency and longevity.

✗ Belts	The inspection revealed that the alternator belts are showing signs of cracking, indicating potential wear and tear. Additionally, the air conditioning belt is also displaying similar cracking, which may affect its performance in the near future.

✗ Fuel System: Filter/Lines	This is the fuel system filter numbers

✗ Ball Joints	The inspection revealed significant wear in the ball joints, resulting in noticeable movement. This condition may affect the vehicle's handling and should be monitored closely for potential impact on performance.

✗	Differential Fluid	The differential fluid was found to be contaminated, indicating it's time for a replacement to ensure optimal performance. Regular maintenance of this fluid will help maintain overall drivetrain efficiency and longevity.
✗	Alignment	
✗	Tires	The tires are exhibiting signs of uneven wear, characterized by cupping, which can lead to vibrations during operation. This condition may affect ride comfort and overall handling.

✗	Front Pads	01mm - Pads are severely worn and require replacement the adjuster (wheel cyc) leaking brake fluid.. (no foot pedal)

✗	Front Rotors	

✔ 21 Good Items

#	Insp Item	Notes
✓	Exterior Photos (4 Corner)	

✓	Mounts	
✓	Hoses	
✓	Ignition	

✓	EVAP System: Canister/Lines/Hoses	
✓	Vacuum Lines	
✓	Timing Belt	N/A
✓	Tie Rods	
✓	Wheel Bearings	
✓	Sway Bar	
✓	Driveshafts / U-Joints	
✓	Powertrain Mounts	
✓	Fluid Leaks	
✓	Exhaust	
✓	Rear Calipers / Cylinders	
✓	Brake Hardware	
✓	Brake Hoses	
✓	Brake Lines and Fittings	
✓	Battery Terminals	
✓	Battery Cables	
✓	Overall Battery Condition	

✔ 11 Requires Future Attention

#	Insp Item	Notes
!	Other	No inspection plate.i don't see anything leaking around bell houseing.i am trying to pull tired but having problems with lug nuts I know there's a left and a rite but my gun won't take them off.i sprayed some lubricant on them and trying to brake them lose Both back small running lights for out, but the tail light is broken.
!	Engine Oil	The engine oil level is below the optimal range, indicating that an oil change would help maintain engine performance and protect internal components. Regular oil changes are essential for ensuring longevity and efficiency.

!	Power Steering Fluid	The power steering fluid is noticeably contaminated, indicating that it has not been changed in some time. Regular maintenance of the fluid will help ensure optimal performance and longevity of the steering system.

!	Coolant/anti freeze	The coolant is a healthy dark green color, indicating it's in good condition. However, the coolant reservoir shows signs of sun damage and has a hole on the top, which may affect its performance.

!	Other	The front shock absorbers are exhibiting significant leakage, indicating they are no longer performing optimally. This condition may affect ride quality and handling, suggesting a need for attention.

!	Control Arm	N/A
!	Suspension	
!	CV Shafts / Axles	N/A
!	Other	The transmission gear oil appears slightly dark, indicating it could benefit from a drain and fill service. While it's currently functional, addressing this maintenance item in the future would help ensure optimal performance.

!	Front Calipers	The inspection indicated noticeable blueing on the front calipers, suggesting they have experienced excessive heat exposure, which could impact braking performance. Additionally, the bearings are overheating, indicating that both the inner and outer bearings may need to be replaced for optimal safety and efficiency.

Callahan Auto & Diesel
255 W Main St.
Mesa AZ - 85201
Phone# (480) 969-3332

Complete Multi Point Check
Invoice No# 13317
Report Date: 03/16/2026
by Autoflow

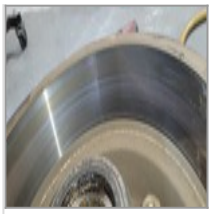

!	Battery Test Results	The battery test results indicate that the battery is currently exhibiting weak performance. It is recommended to monitor its condition closely to ensure reliable starting and operation.

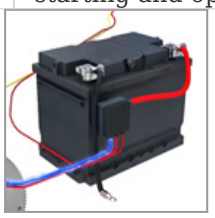

Front Axle

O.E. - Tread Depth

Actual - Tread Depth

PSI Before

PSI After

[LF]

[RF]

PSI Before

PSI After

Axle#2

O.E. -

Actual -

[LR]

[RR]

PSI Before

PSI After

PSI Before

PSI After

Tread Depth

Tread Depth

This report was signed off on 03/16/2026 03:17 pm

Service Writer: Admin User

Technician: Mitch Callahan