Design of a low-tech water turbine

Academic year:
2025-2026

Author:	**NOMA:**
Thonon Robin	63682100
Nishio Hugo	XXXXXXXX

Contents

1 Introduction **1**
1.1 Input Data 1

2 State of the Art **1**

3 Blade design **1**
3.1 General Calculations 1
3.2 1D Meanline Design 2
3.3 3-D design 5
3.4 Blade Geometry 6

1 Introduction

The preliminary design phase is a crucial step in the development of a new product, as it lays the foundation for the subsequent detailed design and manufacturing processes. This phase involves defining the product's specifications, identifying potential design concepts, and evaluating their feasibility. We will have some constraints to respect, and some design parameters to choose.

1.1 Input Data

To start the design, we need to define the constrains of the system. Therefore, we have the following data imposed.

- Hauteur de chute $\Delta H = 2.0\,\mathrm{m}$
- Rayon extérieur $R_o = 0.1\,\mathrm{m}$
- vitesse du fluide $V_x = 2\,\mathrm{m/s}$
- rendement hydraulique théorique maximal $\eta = 0.92$

2 State of the Art

In this section, we will first try to aknowledge the cases of applpication of our project to see which types of solutions could be implemented. Then, we will review the state of the art in the field of turbine blade design, with a focus on Kaplan turbines. We will discuss the various methods and approaches that have been proposed in the literature for designing efficient and effective turbine blades. We will also explore the low-tech aspects of turbine design, such as the use of local materials and simple manufacturing techniques.

3 Blade design

3.1 General Calculations

The design of turbine blades is a critical aspect that directly influences the performance and efficiency of the turbine. We will here use the method proposed by ...(Abeykoon) for the blade design of a Kaplan turbine.

The first step is to estimate the extracted power of the turbine to start the design. Based on the input data, we can start by estimating the blockage factor with the following graph(from fig 15 of 2022 Abeykoon):

- $\sigma = 1.6$

Considering: (from fig 15 of 2022 Abeykoon)

$$R_i = 0.4 \times R_o = 0.04\,\mathrm{m} \tag{1}$$

We also obatin that we have 4 blades for the turbine, which is a common choice for Kaplan turbines.

We can calculate the volumetric flowrate Q:

$$Q = \pi(R_o^2 - R_i^2)V_x = 190.0\,\mathrm{m}^3/\mathrm{h} \tag{2}$$

By taking the maximal theorical hydraulic efficiency for a Kaplan turbine, we can estimate the extracted power:

$$P_{extracted} = \eta P_{hydraulic} = \eta \rho g Q \Delta H \tag{3}$$

$$P_{extracted} \approx 1\,\mathrm{kW} \tag{4}$$

First, we can calculate the rotationnal speed based on the following correlation: (Abeykoon)

$$N = \sigma \frac{(2gH)^{3/4}}{2\sqrt{\pi Q}} \tag{5}$$

Therefore, we have:

$$N = 700.0\,\mathrm{rpm} \tag{6}$$

We can also obtain the mean speed of the blade:

$$U_m = 2\pi R_m \frac{N}{60} \tag{7}$$

with

$$R_m = \frac{(R_o - R_i)}{2} = 0.07\,\mathrm{m} \tag{8}$$

3.2 1D Meanline Design

With all these parameters, we can start the 1D meanline blade design. The first step is to set the angles, and different types of speed :
To insert : velocity triangles, angles, etc...

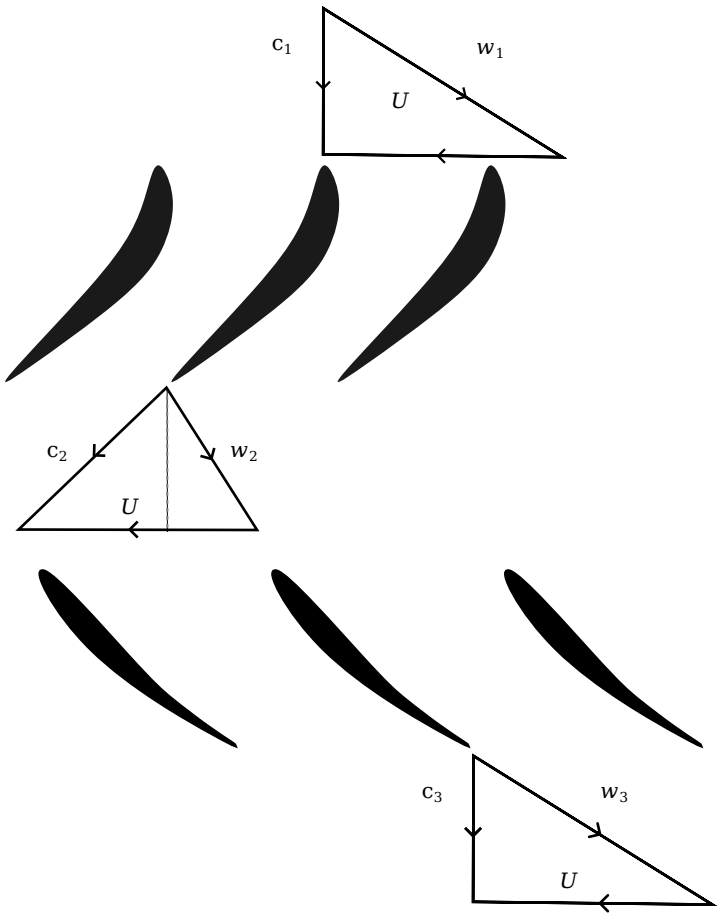

Figure 1: Velocities and angles at the inlet and outlet of the turbine, for the mean radius

From the mass conservation theorem, we know that the axial velocity at the inlet of the turbine is equal to the axial velocity at the outlet of the turbine, therefore we can write:

$$c_{1x,m} = c_{2x,m} = c_{3x,m} = c_{x,pipe} = 2\,\mathrm{m/s} \tag{9}$$

Then, we will calculate $c_{2\theta,m}$ velocity at the outlet of the stator. We also know that the stator doesn't produce any work so we only need the velocity triangle of the rotor.

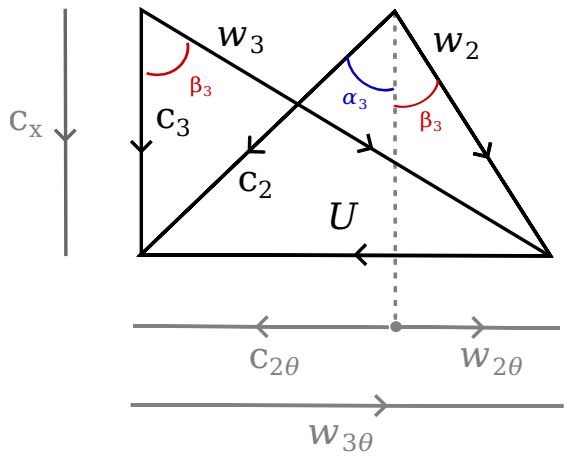

Figure 2: Velocities and angles at the inlet and outlet of the turbine, for the mean radius

We see that we chose to have no tangential velocity at the outlet of the rotor, which means that the flow will be purely axial at the outlet of the turbine. This is a common choice for Kaplan turbines as it allows to maximize the efficiency of the turbine by minimizing the kinetic energy losses at the outlet of the turbine.
We can now use the Euler formula:

$$P = \omega T = \frac{U_m}{R_m} T \tag{10}$$

From the second law of motion, we can write for a constant radius:

$$T = \dot{m} R_m (c_{2\theta,m} - c_{3\theta,m}) \tag{11}$$

which we can rewrite:

$$P = \dot{m} U_m (c_{2\theta,m} - c_{3\theta,m}) \tag{12}$$

and we finally find $c_{2\theta,m}$ knowing that $c_{3\theta,m} = 0$:

$$c_{2\theta,m} = \frac{P}{\dot{m} U_m} \tag{13}$$

We can now calculate the relatives velocities knowing that:

$$\vec{c} = \vec{w} + \vec{U} \tag{14}$$

$$\vec{c} = \vec{c_x} + \vec{c_\theta} \tag{15}$$

On the velocity triangle, we can also see that $c_{3,m} = c_{3x,m}$ as $c_{3\theta,m} = 0$.
We then have:

$$w_{3,m} = \sqrt{c_x^2 + U^2} \tag{16}$$

$$w_{2,m} = \sqrt{c_x^2 + (w_{2\theta,m})^2} = \sqrt{c_x^2 + (U - c_{2\theta,m})^2} \tag{17}$$

$$c_{2,m} = \sqrt{c_{2\theta,m}^2 + c_x^2} \tag{18}$$

We can therefore plot the velocity triangles at the inlet and outlet of the rotor, for the mean radius:

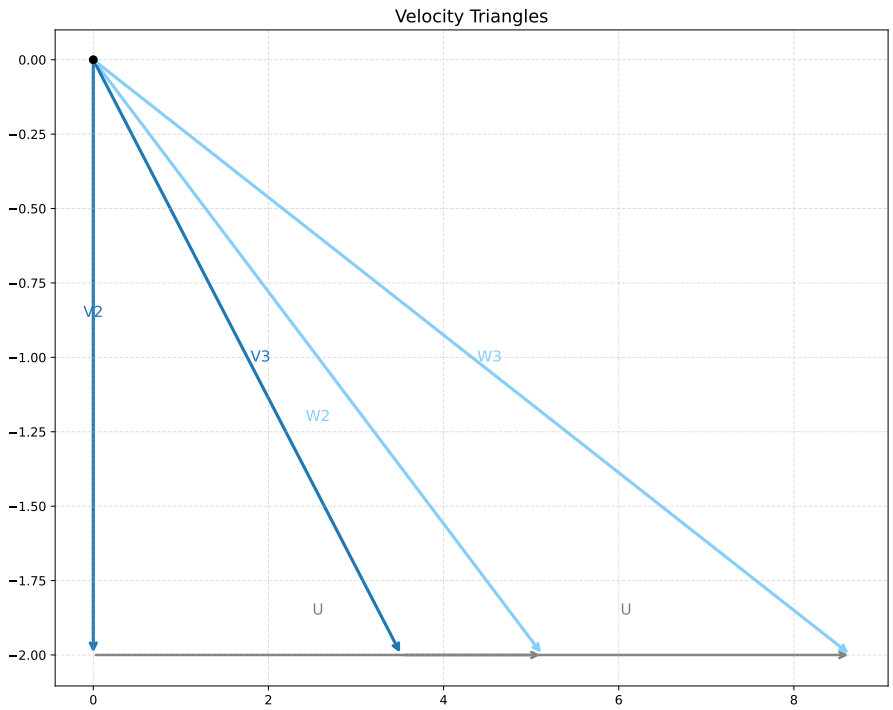

Figure 3: Velocity triangles at the inlet and outlet of the turbine, for the mean radius

3.3 3-D design

Once we have the velocity triangles at R_m, the next step is to divide the blade into several sections and calculate the velocity triangles at each section as we can see on the following figure:

To insert : blade sections

We can choose a vortex distribution for the blade design. Here, we chose a free vortex distribution, which means that the tangential velocity at the inlet of the turbine will be inversely proportional to the radius and we obtain a constant work along the blade. We can therefore write:

$$c_{2\theta}(r) = \frac{K}{r} \tag{19}$$

with K a constant that we can calculate with the velocity triangle at the mean radius:

$$K = c_{2\theta,m} R_m \tag{20}$$

It's important to notice that with this choice of vortex distribution, we will obtain a twisted blade as the velocity triangles will be different at each radius. Knowing $c_{2\theta}(r)$ allows us to calculate the velocity triangles at each radius, and therefore the angles of the blade at each radius by the same methodology as before.
For each radius r_i, the blade speed can be calculated as:

$$U_i = 2\pi r_i \frac{N}{60} \tag{21}$$

The velocity triangle is then calculated as:

$$\begin{cases} c_{3x,i} = c_{2x,i} = c_x = 2\,\mathrm{m/s} \\ c_{2\theta,i} = c_{2\theta}(r_i) = \dfrac{K}{r_i} \\ c_{3,i} = \sqrt{c_x^2 + c_{3\theta,i}^2} = c_x \\ c_{2,i} = \sqrt{c_x^2 + c_{2\theta,i}^2} \\ w_{3,i} = \sqrt{c_x^2 + U_i^2} \\ w_{2,i} = \sqrt{c_x^2 + \left(U_i - c_{2\theta,i}\right)^2} \\ w_{\mathrm{inf},i} = (w_{2,i} + w_{3,i})/2 \end{cases} \tag{22}$$

We can also calculate the angles of the blade at each radius using basic trigonometry. We end up with the following final values:
To insert : table of angles, velocities, etc... at each radius

Then, we will need to define the chord to pitch ratio for each radius, which will allow us to calculate the chord length at each radius. We will use the values from (Abeykoon) for a fast runner, therefore we have $\frac{s''}{t''}$ varying between $0.75 - 1.3$ depending on the radius.
Since we have 4 blades, we can finally calculate the pitch as:

$$t_i'' = \frac{2\pi r_i}{4} \tag{23}$$

The chord is then simply calculated as:

$$s_i'' = t_i'' \times \left[\frac{s''}{t''}\right]_i \tag{24}$$

To insert : table of chord and pitch at each radius

3.4 Blade Geometry

With all the values calculated in the previous sections, we can now start defining the geometry of the blade. We will use a methodology based on Janjua et al. (2013). We can first define the different convention for the different angles and coordinates of the blade, as shown in the following figure: To insert : blade geometry convention

Knowing that for each radius $D_i = 2r_i$, we can calculate the following quantities:

$$\begin{cases} y_{2,i} = \sin(\beta_{2,i} - 90) \times \dfrac{D_i \sin\left(\frac{s_i''}{D} \times \frac{180}{\pi}\right)}{2\cos(\beta_{\infty,i} - \beta_{2,i})} \\ z_{2,i} = \dfrac{y_{2,i}}{\tan(\beta_{2,i} - 90)} \\ x_{2,i} = \dfrac{D_i}{2} - D_i \sin^2\left(\dfrac{\arcsin\left(\frac{2y_{2,i}}{D}\right)}{2}\right) \end{cases} \tag{25}$$

$$\begin{cases} y_{3,i} = -\sin(\beta_{3,i} - 90) \times \dfrac{D_i \sin\left(\frac{s_i''}{D} \times \frac{180}{\pi}\right)}{2\cos(\beta_{3,i} - \beta_{\text{inf},i})} \\ z_{3,i} = \dfrac{y_{3,i}}{\tan(\beta_{3,i} - 90)} \\ x_{3,i} = \dfrac{D_i}{2} - D_i \sin^2\left(\dfrac{\arcsin\left(\frac{2y_{3,i}}{D}\right)}{2}\right) \end{cases} \tag{26}$$

$$\begin{cases} y_{\text{inf},i} = 0 \\ z_{\text{inf},i} = 0 \\ x_{\text{inf},i} = \dfrac{D_i}{2} \end{cases} \tag{27}$$

to do list:

- change velocity triangle graphes
- add the angles conventions
- add the figure for the blade geometry convention
- add the table for the angles, velocities, chord and pitch at each radius
- change th eequations for the rpm calculation