

# ICP-10100, ICP-10101, ICP-10110, ICP-10111

# High Accuracy, Low Power, Waterproof Barometric Pressure

# and Temperature Sensor IC

#### **GENERAL INFORMATION**

The ICP-101xx pressure sensor family is based on MEMS capacitive technology which provides ultra-low noise at the lowest power, enabling industry leading relative accuracy, sensor throughput, and temperature stability. The pressure sensor can measure pressure differences with an accuracy of  $\pm 1$  Pa, an accuracy enabling altitude measurement differentials as small as 8.5 cm, less than the height of a single stair step.

Consuming only 1.3  $\mu$ A @1 Hz, available in a small footprint 2 mm x 2 mm x 0.72 mm waterproof to 1.5m depth 10-pin LGA package (ICP-10100), the ICP-101xx is ideally suited for mobile phones, wearable fitness monitoring, drones, and battery powered IoT.

The ICP-101xx offers an industry leading temperature coefficient offset of  $\pm 0.5$  Pa/°C. The combination of high accuracy, low power, temperature stability, waterproofing in a small footprint enables higher performance barometric pressure sensing for sports activity identification, mobile indoor/outdoor navigation, and altitude-hold in drones.

#### **DEVICE INFORMATION**

DE TICE III									
PART NUMBER	PACKAGE	LID OPENING							
ICP-10100	2x2x0.72mm LGA-10L	3-Hole, IPx8: 1.5m Waterproof							
ICP-10101	2x2x0.72mm LGA-10L	1-Hole							
ICP-10110	2x2.5x0.92mm LGA-8L	3-Hole, IPx8: 1.5m Waterproof							
ICP-10111	2x2.5x0.92mm LGA-8L	1-Hole							

Denotes RoHS and Green-Compliant Package

#### **BLOCK DIAGRAMS**




## **APPLICATIONS**


- Altitude Control of Drones and Flying Toys
- Mobile Phones
- Virtual Reality and Gaming Equipment
- Indoor/Outdoor Navigation (dead-reckoning, floor/elevator/step detection)
- Vertical velocity monitoring
- Leisure, Sports, and Fitness Activity Identification
- Weather Forecasting

#### **FEATURES**

- Pressure operating range: 30 to 110 kPa
- Noise and current consumption
  - 0.4 Pa @ 10.4 μA (ULN mode)
  - 0.8 Pa @ 5.2 μA (LN mode)
  - 3.2 Pa @ 1.3 μA (LP mode)
- Pressure Sensor Relative Accuracy: ±1 Pa for any 10 hPa change over 950 hPa-1050 hPa at 25°C
- Pressure Sensor Absolute Accuracy: ±1 hPa over 950 hPa-1050 hPa, 0°C to 65°C
- Pressure Sensor Temperature Coefficient Offset:
   ±0.5 Pa/°C over 25°C to 45°C at 100 kPa
- Temperature Sensor Absolute Accuracy: ±0.4°C
- IPx8: Waterproof to 1.5m depth (ICP-10100 & ICP-10110)
- Temperature operating range: -40 °C to 85 °C
- Host Interface: I<sup>2</sup>C at up to 400 kHz
- Single Supply voltage: 1.8V ±5%
- RoHS and Green compliant




3-Hole IPx8 Lid Opening ICP-10100 & ICP-10110



1-Hole Lid Opening ICP-10101 & ICP-10111

#### TYPICAL OPERATING CIRCUIT

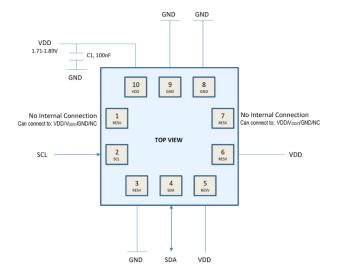

Revision: 1.2

Release Date: 05/06/2019



# **TABLE OF CONTENTS**

	GENER	AL INFORMATION	1
		E INFORMATION	
		CATIONS	
		RES	
		AL OPERATING CIRCUIT	
_			
1	INT	RODUCTION	5
	1.1	Purpose and Scope	
	1.2	Product Overview	5
2	PRI	ESSURE AND TEMPERATURE SENSOR SPECIFICATIONS	е
	2.1	Operation Ranges	F
	2.2	OPERATION MODES	
	2.3	Pressure Sensor Specifications	
	2.4	TEMPERATURE SENSOR SPECIFICATIONS	
	2.5	RECOMMENDED OPERATION CONDITIONS	
3	ELE	CTRICAL SPECIFICATIONS	8
_			
	3.1	Associate Mayania Patings	
	3.2 3.3	ABSOLUTE MAXIMUM RATINGS	
	3.3 3.4	Sensor System Timing  I <sup>2</sup> C Timing Characterization	
	_		
4	API	PLICATIONS INFORMATION	11
	4.1	Interface Specifications	
	4.2	PIN OUT DIAGRAM AND SIGNAL DESCRIPTION	
		-10100 and ICP-10101: 2x2x0.72mm 10-pin LGA	
		-10110 and ICP-10111: 2x2.5x0.92 mm 8-pin LGA	
	4.3 4.4	TYPICAL OPERATING CIRCUIT  BILL OF MATERIALS FOR EXTERNAL COMPONENTS	
_			
5	OP	ERATION AND COMMUNICATION	
	5.1	POWER-UP AND COMMUNICATION START	16
	5.2	Measurement Commands	16
	5.3	Starting a Measurement	
	5.4	Sensor Behavior During Measurement	
	5.5	READOUT OF MEASUREMENT RESULTS	
	5.6	SOFT RESET	
	5.7	READ-OUT OF ID REGISTER	
	5.8	CHECKSUM CALCULATION	
	5.9	CONVERSION OF SIGNAL OUTPUT.	
	5.10	READ-OUT OF CALIBRATION PARAMETERS	
	5.11	SAMPLE CODE: EXAMPLE C SYNTAX	
	5.12	SAMPLE CODE: CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX)	
	5.13	SAMPLE CODE: USING CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX)	
	5.14	COMMUNICATION DATA SEQUENCES	
6	ASS	SEMBLY	24
	6.1	IMPLEMENTATION AND USAGE RECOMMENDATIONS	
		dering	
	Che	emical Exposure and Sensor Protection	24



# ICP-10100, ICP-10101, ICP-10110, ICP-10111

7	PACKAGE DIMENSIONS	25
8	PART NUMBER PART MARKINGS	30
9	ORDERING GUIDE	30
10	REFERENCES	32
11	REVISION HISTORY	33



# ICP-10100, ICP-10101, ICP-10110, ICP-10111

# **LIST OF FIGURES**

Figure 1. Digital I/O Pads Timing	
Figure 2. Pin Out Diagram for ICP-10100 & ICP10101, 2 mm x 2 mm x 0.72 mm LGA	
Figure 3. Pin Out Diagram for ICP-10110 & ICP-10111 2 mm x 2.5 mm x 0.92 mm LGA	
Figure 4. ICP-10100 & ICP-10101 Application Schematic	
Figure 5. Example: Typical application circuit, including pull-up resistor R <sub>p</sub> and decoupling of VDD and VSS by capacitor (2 x 2.5 mm package)	
Figure 6. ICP-10110 & ICP-10111 Application Schematic	
Figure 7. Example: Typical application circuit, including pull-up resistor R <sub>p</sub> and decoupling of VDD and VSS by capacitor (2 x 2.5 mm package)	
Figure 8. Communication Data Sequences	
Figure 9. ICP-10100 & ICP-1010 Package Diagrams	
Figure 10. ICP-10100 & ICP-10101 recommended PCB land pattern	26
Figure 11. ICP-10110 & ICP-10111 Package Diagrams	
Figure 12. ICP-10110 & ICP-10111 recommended PCB land pattern	29
Figure 13. Part Number Part Markings	30
LIST OF TABLES	
Table 1. Operation Ranges	б
Table 2. Operation Modes	<del>(</del>
Table 3. Pressure Sensor Specifications	7
Table 4. Temperature Sensor Specifications	7
Table 5. Electrical Specifications	8
Table 6. Absolute Maximum Ratings	9
Table 7. System Timing Specifications	
Table 8. I <sup>2</sup> C Parameters Specification	10
Table 9. Signal Descriptions	11
Table 10. Signal Descriptions	12
Table 11. Bill of Materials	15
Table 12. ICP-101xx I <sup>2</sup> C Device Address	16
Table 13. Measurement Commands	16
Table 14. Soft Reset Command	17
Table 15. Read-Out Command of ID Register	17
Table 16. 16-bit ID Structure	17
Table 17. ICP-101xx I <sup>2</sup> C CRC Properties	18
Table 18. ICP-10100 & ICP-10101 Package Dimensions	26
Table 19. ICP-10110 & ICP-10111 Package Dimensions	28
Table 20. Part Number Part Markings	20



## 1 INTRODUCTION

## 1.1 PURPOSE AND SCOPE

This document is a preliminary product specification, providing a description, specifications, and design related information for the ICP-101xx Pressure Sensor.

Specifications are subject to change without notice. Final specifications will be updated based upon characterization of production silicon.

#### 1.2 PRODUCT OVERVIEW

The ICP-101xx is an ultra-low power, low noise, digital output barometric pressure and temperature sensor IC. It is based on an innovative MEMS capacitive pressure sensor technology that can measure pressure differences with an accuracy of ±1 Pa at the industry's lowest power. The high accuracy MEMS capacitive pressure sensor is capable of measuring altitude differentials down to 8.5 cm without the penalty of increased power consumption or reduced sensor throughput.

The capacitive pressure sensor has a  $\pm 1$  hPa absolute accuracy over its full range of 300 hPa -1100 hPa. The pressure sensor has an embedded temperature sensor and 400 kHz I<sup>2</sup>C bus for communication. For power-critical applications, the ICP-101xx features a low power mode of 1.3  $\mu$ A at a noise of 3.2 Pa or for high performance applications, it features a low noise mode of 0.8 Pa while only consuming 5.2  $\mu$ A.

The ICP-10100 and ICP-10110 has three 0.025 mm package openings, making waterproof to 1.5m for 30 minutes providing many mobile applications improved water resistance with no additional waterproofing costs.

The ICP-101xx also offers industry leading temperature stability of the pressure sensor with a temperature coefficient offset of  $\pm 0.5$  Pa/°C. The high accuracy, temperature stability, and market leading low power consumption of 1.3  $\mu$ A @1 Hz offered by ICP-101xx makes it ideally suited for applications such as mobile phones, drone flight control and stabilization, indoor/outdoor navigation (elevator, floor, and stair step detection), sports and fitness activity monitoring, and battery-powered IoT.

Document Number: DS-000186



## 2 PRESSURE AND TEMPERATURE SENSOR SPECIFICATIONS

## 2.1 OPERATION RANGES

The sensor shows best performance when operated within the recommended temperature and pressure range (hereafter called normal conditions) of  $0^{\circ}$ C –  $45^{\circ}$ C and 95 kPa – 105 kPa, respectively. The following ranges are defined for the device:

OPERATION RANGE	PRESSURE (KPA)	TEMPERATURE (°C)		
Normal	95 to 105	0 to 45		
Extended	30 to 110	-20 to 65		
Maximum	25 to 115	-40 to 85		

**Table 1. Operation Ranges** 

#### 2.2 OPERATION MODES

The sensor can be operated in up to four different measurement modes to satisfy different requirements for power consumption vs. noise, accuracy and measurement frequency. An overview of the operation modes is given in Table 2.

PARAMETER	CONDITIONS	SENSOR MODE	TYP	MAX	UNITS	NOTES
		Low Power (LP)	1.6	1.8		1
	Time between sending last bit of measurement command, and	Normal (N)	5.6	6.3		1
Conversion Time	sensor data ready for	Low Noise (LN)	20.8	23.8	ms	1
	measurement	Ultra Low Noise (ULN)	83.2	94.5		1
		Low Power (LP)	1.3			
Command	1 Hz ODR	Normal (N)	2.6			
Current		Low Noise (LN)	5.2		μΑ	
Consumption		Ultra Low Noise (ULN)	10.4			
		Low Power (LP)	3.2			
	Valid for D = 100 kDs T = 25°C	Normal	1.6			
Pressure RMS Noise	Valid for P = 100 kPa, T = 25°C, and U = 1.8V	Low Noise (LN)	0.8		Pa	
	aliu 0 - 1.0V	Ultra Low Noise (ULN)	0.4			

**Table 2. Operation Modes** 

#### Notes:

1. Guaranteed by design.

Low Power modes supports ODR greater than 500 Hz while the Low Noise mode provides industry leading RMS noise at a fast 40 Hz ODR. Further decrease in noise may be achieved by software oversampling and filtering through customer's software implementation or custom TDK-InvenSense operation modes available upon request.



## 2.3 PRESSURE SENSOR SPECIFICATIONS

Pressure sensor specifications are given in Table 3. Default conditions of 25 °C and 1.8V supply voltage apply, unless otherwise stated.

PARAMETER	CONDITIONS	TYP	UNITS	NOTES
Absolute Accuracy	Normal range	±1	hPa	1
	Extended range	±1.5		
Relative Accuracy	Any step ≤ 1 kPa, 25 °C	±1		
	Any step ≤ 10 kPa, 25 °C	±3	Pa	
Long-term drift During 1 year	Extended range	±1	hPa/y	
Solder drift		1.5	hPa	1, 2
Temperature coefficient offset	P = 100 kPa 25°C 45°C	±0.5	Pa/°C	
Resolution	Maximum range	0.01	Pa	

**Table 3. Pressure Sensor Specifications** 

#### Notes:

- 1. Absolute accuracy may be improved through One Point Calibration
- 2. Sensor accuracy post Solder reflow may be improved through One Point Calibration

#### 2.4 TEMPERATURE SENSOR SPECIFICATIONS

Specifications of the temperature sensor are shown in Table 4.

PARAMETER	CONDITIONS	TYP	UNITS
Absolute Accuracy	Extended range	±0.4	°C
Repeatability	Extended range	±0.1	°C
Resolution	Maximum range	0.01	°C
Long-term drift	Normal range	< 0.04	°C/y

**Table 4. Temperature Sensor Specifications** 

## 2.5 RECOMMENDED OPERATION CONDITIONS

The pressure sensor exhibits best performance when operated within the normal pressure and temperature range  $0^{\circ}$ C < T <  $45^{\circ}$ C and 95 kPa < P < 105 kPa.

Injected photo current due to strong light sources can influence the sensor performance and should be avoided to guarantee best operation.

The sensor should not be exposed to high mechanical stress, the resulting deformation of the package can alter internal dimensions and therefore falsify the sensor signal. Solder reflow may affect device performance. One-point calibration can improve the sensor accuracy post solder reflow.



# **3 ELECTRICAL SPECIFICATIONS**

## 3.1 ELECTRICAL CHARACTERISTICS

Default conditions of 25 °C and 1.8V supply voltage apply to values in Table 5, unless otherwise stated.

PARAMETER SYMBOL		CONDITIONS	MIN	ТҮР	MAX	UNITS	COMMENTS
Supply voltage	$V_{DD}$		1.71	1.8	1.89	V	
Power-up/down level	$V_{POR}$	Static power supply	1.0	1.25	1.5	V	
Supply Ramp Time	$T_RAMP$	Monotonic ramp. Ramp rate is 10% to 90% of the final value	0.01		100	ms	
		Idle state	-	1.0	2.5	μΑ	
	I <sub>DD</sub>	Measurement	ı	210	300	μΑ	Current consumption while sensor is measuring.
Supply current		Average	1	1.3	-	μΑ	Current consumption in continuous operation @ 1 Hz ODR in LP Mode
		Average	1	5.2	ı	μА	Current consumption in continuous operation @1 Hz ODR in LN Mode
Low level input voltage	$V_{IL}$		0	-	0.3 V <sub>DD</sub>	V	
High level input voltage	V <sub>IH</sub>		0.7 V <sub>DD</sub>	-	$V_{DD}$	V	
Low level output voltage	V <sub>OL</sub>	0 < IOL < 3 mA	-	-	0.2 V <sub>DD</sub>	V	
Output Sink Compant		V <sub>OL</sub> = 0.4V	3.1	4.1	-	mA	
Output Sink Current	I <sub>OL</sub>	V <sub>OL</sub> = 0.6V	3.5	4.5	-	mA	

**Table 5. Electrical Specifications** 



## 3.2 ABSOLUTE MAXIMUM RATINGS

Stress levels beyond those listed in Table 6 may cause permanent damage to the device. These are stress ratings only and functional operation of the device at these conditions cannot be guaranteed. Exposure to the absolute maximum rating conditions for extended periods may affect the reliability of the device.

PARAMETER	RATING			
Supply voltage, VDD	-0.3V to 2.16V			
Supply Voltage, SCL & SDA	-0.3V to VDD 0.3V			
Operating temperature range	-40°C to 85°C			
Storage temperature range	-40°C to 125°C			
ESD HBM	2.0 kV			
ESD CDM	250V			
Latch up, JESD78 Class II, 85°C	100 mA			
Overpressure	>600kPa			

**Table 6. Absolute Maximum Ratings** 

## 3.3 SENSOR SYSTEM TIMING

Default conditions of 25°C and 1.8V supply voltage apply to typ. values listed in Table 7, unless otherwise stated. Max. values apply over the specified operating range of VDD and over the operating temperature range.

PARAMETER	PARAMETER SYMBOL CONDITIONS		MIN	ТҮР	MAX	UNITS	COMMENTS
ower-up time $t_{PU}$ After hard reset, $V_{DD} \ge V_{POF}$		ı	170	ı	μs	Time between V <sub>DD</sub> reaching V <sub>PU</sub> and sensor entering idle state	
Soft reset time t		After soft reset	ı	170	ı		Time between ACK of soft reset command and sensor entering idle state
Measurement duration	nent duration t <sub>MEAS</sub> LN Mode - 20		20.8	23.8	ıms	Duration for a pressure and temperature measurement	

**Table 7. System Timing Specifications** 



## 3.4 I<sup>2</sup>C TIMING CHARACTERIZATION

Default conditions of 25°C and 1.8V supply voltage apply to values in Table 8, unless otherwise stated.

PARAMETER	SYMBOL	CONDITIONS	MIN	ТҮР	MAX	UNITS
SCL clock frequency	f <sub>SCL</sub>		0	-	400	kHz
Hold time (repeated) START condition	t <sub>HD;STA</sub>	After this period, the first clock pulse is generated	0.6	-	-	μs
LOW period of the SCL clock	t <sub>LOW</sub>		1.3	-	-	μs
HIGH period of the SCL clock	t <sub>HIGH</sub>		0.6	-	-	μs
Set-up time for a repeated START condition	t <sub>su;sta</sub>		0.6	-	-	μs
SDA hold time	t <sub>HD;DAT</sub>		0	-	-	μs
SDA set-up time	t <sub>su;dat</sub>		100	-	-	ns
SCL/SDA rise time	t <sub>R</sub>		20	-	300	ns
SCL/SDA fall time	t <sub>F</sub>		-	-	300	ns
SDA valid time	t <sub>VD;DAT</sub>		-	-	0.9	μs
Set-up time for STOP condition	t <sub>su;sto</sub>		0.6	-	-	μs
Capacitive load on bus line	C <sub>B</sub>		-	-	400	pF

Table 8. I<sup>2</sup>C Parameters Specification

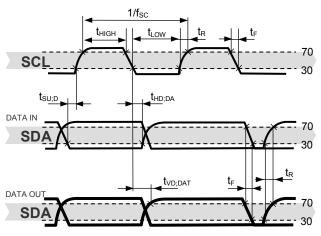


Figure 1. Digital I/O Pads Timing



# **4 APPLICATIONS INFORMATION**

## 4.1 INTERFACE SPECIFICATIONS

The ICP-101xx supports I<sup>2</sup>C fast mode, SCL clock frequency from 0 to 400 kHz.

## 4.2 PIN OUT DIAGRAM AND SIGNAL DESCRIPTION

ICP-10100 and ICP-10101: 2x2x0.72mm 10-pin LGA

PIN NUMBER	PIN NAME	DESCRIPTION
1	RESV	No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC
2	SCL	I <sup>2</sup> C Serial Clock
3	RESV	Connect to Ground
4	SDA	I <sup>2</sup> C Serial Data
5	RESV	Connect to VDD
6	RESV	Connect to VDD
7	RESV	No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC
8	GND	Connect to Ground
9	GND	Connect to Ground
10	VDD	Power Supply VDD

**Table 9. Signal Descriptions** 

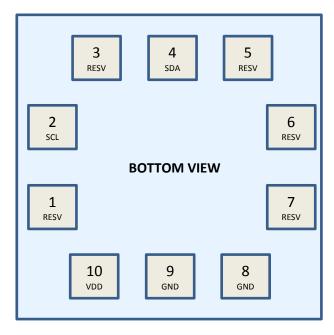


Figure 2. Pin Out Diagram for ICP-10100 & ICP10101, 2 mm x 2 mm x 0.72 mm LGA

# ICP-10110 and ICP-10111: 2x2.5x0.92 mm 8-pin LGA

PIN NUMBER	PIN NAME	DESCRIPTION
1	GND	Connect to Ground
2	RESV	No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC
3	SDA	I <sup>2</sup> C Serial Data
4	SCL	I <sup>2</sup> C Serial Clock
5	RESV	Connect to Ground
6	RESV	No Internal Connection: Can connect to VDD/V <sub>DDIO</sub> /GND/NC
7	GND	Connect to Ground
8	VDD	Power Supply VDD

**Table 10. Signal Descriptions** 

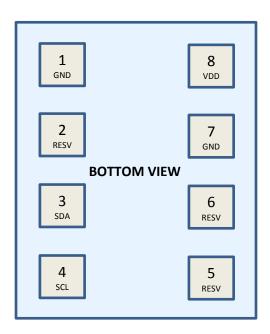


Figure 3. Pin Out Diagram for ICP-10110 & ICP-10111 2 mm x 2.5 mm x 0.92 mm LGA

## 4.3 TYPICAL OPERATING CIRCUIT

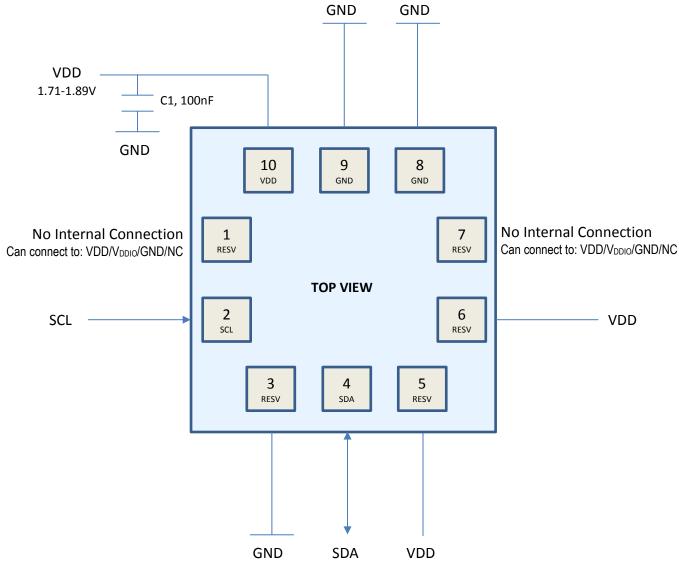


Figure 4. ICP-10100 & ICP-10101 Application Schematic

Power supply pins supply voltage (Vdd) and ground (Vss) must be decoupled with a 100 nF capacitor that shall be placed as close to the sensor as possible (see Figure 5).

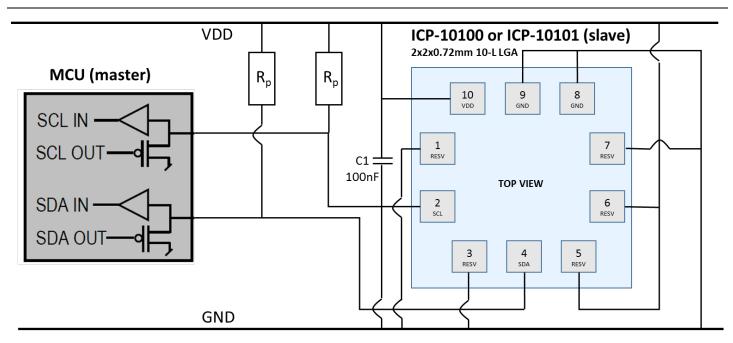


Figure 5. Example: Typical application circuit, including pull-up resistor Rp and decoupling of VDD and VSS by capacitor (2 x 2.5 mm package)

SCL is used to synchronize the communication between the microcontroller and the sensor. The master must keep the clock frequency within 0 to 400 kHz as specified in Table 8.

The SDA pin is used to transfer data in and out of the sensor. For safe communication, the timing specifications defined in the I<sup>2</sup>C manual must be met.

To avoid signal contention, the microcontroller must only drive SDA and SCL low. External pull-up resistors (i.e.  $10 \text{ k}\Omega$ ) are required to pull the signal high. For dimensioning resistor sizes, user should also consider bus capacity requirements. It should be noted that pull-up resistors may be included in I/O circuits of microcontrollers.

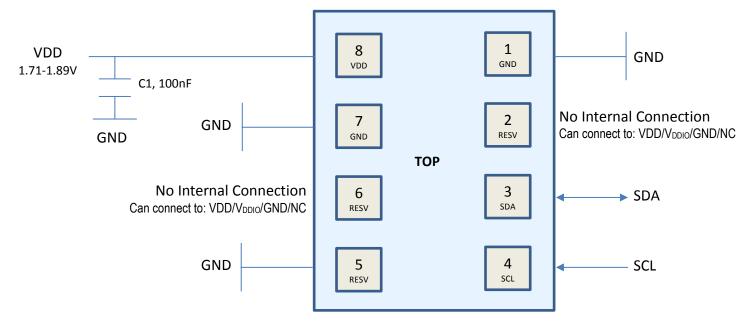


Figure 6. ICP-10110 & ICP-10111 Application Schematic



# ICP-10100, ICP-10101, ICP-10110, ICP-10111

Power supply pins supply voltage (Vdd) and ground (Vss) must be decoupled with a 100 nF capacitor that shall be placed as close to the sensor as possible (see Figure 7).		

Figure 7. Example: Typical application circuit, including pull-up resistor Rp and decoupling of VDD and VSS by capacitor (2 x 2.5 mm package)

## 4.4 BILL OF MATERIALS FOR EXTERNAL COMPONENTS

COMPONENT	LABEL	SPECIFICATION	QUANTITY
VDD Bypass Capacitor	C1	Ceramic, X7R, 100 nF ±10%	1

Table 11. Bill of Materials



## 5 OPERATION AND COMMUNICATION

All commands and memory locations of the ICP-101xx are mapped to a 16-bit address space which can be accessed via the  $I^2$ C protocol.

ICP-101XX	BINARY	DECIMAL	HEXADECIMAL
I <sup>2</sup> C address	110'0011	99	0x63

Table 12. ICP-101xx I<sup>2</sup>C Device Address

#### 5.1 POWER-UP AND COMMUNICATION START

Upon VDD reaching the power-up voltage level V<sub>POR</sub>, the ICP-101xx enters idle state after a duration of t<sub>PU</sub>. In idle state, the ICP-101xx is ready to receive commands from the master (microcontroller).

Each transmission sequence begins with START condition (S) and ends with an (optional) STOP condition (P) as described in the  $I^2$ C-bus specification. Whenever the sensor is powered up, but not performing a measurement or communicating, it automatically enters idle state for energy saving.

## **5.2 MEASUREMENT COMMANDS**

The ICP-101xx provides the possibility to define the sensor behavior during measurement as well as the transmission sequence of measurement results. These characteristics are defined by the appropriate measurement command.

Each measurement command triggers both a temperature and a pressure measurement.

OPERATION MODE	TRANSMIT T FIRST	TRANSMIT P FIRST
Low Power (LP)	0x609C	0x401A
Normal (N)	0x6825	0x48A3
Low Noise (LN)	0x70DF	0x5059
Ultra-Low Noise (ULN)	0x7866	0x58E0

**Table 13. Measurement Commands** 

#### 5.3 STARTING A MEASUREMENT

A measurement communication sequence consists of a START condition followed by the I<sup>2</sup>C header with the 7-bit I<sup>2</sup>C device address and a write bit (write W: '0', 8-bit word including I<sup>2</sup>C header: 0xC6). The sensor indicates the proper reception of a byte by pulling the SDA pin low (ACK bit) after the falling edge of the 8th SCL clock. Then the sensor is ready to receive a 16-bit measurement command. Again, the ICP-101xx acknowledges the proper reception of each byte with ACK condition. A complete measurement cycle is presented in Figure 8.

With the acknowledgement of the measurement command, the ICP-101xx starts measuring pressure and temperature.

## 5.4 SENSOR BEHAVIOR DURING MEASUREMENT

In general, the sensor does not respond to any I<sup>2</sup>C activity during measurement, i.e. I<sup>2</sup>C read and write headers are not acknowledged (NACK).

## 5.5 READOUT OF MEASUREMENT RESULTS

After a measurement command has been issued and the sensor has completed the measurement, the master can read the measurement results by sending a START condition followed by an  $I^2C$  read header (8-bit word including  $I^2C$  header: 0xC7). The sensor will acknowledge the reception of the read header and send the measured data in the specified order to the master. The MSB of the corresponding data is always transmitted first. Temperature data is transmitted in two 8-bit words and pressure data is transmitted in four 8-bit words. Regarding the pressure data, only the first three words MMSB, MLSB and LMSB contain information about the ADC pressure value  $p\_dout$ . Therefore, for retrieving the ADC pressure value, LLSB must be disregarded:

 $p\_dout = MMSB \ll 16 \mid MLSB \ll 8 \mid LMSB.$ 

Two bytes of data are always followed by one byte CRC checksum, for calculation see section 5.8. Each byte must be acknowledged by the microcontroller with an ACK condition for the sensor to continue sending data. If the ICP-101xx does not receive an ACK from the master after any byte of data, it will not continue sending data.

Whether the sensor sends out pressure or temperature data first depends on the measurement command that was sent to the sensor to initiate the measurement (see Table 13).

The I<sup>2</sup>C master can abort the read transfer with a NACK condition after any data byte if it is not interested in subsequent data, e.g. the CRC byte or the second measurement result, to save time.

#### 5.6 SOFT RESET

The ICP-101xx provides a soft reset mechanism that forces the system into a well-defined state without removing the power supply. If the system is in idle state (i.e. if no measurement is in progress) the soft reset command will be accepted by ICP-101xx. This triggers the sensor to reset all internal state machines and reload calibration data from the memory.

COMMAND	HEXADECIMAL CODE	BINARY CODE
Soft reset	0x805D	1000'0000'0101'1101

**Table 14. Soft Reset Command** 

#### 5.7 READ-OUT OF ID REGISTER

The ICP-101xx has an ID register which contains a specific product code. The read-out of the ID register can be used to verify the presence of the sensor and proper communication. The command to read the ID register is shown in Table 15.

COMMAND	HEXADECIMAL CODE	BINARY CODE
Read ID register	0xEFC8	1110'1111'1100'1000

Table 15. Read-Out Command of ID Register

It needs to be sent to the ICP-101xx after an I<sup>2</sup>C write header. After the ICP-101xx has acknowledged the proper reception of the command, the master can send an I<sup>2</sup>C read header and the ICP-101xx will submit the 16-bit ID followed by 8 bits of CRC. The structure of the ID is described in Table 16. Bits 15:6 of the ID contain unspecified information (marked as "x"), which may vary from sensor to sensor, while bits 5:0 contain the ICP-101xx specific product code.

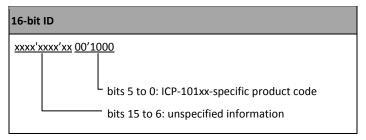


Table 16. 16-bit ID Structure

#### 5.8 CHECKSUM CALCULATION

The 8-bit CRC checksum transmitted after each data word is generated by a CRC algorithm with the properties displayed in Table 17. The CRC covers the contents of the two previously transmitted data bytes.

Document Number: DS-000186

PROPERTY	VALUE
Name	CRC-8
Width	8 bits
Polynomial	0x31 (x <sup>8</sup> + x <sup>5</sup> + x <sup>4</sup> + 1)
Initialization	0xFF
Reflect input	false
Reflect output	false
Final XOR	0x00
Examples	CRC(0x00) = 0xAC CRC(0xBEEF) = 0x92

Table 17. ICP-101xx I2C CRC Properties

#### 5.9 CONVERSION OF SIGNAL OUTPUT

Pressure measurement data is always transferred as 4 8-bit words; temperature measurement data is always transferred as two 8-bit words. Please see section 5.5 for more details.

Temperature measurement values  $t_dout$  are linearized by the ICP-101xx and must be calculated to °C by the user via the following formula:

$$T = -45^{\circ}\text{C} + \frac{175^{\circ}\text{C}}{2^{16}} \times t\_dout.$$

For retrieving physical pressure values in Pa the following conversion formula has to be used:

$$P = A + \frac{B}{C + \rho_{\text{dout}}},$$

where  $p\_dout$  is the sensor's raw pressure output. The converted output is compensated for temperature effects via the temperature dependent functions A, B and C. Besides the raw temperature output  $t\_dout$ , the calculation of A, B and C requires to access calibration parameters OTP0, OTP1, OTP2, OTP3 stored in the OTP of the sensor. Read-out of OTP parameters is described in section 5.10.

Full sample code for calculating physical pressure values is given in section 5.11. The general workflow of the conversion is done by:

- 1) Import class Invensense\_pressure\_conversion
- 2) Read out values OTP0, ..., OTP3 and save to c1, ..., c4
- Create object name for an individual sensor with parameter values c1, ..., c4 name = Invensense\_pressure\_conversion ([c1,c2,c3,c4])
- 4) Get raw pressure p\_dout and temperature t\_dout data from the sensor as described in chapter 5.5.
- 5) Call function get\_pressure: name.get\_pressure(p\_dout, t\_dout)

The sample code from section 5.13 gives an example of this workflow.



#### **5.10 READ-OUT OF CALIBRATION PARAMETERS**

For converting raw pressure data to physical values, four calibration parameters have to be retrieved from the OTP of the sensor.

#### Set up of OTP read:

- 1) Send I<sup>2</sup>C write header 0xC6
- 2) Send command 0xC595 (move pointer in address register)
- 3) Send address parameter together with its CRC 0x00669C

Steps 1) -3) can be executed on many platforms by a single I<sup>2</sup>C write of the value 0xC59500669C.

#### Read out parameters:

Repeat the following procedure 4 times:

- a) Send I<sup>2</sup>C write header 0xC6
- b) Send command 0xC7F7 (incremental read-out of OTP)
- c) Send I<sup>2</sup>C read header 0xC7
- d) Read 3B (2B of data and 1B of CRC)
- e) Decode data as 16bit big endian signed integer and store result into n-th calibration parameter cn.

Steps a) to d) can be executed on many platforms by a single write 0xC7F7 to the chip address followed by a single read of 3 B from the chip address.

#### **5.11 SAMPLE CODE: EXAMPLE C SYNTAX**

```
/* data structure to hold pressure sensor related parameters */
typedef struct inv_invpres
  struct inv_invpres_serif serif;
  uint32_t min_delay_us;
  uint8_t pressure_en;
  uint8_t temperature_en;
  float sensor_constants[4]; // OTP values
  float p_Pa_calib[3];
  float LUT_lower;
 float LUT_upper;
  float quadr_factor;
  float offst_factor;
} inv_invpres_t;
int inv_invpres_init(struct inv_invpres * s)
  short otp[4];
  read_otp_from_i2c(s, otp);
 init base(s, otp);
 return 0;
int read_otp_from_i2c(struct inv_invpres * s, short *out)
  unsigned char data_write[10];
  unsigned char data_read[10] = {0};
  int status;
  int i:
  // OTP Read mode
  data\_write[0] = 0xC5;
  data_write[1] = 0x95;
  data\_write[2] = 0x00;
  data_write[3] = 0x66;
  data_write[4] = 0x9C;
```

```
status = inv_invpres_serif_write_reg(&s->serif, ICC_ADDR_PRS, data_write, 5);
  if (status)
            return status;
  // Read OTP values
  for (i = 0; i < 4; i++) {
            data_write[0] = 0xC7;
            data_write[1] = 0xF7;
            status = inv_invpres_serif_write_reg(&s->serif, ICC_ADDR_PRS, data_write, 2);
            if (status)
            status = inv_invpres_serif_read_reg(&s->serif, ICC_ADDR_PRS, data_read, 3);
            if (status)
                       return status:
            out[i] = data_read[0]<<8 | data_read[1];</pre>
  return 0;
void init_base(struct inv_invpres * s, short *otp)
  int i;
  for(i = 0; i < 4; i++)</pre>
            s->sensor_constants[i] = (float)otp[i];
  s->p_Pa_calib[0] = 45000.0;
s->p_Pa_calib[1] = 80000.0;
  s \rightarrow p_p a_calib[2] = 105000.0;
  s - > LUT_lower = 3.5 * (1 << 20);
  s->LUT_upper = 11.5 * (1<<20);
  s->quadr_factor = 1 / 16777216.0;
  s->offst_factor = 2048.0;
}
// p_LSB -- Raw pressure data from sensor
// T_LSB -- Raw temperature data from sensor
int inv_invpres_process_data(struct inv_invpres * s, int p_LSB, int T_LSB,
                                                                  float * pressure, float * temperature)
  float t;
  float s1.s2.s3;
  float in[3];
  float out[3];
  float A,B,C;
  t = (float)(T_LSB - 32768);
  s1 = s->LUT_lower + (float)(s->sensor_constants[0] * t * t) * s->quadr_factor;
s2 = s->offst_factor * s->sensor_constants[3] + (float)(s->sensor_constants[1] * t * t) * s->quadr_factor;
  s3 = s->LUT_upper + (float)(s->sensor_constants[2] * t * t) * s->quadr_factor;
  in[0] = s1;
  in[1] = s2;
  in[2] = s3;
  calculate_conversion_constants(s, s->p_Pa_calib, in, out);
  A = out[0];
  B = out[1];
  C = out[2];
  *pressure = A + B / (C + p_LSB);
*temperature = -45.f + 175.f/65536.f * T_LSB;
  return 0;
// p_Pa -- List of 3 values corresponding to applied pressure in Pa
// p_LUT -- List of 3 values corresponding to the measured p_LUT values at the applied pressures.
void calculate_conversion_constants(struct inv_invpres * s, float *p_Pa,
                                                                                       float *p_LUT, float *out)
  float A,B,C;
  C = (p\_LUT[0] * p\_LUT[1] * (p\_Pa[0] - p\_Pa[1]) +
            p_LUT[1] * p_LUT[2] * (p_Pa[1] - p_Pa[2]) + p_LUT[2] * p_LUT[0] * (p_Pa[2] - p_Pa[0])) /
```



```
(p_LUT[2] * (p_Pa[0] - p_Pa[1]) +
             p_LUT[0] * (p_Pa[1] - p_Pa[2]) +
p_LUT[1] * (p_Pa[2] - p_Pa[0]));
A = (p\_Pa[0] * p\_LUT[0] - p\_Pa[1] * p\_LUT[1] - (p\_Pa[1] - p\_Pa[0]) * C) / (p\_LUT[0] - p\_LUT[1]);
B = (p\_Pa[0] - A) * (p\_LUT[0] + C);
out[0] = A;
out[1] = B;
out[2] = C;
```

```
5.12 SAMPLE CODE: CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX)
class InvensensePressureConversion:
    """ Class for conversion of the pressure and temperature output of the Invensense sensor"""
   def __init__(self, sensor_constants):
       """ Initialize customer formula
       Arguments:
       sensor_constants -- list of 4 integers: [c1, c2, c3, c4]
       self.sensor_constants = sensor_constants
       # configuration for ICP-101xx Samples
       self.p_Pa_calib = [45000.0, 80000.0, 105000.0]
       self.LUT_lower = 3.5 * (2**20)
       self.LUT\_upper = 11.5 * (2**20)
       self.quadr_factor = 1 / 16777216.0
       self.offst_factor = 2048.0
    def calculate_conversion_constants(self, p_Pa, p_LUT):
        """ calculate temperature dependent constants
       Arguments:
       p_Pa -- List of 3 values corresponding to applied pressure in Pa
       p\_LUT -- List of 3 values corresponding to the measured p\_LUT values at the applied pressures.
       C = (p_LUT[0] * p_LUT[1] * (p_Pa[0] - p_Pa[1]) +
            p_LUT[1] * p_LUT[2] * (p_Pa[1] - p_Pa[2]) +
            p_LUT[2] * p_LUT[0] * (p_Pa[2] - p_Pa[0])) / \
            (p_LUT[2] * (p_Pa[0] - p_Pa[1]) +
            p_LUT[0] * (p_Pa[1] - p_Pa[2]) +
            p_LUT[1] * (p_Pa[2] - p_Pa[0]))
       A = (p_{Pa}[0] * p_{LUT}[0] - p_{Pa}[1] * p_{LUT}[1] - (p_{Pa}[1] - p_{Pa}[0]) * C) / (p_{LUT}[0] - p_{LUT}[1])
       B = (p_Pa[0] - A) * (p_LUT[0] + C)
       return [A, B, C]
    def get_pressure(self, p_LSB, T_LSB):
```




""" Convert an output from a calibrated sensor to a pressure in Pa. Arguments: p\_LSB -- Raw pressure data from sensor T\_LSB -- Raw temperature data from sensor  $t = T_LSB - 32768.0$ s1 = self.LUT\_lower + float(self.sensor\_constants[0] \* t \* t) \* self.quadr\_factor s2 = self.offst\_factor \* self.sensor\_constants[3] + float(self.sensor\_constants[1] \* t \* t) \* self.quadr\_factor s3 = self.LUT\_upper + float(self.sensor\_constants[2] \* t \* t) \* self.quadr\_factor A, B, C = self.calculate\_conversion\_constants(self.p\_Pa\_calib, [s1, s2, s3]) return A + B /  $(C + p_LSB)$ [end of the pseudocode]

```
5.13 SAMPLE CODE: USING CONVERSION FORMULA (EXAMPLE PYTHON SYNTAX)
```


```
def read_otp_from_i2c():
         # TODO: implement read from I2C
         # refer to data sheet for I2C commands to read OTP
         return 1000, 2000, 3000, 4000
def read_raw_pressure_temp_from_i2c():
         # TODO: implement read from I2C
         # refer to data sheet for I2C commands to read pressure and temperature
         return 8000000, 32000
# Sample code to read
from Invensense_pressure_conversion import Invensense_pressure_conversion
# -- initialization
c1, c2, c3, c4 = read_otp_from_i2c()
conversion = Invensense_pressure_conversion([c1, c2, c3, c4])
# -- read raw pressure and temp data, calculate pressure
p, T = read_raw_pressure_temp_from_i2c()
pressure = conversion.get_pressure(p, T)
print 'Pressure: %f' % pressure
[end of the pseudocode]
```


## 5.14 COMMUNICATION DATA SEQUENCES


3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28





# ICP-10100, ICP-10101, ICP-10110, ICP-10111

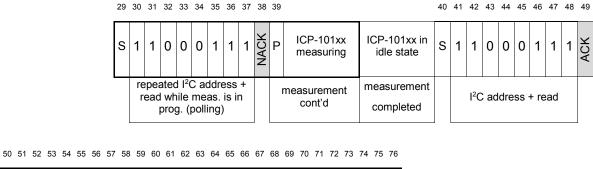









**Figure 8. Communication Data Sequences** 



## 6 ASSEMBLY

This section provides general guidelines for assembling TDK-InvenSense Micro Electro-Mechanical Systems (MEMS) pressure sensors.

#### 6.1 IMPLEMENTATION AND USAGE RECOMMENDATIONS

## **Soldering**

When soldering, use the standard soldering profile IPC/JEDEC J-STD-020 with peak temperatures of 260°C. ICP-101xx may exhibit a pressure offset after soldering, some settling time may be required depending on soldering properties, PCB properties, and ambient conditions.

The ICP-101xx is an open cavity package, it is mandatory to use no-clean solder paste and no board wash should be applied.

## **Chemical Exposure and Sensor Protection**


The ICP-101xx is an open cavity package, the ICP-101x0 is waterproof to 1.5m for 30 minutes (IPx8), however the ICP-101x1 should not be exposed to particulates or liquids. If any type of protective coating must be applied to the circuit board, the sensor must be protected during the coating process.

Document Number: DS-000186



# 7 PACKAGE DIMENSIONS

Package dimensions for the ICP-10100 & ICP-10101:

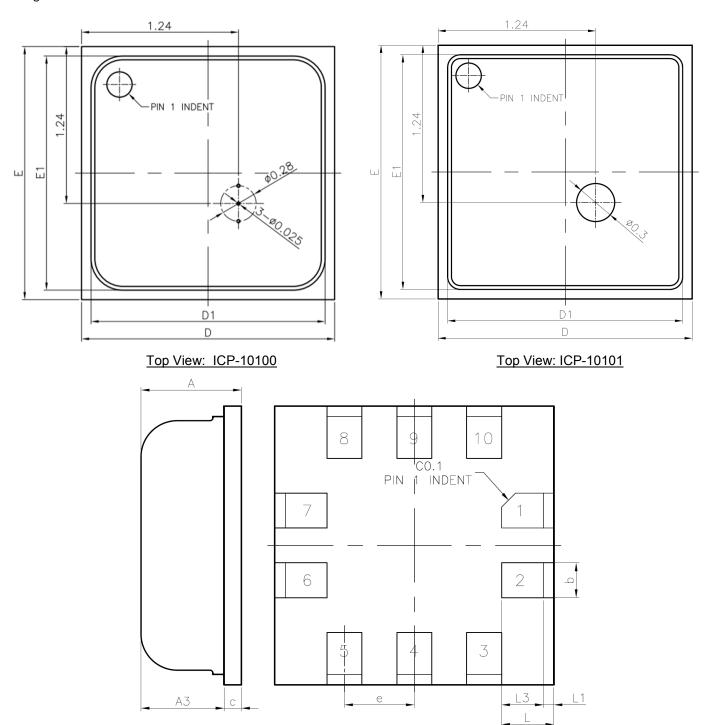

Bottom View: ICP-10100 & ICP-10101

Figure 9. ICP-10100 & ICP-1010 Package Diagrams

CVMDOLC	DIMENSIONS IN MILLIMETERS			
SYMBOLS	MIN.	NOM.	MAX.	
А	0.64	0.72	0.800	
A3		0.595 REF.		
b		0.25		
С		0.125 REF.		
D	1.90	2.00	2.10	
D1		1.85		
E	1.90	2.00	2.10	
E1		1.85		
е		0.50		
L	0.275	0.375	0.400	
L1	0.025	0.075	0.100	
L3	0.250	0.300	0.325	

Table 18. ICP-10100 & ICP-10101 Package Dimensions

Recommended PCB land pattern for the ICP-10100 & ICP-10101:



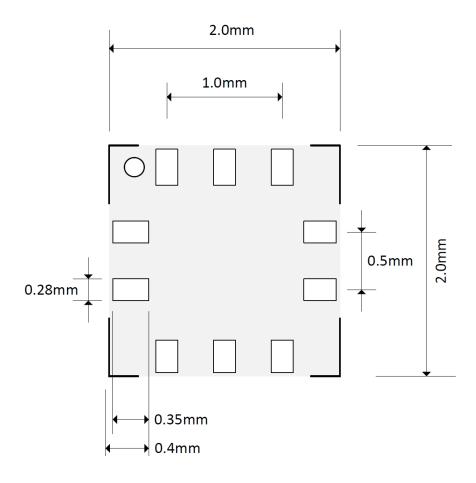


Figure 10. ICP-10100 & ICP-10101 recommended PCB land pattern

## Product artwork for the ICP-10100 & ICP-10101:

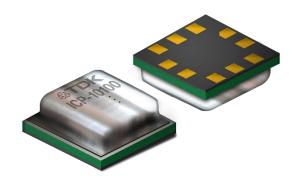


Package Artwork: ICP-10100

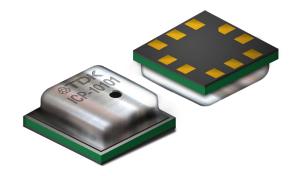


Package Artwork: ICP-10101


## Package dimensions for the ICP-10110 & ICP-10111:

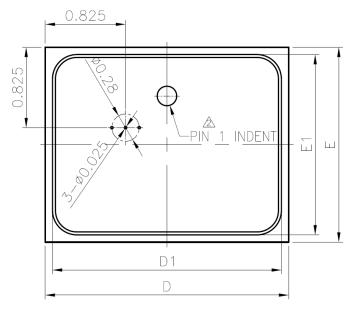

Top View: ICP-10110

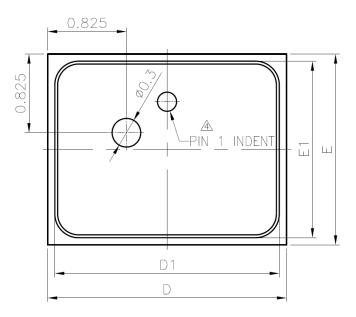

Top View: ICP-10111

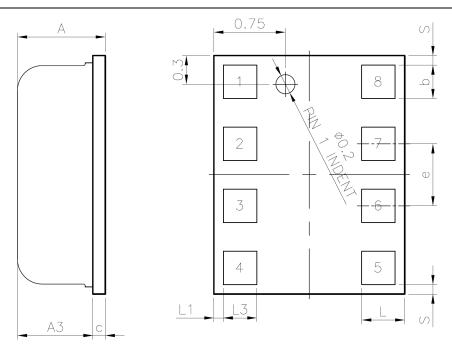

Bottom View: ICP-10110 & ICP-10111

Figure 11. ICP-10110 & ICP-10111 Package Diagrams

SYMBOLS	DIMENSIONS IN MILLIMETERS		
STIVIDOLS	MIN.	NOM.	MAX.
А	0.84	0.92	1.00
A3		0.79 REF.	
b		0.35	
С		0.13 REF.	
E	1.90	2.00	2.10
E1		1.85	
D	2.40	2.50	2.60
D1		2.35	
е		0.65	
L	0.35	0.45	0.55
L1	0.05	0.10	0.15
L3	0.30	0.35	0.40
S		0.10	

Table 19. ICP-10110 & ICP-10111 Package Dimensions

Recommended PCB land pattern for the ICP-10110 & ICP-10111:



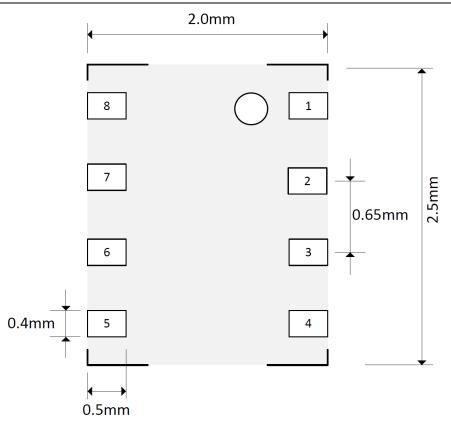


Figure 12. ICP-10110 & ICP-10111 recommended PCB land pattern

## Product artwork for the ICP-10110 & ICP-10111:

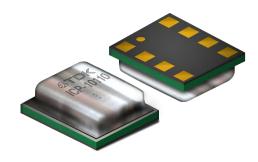

Package Artwork: ICP-10110

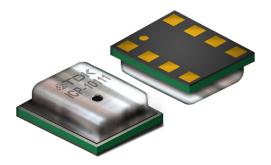

Package Artwork: ICP-10111



## 8 PART NUMBER PART MARKINGS

The part number part markings for ICP-101xx devices are summarized below:

PART NUMBER	PART MARKING
ICP-10100	P1
ICP-10101	P2
ICP-10110	P5
ICP-10111	P6

**Table 20. Part Number Part Markings** 

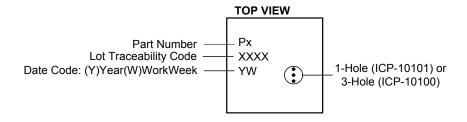


Figure 13. Part Number Part Markings for 2x2mm (ICP-10101 & ICP-10100)

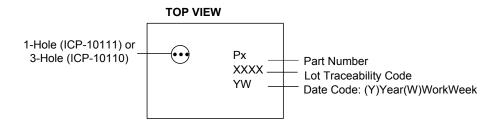


Figure 144. Part Number Part Markings for 2x2.5mm (ICP-10111 & ICP-10110)



# 9 ORDERING GUIDE

PART	TEMP RANGE	PACKAGE BODY	PACKAGE LID	QUANTITY	PACKAGING
ICP-10100†	-40°C to +85°C	2x2x0.72mm LGA-10L	3-Hole: 1.5m Waterproof	10,000	13" Tape and Reel
ICP-10101†	-40°C to +85°C	2x2x0.72mm LGA-10L	1-Hole	10,000	13" Tape and Reel
ICP-10110†	-40°C to +85°C	2x2.5x0.92mm LGA-8L	3-Hole: 1.5m Waterproof	10,000	13" Tape and Reel
ICP-10111†	-40°C to +85°C	2x2.5x0.92mm LGA-8L	1-Hole	10,000	13" Tape and Reel

<sup>†</sup>Denotes RoHS and Green-Compliant Package



## 10 REFERENCES

Please refer to "InvenSense MEMS Handling Application Note (AN-IVS-0002A-00)" for the following information:

- Manufacturing Recommendations
  - o Assembly Guidelines and Recommendations
  - o PCB Design Guidelines and Recommendations
  - o MEMS Handling Instructions
  - o ESD Considerations
  - Reflow Specification
  - Storage Specifications
  - Package Marking Specification
  - o Tape & Reel Specification
  - o Reel & Pizza Box Label
  - Packaging
  - o Representative Shipping Carton Label
- Compliance
  - Environmental Compliance
  - o DRC Compliance
  - o Compliance Declaration Disclaimer



# 11 REVISION HISTORY

Revision Date	Revision	Description
01/02/2017	1.0	Initial Release
02/04/2019	1.1	Updated package drawing information to include additional details
05/06/2019	1.2	Updated package drawing information to clarify dimensions



This information furnished by InvenSense, Inc. ("InvenSense") is believed to be accurate and reliable. However, no responsibility is assumed by InvenSense for its use, or for any infringements of patents or other rights of third parties that may result from its use. Specifications are subject to change without notice. InvenSense reserves the right to make changes to this product, including its circuits and software, in order to improve its design and/or performance, without prior notice. InvenSense makes no warranties, neither expressed nor implied, regarding the information and specifications contained in this document. InvenSense assumes no responsibility for any claims or damages arising from information contained in this document, or from the use of products and services detailed therein. This includes, but is not limited to, claims or damages based on the infringement of patents, copyrights, mask work and/or other intellectual property rights.

Certain intellectual property owned by InvenSense and described in this document is patent protected. No license is granted by implication or otherwise under any patent or patent rights of InvenSense. This publication supersedes and replaces all information previously supplied. Trademarks that are registered trademarks are the property of their respective companies. InvenSense sensors should not be used or sold in the development, storage, production or utilization of any conventional or mass-destructive weapons or for any other weapons or life threatening applications, as well as in any other life critical applications such as medical equipment, transportation, aerospace and nuclear instruments, undersea equipment, power plant equipment, disaster prevention and crime prevention equipment.

©2016—2017 InvenSense. All rights reserved. InvenSense, MotionTracking, MotionProcessing, MotionProcessor, MotionFusion, MotionApps, DMP, AAR, and the InvenSense logo are trademarks of InvenSense, Inc. The TDK logo is a trademark of TDK Corporation. Other company and product names may be trademarks of the respective companies with which they are associated.



©2016—2019 InvenSense. All rights reserved.