

Tel:+81-476-33-5811
Fax:+81-476-33-5509
AFTN:RJAAJNYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 033/09
27 AUG 2009

033/09

有視界飛行方式により飛行する航空機の異常接近 防止対策について

航空交通の輻輳する空域を有視界飛行方式(VFR)により飛行する航空機は、計器飛行方式(IFR)により飛行する航空機並びに他のVFR機との異常接近を防止するため外部監視を十分にを行い、搭載しているATCトランスポンダーのVFRコード(飛行高度10,000フィート未満は1200, 10,000フィート以上は1400)及びモードCを常時発信させることに加えて、次に掲げる事項を徹底されたい。

1. ターミナルレーダー管制業務が行われている進入管制区において、航空路、出発経路及び到着経路等の設定により、特にIFR機が輻輳する空域を飛行する場合は、関係管制機関と無線電話により通信設定を行い、自機の位置、高度等運航情報の連絡に努めること。
また、他機の動向を把握するためにも、無線通信の聴取に努めること。
2. TCAアドバイザリー業務が行われている空域においては、積極的に当該サービスの提供を受けること。
3. 管制区または管制圏において、写真撮影等の特殊な飛行を行う場合は、事前に関係航空交通管制部、空港事務所及び空港出張所と飛行計画の概要及び使用無線周波数並びに装備しているATCトランスポンダーの発信コード等について十分に調整すること。
4. レーダー業務の提供を受けている場合、又はターミナル管制機関と通信設定を行っている場合においても、衝突防止の見張り義務がVFR機パイロットに課せられていることを認識すること。

033/09

Countermeasures for the prevention of near collision of aircraft operating in accordance with Visual Flight Rules

The pilot of operating in accordance with Visual Flight Rules (VFR) in the airspace congested by traffic shall watch outside enough to avoid near collision with aircraft flying in accordance with Instrument Flight Rules (IFR) and/or VFR, and should squawk VFR Beacon Code (1200 specified below 10,000 feet, 1400 specified at or above 10,000 feet) with mode C of ATC transponder on board.

In addition to these procedures, the pilot is strongly required to accomplish the items listed below.

1. To contact with ATC facilities and to report his flight information such as position, altitude etc., in approach control area provided with radar service, especially in the airspace congested by IFR traffic because of establishment of airways, departure routes, arrival routes so on.
To monitor communication of Air Traffic Control in order to understand the situation of other traffic in the vicinity as well.
2. To request TCA advisory services positively within the Terminal Control Area (TCA).
3. To coordinate enough with appropriate ACC (Area Control Center) or Airport officer in advance about flight plans, frequencies to communicate and ATC transponder beacon codes in case of conducting a special flight like a photomission in the control area and/or the control zone.
4. To recognize that pilot has a responsibility to avoid near collision with other aircraft even if he is under radar control or just has communication with terminal air traffic control facilities.

本航空情報サーキュラーは、平成3年4月15日付 AIC NR009
を再発行したものである。

AIC NR009 dated 15 APR 1991 is reissued as this AIC

Tel:+81-476-33-5811
Fax:+81-476-33-5509
AFTN:RJAAANYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 034/09
27 AUG 2009

034/09

出発及び到着の方式等を構成する航空保安無線施設の短時間(4時間程度)停波及び突発的停波時における対応について

平成7年9月14日0000JSTから、出発及び到着の方式等を構成する航空保安無線施設が短時間(4時間程度)または突発的に停波する際、レーダー管制業務が提供されており、運航者にとって有益であり、かつ、管制官にとって有効であると判断される場合には、以下の措置が講じられる。

1. 標準計器出発方式、転移経路及び標準到着経路

構成する航空保安無線施設の停波時にあっては、レーダー誘導により管制承認が発出される。

2. 計器進入方式

進入復行方式を構成する航空保安無線施設の停波時にあっては、進入復行についてレーダー誘導が実施される場合、計器進入方式が許可される。

この場合、進入復行がレーダー誘導により実施される旨、あらかじめ通報(周知)される。

3. 誘導中における通信途絶の場合の飛行方法

出発航空機は、他の周波数を用いて通信設定を試みること等のほか、通報された誘導目標に向かい飛行する。また、進入復行中の航空機もこれに同じとする。

034/09

In case of short (for about 4 hours) or unexpected outage of Aeronautical Radio Navigational Aid (NAVAID) which composes departure or arrival procedures etc.

From 1500 UTC 13 SEP 1995, in case of short (for about 4 hours) or unexpected outage of NAVAID which composes departure or arrival procedures etc., where radar control service is provided and when the operational benefits of aircraft and the advantage of ATC are expected, following methods will be taken.

1. Standard Instrument Departure, Transition and Standard Arrival Route

Clearance with radar vectors will be issued when NAVAID which composes them is out of service.

2. Instrument Approach Procedure (IAP)

When NAVAID which composes its Missed Approach procedure is out of service, Aircraft will be cleared for IAP on condition that radar vectors are to be provided for missed approach.

In this case, it will be informed to all operators in advance that radar vectors will be provided for missed approach.

3. Pilot procedures for communication failure during radar vectors

Departing aircraft shall proceed to the fix that has been reported as the vector purpose as well as attempting to contact ATC on other frequencies. Aircraft executing missed approach shall also follow as above.

本航空情報サーキュラーは、平成7年8月17日付AIC NR011を再発行したものである。

AIC NR011 dated 17 AUG 1995 is reissued as this AIC.

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN
MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 053/09
24 SEP 2009

053/09

大阪国際空港における滑走路誤進入防止について

1. 大阪国際空港における滑走路誤進入防止対策の一環として、滑走路への進入の許可又は滑走路横断の許可と滑走路手前待機指示の違いを明確にするため、大阪飛行場管制所が発出する滑走路手前待機指示には以下の用語が使用される。

"Hold short of STOP LINE"

2. 備考

- 1) パイロットへの注意喚起強化のため、付図に示す STOP 標識が停止位置案内標識の手前に設置される。
2) 滑走路警灯が常時点灯される。

053/09

Prevention of RWY incursion at Osaka INTL AP/ RJOO


1. As a measure for prevention of RWY incursion at Osaka INTL AP, ATC issues instruction for pilot to hold short of RWY by the following phraseology.

This phraseology is intended to clarify the difference between the clearance to enter RWY/cross RWY and the instruction to hold short of RWY.

"Hold short of STOP LINE"

2. Remarks

- 1) "STOP" markings are installed before mandatory instruction markings for enhancing situational awareness of pilot.
2) Runway guard lights are turned on in operational time of Osaka INTL AP.

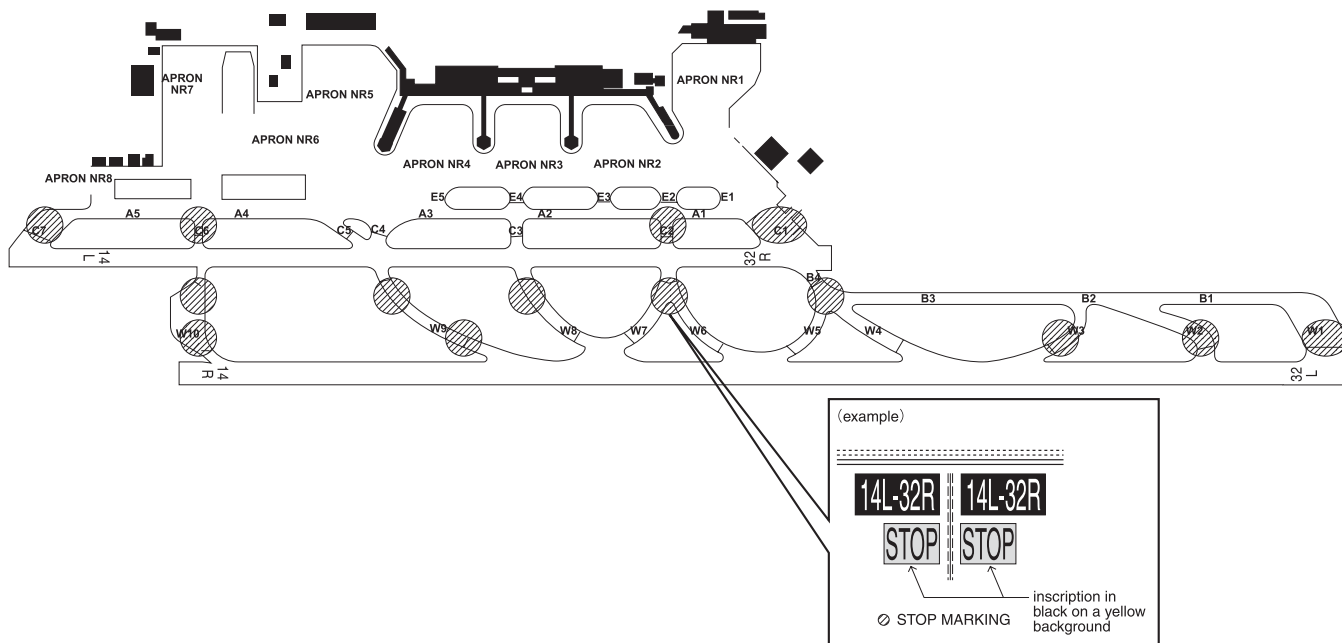

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

034/14

航空安全情報自発報告制度 (VOICES) について

国土交通省航空局は、ICAO ANNEX 19 SAFETY MANAGEMENT に従い、航空安全プログラム (SSP : State Safety Program) を平成 26 年 4 月 1 日に施行し、また、同プログラムの一環として、航空安全情報自発報告制度 (以下、「自発報告制度」という) の運用を同年 7 月 10 日から開始した。本制度の略称を「VOICES」という。

1. 目的

自発報告制度は、義務報告制度では捕捉しにくい、民間航空の安全に関する情報を幅広く収集し、分析し、及び関係者と共有することにより、航空事故その他の航空の安全運航に影響を及ぼす事態の予防的対策の実施に役立てることを目的とする。

2. 定義

本航空情報サーキュラーで使用する用語の定義は次のとおりとする。

- (1) 「航空安全当局」とは、国土交通省航空局 (地方航空局を含む。) のうち、民間航空の安全を確保するための監督を行う課等をいう。
- (2) 「航空安全情報自発報告サイト」とは、民間航空の運航に係る安全情報を収集、分析及び共有するために、国土交通省航空局が設置し、第三者機関が運営するウェブサイトを用いる。

<https://asicss.cab.mlit.go.jp/voluntary/>

※航空安全情報自発報告サイトの内部の情報は、7. 第三者機関及び問い合わせ先を示す本制度を運営する第三者機関のみが取り扱う。

3. 基本原則

- (1) 主たる報告者は、航空活動に自ら直接携わる個人又は当該個人が所属する組織とする。
- (2) 主たる報告対象事象は、航空活動を行う中で、自ら経験した、又は視認した、航空の安全上の支障を及ぼす可能性があったと思われる事象とする。
※報告事項は、航空活動を行う中で、自らが、当事者であるか否かにかかわらず、その五感により直接確認した (他人からの伝聞によるものは含まない)、航空の安全上の支障を及ぼす可能性があったと思われる事象とする。
- (3) 報告を受ける主体は、航空安全当局及び主たる報告者以外の者 (以下、「第三者機関」という) が行う。
- (4) 航空安全当局は、この制度において収集した情報のうち、個人、会社名等が特定される情報について、直接アクセスせず、運営主体に対し、当該情報の提供を求めない。また、仮に当該情報において違反があったことを知ったとしても、当該情報を不利益処分等の根拠として使用しない。

4. 対象

本制度は、上記 3. 基本原則 (1) に示すとおり、航空機の運航に関係する、又は航空機の運航を直接的に支援する活動に自ら直接携わる個人又は当該個人が所属する組織を対象とする。

034/14

Voluntary Information Contributory to Enhancement of the Safety (VOICES)

Japan Civil Aviation Bureau (JCAB), in accordance to ANNEX 19 SAFETY MANAGEMENT to the Convention on International Civil Aviation, implemented a State Safety Program (SSP) on 1 April 2014, and as part of the SSP it established and commenced the operation of a voluntary safety information reporting system on 10 July 2014, which is referred to as "Voluntary Information Contributory to Enhancement of the Safety (VOICES)".

1. Objectives

The objectives of VOICES are to facilitate collection of information that cannot be easily acquired within the framework of the mandatory incident reporting system, analyze relevant data related to the safety of civil aviation, and share them with stakeholders to be effectively used to help implement proactive measures to prevent aircraft accidents and any other occurrences that may adversely affect safe operation of aircraft.

2. Definitions

Words used in this AIC are defined as follows;

- 1) "Civil aviation safety authority" is a division or a section of JCAB (including the regional civil aviation bureaus) that is responsible for the safety oversight of civil aviation.
- 2) "Aviation Safety Information Voluntary Reporting Site" is the website established by JCAB and confided to a third party to collect, analyze, and share safety information concerning aviation activities.

<https://asicss.cab.mlit.go.jp/voluntary/>

Note: Information recorded at this website is handled only by the third party operating this system shown in item 7.

3. General principles

VOICES is implemented according to the following concepts:

- 1) A reporter shall be an individual who is directly engaged in aviation activities or the organization the individual belongs to.
- 2) A safety occurrence to be reported is the one which could have impacted the safety of aviation, experienced or viewed by either the reporter or a personnel belonging to the reporter in the course of his/her aviation activities.
Note: A safety occurrence to be reported should be directly perceived by either the reporter or a personnel belonging to the reporter with his/her senses in the course of its aviation activities, excluding indirect experiences.
- 3) A third party responsible for receiving the reports shall be appointed and its operation will be independent from civil aviation safety authorities.
- 4) The civil aviation safety authorities shall not have direct access to any information through which the individuals or organizations that were involved can be identified, nor request the operating entity to provide such information. In addition, even if any violation is found from the information, the information shall not be used as the evidence of any punitive action.

4. Applicability

This notice is applied to personnel and organizations who are engaged in aviation activities.

※個人及び組織には、次のものが含まれるが、これらに限定するものではない。

航空従事者（操縦士、整備士等）、客室乗務員、運航管理者、指定航空従事者養成施設及び認定事業場の業務実施者、航空管制官等の航空保安業務実施者、航空保安施設の管理運用に携わる者、空港施設・運用業務実施者、地上取扱業務実施者、及び航空機の設計製造に携わる者、並びにこれらの者が所属する組織（航空運送事業者、航空機使用事業者、指定航空従事者養成施設、認定事業場、航空管制機関、航空保安施設管理者、空港管理者、グラウンドハンドリング会社、航空機設計製造会社、航空機を運航する公的機関等）

5. 報告の方法

次のいずれの方法でも報告が可能。第三者機関の分析担当者が報告内容の確認を行うために、報告様式に連絡先等の情報を記入することを必須とするが、当該情報は秘匿化実施後にすべて抹消される。

- (1) 第三者機関が管理する自発報告制度専用のウェブサイト（以下、「第三者機関ウェブサイト」という）から提出可能。
<http://www.jihatsu.jp/>
- (2) 航空安全情報自発報告サイト
<https://asicss.cab.mlit.go.jp/voluntary/>
- (3) 電子メールにより直接 mail@jihatsu.jp へて送付することも可能。
- (4) ファックス 03-6435-4727
第三者機関ウェブサイトで送信用報告用紙をダウンロード可能。自由形式でも受け付けられる。
- (5) 電話（フリーダイヤル） 0800-8057-482
受付時間：平日午前 9 時～午後 5 時
- (6) 報告用紙の郵送による報告
報告様式を、第三者機関へて郵送する（7. 第三者機関及び問い合わせ先参照）。郵送用報告様式は、第三者機関ウェブサイトからダウンロード可能。

6. 報告された安全情報の取扱い

提供された安全情報の処置、分析およびフィードバックは次のように実施される。

- (1) 報告の受付
第三者機関により自発報告制度で取扱うことができる情報かどうか確認した上で、情報が受理される。受理できない場合は、第三者機関の分析担当者から、その旨報告者に対して連絡する。
- (2) 分析担当者による確認
報告者から提供された情報に分析・分類等を行う上で必要な内容が不足している等、詳細を確認する必要がある場合、分析担当者より電話や電子メール等によりヒアリングを行うことがある。
- (3) 情報の秘匿化
分析担当者は、個人又は会社等が特定される可能性のある情報の秘匿化を実施する。秘匿化実施後、報告が航空安全情報自発報告サイト以外の手段で提供された場合は、当該サイトに登録される。その際、報告者が、報告内容や分析状況等を当該サイトで閲覧するための「受付番号」と「パスワード」が通知される。
上記作業実施後、分析担当者は報告者へ連絡の上、提供された連絡先等を抹消する。
- (4) 分析作業およびフィードバック
報告された事象等を適切に評価分析するため、第三者機関において各業務分野に精通した担当者で構成される専門チームにより、航空の安全を阻害する要因を特定すべく予防的な観点から分析を実施する。専門チームの分析結果は、業務分野別に設定する分析検討ワーキング・グループにて定期的に各分野の専門家から意見収集を行った後、学識経験者等で構成される分析委員会（年 2 回程度開催）にて、分析結果を取りまとめ、第三者機関ウェブサイト上にて刊行物を発行し公表する。
また自発報告制度の分析結果にもとづき、第三者機関から航空安全当局に対し、必要な報告や安全対策についての提言が行われる。この場合も個人や会社名が特定される情報が提供されることはない。
報告者へのフィードバックとして、第三者機関の担当者が入力した個別情報の分析等の進捗状況を、報告者は航空安全情報自発報告サイト上で確認することができる。

Note: The reporters include, but are not limited to:

- 1) pilots, maintenance engineers, cabin crew members, dispatchers, air traffic controllers, and those organizations to whom they belong; and
- 2) approved training organizations, approved maintenance organizations, air navigation services providers, airport operators, aircraft ground handling companies, aircraft manufactures, and individuals who are employed in those organizations.

5. Methods of reporting

Each method shown below is available to submit a voluntary report to VOICES. It is requested to fill the contact address etc. in the report form in order for the third party to contact the reporter and verify the contents of the report. It should be noted that such information will all be deleted after de-identification.

- 1) Website owned and operated by Association of Air Transport Engineering and Research
<http://www.jihatsu.jp/>
- 2) Aviation Safety Information Voluntary Reporting Site
<https://asicss.cab.mlit.go.jp/voluntary/>
- 3) E-mail mail@jihatsu.jp
- 4) Facsimile +81-3-6435-4727
A reporting form can be downloaded at the website introduced at 5. 1), while its use is not mandatory.
- 5) Toll-free number : +81-800-8057-482
Available from 0000UTC until 0800UTC on weekdays except for Japanese national holidays.
- 6) Postal mail
The envelope for the free mail can be downloaded from the website introduced at 5. 1).

6. Handling of the report

The analysis and feedback of the report will follow processes shown below:

- 1) Acceptance of the report
The third party checks the report and receives it as long as it seems appropriate to be processed through VOICES.
- 2) Additional information
Analysis staff may contact the reporter when further information is needed for the analysis of the report.
- 3) De-identification of the report
The report is de-identified so that any individuals or organizations will not be identified. After the de-identification all reports are registered to Aviation Safety Information Voluntary Reporting Site. An ID number and a password will be delivered to each reporter to check the process of its own report. The third party deletes the name, address, and other information of the reporter after issuing an ID number and a password.
- 4) Analysis and feedback
Expert teams established within the third party will investigate the report in the proactive aspect to identify factors that could harm the safety of aviation.
The results of the investigation by the expert teams will periodically be brought to working groups of each mode of aeronautical services for comments.
The analysis committee held twice a year which consists of some literates, academic experts, etc. will summarize the results of analysis and develop a publication on the website of the third party.
Based on the final results of the analysis, the third party will advance a proposal(s) to the civil aviation safety authorities. The information which can identify the specific individuals or organizations will not be provided to the authorities.
As the feedback the reporter can see the progress of the process and the result of the analysis of its report at the Aviation Safety Information Voluntary Reporting Site.

7. 第三者機関及び問い合わせ先

本自発報告制度を運営する第三者機関及び問い合わせ先は次のとおり。

公益財団法人 航空輸送技術研究センター

(1) 住所：〒108-0073 東京都港区三田 1-3-39

(2) ヘルプデスク：03-5476-5464

受付時間は、平日午前 9 時から午後 5 時の間

(3) ウェブサイト：http://www.jihatsu.jp/

7. The third party

The third party who operates VOICES is as follows;

Association of Air Transport Engineering and Research

1) Postal Address :1-3-39 Mita, Minato-ku, Tokyo

108-0073 Japan

2) Helpdesk : +81-3-5476-5464

Available from 0000UTC until 0800UTC on weekdays except for Japanese national holidays.

3) Website : http://www.jihatsu.jp/

013/19

航空機衝突防止装置 (ACAS II) の運用について

ACAS II の運用が以下のとおり実施される。

■ なお、平成 31 年 4 月 25 日 0000JST をもって、平成 23 年 7 月 28 日付 AIC NR026/11 を取り消す。

また、新情報及び変更部分は太い縦線により表示される。

1. ACAS II 運用の実施

福岡 FIR 内を飛行する全ての ACAS II 装備機のパイロットは、可能な限り本 AIC に基づき必要な措置を講じなければならない。

2. ACAS II の装備要件

ACAS II は、国際民間航空条約第 10 附属書第 IV 部の規定に適合するものであること。

3. パイロットの要件

ACAS II の運用を実施するパイロットは、ACAS II 訓練を終了していること。

4. パイロットがとるべき措置

■ パイロットは、以下の手順に従うこと。

a) トラフィック・アドバイザリー（以下、「TA」という。）のみにより自機の回避操作を行わないこと。なお、接近する航空機の目視確認に努めるとともに、管制機関から交通情報の提供がない場合は、当該管制機関に対し確認することが望ましい。

注 1 - TA は、レゾリュション・アドバイザリー（以下「RA」という。）が発せられる可能性を警告すること、状況認識を向上させること及び TA の原因となった航空機を目視で探す際に補助することを意図したものである。しかしながら、目視で確認した航空機は TA の原因となった航空機ではない可能性がある。目視によって脅威機を確認することは、特に夜間において、誤解となりかねない。

注 2 - TA の使用に係る上記の制限は、水平方向に関する ACAS II の精度の限界及び表示された交通情報から正確な高度の変化率を読みとることが困難であることによる。

b) TA が発せられた際には、利用可能な全ての情報を使用し、RA が発せられた場合に適切に対応できるように準備すること。

c) RA が発せられた場合には、以下によること。

1) RA に従うことがより危険な状況となる場合を除き、速やかに RA に従うこと。

注 1 - 失速警報、ウィンドシアア警報及び対地接近警報は、ACAS II に優先する。

注 2 - 目視によって確認した航空機は、RA の原因となった航空機とは限らない。目視により脅威機を確認することは、特に夜間において、誤解となりかねない。

2) 管制指示と RA が相反する場合であっても、RA に従うこと。

3) RA と反対方向の操作は行わないこと。

注 - 相手機が ACAS II を装備している場合には、ACAS II は互いに調整 (coordinate) を行っており、相手機の ACAS II は、自機と反対方向の RA を指示しているからである。一方の航空機が RA と反対方向の操作を行い、他方の航空機が RA に従って操作した場合には、安全な垂直間隔が失われる可能性があり、その結果、異常に接近するおそれがある。

013/19

Operation of the Airborne Collision Avoidance System (ACAS II)

ACAS II is being operated as follows:

■ AIC NR026/11 dated 28 JUL 2011 will be superseded at 1500UTC 24 APR 2019.

New information and changes are indicated by bold vertical line.

1. Operational use of ACAS II

Pilots shall observe this AIC as possible when they execute operational use of ACAS II in Fukuoka FIR.

2. Requirements for ACAS II equipments

ACAS II equipments shall comply with the requirements as defined by Annex 10, Volume IV to the Convention on International Civil Aviation.

3. Requirements of pilots

Pilots shall not execute operational use of ACAS II unless the training for it has been completed.

4. Procedures to be followed by pilots

Comply with the following procedures:

a) pilots shall not manoeuvre their aircraft in response to traffic advisories (TAs) only. Pilots shall search for the approaching traffic, and pilots are expected to contact ATC to conform it when ATC has not provided such traffic information;

Note 1.- TAs are intended to alert the pilots to the possibility of a resolution advisory (RA), to enhance situational awareness, and to assist in visual acquisition of conflicting traffic. However, visually acquired traffic may not be the same traffic causing a TA. Visual perception of an encounter may be misleading, particularly at night.

Note 2.- The above restriction in the use of TAs is due to the limited bearing accuracy and to the difficulty in interpreting altitude rate from displayed traffic information.

b) on receipt of a TA, pilots shall use all available information to prepare for appropriate action if an RA occurs;

c) in the event of an RA, pilots shall:

1) respond immediately by following the RA as indicated, unless doing so would jeopardize the safety of the aeroplane;

Note 1.- Stall warning, wind shear, and Ground Proximity Warning System alerts have precedence over ACAS II.

Note 2.- Visually acquired traffic may not be the same traffic causing an RA. Visual perception of an encounter may be misleading, particularly at night.

2) follow the RA even if there is a conflict between the RA and an air traffic control (ATC) instruction to manoeuvre;

3) not manoeuvre in the opposite sense to an RA.

Note.- In the case of an ACAS II- ACAS II coordinated encounter, the RAs complement each other in order to reduce the potential for collision. Manoeuvres, or lack of manoeuvres, that result in vertical rates opposite to the sense of an RA could result in a collision with the threat aircraft.

- 4) 管制指示又は管制承認から逸脱する RA が発せられた場合には、運航乗務員の業務量が許す範囲において、可能な限り速やかに管制機関に通知すること。
注—運航乗務員からの通知がなければ、管制機関は RA が発せられていることを知り得ない。このため、管制機関は RA と反対方向の管制指示を発出する可能性がある。したがって、管制指示と RA が相反するために管制指示に従わない際には、管制機関に通知することが重要である。
- 5) RA が変更された場合には、その変更速やかに従うこと。
- 6) RA により高度を変更する場合、その変更は RA に従う必要最小限にとどめること。
- 7) RA に従って回避操作を実施する場合には、衝突のおそれのある航空機の目視確認に努めるとともに自機が変更しようとする方向の外部監視も行うこと。
- 8) RA により管制指示高度を逸脱し、その後衝突の危険が回避された場合には、直ちに所定の管制指示高度に復帰すること。
- 9) 現在受けている管制指示高度に戻る際には、管制機関に対し通知すること。
- 10) RA に従わない場合であっても、RA が発生していることを無線電話により管制機関に通報するよう努めること。
- d) 管制指示の確認、自機の飛行状況の通報、管制機関への情報提供の要請を積極的に行うよう努めること。
- e) 管制機関への連絡に当たっては、以下の用語例に従うこと。

- 4) as soon as possible, as permitted by flight crew workload, notify the appropriate ATC unit of any RA which requires a deviation from the current air traffic control instruction or clearance;
Note.- Unless informed by the pilot, ATC does not know when ACAS II issues RAs. It is possible for ATC to issue instructions that are unknowingly contrary to ACAS II RA indications. Therefore, it is important that ATC be notified when an ATC instruction or clearance is not being followed because it conflicts with an RA.
- 5) promptly comply with any modified RAs;
- 6) limit the alterations of the flight path to the minimum extent necessary to comply with the RAs;
- 7) search for the conflicting traffic and make a visual scan of the airspace into which own aircraft might manoeuvre when pilots manoeuvre their aircraft in response to an RA;
- 8) promptly return to the terms of the ATC instruction or clearance when the conflict is resolved;
- 9) notify ATC when returning to the current clearance; and
- 10) notify ATC of the RA occurrence, even if pilots do not respond an RA.
- d) Pilots are expected to positively communicate with ATC to confirm ATC instructions or clearances, notify own flight path and request related traffic information.
- e) Pilot shall use the following phraseologies in notifying ATC.

状況 Circumstances	用語例 Phraseologies
ACAS RA に従って管制指示からの逸脱を開始したとき a flight crew starts to deviate from any ATC clearance or instruction comply with an RA	TCAS RA
ACAS RA に応答後、管制指示への復帰を開始したとき after the response to an ACAS RA is completed and a return to the ATC clearance or instruction is initiated	CLEAR OF CONFLICT, RETURN TO(assigned clearance)
ACAS RA に応答後、管制指示に復帰したとき after the response to an ACAS RA is completed and the assigned ATC clearance has been resumed	CLEAR OF CONFLICT (assigned clearance) RESUMED
RA と反対の管制指示を受領した後に、RA に従い直ちに管制機関に通報するとき after an ATC clearance or instruction contradictory to the RA is received, the pilot will follow the RA and inform ATC directly	UNABLE, TCAS RA

(注) 管制用語として使用する場合のみ“ACAS”に替え“TCAS”を使用する。

NOTICE : "TCAS" should be used as ATC phraseology instead of "ACAS".

5. 運航者がとるべき措置

運航者は、詳細な操作手順を運航規程に規定すること。

5. Aircraft operators involvement

Operators shall stipulate detailed ACAS II operational procedures in each Airline Operations Manual.

6. パイロットの責任

RA により管制指示高度から逸脱を行う場合、パイロットは航空法第 96 条第 1 項の違反には問われない。

7. 管制官の責任

航空機が RA により管制指示高度から逸脱している間、管制官は当該機と回避操作により影響を受ける他の航空機との間における管制間隔の設定について責任を有しない。

管制官の管制間隔設定の責任は、次の場合に再び生ずる。

- (1) 航空機が回避を終了し、指示高度に復帰したとき。
- (2) 航空機から回避を終了した旨の通報があり、当該機と他の航空機との間に管制間隔が設定されていることが管制官に確認されたとき。

6. Pilot responsibility

When RA is initiated and pilot deviates from ATC clearance, the pilot is not considered to be violating the Civil Aeronautics Law, article 96-1.

7. Controller's responsibility during an RA

Once an aircraft departs from an assigned ATC clearance in compliance with an RA, a controller ceases to be responsible for providing ATC separation between that aircraft and other aircraft affected by the direct consequence of that RA manoeuvre.

Controller's responsibility for providing separation for all affected aircraft resumes when either;

- (1) the aircraft returns to the assigned clearance, or
- (2) the pilot reports a controller ATC that RA manoeuvre is completed and the controller confirms that separation is established.

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

051/19

成田国際空港における離着陸制限時間の運用特例について

成田国際空港において、航空機の離着陸制限時間の特例として離着陸の弾力的な運用が開始されている。これは緊急又はやむを得ない場合を除いて離着陸が制限されている一部時間帯に、適用事由に該当する航空機の離着陸を、例外的に認める運用である。

本航空情報サーキュラーは、令和元年10月27日0000JSTから適用される。

なお、同日時をもって平成25年5月30日付AIC Nr 025/13を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 離着陸制限時間

AIP RJAA AD2.20 参照

2. 対象時間帯

16R/34L: 0000JST から 0030JST まで

3. 適用対象機

下記 1) 且つ 2) に該当する場合

1) 成田航空機騒音インデックス A、B、C のいずれかに該当する航空機

2) 次のいずれかの事由により離着陸する場合。ただし、運航者の都合によるものを除く。

- a) 成田空港を目的地とする航空機が、出発地の空港における台風、大雪等の悪天候又は急病患者、空港機能障害等の異常事態等やむを得ない理由により、遅延した場合の着陸
- b) 成田空港を目的地とする航空機が、飛行中の悪天候又は異常事態等やむを得ない理由のため一旦他の空港へ着陸したことにより、遅延した場合の着陸
- c) 飛行中又は空港における悪天候、異常事態又は運航の安全確保等やむを得ない理由のため遅延が発生し、その影響により、成田空港を目的地とする航空機に玉突き遅延が発生した場合の着陸
- d) 成田空港を出発地とする航空機が、離陸した後、目的地の空港における悪天候又は異常事態等やむを得ない理由により、引き返す場合の着陸
- e) 上記の他、異常事態又は運航の安全確保等やむを得ない理由により、遅延した場合の離着陸

4. 料金

対象時間帯における離陸又は着陸1回ごとに、下記 1) 又は 2) により算出した額を、成田国際空港株式会社 (NAA) に支払うものとする。

1) 国際線

AIP GEN 4.1.1.4.1)

2) 国内線

AIP GEN 4.1.1.4.2) a)、b)、又は d)

5. その他

離着陸制限時間の弾力的な運用の適用を受ける場合には、NAA が別途定める規則に従うものとする。

6. 窓口

成田国際空港株式会社運用管理部
ランプコントロール中央運用室
電話: 0476-32-2246
ファックス: 0476-30-1586

051/19

Special Provisions for Landing and Take-off Restrictions at Narita INTL AP/RJAA

Special Provisions for Landing and Take-off Restrictions is implemented at Narita INTL AP/RJAA.

This is an exceptional measure to allow Landing and Take-off operation of aircraft under specific extraordinary circumstances during certain time zones of restrictions on Landing and Take-off with the exception of aircraft in an emergency or in an unavoidable situation.

This AIC will be effective from 1500UTC 26 OCT 2019, and will supersede AIC Nr 025/13 dated 30 MAY 2013 at the same time. New information and changes are indicated by bold vertical lines.

1. Time restrictions on departures and arrivals

See AIP RJAA AD2.20

2. Applicable Time Zones

16R/34L: Between 1500UTC and 1530UTC

3. Applicable Aircraft

Aircraft satisfying both conditions 1) and 2).

1) Aircraft falling under Narita Aircraft Noise Rating Index categories A, B and C.

2) Landing and Take-off operation in one of the following cases, except for causes attributable to the operator:

- a) Landing of aircraft destined to RJAA delayed due to unusual weather conditions, sudden/serious medical cases or failure of essential airport functions at the port of departure.
- b) Landing of aircraft destined to RJAA delayed due to landing at another airport for unusual weather conditions or other irregular circumstances en route.
- c) Landing of aircraft destined to RJAA delayed as a result of serial delays caused by unusual weather conditions, irregular circumstances or ensuring safety of flight operation.
- d) Landing of aircraft turned back to RJAA due to unusual weather conditions or other irregular circumstances at destination airport.
- e) Take-off/landing of aircraft delayed due to unusual irregular circumstances other than those under a)-d) and/or ensuring safety of operation.

4. Applicable Charges

For each of take-off or landing during the specified time zone, the amount calculated by 1) or 2) below will be payable to Narita International Airport Corporation (NAA).

1) International

AIP GEN 4.1.1.4.1)

2) Domestic

AIP GEN 4.1.1.4.2) a), b), or d)

5. Others

When applying for this conditional relaxation, applicant must abide by the rules set forth separately by NAA.

6. Contact

Ramp Control Central Operations
NAA Ground Operations Dept.
TEL: +81-476-32-2246
FAX: +81-476-30-1586

JAPAN

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 007/20
30 JAN 2020

007/20

9GHz 帯航空機搭載型合成開口レーダーシステムに関する注意喚起

1 9GHz 帯航空機搭載型合成開口レーダーシステムは、航空機にアンテナを搭載し移動することで航空機の進行方向に仮想の大きなアンテナを合成し分解能を高めたレーダーシステムである。

当該システムは、上空から電波を用いて、震災や噴火時における夜間や噴煙など視界がきかない状況下での情報収集や 3 次元地図データの作成などに使用される。

2 航空機気象レーダーのレンジ内に、レーダーと正対する方向に 9GHz 帯航空機搭載型合成開口レーダーが存在 ※ した際、航空機気象レーダーのレーダー画面に、干渉波が重畳して影響を与える場合がある。

※ 対象の航空機との高度差が高度 3,000m 以上で 300m 以内、高度 3,000m 未満で 150m 以内の場合に発生する可能性がある。

3 9GHz 帯航空機搭載型合成開口レーダーから干渉を受けた場合、下図のように、航空機気象レーダーの画面に、気象クラッタと異なる、破線状の模様が現れるので注意すること。

007/20

9GHz AIRBORNE SYNTHETIC APERTURE RADAR NOTIFICATION

1 9GHz AIRBORNE SYNTHETIC APERTURE RADAR is a radar system with high image resolution that virtually synthesizes a large antenna in the direction of travel of aircraft equipped with antennas.


This system is used for creating 3D map data and collecting information in situations of poor visibility such as at nighttime or because of smoke during an earthquake or volcanic eruption.

2 When the 9GHz AIRBORNE SYNTHETIC APERTURE RADAR is within the range of aircraft weather radar, and in the direction facing the radar, radio waves from this system may have a superimposed effect on aircraft weather radar displays.*

*This may occur when the altitude difference from the target aircraft is within 300m at an altitude of 3,000m or more, and within 150m at an altitude of less than 3,000m.

3 Aircraft weather radar users are encouraged to be aware that a dashed line pattern, different to a weather clutter, will appear on their displays, as shown in ATTACHMENT, when they are receiving interference from the 9GHz AIRBORNE SYNTHETIC APERTURE RADAR.

ATTACHMENT

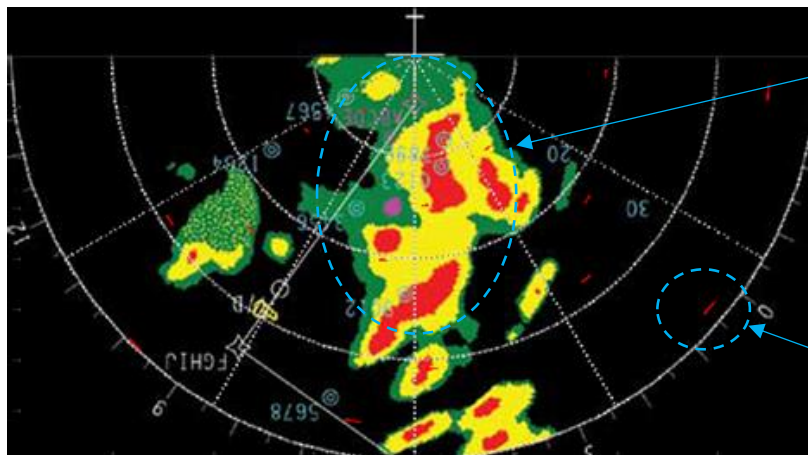

問い合わせ窓口：
総務省総合通信基盤局電波部基幹・衛星移動通信課
TEL: 03-5253-5902
FAX: 03-5253-5903
E-mail: aeronautical.radio@ml.soumu.go.jp

Inquiry counter
Fixed and Satellite Radio Communications Division
Radio Department, Telecommunications Bureau
Ministry of Internal Affairs and Communications
TEL: +81-3-5253-5902
FAX: +81-3-5253-5903
E-mail: aeronautical.radio@ml.soumu.go.jp

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU

AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 015/20
26 MAR 2020

015/20

東京国際空港における誘導路誤進入防止について

015/20

Prevention of TWY incursion at Tokyo INTL API/ RJTT

1. 付図に示すとおり、廃止された誘導路の形状が視認できる状態にあるので、航空機は当該誘導路に進入しないように注意すること。
本航空情報サーキュラー発行と同時に令和2年1月30日付航空情報サーキュラー NR006/20 を取り消す。
また、新情報及び変更部は太い縦線により表示される。

2. 備考

1. 付図1の廃止された誘導路には、禁止標識が順次設置される。


1. The figure of the abolished TWY is visible as shown in the attachment. Accordingly, aircraft should pay attention not to enter those TWY.

This AIC supersedes AIC NR006/20 dated 30 JAN 2020.
New information and changes are indicated by bold vertical lines.

2. Remarks

1. Closed marking is gradually installed on the abolished TWY shown in Figure 1.

ATTACHMENT

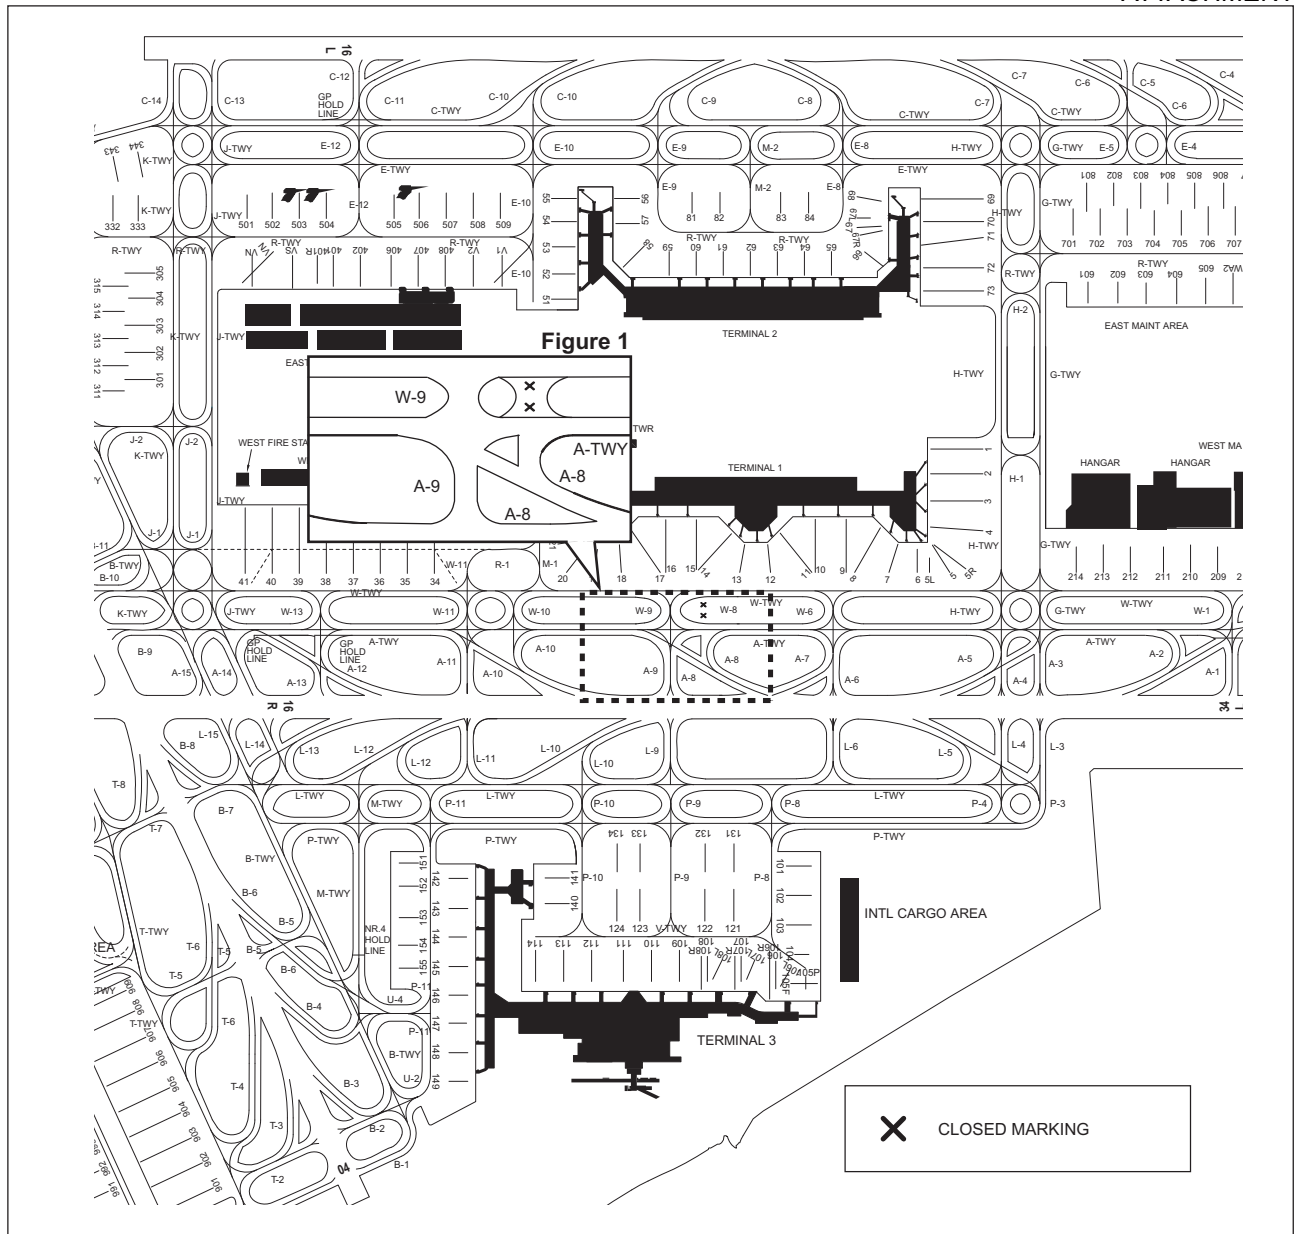

JAPAN

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAA NYX
E-mail:
helpdesk@ais.mlit.go.jp

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 003/21
28 JAN 2021

003/21

成田国際空港における飛行コースの監視について

成田国際空港（付図 1 及び 2 に示す区域）において航空機騒音の拡散防止を徹底するために、飛行コースの監視が行われている。運航者には従来の標準計器出発方式、計器進入方式、騒音軽減運航方式の一層の遵守が求められる。

本航空情報サーキュラーは、令和 3 年 3 月 25 日 0000JST から適用される。なお、同日時をもって、平成 26 年 6 月 26 日付航空情報サーキュラー NR023/14 を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 目的

成田国際空港に離着陸する航空機の騒音拡散を防止する

2. 飛行コースの監視区域

付図 1 及び 2 に示す区域

3. 適用

成田国際空港に IFR で離着陸する全ての航空機

4. 運用時間

24 時間

5. 運用方法

飛行コースの監視を行うための区域を逸脱した航空機に対して、その事由の問い合わせを行い、航行の安全上必要であった場合を除き、便名を含め逸脱の事実を公表することがある。

6. 備考

着陸機については、ILS 進入方式による場合のみ適用される。本航空情報サーキュラーは、ノータム RJAA NR1162/20 を取り込んだものである。

003/21

Flight track monitoring at Narita INTL AP/RJAA

Flight track monitoring at Narita INTL Airport as shown in the ATTACHMENT 1 and 2 is conducted in addition to strict observance of SID, IAP, and noise abatement procedures as usual, in order to reduce the nuisance of aircraft noise.

This AIC will be effective from 1500UTC 24 MAR 2021, and will supersede AIC NR023/14 dated 26 JUN 2014 at the same time.

New information and changes are indicated by bold vertical lines.

1. Purpose

To prevent the spread of noise made by aircraft operating to and from Narita INTL Airport.

2. Flight corridor

As shown in the ATTACHMENT 1 and 2.

3. Application

All IFR aircraft take off from/land to Narita INTL Airport.

4. Hours of monitoring


24H


5. Procedure

The aircraft deviated from flight corridor may be inquired of the reason and the fact inclusive of flight number might be made public except that it is necessary in the interest of safety.

6. Remarks

As to the arrivals, only the aircraft landed on ILS is applicable. This AIC INCORP NOTAM RJAA NYX NR A1676/20.

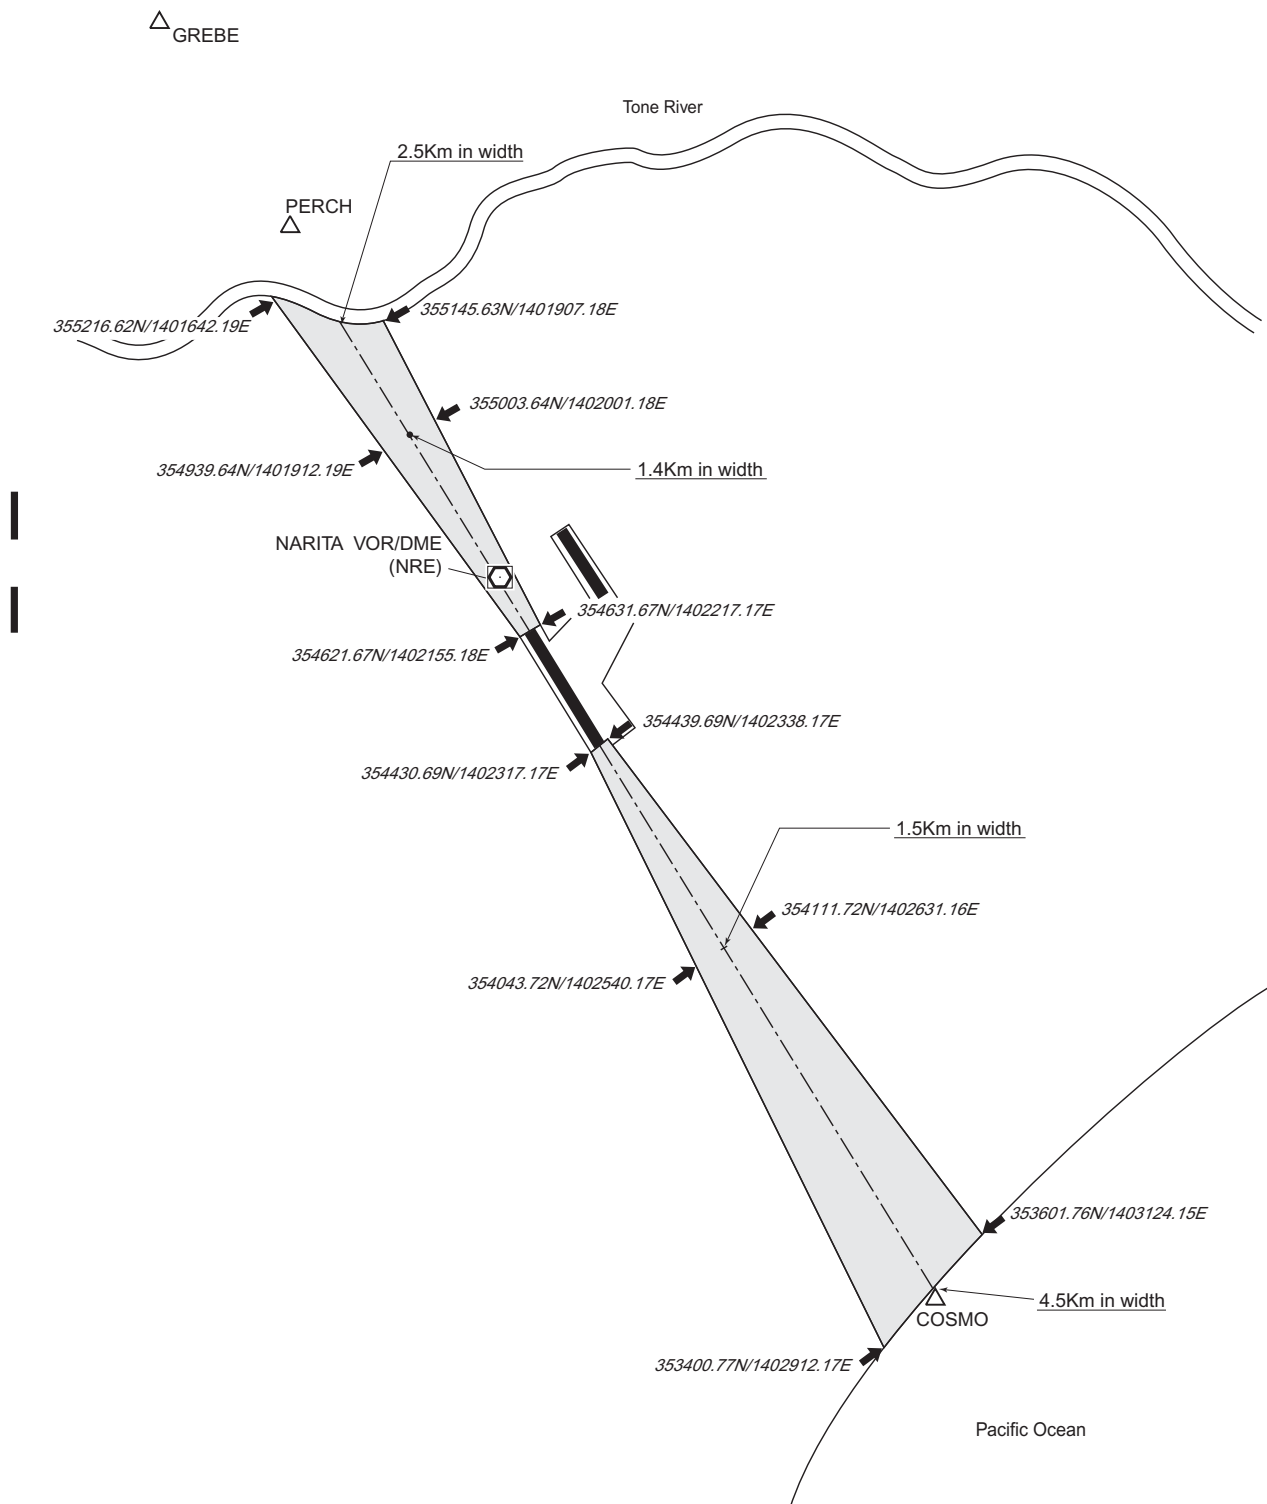

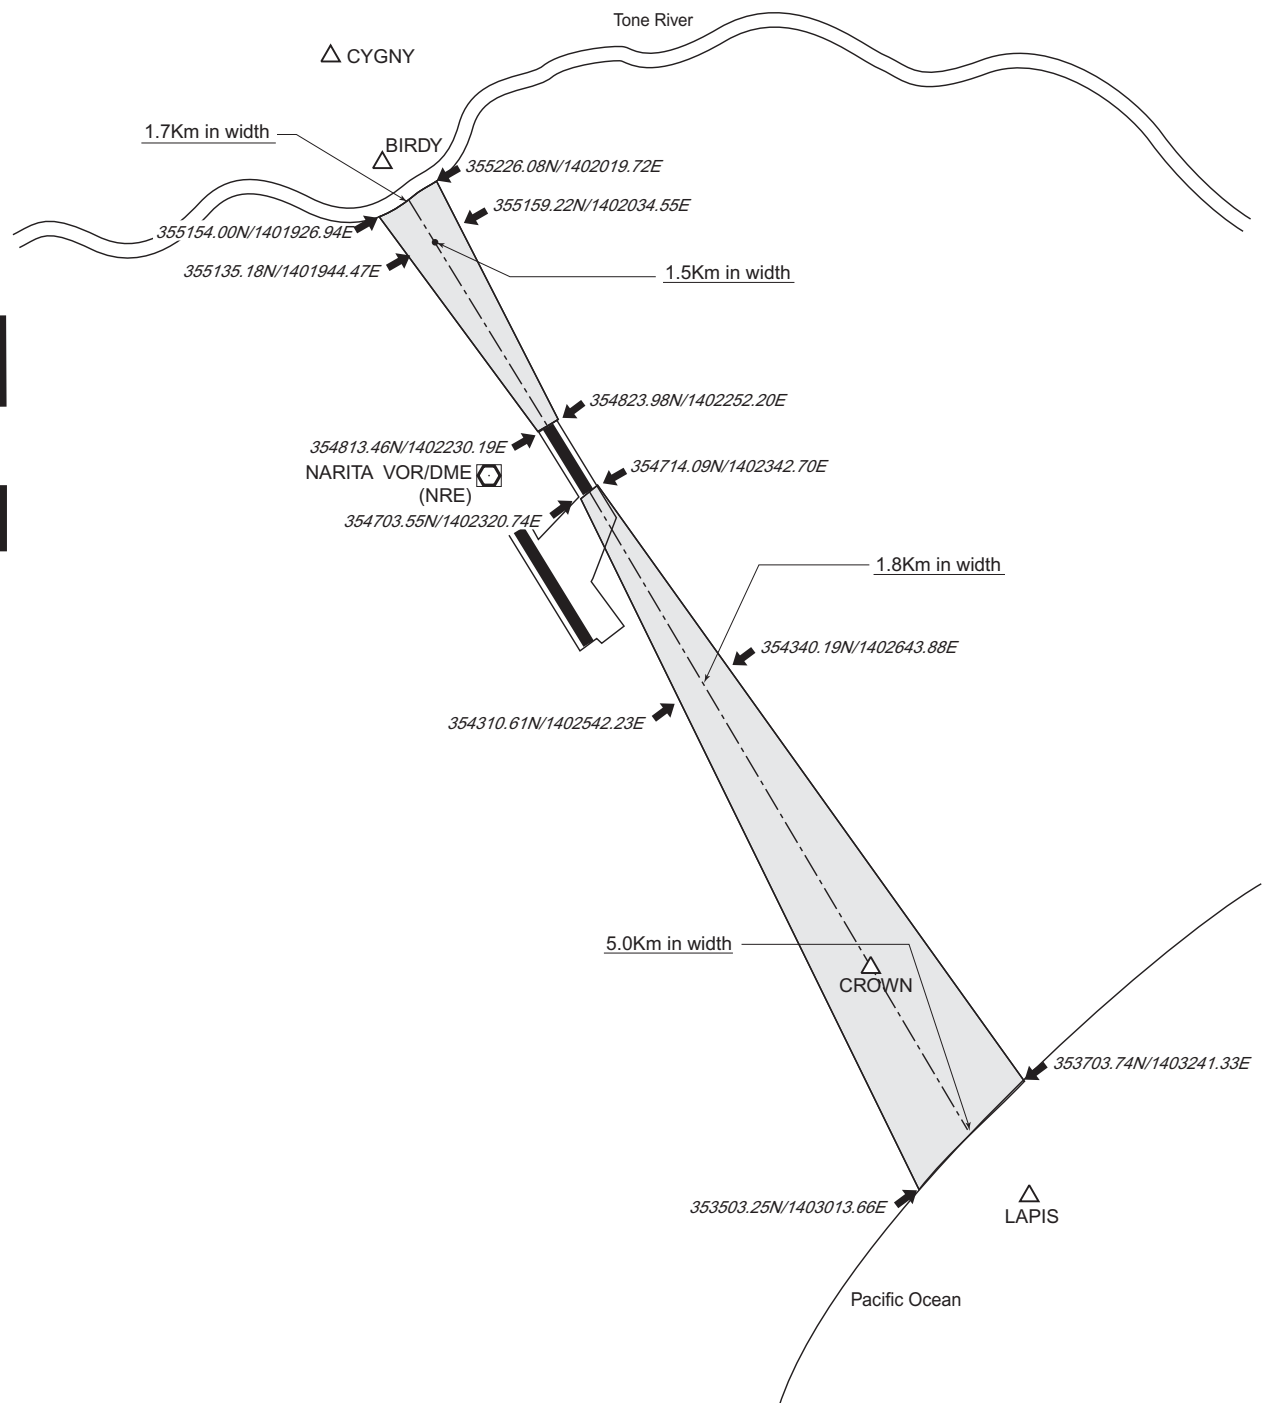

024/21

目視外飛行を行う無人航空機に関する飛行情報の提供について

本航空情報サーキュラーは、令和3年10月1日0000JSTから適用される。なお、同日時をもって、平成30年11月8日付航空情報サーキュラーNR035/18を取り消す。
また、新情報及び変更部は太い縦線により表示される。

1. 概要

地表又は水面から150m未満や空港等周辺（進入表面、転移表面、水平表面、延長進入表面、円錐表面若しくは外側水平表面の上空の空域又は国土交通大臣が告示で定める空域）以外の空域においても一定の条件で目視外飛行を行う無人航空機に関する飛行情報は、以下のとおりノータムにより提供される。

2. 操縦士に求める措置

操縦士は飛行前に目視外飛行を行う無人航空機に関する飛行情報を確認し、予定する飛行内容に影響を及ぼす可能性がある場合には、無人航空機を飛行させる者に連絡されたい。

注）操縦士から連絡を受けた無人航空機を飛行させる者は、航空機の飛行の安全に影響を及ぼす可能性がある場合、無人航空機の飛行の中止又は飛行計画（飛行日時、飛行経路、飛行高度等）の変更等の安全措置を講じる。

3. ノータムによる飛行情報の提供について

- (1) 目視外飛行を行う無人航空機に関する飛行情報について、ノータムにより以下のとおり提供される。
- a) 飛行日時：飛行の開始日時及び終了日時
 - b) 飛行経路：緯度経度（世界測地系）及び地名（都道府県名及び市区郡名）
 - c) 飛行高度：下限及び上限の海拔高度
 - d) 機体数：同時に飛行させる無人航空機の最大機数（複数機の場合のみ）
 - e) 機体諸元：無人航空機の種類（固定翼または飛行船の場合のみ）及び重量
 - f) 問い合わせ先：無人航空機を飛行させる者の連絡先

024/21

Provision of flight information about unmanned aircraft flying beyond visual line of sight

This AIC will be effective from 1500UTC 30 SEP 2021, and will supersede AIC NR 035/18 dated 8 NOV 2018 at the same time.
New information and changes are indicated by bold vertical lines.

1. Overview

Flight information about unmanned aircraft flying beyond visual line of sight under specific conditions regardless of airspace less than 150m from the ground /water surface or around airports, etc. (approach surface, transitional surface, horizontal surface, extended approach surface, conical surface or outer horizontal surface, or airspace prescribed by public notice of the Minister of Land, Infrastructure, Transport and Tourism) are provided by NOTAM as follows.

2. Required Action to the pilot

Before flight, when the pilot confirm flight information about unmanned aircraft flying beyond visual line of sight that there is a possibility to affect the flight, the pilot should contact the operator of the unmanned aircraft.

Note: The operator of the unmanned aircraft who has received a report from the pilot suspend the flight of the unmanned aircraft or change the flight plan (flight day, flight area, flight altitude, etc.), if there is a possibility to affect the aircraft.

3. Flight information provided by NOTAM

- (1) Flight information about unmanned aircraft flying beyond visual line of sight is provided by NOTAM as follows.
- a) Flight date and time: Date and time of commencing and end of flight
 - b) Flight area: Latitude/Longitude (WGS-84) and place name (prefectures and/or municipality)
 - c) Flight altitude: Lower limit and upper limit (by mean sea level)
 - d) Number: Maximum number of unmanned aircraft to fly at the same time (only when flying multiple unmanned aircrafts)
 - e) Characteristics: Type (only fixed wing or airship), weight of unmanned aircraft
 - f) Operator Contact information: Contact information of the operator of the unmanned aircraft

(2) ノータイム例

(2) Example

Q)RJJJ/QWULW/IV/BO/W/000/007/36XXN140XXE00X
A)RJXX B)2112100000 C)2112280100
D)0000/0100
E)UNMANNED ACFT FLYING BEYOND VISUAL LINE OF SIGHT
(FIXED WING):
1.FLT RTE : A LINE CONNECTING THE FLW POINTS
3600XXN14000XXE 3600XXN14003XXE
3603XXN14003XXE 3603XXN14006XXE
(XXXXXX-GUN IN XXXXX)
2.NUMBER : 2
3.WT : 10KG
4.CONTACT INFORMATION: 03 XXXX XXXX
F)SFC G)657FT AMSL

有効期間

2021 年 12 月 10 日 9 時 00 分 (JST) から 2021 年 12 月
28 日 10 時 00 分 (JST)

内容

毎日 9 時 00 分 (JST) から 10 時 00 分 (JST) までの間、
無人航空機 (固定翼) による目視外飛行が以下のとおり実
施される。

・飛行経路：以下の点をつないだ経路

北緯 36 度 00 分 XX 秒、東経 140 度 00 分 XX 秒
北緯 36 度 00 分 XX 秒、東経 140 度 03 分 XX 秒
北緯 36 度 03 分 XX 秒、東経 140 度 03 分 XX 秒
北緯 36 度 03 分 XX 秒、東経 140 度 06 分 XX 秒
(XXXXXX 県 XXXXX 郡)

・機体数：2

・重量：10kg

・連絡先：03-XXXX-XXXX

・飛行高度：地表面から海拔高度 657ft (200m)

Valid period

From 10TH DEC 2021 0000UTC to 28TH DEC 2021
0100UTC

Contents

Unmanned aircraft flying beyond visual line of sight (fixed
wing) will fly during valid period from 0000UTC to
0100UTC daily, as follows,

・Flight route : A LINE CONNECTING THE FLW POINTS
3600XXN14000XXE 3600XXN14003XXE
3603XXN14003XXE 3603XXN14006XXE
(XXXXXX-GUN IN XXXXX)

・Number of flight : 2

・Weight : 10KG

・OPERATOR CONTACT INFORMATION: 03 XXXX XXXX

・Flight altitude: from surface to 657ft(200m) above mean
sea level

030/21

東京国際空港における滑走路誤進入防止について

1. 東京国際空港における滑走路誤進入防止対策の一環として、付図に示す高速脱出誘導路に NO ENTRY 標識が試行設置される。NO ENTRY 標識が設置された高速脱出誘導路を滑走路方向に走行してはならない。

本航空情報サーキュラー発行と同時に令和2年6月18日付航空情報サーキュラー NR033/20 を取り消す。
また、新情報及び変更部は太い縦線により表示される。

- ## 2. 問い合わせ窓口

国土交通省東京航空局空港部
東京国際空港機能強化推進室
TEL : 03-5275-9298
FAX : 03-3221-3687

030/21

Prevention of RWY incursion at Tokyo INTL AP/ RJTT


1. As a measure for prevention of RWY incursion at Tokyo INTL AP, NO ENTRY markings on High speed TWY described in the attachment below are installed as a trial. Taxiing towards the runway via High speed TWY where NO ENTRY markings are installed is prohibited.

This AIC supersedes AIC NR033/20 dated 18 JUN 2020.

New information and changes are indicated by bold vertical lines.

2. For further questions

Tokyo International Airport Functional Enhancement Division,
Airport Department,
East Japan Civil Aviation Bureau, Ministry of Land,
Infrastructure, Transport and Tourism
TEL : +81-3-5275-9298
FAX : +81-3-3221-3687

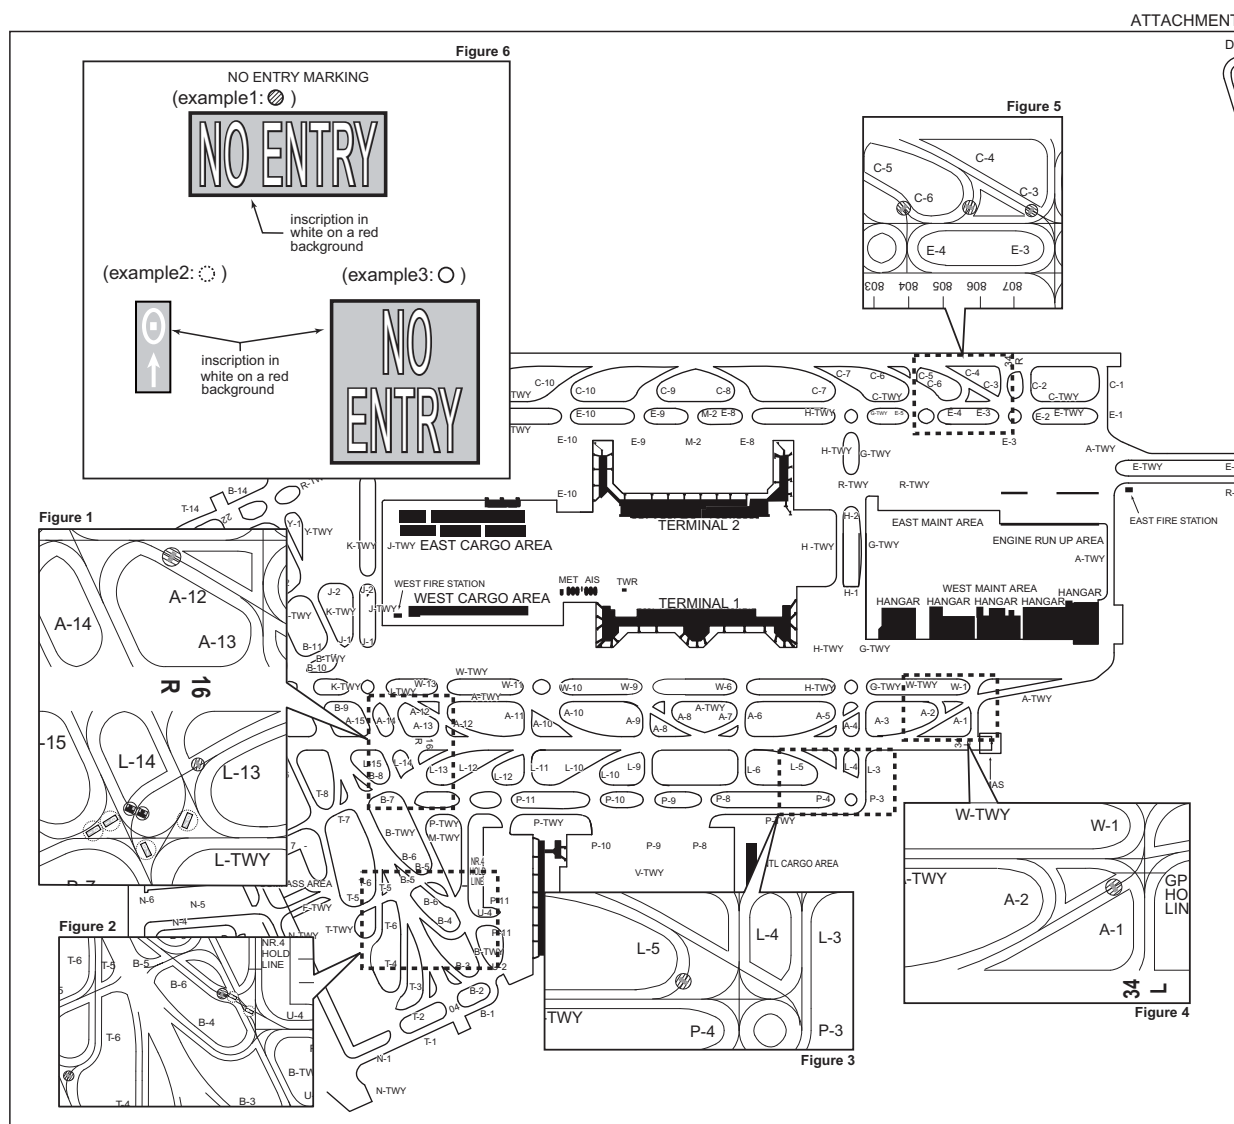

002/22

多機能型地震計の運用について

多機能型地震計の運用が以下のとおり実施される。

本航空情報サーキュラーは、令和4年2月24日0000JSTから適用される。なお、同日時をもって平成29年8月17日付航空情報サーキュラーNR023/17を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 多機能型地震計

(1) 多機能型地震計が以下の空港において運用される。

新千歳空港
 仙台空港
 成田国際空港
 東京国際空港
 中部国際空港
 大阪国際空港
 関西国際空港
 福岡空港
 鹿児島空港
 那覇空港
 新潟空港
 広島空港
 高松空港

(2) 多機能型地震計により入手できる情報は以下のとおりである。

1) 緊急地震速報

気象庁が震源に近い観測点で得られた地震波を使用し、震源、地震の規模及び各地の震度を短時間で推定した情報

2) 震度情報

観測点において測定され、気象庁が発表する地震の震度情報

2. 緊急地震速報または震度情報については、空港に離着陸する航空機に対して以下のとおり提供される。

(1) 緊急地震速報については、航空機の運航に影響を及ぼすおそれがある場合（震度4以上）には、緊急地震速報が発出された旨、管制官から可能な限り情報提供される。

〔用語例〕

ALL STATIONS, EARTHQUAKE EARLY WARNING WAS ISSUED, USE CAUTION.

(2) 震度情報については、滑走路等点検が必要となる場合（震度4以上）は、管制官から離陸許可の取り消し又は着陸復行等の指示が発出される。（ただし、離陸滑走の中止又は着陸復行を行うことにより運航の安全に影響を及ぼすおそれがあると判断した場合を除く。）

〔用語例〕

CANCEL TAKE-OFF CLEARANCE DUE TO EARTHQUAKE, (SEISMIC INTENSITY 4)

GO AROUND DUE TO EARTHQUAKE (SEISMIC INTENSITY 4)

ALL STATIONS, EARTHQUAKE INFORMATION, SEISMIC INTENSITY 4, (RUNWAY INSPECTION WILL BE MADE)

002/22

Operation of the Multifunctional Seismometer

Multifunctional Seismometer is being operated as follows.

This AIC will be effective from 1500UTC 23 FEB 2022, and will supersede AIC NR023/17 dated 17 AUG 2017 at the same time. New information and changes are indicated by vertical lines.

1. The Multifunctional Seismometer

(1) The Multifunctional Seismometer is operated at the following airports.

New Chitose airport
 Sendai airport
 Narita International airport
 Tokyo International airport
 Chubu Centrair International airport
 Osaka International airport
 Kansai International airport
 Fukuoka airport
 Kagoshima airport
 Naha airport
 Niigata airport
 Hiroshima airport
 Takamatsu airport

(2) Information that can be acquired by the Multifunctional Seismometer is as follows.

1) Earthquake Early Warning

Warning information on anticipated hypocenter, magnitude and seismic intensities of various places in seconds by using seismic waveform data observed at seismic stations close to the hypocenter issued by Japan Meteorological Agency (JMA).

2) Seismic intensity information

Information on seismic intensity in Japanese scale (JMA scale) observed at the airport.

2. Earthquake Early Warning or Seismic Intensity Information will be provided for departing or/and landing aircraft as follows.

(1) Earthquake Early Warning will be provided by ATC when the earthquake will be possible to impact for flight of aircraft (seismic intensity 4 or above).

[Example]

ALL STATIONS, EARTHQUAKE EARLY WARNING WAS ISSUED, USE CAUTION.

(2) Seismic intensity information will be provided in addition to be cancelled the take-off clearance or be instructed to execute a go-around by ATC, when it will be necessary for runway inspection (seismic intensity 4 or above), unless ATC consider that the instruction will be possible to impact for safety flight of aircraft.

[Example]

CANCEL TAKE-OFF CLEARANCE DUE TO EARTHQUAKE, (SEISMIC INTENSITY 4)

GO AROUND DUE TO EARTHQUAKE (SEISMIC INTENSITY 4)

ALL STATIONS, EARTHQUAKE INFORMATION, SEISMIC INTENSITY 4, (RUNWAY INSPECTION WILL BE MADE)

注１）震度情報が震度３以下であっても、必要に応じて各航空機に対し情報提供される場合がある。

注２）震度階級については、以下の気象庁ホームページを参照のこと。

<https://www.jma.go.jp/jma/kishou/known/shindo/index.html>

Note1) Seismic intensity information may be provided for aircraft even if seismic intensity is under 3.

Note2) Seismic intensity scale has been listed on JMA homepage. URL as follows:

<https://www.jma.go.jp/jma/en/Activities/intsummary.pdf>

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

008/22

衝撃により自動的に作動する航空機用救命無線機 (ELT) の装備を免除することについて

本航空情報サーキュラーは、平成 25 年 7 月 19 日より適用される国土交通省告示 (平成 25 年第 746 号) について補足するものである。

■ なお、本航空情報サーキュラー発行と同時に平成 25 年 10 月 17 日付航空情報サーキュラー NR040/13 を取り消す。また、新情報及び変更部は太い縦線により表示される。

1. 背景及び概要

平成 25 年 7 月 12 日 (英国時間) に発生したエチオピア航空のボーイング 787 型機が、ロンドン・ヒースロー空港において駐機中、胴体後方の上部が熱損傷する事案に関して、本事案の調査を行った英国事故調査当局 (AAIB) が米国連邦航空当局 (FAA) に対して、航空会社を対象にハネウェル式 1152682-2 型式及び 1152682-3 型式の航空機用救命無線機 (ELT) の一時的な取りおろしを求める安全勧告を行った。

これを踏まえ、我が国においては、国土交通省告示 (平成 25 年第 746 号) において、航空法施行規則の一部を改正する省令 (平成 20 年第 56 号) の附則第 3 項の規定に基づき、衝撃により自動的に作動する ELT であってハネウェル式 1152682-2 型及び同式 1152682-3 型以外のものを装備できない航空機については、1 つ以上のいずれかの ELT を装備することを条件に衝撃により自動的に作動する ELT の装備を免除することができる。

2. 問い合わせ先

■ 国土交通省航空局安全部安全政策課
電話 03-5253-8737
FAX 03-5253-1661

008/22

Exemption from equipping automatic ELT activated by impact

This AIC is to provide supplementary information regarding a pronouncement of Ministry of Land, Infrastructure, Transport and Tourism of Japan (No.746, 2013) effective on July 19, 2013.

■ This AIC supersedes AIC NR040/13 dated 17 OCT 2013. New information and changes are indicated by bold vertical lines.

1. Introduction and summary

A fire event occurred on a parked Boeing 787-8 of Ethiopian Airlines at London Heathrow Airport on July 12, 2013. The United Kingdom Air Accidents Investigation Branch (AAIB) that has investigated the event notified the Federal Aviation Administration (FAA) of safety recommendation.

It recommended the FAA initiate action for making inert the Honeywell ELT (model 1152682-2 and 1152682-3).

Based on these circumstances, the aircraft unable to equip an automatic ELT activated by impact other than Honeywell model 1152682-2 or 1152682-3 are exempted from equipping an automatic ELT activated by impact on the condition that they equip at least one ELT of any model in accordance with the Paragraph 3 of supplementary provision of the ordinance No.56 in 2008 to amend a part of Civil Aeronautics Regulations and the pronouncement of Ministry of Land, Infrastructure, Transport and Tourism of Japan (No.746, 2013).

2. For further information

Flight Standards Division, Aviation Safety and Security
Department, Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism
TEL +81-3-5253-8737
FAX +81-3-5253-1661

010/22

航空機への鳥衝突（バードストライク）等が発生した場合の報告について

航空局は、主として空港及びその周辺における効果的な鳥衝突防止対策を講じ、ICAO ANNEX 14, Vol. I, 9.4.2 を実施するため、航空機への鳥衝突（バードストライク）が発生した場合に航空局への報告を要請している。

運航者又は機長は、次の要領により報告すること。

■ なお、本航空情報サーキュラー発行と同時に、令和元年 6 月 20 日付航空情報サーキュラー NR030/19 を取り消す。
また、新情報及び変更部は太い縦線によって表示される。

1. 定義

この要領で使用する用語の定義は次のとおりとする。

- (1) 「鳥衝突（バードストライク）」とは、航空機と鳥との衝突をいう。

なお、空港及びその周辺で鳥の死骸等が回収されず、かつ、機体点検においても損傷や痕跡が確認されなかった場合であっても、機長が衝撃、音等により鳥衝突と判断した場合は鳥衝突として扱う。

- (2) 「鳥とのニアミス」とは、鳥と衝突のおそれがあったものをいう。

2. 適用

この要領は次の区域と飛行区分に適用される。

- (1) 本邦内の空港における駐機、地上走行、離陸滑走又は着陸滑走中
(2) 本邦内の空港及びその周辺における上昇、降下又は進入中
(3) 上記以外の福岡 FIR 内における航行中

3. 運航者又は機長がとるべき措置

運航者又は機長は、鳥衝突又は鳥とのニアミスがあった場合は、鳥衝突情報共有サイト（URL: <https://bird.cab.mlit.go.jp>）にインターネットを通じて接続することにより報告、若しくは 5. により鳥衝突報告を作成し、次に掲げる時期に 4. に示す機関あて電子メール又は郵送により提出するものとする。

- (1) 航空機の顕著な損傷又は計画した飛行の変更を伴う鳥衝突にあっては、その都度、判明している事項について、できる限り速やかに。
(2) (1) 以外の鳥衝突又は鳥とのニアミスにあっては、月単位でとりまとめて翌月 10 日までに。

また、整備士又は空港管理者からの航空機の損傷状況又は鳥の種類に係るより詳細な情報を入手した場合は、(1) 及び (2) の報告の後においても、入手した情報を送付するよう努めること。

4. 鳥衝突報告の提出先及び問い合わせ先

外国運航者を含む全ての運航者
〒100-8918
東京都千代田区霞が関 2-1-3
国土交通省航空局安全部安全政策課空港安全室

E-mail: hqt-birdrep@gxb.mlit.go.jp

010/22

BIRD STRIKE Reporting

The Japan Civil Aviation Bureau (JCAB) requests reporting when a bird strike to aircraft occurs in order to take more effective bird hazard reduction measures mainly at or around airports in JAPAN and to implement ICAO Annex 14, Volume I, 9.4.2. Aircraft operators or PICs should report as follows.

■ This AIC supersedes AIC NR030/19 dated 20 JUN 2019.
New information and changes are indicated by bold vertical lines.

1. Definition

Words used in this notice are defined as follows;

- 1) "Bird strike" means any collisions between bird(s) and an aircraft.

It includes cases that PIC recognized a bird strike only by shock, noise, etc., even if neither damage nor trace is confirmed by aircraft inspection, and no bird remains are recovered at or around the airport.

- 2) "Bird Near-Miss" means near collision between bird(s) and an aircraft.

2. Applicability

This notice is applied to the following areas and flight phases;

- 1) During parking, taxiing, take-off run or landing roll at an airport located in JAPAN.
2) During climb, descent or approach at or around an airport located in JAPAN.
3) During operation within the airspace of Fukuoka FIR except above.

3. Action to be taken by aircraft operators/PICs

When "Bird strike"/"Bird Near-Miss" has occurred, Aircraft operators/PICs should submit a bird strike report on the Web-site "BIRD STRIKE INFORMATION JAPAN" (URL: <https://bird.cab.mlit.go.jp>). Otherwise they should prepare the report in accordance with paragraph 5 and then submit it to the authorities described in paragraph 4 by e-mail or postal mail within the following periods;

- 1) As soon as possible even though incomplete report, in case of a bird strike which involves significant damage to the aircraft or change to the planned flight.
2) By the 10th of next month, all bird strike reports except for sub-paragraph 1), in case of bird strikes and bird near-misses which occurred within the month.
In addition, even after reporting according to sub-paragraphs 1) and 2) above, more detailed information about the extent of damage to the aircraft or about the bird species should be submitted when such information has been provided by mechanics and/or airport administrator.

4. Contact authority and addressee to where a bird strike report is sent

(For all aircraft operators including foreign aircraft operators.)
Airport Safety Office, Flight Standards Division,
Aviation Safety and Security Department, Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism
Postal: 2-1-3 Kasumigaseki, Chiyoda-ku Tokyo,
JAPAN 100-8918

E-mail: hqt-birdrep@gxb.mlit.go.jp

5. 鳥衝突報告様式記入要領

- (1) 報告は、鳥衝突情報共有サイトに接続した際のウェブ画面上の報告様式に従って記載することとし、電子メール又は郵送により報告する場合には、原則として鳥衝突報告様式 (ATTACHMENT 参照) によること。

なお、運航者が独自に様式を定める場合は、鳥衝突報告様式の項目が全て含まれていること。

※ 鳥衝突報告様式は、国土交通省のホームページ (<http://www.mlit.go.jp/koku/birdrep.html>) からダウンロードできる。

- (2) 鳥衝突報告様式は日本語又は英語で記入すること。

- (3) 「その他 (詳細を記入) /other (specify)」欄には詳細を記入すること。

- (4) 鳥とのニアミスの場合は「衝突を受けた航空機の部分 / Parts of Aircraft」及び「鳥の数 /Number of Birds」における「衝突 /Struck」欄はチェックしないこと。

- (5) 「鳥の種類 /Bird Species」は、可能な限り詳細に記入すること。

- (6) 航空機の損傷を伴う鳥衝突 (バードストライク) にあっては、備考 /Remarks」欄にできる限りコスト等を含めた詳細を記入するとともに写真を添付することが望ましい。

- (7) 報告担当者の連絡先を明記すること。

6. IBIS への登録

報告された情報は、航空局により、国際民間航空機関が管理するデータベース (IBIS) に登録される。

IBIS については、ICAO Doc 9332 "Manual on the Bird strike Information Manual" を参照。

備考：

本航空情報サーキュラーは、ノータム RJJJ NR2037/22、NR2038/22 を取り込んだものである。

5. How to fill the "BIRD STRIKE reporting form"

- 1) "Bird strike"/"Bird Near-Miss" should be reported by using the form on the website "BIRD STRIKE INFORMATION JAPAN site" or when by e-mail or postal mail, the attached "BIRD STRIKE reporting form" (see ATTACHMENT). (Operators may use their own form, if it includes all items of the attached "BIRD STRIKE reporting form") "BIRD STRIKE reporting form" can also be downloaded by following URL. (<http://www.mlit.go.jp/koku/birdrep.html>)

- 2) "BIRD STRIKE reporting form" should be written down in Japanese or English language.

- 3) If you check in "Other (specify)" box, add more detailed information in adjacent column.

- 4) If you report "Bird Near-Miss", DO NOT check in "Struck" boxes in columns "Parts of Aircraft" and "Number of Birds".

- 5) "Bird Species" column should be filled in detail as much as possible.

- 6) When the damage to the aircraft is caused by the bird strike, it is recommended that the detail including repair cost be described in "Remark" column and that the photographs be attached to the report.

- 7) Name and phone number of the contact person should be noted clearly.

6. Registration to IBIS

JCAB registers all reported bird strike data to ICAO for inclusion in their IBIS* database.

IBIS* Doc9332- Manual on the ICAO Bird Strike Information System

Remarks:

This AIC INCORP NOTAM RJAAJNYX Q0846/22 and Q0847/22.

BIRD STRIKE REPORTING FORM

鳥衝突報告

☐ 鳥衝突
Birdstrike☐ 鳥とのニアミス
Near-missOperator
運航者 _____ 01/02Aircraft Make/Model
航空機型式 _____ 03/04Engine Make/Model
発動機型式 _____ 05/06Aircraft Registration
登録番号 _____ 07Date day _____ month _____ year _____ 08
日付 日 月 西暦Local time h _____ : m _____ JST(UTC +9hrs) 09
時刻 時 分dawn ☐ day ☐ dusk ☐ night ☐ 10
薄明 昼間 薄暮 夜間Aerodrome Name
空港名 _____ 11/12Runway Used
使用滑走路 _____ 13Location if En Route
発生場所 _____ 14Height AGL
地上よりの高さ _____ ft 15Speed(IAS)
指示対気速度 _____ kt 16Phase of Flight
衝突事故発生時の飛行区分 17

parked ☐	en route ☐
駐機	巡航
taxi ☐	descent ☐
タキシング	降下
take-off run ☐	approach ☐
離陸滑走	進入
climb ☐	landing roll ☐
上昇	着陸滑走

Part(s) of Aircraft
衝突を受けた航空機の部分

	Struck 衝突	Damaged 損傷
radome レドーム	☐ 18	☐
windshield ウィンドシールド	☐ 19	☐
nose(excluding above) ノーズ(上記のものを除く)	☐ 20	☐
engine 発動機番号	no.1 ☐ 21	☐
	no.2 ☐ 22	☐
	no.3 ☐ 23	☐
	no.4 ☐ 24	☐
propeller プロペラ	☐ 25	☐
wing/rotor ウィング/ローター	☐ 26	☐
fuselage 胴体	☐ 27	☐
landing gear 着陸装置	☐ 28	☐
tail 尾部	☐ 29	☐
lights 灯火	☐ 30	☐
other(specify) その他(詳細を記入)	☐ 31	☐

Effect on Flight
フライトへの影響

none なし	☐ 32
aborted take-off 離陸中止	☐ 33
precautionary landing 目的地外着陸	☐ 34
engines shut down 発動機停止	☐ 35
other(specify) その他(詳細を記入)	☐ 36

Sky Condition
天候状態 _____ 37

no cloud 快晴	☐ A
some cloud 一部雲	☐ B
overcast 一面雲	☐ C

Precipitation
降水

fog 霧	☐ 38
rain 雨	☐ 39
snow 雪	☐ 40

Bird Species
鳥の種類 _____ 41

sparrow スズメ	☐	swallow ツバメ	☐	plover/sandpiper チドリ/シギ	☐
gull カモメ	☐	crow カラス	☐	pigeon ハト	☐
egret サギ	☐	kite トビ	☐	other その他	☐
unknown 不明	☐	other(specify) その他(鳥種を記入)	_____		

Number of Birds
鳥の数(単位:羽)

1	☐ A	Seen 視認	42	Struck 衝突	43
2-10	☐ B			☐ A	
11-100	☐ C			☐ B	
more 多数	☐ D			☐ C	
				☐ D	

Size of Bird
鳥の大きさ _____ 44

small 小(スズメ程度)	☐ S	unknown 不明	☐
medium 中(カモメ程度)	☐ M		
large 大	☐ L		

Pilot warned of Birds
パイロットへの警告の有無 _____ 45

yes 有	☐ Y	no 無	☐ N
----------	----------------------------	---------	----------------------------

Remarks
(describe damage, injuries/and other pertinent information) _____ 46/47

備考
(航空機、人員の損害/負傷の状況、程度及びその他参考となる事項等)

fan blade damaged ファンブレード損傷	☐	fan blade change ファンブレード交換	☐
engine change エンジン交換	☐	other(specify) その他(詳細を記入)	☐
injuries 人員の負傷	☐	(include cost as far as possible) (できる限りコスト等を含めること)	

Airport Safety Office, Flight Standards Division, Aviation Safety and Security Department, Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism.JAPAN
国土交通省航空局安全部安全政策課空港安全室THIS INFORMATION IS REQUIRED FOR AVIATION SAFETY
本情報は航空の安全のために必要とされています。

operator's column 運航者欄	flight number 便名 _____	departure point 出発地 _____	arrival point 到着地 _____	name of reporter 担当者 _____	TEL 連絡先 _____
---------------------------	---------------------------	------------------------------	----------------------------	-------------------------------	------------------

011/22

航空機による危険物の安全輸送について

我が国における航空機を用いた危険物の輸送基準については、「国際民間航空条約第 18 附属書 危険物の航空安全輸送」及び「危険物の航空安全輸送に関する技術指針」(ICAO Doc9284) に準拠して、「航空法施行規則第 194 条」及び「航空機による爆発物等の輸送基準等を定める告示」で規定している。

本航空情報サーキュラーは、令和 2 年 4 月 1 日に施行された改正後の「航空機による爆発物等の輸送基準等を定める告示」について補足するものである。

■ なお、本航空情報サーキュラー発行と同時に令和 2 年 5 月 21 日付航空情報サーキュラー NR028/20 を取り消す。また、新情報及び変更部は太い縦線により表示される。

1. 当該告示の別表第 18 (注)4) の規定については、国際民間航空機関による推奨のもと日本として義務化するものである。

別表第 18 (注)4)

搭乗者が身に付け、携帯し、又は携行する物件のうち、リチウム電池及び当該電池を内蔵した電子機器であって、熱、火気若しくは短絡により危険な状態に進展するおそれがあるため製造者により通常の使用に適さないと判断されたものは、以下の条件を満たすこと。

- ・ 持込み手荷物とすること。
- ・ 携帯する搭乗者の監視下に置かれること。
- ・ 電源が切られていること。
- ・ 航空機内において充電されないこと。
- ・ 不測の作動を防止するように措置されているとともに、損傷しないように保護されていること。

2. 問い合わせ先

■ 国土交通省航空局安全部安全政策課
 電話 03-5253-8737
 FAX 03-5253-1661
 Email hqt-dg-jcab@gxb.mlit.go.jp

011/22

Safe transport of dangerous goods by air

The provisions for the transport standards of dangerous goods by air in Japan are stipulated in "Article 194 of Ordinance for Enforcement of the Civil Aeronautics Act" and "Pronouncement for the standards to transport dangerous goods by air" based on "International Civil Aviation Convention, Annex 18: The Safe Transport of Dangerous Goods by Air" and "Technical Instructions for the Safe Transport of Dangerous Goods by Air" (ICAO Doc 9284).

This Aeronautical Information Circular supplements the revised "Pronouncement for the standards to transport dangerous goods by air" which came into effect on 1 April, 2020.

■ This AIC supersedes AIC NR028/20 dated 21 MAY 2020.
 New information and changes are indicated by bold vertical lines.

1. Japan obligates to follow the provisions of Table 18 (Note) 4) of this pronouncement in accordance with the recommendations from the International Civil Aviation Organization.

Table 18 (Note) 4)

Of substances to be carried by passengers as carry-on baggage, checked baggage or on their persons, lithium batteries and electronic devices containing such batteries identified by the manufacturer as being unsuitable for normal use because they have potential of evolving into a dangerous state by heat, fire or short circuit shall meet the following conditions.

- They are carried in the cabin;
- they are under the supervision of the passenger;
- they are powered off;
- they are not recharged on board the aircraft; and
- measures are taken to prevent unintentional activation and to protect from damage.

2. Contact point

Flight Standards Division,
 Aviation Safety and Security Department,
 Civil Aviation Bureau,
 Ministry of Land, Infrastructure, Transport and Tourism
 Phone +81-3-5253-8737
 Fax +81-3-5253-1661
 Email hqt-dg-jcab@gxb.mlit.go.jp

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

012/22

自家用航空機による空港使用について

本航空情報サーキュラー発行と同時に令和 2 年 6 月 18 日付航空情報サーキュラー NR032/20 を取り消す。また、新情報及び変更部は太い縦線により表示される。

空港管理者（空港運営権者を含む。以下、本サーキュラーにおいて同じ。）は航空機の使用者に対して以下の事項を確認する。

1. 航空機落下物防止対策について

適用空港 1 において空港管理者は以下の事項を確認する。

飛行機（最大離陸重量が 5,700kg を超える飛行機をいう。以下同じ。）の運航に伴う部品等の脱落の発生を防止するための措置を講じていることを約する誓約書に、使用の届出に係る飛行機の使用者が署名していること。

飛行機の使用者は空港使用の届出の際に「落下物防止対策を講じることを約する誓約書」（別紙 1 参照）に署名し、提出すること。

適用空港 1

RJAA/ 成田国際, RJBB/ 関西国際, RJOO/ 大阪国際,
RJGG/ 中部国際, RJTT/ 東京国際, RJCC/ 新千歳, RJCW/ 稚内,
RJCK/ 釧路, RJCH/ 函館, RJSS/ 仙台, RJSN/ 新潟, RJOA/ 広島,
RJOT/ 高松, RJOM/ 松山, RJOK 高知, RJFF/ 福岡, RJFR/ 北九州,
RJFU/ 長崎, RJFT/ 熊本, RJFO/ 大分, RJFM/ 宮崎,
RJFK/ 鹿児島, ROAH/ 那覇, RJCO/ 札幌丘珠, RJA/ 百里,
RJNK/ 小松, RJOH/ 美保, RJOS/ 徳島, RJSM/ 三沢,
RJOI/ 岩国, RJOY/ 大阪八尾

2. 航空機落下物被害者救済について

適用空港 1 において空港管理者は以下の事項を確認する。

航空機の運航に伴う部品等の脱落により、人の生命、身体又は財産に損害が生じた場合において、その部品等の脱落に伴う運航に使用された航空機に該当する蓋然性が相当程度高いものとして国土交通省地方航空局に設置する落下物確認委員会が決定する航空機に自ら使用する航空機が含まれる場合に、推定航空機の数に応じて按分して補償することを約する協定書の取り決め、使用の届出に係る航空機の使用者が同意していること。

航空機の使用者は空港使用の届出の際に「航空機落下物による被害の救済に関する協定書」（別紙 2 参照）の取決めについての同意確認書を提出すること（但し、官公庁等による使用及び緊急時等の場合を除く。）。なお、従前に提出された同意確認書が、国土交通省航空局又は使用する空港の空港管理者により管理及び保管されている場合にあっては、当該同意確認書の提出を省略することができる。

012/22

Regarding conditions for the use of aerodromes by private flights

This AIC supersedes AIC NR032/20 dated 18 JUN 2020. New information and changes are indicated by bold vertical lines.

Airport administrators (including the Operating Right Holder of a National Airport, the same shall apply hereinafter in this AIC) confirm aircraft operators items as follows

1. Measures to Prevent Objects Falling off Airplane

At Applied Aerodromes¹, airport administrators shall confirm the following.

Operators of airplanes (airplanes with a maximum takeoff weight of more than 5,700 kg; hereinafter the same) shall sign the Statement to take the measures to prevent objects falling off airplanes.

Airport administrators shall confirm that airplanes operators sign and submit the "Statement to Prevent Objects Falling off Airplanes" (See ATTACHMENT 1) at the time of the submission of a notification of the use of the aerodrome.

Applied Aerodromes 1:

RJAA/ Narita INTL, RJBB/ Kansai INTL, RJOO/ Osaka INTL,
RJGG/ Chubu Centrair INTL, RJTT/ Tokyo INTL,
RJCC/ New Chitose, RJCW/ Wakkanai, RJCK/ Kushiro,
RJCH/ Hakodate, RJSS/ Sendai, RJSN/ Niigata,
RJOA/ Hiroshima, RJOT/ Takamatsu, RJOM/ Matsuyama,
RJOK Kochi, RJFF/ Fukuoka, RJFR/ Kitakyushu,
RJFU/ Nagasaki, RJFT/ Kumamoto, RJFO/ Oita,
RJFM/ Miyazaki, RJFK/ Kagoshima, ROAH/ Naha,
RJCO/ Sapporo Okadama, RJA/ Hyakuri,
RJNK/ Kanazawa/Komatsu, RJOH/ Miho,
RJOS/ Tokushima, RJSM/ Misawa, RJOI/ Iwakuni,
RJOY/ Osaka/Yao

2. Relief system for damaged party by falling objects from aircraft

At Applied Aerodromes¹ airport administrators shall confirm the following.

On the assumption of the damage to human life and body or property be caused by falling objects from aircraft in operation, operators of aircraft applying for use shall agree to the arrangements of the Memorandum of Agreement which undertakes compensation in proportion to the number of aircraft, when the aircraft of its own use is identified as an aircraft used for operation with high probability of falling objects by the Falling Object Confirmation Committee established in Regional Civil Aviation Bureaus of MLIT.

Airport administrators shall confirm that aircraft operators (except flights by the government or for emergency purpose) agree to the arrangements of the "Memorandum of Agreement on Relief for Damage Caused by Falling Objects from Aircraft" (See ATTACHMENT 2) by the signature of the notification for use at the time of its submission. If the consent confirmation document submitted previously is managed and stored by the Civil Aviation Bureau of Ministry of Land, Infrastructure, Transport and Tourism or the airport administrators, re-submissions of the document can be omitted.

3. 酒気を帯びた状態で航空業務を行うことを防止するための対策について

適用空港 2 の空港管理者は以下の事項を確認する。

- i) 航空機乗組員が、酒気を帯びて航空業務を行わないこと。
- ii) 航空機乗組員が、酒気帯び（体内にアルコールを保有している状態をいう。）の有無について、アルコール検知器を使用したアルコール検査による確認を求められた場合はこれに応じること。

適用空港 2

RJTT/ 東京国際, RJCC/ 新千歳, RJCW/ 稚内, RJCK/ 釧路, RJCH/ 函館, RJSN/ 新潟, RJOA/ 広島, RJOM/ 松山, RJOK/ 高知, RJFR/ 北九州, RJFU/ 長崎, RJFO/ 大分, RJFM/ 宮崎, RJFK/ 鹿児島, ROAH/ 那覇, RJCO/ 札幌丘珠, RJA/ 百里, RJNK/ 小松, RJOH/ 美保, RJOS/ 徳島, RJOY/ 大阪八尾

4. 保険その他の条件について

適用空港 3 の空港管理者は以下の事項を確認する。

- i) 航空機が、航空保険（第三者賠償責任保険）に加入していること。（但し、官公庁等による使用及び緊急時等の場合を除く）
- ii) 法令の違反その他空港管理上支障がないよう使用すること。
- iii) 届出者が、空港を使用した行為により、禁錮以上の刑に処せられ、その執行を終わり、又は執行を受けることがなくなった日から 2 年を経過しない者でないこと。

適用空港 3

RJTT/ 東京国際, RJCC/ 新千歳, RJCW/ 稚内, RJCK/ 釧路, RJCH/ 函館, RJSS/ 仙台, RJSN/ 新潟, RJOA/ 広島, RJOT/ 高松, RJOM/ 松山, RJOK/ 高知, RJFF/ 福岡, RJFR/ 北九州, RJFU/ 長崎, RJFT/ 熊本, RJFO/ 大分, RJFM/ 宮崎, RJFK/ 鹿児島, ROAH/ 那覇, RJCO/ 札幌丘珠, RJA/ 百里, RJNK/ 小松, RJOH/ 美保, RJOS/ 徳島, RJSM/ 三沢, RJOI/ 岩国, RJOY/ 大阪八尾

5. 問い合わせ先窓口

- i) 1. 航空機落下物防止対策について及び 3. 酒気を帯びた状態で航空業務を行うことを防止するための対策について
国土交通省 航空局 安全部

安全政策課

TEL: 03-5253-8737

FAX: 03-5253-1661

- ii) 2. 航空機落下物被害者救済について及び 4. 保険その他の条件について

国土交通省 航空局 航空ネットワーク部

航空ネットワーク企画課

TEL: 03-5253-8715

FAX: 03-5253-1658

3. Measures to prevent the performing of flight duties under the influence of alcohol.

At Applied Aerodromes 2, airport administrators shall confirm the following:

- i) Flight crew must not operate any aircraft under the influence of alcohol.
- ii) To confirm whether the flight crew is under the influence of alcohol (alcohol is present in the body) or not, flight crew shall accept to take an alcohol inspection using an alcohol detection device when requested.

Applied Aerodromes 2:

RJTT/Tokyo INTL, RJCC/ New Chitose, RJCW/Wakkanai, RJCK/Kushiro, RJCH/Hakodate, RJSN/Niigata, RJOA/Hiroshima, RJOM/Matsuyama, RJOK/Kochi, RJFR/Kitakyushu, RJFU/Nagasaki, RJFO/Oita, RJFM/Miyazaki, RJFK/Kagoshima, ROAH/Naha, RJCO/Sapporo Okadama, RJA/Hiyokuri, RJNK/Komatsu, RJOH/Miho, RJOS/Tokushima, RJOY/Osaka Yao

4. Insurance and other conditions.

At Applied Aerodromes 3, airport administrators shall confirm the following:

- i) Aircraft shall be insured by aviation insurance (third party liability insurance) except flights by the government or for emergency purposes.
- ii) Avoid law violations and interference with airport administration when in use.
- iii) No person who has been sentenced to a penalty of imprisonment or more severe punishment for violation of any relative laws of using airports, and less than two years have passed since completion of the sentence or since it was suspended.

Applied Aerodromes 3:

RJTT/Tokyo INTL, RJCC/ New Chitose, RJCW/Wakkanai, RJCK/Kushiro, RJCH/Hakodate, RJSS/Sendai, RJSN/Niigata, RJOA/Hiroshima, RJOT/Takamatsu, RJOM/Matsuyama, RJOK/Kochi, RJFF/Fukuoka, RJFR/Kitakyushu, RJFU/Nagasaki, RJFT/Kumamoto, RJFO/Oita, RJFM/Miyazaki, RJFK/Kagoshima, ROAH/Naha, RJCO/Sapporo Okadama, RJA/Hiyokuri, RJNK/Komatsu, RJOH/Miho, RJOS/Tokushima, RJSM/Misawa, RJOI/Iwakuni, RJOY/Osaka Yao

5. For further information

- i) 1. Measures to Prevent Objects Falling off Airplane and 3. Measures to prevent the performing of flight duties under the influence of alcohol.

Flight Standards Division, Aviation Safety Department,

Civil Aviation Bureau,

Ministry of Land, Infrastructure, Transport and Tourism

TEL: +81-3-5253-8737

FAX: +81-3-5253-1661

- ii) 2. Relief system for damaged party by falling objects from aircraft and 4. Insurance and other conditions

Airport Safety Office, Planning Division, Aviation Network Department,

Civil Aviation Bureau,

Ministry of Land, Infrastructure, Transport and Tourism

TEL: +81-3-5253-8715

FAX: +81-3-5253-1658

落下物防止対策を講じることを約する誓約書

この誓約書に署名する者は、平成31年3月30日以降において日本国内に存する空港における離着陸に伴い、航空機部品の脱落、氷塊の落下その他の航行中の航空機から物体の落下を防止するために、下記の措置を講じていることを誓約する。

記

- ① 飛行規程及び製造者の定めるメンテナンス・マニュアル等に従って項目を定めた日常点検を飛行前及び飛行後に確実に実施すること。
- ② 製造者の定めるメンテナンス・マニュアル等に従って定時点検を確実に実施すること。
- ③ 部品等の脱落の防止に有効と考えられる次の対策を実施すること。

(1) 給排水作業実施時における給排水パイプ内の残留水の水切りについて、整備関係者及びサービス委託業者に注意喚起し、その徹底を図ること。また、作業実施後には給排水パネルが適切に閉扉されていることを確認すること。

(2) 給排水系統の漏洩及び機能について定期的に点検を行うこと。特に、着氷の恐れのある胴体部位のドレイン・バルブについては定期的にクリーニングを実施すること。

(3) 貨物搭載時等において、貨物の上面に溜まった雨水や積雪等を除去すること。また、貨物室ドア及び貨物室内に水等が溜まっていないことを確認すること。

- ④ 部品等の脱落の防止に有効な対策と考えられる技術的資料（サービス・ブレティン等）については、積極的にこれを採用するよう努めること。
- ⑤ 前項に規定する技術的資料のほか、発動機のケースを破片が貫通し、又は発動機の内部において大規模な破損が生じるような発動機の破損については、破損した部品が脱落し地上又は水上の人又は物件の安全が損なわれるおそれがあるため、部品等脱落防止措置を要するものとして発動機に関する技術的資料を採用するよう努めること。

この誓約書への署名等は、各々の法人又は団体からの正当な委任を受けて行うことを確認する。

また、この誓約書の正本は、便宜上、国土交通省航空局において保管されることを確認する。

年 月 日

_____/_____/_____
 (署名) (法人名) (職名)

Statement to Prevent Objects Falling off Airplanes

Signers of this Statement shall pledge to take the following measures to prevent the occurrence of dropping aircraft parts, falling ice blocks or falling objects from in-flight aircraft during its taking off or landing at airports in Japan on or after 30 March 2019.

- ① Daily inspection shall be performed before and after a flight for the items stipulated in accordance with the flight manuals, and the maintenance manuals etc. provided by the manufacturer.
- ② Periodic inspection shall be performed in accordance with the maintenance manuals, etc. provided by the manufacturer.
- ③ Following measures that are considered effective as a means to prevent falling objects shall be taken.
 - (1) Call attention to the maintenance staff and service contractors to completely discharge excess fluids in the potable water and lavatory waste service pipes after servicing. In addition, confirm that the panels of the potable water and lavatory waste service doors are properly closed.
 - (2) Inspect for possible leakage as well as the function of the potable water service and drain system on a regular basis. In particular, conduct regular cleaning of the drain valves on the fuselage, which are prone to cause ice accumulation.
 - (3) During cargo loading, remove rainwater pool or snow pile on top of the cargo. In addition, ensure that there is no pool formed by water and others around cargo loading doors and cargo compartments.
- ④ Technical documents (e.g. Service Bulletins) that are considered effective as a means to prevent falling objects should be employed positively.
- ⑤ In addition to the technical documents in the preceding paragraph, technical documents regarding engine failures should be employed, because uncontained release of debris due to damage of engine, in such a case as fragments penetrated the casing of the subject engine or a major damage occurred inside the engine, could endanger the safety of persons or objects on land or on water.

The signers of this Statement shall have due delegation from the respective company or organization.

The original of this Statement shall be filed at Ministry of Land, Infrastructure, Transport and Tourism for the convenience.

DD MM YY

_____/_____/_____
 (Signature) / (Company name) / (Title)

平成31年2月28日

航空機落下物による被害の救済に関する協定書

この協定書に署名する者は、平成31年3月30日以降において日本国内に存する空港における離着陸に伴い、航空機部品の脱落、氷塊の落下その他の航行中の航空機から物体の落下が発生した場合において、人の生命若しくは身体又は財産に損害（以下「航空機落下物損害」という。）が生じた際に、その損害の補償に要する費用の負担に関し、下記取決めについて同意することを確認する。

記

1. 航空機落下物損害を生じさせた航空機（以下「原因航空機」という。）を一に特定できず、当該損害に対する補償の責任を有すべき者を特定できない場合において、国土交通省地方航空局に設置される航空機落下物確認委員会が、原因航空機として推定可能な航空機（以下「認定航空機」という。）を決定したときは、認定航空機の利用者は、当該損害の補償に要する費用のうち、認定航空機の数に応じて按分して得た額を負担するものとする。
2. 航空機落下物の原因航空機として推定可能な航空機の決定要領（平成31年2月6日付け、国空ネ企第103号）に即して行われた航空機落下物確認委員会による認定航空機の決定は、1. に記載する負担に関し、強制力を有する。

この協定書への署名等は、各々の法人又は団体からの正当な委任を受けて行うことを確認する。

また、この協定書の正本は、便宜上、国土交通省航空局において保管されることを確認する。

追加加入者用

平成31年2月28日に同意された「航空機落下物による被害の救済に関する協定書」の取決めについて同意することを確認する。

この確認書への署名が、各々の法人又は団体からの正当な委任を受けて行われている場合にあっては、これを確認する。

また、この確認書の正本は、便宜上、国土交通省航空局又は空港管理者（空港運営権者を含む）において保管されることを確認する。

年 月 日

・ _____ / _____ / _____
(署名 ※¹) / (法人名 ※²) / (職 名)

※1 署名者氏名（楷書）

※2 委任を受けて署名している場合は以下を追記及び添付すること。

- ① 委託を受けた法人（団体）名：
- ② 正当な委任を受けていることを証する書類。

Memorandum of Agreement on Relief for Damage Caused by Falling Objects from Aircraft

Signers of this Memorandum of Agreement shall acknowledge an agreement to the following arrangements in relation to the burden of expenses required for compensation of the damage to human life or body, or property caused by dropping aircraft parts, falling ice blocks or falling objects from in-flight aircraft during its taking off or landing at airports in Japan on or after 30 March 2019 (hereinafter called "the damage by falling objects from aircraft").

1. In the case that it is not possible to identify one specific aircraft which caused the damage by falling objects from aircraft (hereinafter referred to as "the causing aircraft") and to identify a person responsible for the compensation of the damage, and if the Falling Object Confirmation Committee established in Regional Civil Aviation Bureaus of Ministry of Land, Infrastructure, Transport and Tourism determines a presumably causing aircraft (hereinafter referred to as "the acknowledged aircraft"), the operator of the acknowledged aircraft shall bear the amount of expenses for compensation of the damage, proportionally divided by the number of the acknowledged aircraft.

2. The determination of the acknowledged aircraft by Falling Object Confirmation Committee in accordance with the procedures for determination of a presumably causing aircraft for the falling objects from aircraft (dated 6 FEB 2019 No. 103) shall have legal power in regards to the burden stipulated in the above 1.

The signers of this Memorandum of Agreement shall have due delegation from the respective company or organization.

The original of this Memorandum of Agreement shall be filed at the Ministry of Land, Infrastructure, Transport and Tourism for convenience.

For subsequent participants

We hereby agree to the arrangements stipulated in the "Memorandum of Agreement on Relief for Damage Caused by Falling Objects from Aircraft" agreed on 28 FEB 2019.

In the case that the signer is an agent, The signers of this Confirmation Note shall have due delegation from the respective company or organization.

The original of this Confirmation Note shall be filed at the Civil Aviation Bureau of Ministry of Land, Infrastructure, Transport and Tourism or the airport administrators (including the Operating Right Holder of a National Airport), for convenience.

DD MM YY

• _____ / /
(Signature) ※¹ (Company name) ※² (Title)

※ 1 PRINT NAME:

※ 2 In the case that the signer is an agent,

1) company name of the customer:

2) a power of attorney should be attached.

Tel: +81-476-33-5811
Fax: +81-476-33-5509
AFTN: RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

013/22

**MSAS による LP/LPV 進入の評価データの提供依頼
について****1. 概要**

令和 3 年 12 月 2 日から MSAS (Michibiki Satellite-based Augmentation Service : みちびき衛星航法補強サービス) を用いた LP/LPV 進入が開始された。

MSAS が提供する GPS 補強情報には、GPS の誤差補正情報、電離層遅延量の補正情報、GPS 衛星の異常有無に関する情報が含まれており、航空機はこれらを利用することで航法の測位精度及び信頼性が向上する。LP/LPV(Localizer Performance / Localizer Performance with Vertical guidance) 進入時においては、航空機は ILS と同様に適正な進入コースからの偏位量を表示することが可能となる。

本航空情報サーキュラーは、令和 4 年 6 月 16 日 0000JST から適用される。

2. 評価用データの利用目的

LP/LPV 進入の安定的なサービスを提供するため、運航者から LP/LPV 運航時のデータを収集し、長期間の評価を実施するものである。

3. 対象航空機

LP/LPV 進入を実施する航空機

4. MSAS による LP/LPV 進入の評価用データの報告

運航者は、LP/LPV 実施報告書を 1 ヶ月毎に 5. の報告先に送付する。報告様式は交通管制部管制技術課から配布する。

5. 報告先及び問い合わせ窓口

国土交通省航空局交通管制部管制技術課
住所：〒100-8918 東京都千代田区霞が関 2-1-3
電話：03-5253-8755
ファックス：03-5253-1663
電子メール：hqt-msas-lpv@gxb.mlit.go.jp

013/22

**Request for an evaluation data of MSAS LP/LPV
approach****1. Overview**

The LP/LPV approach using Michibiki Satellite-based Augmentation Service(MSAS) was launched on 2 DEC 2021. The GPS augmentation messages provided by MSAS includes GPS error correction, ionospheric delay correction, and GPS satellite anomaly information. On Localizer Performance (LP) / Localizer Performance with Vertical guidance(LPV) approach, the aircraft can display the deviation from the proper approach course as well as ILS.

This AIC will be effective from 1500UTC 15 JUN 2022.

2. Purpose of evaluation data

To realize a stable service for LP/LPV approach, JCAB collect a data regarding LP/LPV operation from operators, and evaluate a performance for a long-term.

3. Target aircraft

Aircraft performing LP/LPV approach

4. Reporting of data for evaluation of LP/LPV entry by MSAS

Operators are asked to collect and send the trial reports every month to the address in 5. by post. The format of the report will be provided by Air Navigation Services Department.

5. For further information

Air Navigation Services Department, Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism.
TEL : +81-3-5253-8755
FAX : +81-3-5253-1663
e-mail : hqt-msas-lpv@gxb.mlit.go.jp

033/22

「特定操縦技能審査制度」の導入について

平成 23 年 5 月 25 日に航空法の一部が改正され、平成 26 年 4 月 1 日に施行されるにあたり、平成 24 年 4 月 1 日から「特定操縦技能審査制度」が導入されている。

■ なお、本航空情報サーキュラー発行と同時に、令和 4 年 5 月 19 日付け航空情報サーキュラー NR009/22 を取り消す。
 また、新情報及び変更部は太い縦線により表示される。

1. 概要

操縦技能証明を有する者は、平成 24 年 4 月 1 日から平成 26 年 3 月 31 日までの間に、飛行前の一定期間内（原則 2 年以内）に「操縦技能審査員」による「特定操縦技能審査」を受験し、合格しなければ、平成 26 年 4 月 1 日以降は、次に掲げる行為（以下「操縦等」という。）を行うことができなくなる。

- 1) 航空機に乗り組んで行うその操縦
- 2) 必要な操縦技能証明を有さない者が行う操縦の練習の監督
- 3) 特定操縦技能審査に合格していない者が行う操縦の練習の監督
- 4) 必要な計器飛行証明を有さない者が行う計器飛行等の練習の監督

ただし、次の場合には、「特定操縦技能審査」を受けなくてもよい。

- a) 飛行前の一定期間内に次のいずれかの方法により特定操縦技能を有することが確認された場合
 - i) 操縦技能証明又はその限定変更を受けた場合
 - ii) 航空運送事業者が運航規程に基づき行う技能審査に合格した場合
- b) やむを得ない事由があると認めて国土交通大臣が許可した場合

※ 災害時に救助活動を行う場合、外国で有効期間が満了した場合等を想定
- c) 機長としてその航空機を操縦することができる技能証明及び航空身体検査証明を有する者であって特定操縦技能審査に合格した者による監督の下で操縦の練習を行う場合

※ 必要な技能証明を有する者の監督を受けることが困難な場合は、国土交通大臣が指定した者による監督でも可

2. 定義

「特定操縦技能審査」とは、飛行前の一定期間内（原則 2 年以内）に、航空機の操縦に従事するのに必要な知識及び能力の維持について行う審査をいう。

「操縦技能審査員」とは、航空機の操縦技能審査に必要な経験、知識及び能力を有することについて、項目 3. 1) の基準で国土交通大臣により認定された者をいう。

033/22

The introduction of "Pilot Competency Assessment system"

Civil Aeronautics Act was revised on May 25, 2011 and it will come into effect on April 1, 2014. Along with that, "Pilot Competency Assessment system" is introduced from April 1, 2012.

■ This AIC supersedes AIC NR009/22 dated 19 MAY 2022.

New information and changes are indicated by bold vertical lines.

1. Abstract

On and after April 1, 2014, no person who holds a Pilot Competency Certificate must do what is listed below unless passing a Pilot Competency Assessment conducted by a Pilot Competency Assessor has been made within a specific period (2 years in principle) preceding a flight:

- 1) getting on board the aircraft and operating it;
- 2) supervising the flight training made by a person who doesn't have an applicable license;
- 3) supervising the flight training made by a person who hasn't passed a Pilot Competency Assessment; and
- 4) supervising the flight training made by a person who doesn't have an instrument flight rating.

However, passing a Pilot Competency Assessment is not required in one of the following situations:

- a) having confirmed to have Pilot Competency within a specific period by:
 - i) obtaining a Pilot Competence Certificate or changing the ratings of the Pilot Competence Certificate; or
 - ii) passing a Pilot Competency Assessment conducted by an air carrier according to its operation manual.
- b) being admitted by Minister of Land, Infrastructure, Transport and Tourism on account of an inevitable reason.

* This item is assumed for the situation of rescuing at the time of disaster, expiring in a foreign country, etc.
- c) making flight training supervised by a person who holds a Pilot Competence Certificate with which the person can operate aircraft as a pilot in command and an aviation medical certificate and who has passed the Pilot Competency Assessment.

* When it is hard to make flight training supervised by an appropriate person who holds a necessary Pilot Competency Certificate, a person designated by the Minister of Land, Infrastructure, Transport and Tourism may supervise the training.

2. Definitions

"Pilot Competency Assessment."

A Pilot Competency Assessment is an assessment in which a pilot is assessed whether the pilot maintains knowledge and competency required for operating aircraft, which shall be conducted within a specific period (2 years in principle) preceding a flight.

"Pilot Competency Assessor."

A Pilot Competency Assessor is a person who is approved by the Minister of Land, Infrastructure, Transport and Tourism about having experience, aeronautical knowledge and aeronautical proficiency which are required for conducting a Pilot Competency Assessment in the standard of item 3.1).

3. 「操縦技能審査員」について

1) 認定基準

操縦技能審査の認定は地方航空局長により、以下の条件を満たす者に対して行われる。

i) 特定操縦技能審査に係る航空機と同じ種類の航空機（以下「同種航空機」という。）を機長として操縦することができる技能証明を有していること

ii) 特定操縦技能審査を行うのに十分な知識及び能力を有すること（下記のいずれかに該当すること）

- ・ 同種航空機について操縦教育証明を有すること
- ・ 同種航空機について操縦士資格に係る指定航空従事者養成施設の技能審査員として国土交通大臣の認定を受けていること
- ・ 同種航空機について指定本邦航空運送事業者の査察操縦士として国土交通大臣の指名を受けていること
- ・ 同種航空機について本邦航空運送事業者の運航規程に定められた任命基準に基づき審査担当者として任命されていること
- ・ 同種航空機について航空機使用事業者の運航基準に定められた任命基準に基づき審査担当者として任命されていること
- ・ 航空局が行う操縦技能審査員認定試験に合格すること

iii) 特定操縦技能審査に関して国土交通大臣が行う講習を修了していること又はこれと同等以上と認められる知識を有すること

2) 義務

i) 特定操縦技能審査を行う場合には、操縦技能審査員の証の携帯を義務付ける。

ii) 認定の翌年から、2年に1度国土交通大臣による定期講習を受講することを義務付ける。ただし、これと同等以上と認められる知識を有する場合はこの限りでない。

4. 「特定操縦技能審査」について

1) 審査方法

i) 特定操縦技能審査は、航空機の種類ごとに行う。

ii) 操縦技能審査員は、原則、その操縦技能証明について限定をされた範囲の航空機について特定操縦技能審査を行うことができる

※ 当該航空機を機長として操縦することができる技能証明を有する者による特定操縦技能審査を受けることが困難な場合にあっては、操縦技能審査員のうち当該航空機について特定操縦技能審査を行うことができると国土交通大臣が指定した者による審査を受けることが可能である。

iii) 実技審査の全部又は一部については、国土交通大臣が認定した模擬飛行装置又は飛行訓練装置により行うことができる。

iv) 操縦技能審査員は、特定操縦技能審査を行った場合には、その結果（及び合格の場合にはその有効期間）等を当該審査の申請者の技能証明書に記入するとともに、速やかに国土交通大臣に報告すること。

3. Pilot Competency Assessor

1) Standards for Approval

Approval of a Pilot Competency Assessor is given by the Director of a Regional Civil Aviation Bureau to a person who is:

i) having a Pilot Competency Certificate with which the person can operate aircraft of the same category which is used for the Pilot Competency Assessment, as pilot-in-command;

ii) having knowledge and competency necessary for conducting the Pilot Competency Assessment, meeting one of the following requirements:

- holding a flight instructor certificate of the same aircraft category;
- having been approved by the Minister of Land, Infrastructure, Transport and Tourism as a competency assessor of the same aircraft category for a designated airman training school;
- having been designated by the Minister of Land, Infrastructure, Transport and Tourism as a check pilot of the same category aircraft for a domestic air carrier designated by the Minister of Land, Infrastructure, Transport and Tourism;
- having been designated as a check pilot of the same aircraft category for a domestic air carrier based on its designation standards prescribed in the operation manual;
- having been designated as a check pilot of the same aircraft category of aerial work for a based on its designation standards prescribed in the operation standards; or
- having passed a qualification test for the Pilot Competency Assessor conducted by Japan Civil Aviation Bureau;

iii) having completed the course for the Pilot Competency Assessment conducted by the Minister of Land, Infrastructure, Transport and Tourism or having knowledge equivalent to or more advanced than that which is given in the course.

2) Obligation

i) When conducting a Pilot Competency Assessment, Pilot Competency Assessor is obliged to carry Identification Card of Pilot Competency Assessor; and

ii) Pilot Competency Assessor is obliged to attend to periodical course provided by the Minister of Land, Infrastructure, Transportation and Tourism once in two years, from the next year of approval, provided, however, that this shall not apply to those who are approved to have equivalent knowledge.

4. Pilot Competency Assessment

1) Way of assessment

i) A Pilot Competency Assessment is conducted by category of aircraft;

ii) In principle, Pilot Competency Assessors are designated for conducting Pilot Competency Assessment for aircrafts under their Pilot Competence Certificate ;

*When it is hard to be conducted Pilot Competency Assessment by appropriate persons who hold necessary Pilot Competence Certificate as a pilot in command, persons who are Pilot Competency Assessors and designated by the Minister of Land, Infrastructure, Transport and Tourism are available.

iii) All or part of practical assessment can be conducted with flight simulated device or flight training device approved by the Minister of Land, Infrastructure, Transport and Tourism;

iv) When Pilot Competency Assessors conduct a Pilot Competency Assessment, they should write result of the assessment, (and validity period in case of passing) and the other required things into applicant's Pilot Competence Certificate and promptly report to the Minister of Land, Infrastructure, Transport and Tourism ; and

- v) 特定操縦技能審査に不合格となった者は、再審査、操縦の練習等のために必要な場合を除き、速やかにその技能証明書を国土交通大臣に提出しなければならない。

2) 審査内容

特定操縦技能審査は、次に掲げる項目について口述及び実技により実施する。

a) 運航に必要な知識

※ 航空法規の改正点、最新の運航規則、最近の航空事故等を踏まえた留意事項等

b) 飛行前作業

※ 重量重心位置、航空情報、気象情報、航空機整備状況、搭載燃料等の確認、飛行計画の策定・承認等

c) 空港等及び場周経路における運航

d) 通常の離陸及び着陸並びに着陸復行及び離陸中止

e) 基本的な計器による飛行

f) 飛行全般における通常時の操作

※ 異常時及び緊急時の操作、着陸復行及び離陸中止については、実技審査中における口頭による審査を想定

3) 特定操縦技能審査を受ける時期

特定操縦技能審査は、原則、操縦等を行う日前「2年以内」に受けなければならない（審査合格日の翌日から2年間は操縦等が可能）。

ただし、前回の審査合格に係る操縦等可能期間（2年）内に、新たに審査に合格した場合には、45日間を限度として、新たな審査合格の有効期間は、2年に前回の審査合格の有効期間の残余を加算したものとする。

5. 問い合わせ先

1) 東京航空局保安部運航課

電話：03-5275-9321 10時～17時（JST）

電子メール：cab-tcabpca@mlit.go.jp

2) 大阪航空局保安部運航課

電話：06-6937-2781 10時～17時（JST）

電子メール：cab-opca@mlit.go.jp

備考：

本航空情報サーキュラーはノータム RJJJ 7160/22 を取り込んだものである。

- v) Anyone who failed Pilot Competency Assessment should submit their Pilot Competence Certificate soon to Minister of Land, Infrastructure, Transport and Tourism unless it is required for re-assessment or flight training;

2) Contents of assessment

Pilot Competency Assessment should be conducted by oral test and practical test about the items listed below:

a) Knowledge required for operation;

* Revised point of aviation law, latest operation rule and consideration based on recent aviation accident, etc.

b) Pre-flight work;

* Position of center of gravity, aeronautical information, weather information, information of aircraft maintenance, confirmation of fuel loaded and making and approval of flight plan, etc.

c) Operation at an airport etc. and traffic pattern;

d) Takeoff and landing and go-around and rejected takeoff;

e) Flight with basic instrument; and

f) Normal operation for general flight;

* Non-normal and emergency operation, go-around and rejected takeoff are assumed to be conducted by oral test during practical test.

3) Time for going through Pilot Competency Assessment

In principle, passing the Pilot Competency Assessment should be made within 2 years from the date of piloting. (i.e. flying is allowed for 2 years since passing of Pilot Competency Assessment.)

But, in case passing another Pilot Competency Assessment before Expiration Date of Piloting Capable Period (2 years), length of the new Piloting Capable Period is 2 years plus residual date of the old Piloting Capable Period (at most 45 days).

5. Contact information

1) Flight Standards Division, Air Traffic Services and Safety

Department, East Japan civil aviation bureau

Tel : +81-(0)3-5275-9321 (01:00~08:00 UTC)

Email: cab-tcabpca@mlit.go.jp

2) Flight Standards Division, Air Traffic Services and Safety

Department, West Japan civil aviation bureau

Tel : +81-(0)6-6937-2781 (01:00~08:00 UTC)

Email: cab-opca@mlit.go.jp

Remarks:

This AIC INCORP NOTAM RJAAJNYX Q2761/22.

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM

CIVIL AVIATION BUREAU

AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 005/23
23 FEB 2023

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

005/23

日本の領域内におけるBoeing 737 MAXの運航について

日本の領域内において Boeing 737 MAX (ボーイング 737-8 型機 (B38M) 及び 737-9 型機 (B39M) をいう) を運航する場合、以下の要件を満たしていなければならない。

1. 米国連邦航空局より発出された耐空性改善命令 (Airworthiness Directive : AD 2020-24-02) 又はこれと同等な文書に従い処置を完了していること。
2. 米国連邦航空局より公表された乗員訓練要件 (Flight Standardization Board (FSB) Report for Boeing 737, Revision 17 (又はそれ以降) , Appendix 7 (Boeing 737 MAX Special Training for Flight Crews)) に従った訓練を完了していること。

備考 :

本航空情報サーキュラーはノータム RJJJ NR0075/23 を取り込んだものである。

005/23

Operation of Boeing 737 MAX within the territory of Japan

Operators with Boeing 737 MAX (Boeing 737-8 (B38M) and Boeing 737-9 (B39M)) within the territory of Japan shall meet the following requirements.

1. All elements contained in Federal Aviation Administration (FAA) AD 2020-24-02 or equivalent document have been completed.
2. All elements contained in FAA Flight Standardization Board (FSB) Report for Boeing 737, Revision 17 and subsequent revisions, Appendix 7 (Boeing 737 MAX Special Training for Flight Crews)) have been completed.

Remarks:

This AIC INCORP NOTAM RJAAYNYX Q0031/23.

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM

CIVIL AVIATION BUREAU

AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 006/23
23 FEB 2023

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

006/23

日本の領域内における PW4000 シリーズエンジンを搭載する Boeing 777 型航空機の運航について

すべての航空運送事業者は、日本の領域内において PW4000 シリーズエンジンを搭載する Boeing 777 型航空機の離着陸及び上空通過を避けることが求められる。

ただし、以下の要件を満たしているものを除く。

1. 米国連邦航空局より発出された耐空性改善命令 (Airworthiness Directive : AD 2022-06-09、2022-06-10、2022-06-11) 又はこれと同等な文書に従い処置を完了していること。
2. 外国の航空運送事業者が日本の領域内において離着陸を行う場合には、1. の実施状況について事前に国土交通省航空局の確認を受けていること。

備考：

本航空情報サーキュラーはノータム RJJJ NR8231/22 を取り込んだものである。

006/23

Operation of Boeing 777 equipped with PW4000 series engines within the territory of Japan

All air carriers are requested to avoid operation (taking-off/landing and overflight) of Boeing 777 equipped with PW4000 series engines within the territory of Japan, except those that meet the following requirements.

1. All elements contained in Federal Aviation Administration (FAA) AD 2022-06-09, 2022-06-10, 2022-06-11 or equivalent document have been completed.
2. Foreign air carriers have undergone safety review regarding the implementation status of item 1 by Japan Civil Aviation Bureau before taking-off/landing within the territory of Japan.

Remarks:

This AIC INCORP NOTAM RJAAYNYX Q3163/22.

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

027/23

滑走路面状態評価及び報告方式の補足について

令和 3 年 11 月 4 日 0000 J S T から、ICAO 附属書に準拠し、空港の航空機移動区域において、積雪又は凍結がある場合には、滑走路面状態評価及び報告が行われている。

本航空情報サーキュラーは、わが国における滑走路面状態評価及び報告の適用について補足するものである。

■ なお、本航空情報サーキュラー発行と同時に、令和 4 年 12 月 1 日付航空情報サーキュラー NR032/22 を取り消す。
また、新情報及び変更部は太い縦線により表示される。

■ 1. スノータムによる滑走路状態の周知

滑走路状態コード (RWYCC) を含む滑走路のスノータムが発行される。なお、わが国では RWYCC のダウングレードは考慮されるが、RWYCC のアップグレードは考慮されない。
(スノータムの詳細は AIP AD 1.2 を参照)

■ 2. ノータムによる誘導路及びエプロンの状態の周知

わが国では、誘導路又はエプロンの調査において、国により測定することが認められた摩擦計測機器を使用して、摩擦係数が 0.26 未満の場合又は 3mm を超える深さの SLUSH の占める割合が 25% を超える場合は「POOR」(状態が不良)として、ノータムが発行される。
なお、調査する誘導路又はエプロンが限定される場合は、調査対象の誘導路及びエプロンが AD 2.7 SEASONAL AVAILABILITY-CLEARING において公示される。
(ノータムの詳細は AIP AD 1.2 を参照)

■ 3. パイロットブレーキングアクション通報の取り扱い

ANNEX6 に基づくパイロットブレーキングアクションの通報は以下により使用される。

- 1) 空港管理者による滑走路状態の評価
- 2) 管制機関等による滑走路状態の提供

■ 4. 管制機関等による滑走路状態の提供

以下の用語が使用される。

- 1) RWYCC

航空機からみて手前の地点から順に提供される。

[時刻] の滑走路 [番号] の滑走路状態コードは、[数値]、
[数値]、[数値] です。
RUNWAY [number] SURFACE CONDITION CODE,
[number], [number], [number] AT [time] .

- 2) 3. 2) で通報されたブレーキングアクション
最新のブレーキングアクションに係る情報を、通報した航空機の型式及び通報時刻を併せて、滑走路面状態が再評価されるまでの間提供される。

[時刻] の [航空機型式] の通報では、滑走路 [番号] のブレーキングアクションは [状態] です。
RUNWAY [number] BRAKING ACTION [condition] REPORTED BY
[type of aircraft] (AT) [time] .

027/23

Supplemental of procedures for assessing and reporting runway surface conditions

From 1500 UTC 3 NOV 2021, according to ICAO ANNEX, procedures for assessing and reporting runway surface conditions, commonly known as the Global Reporting Format (GRF) has been conducted when snow or ice appears on movement area at airport.

This AIC is to provide a supplementary explanation concerning application of the procedures for assessing and reporting runway surface conditions in Japan.

■ This AIC supersedes AIC NR032/22 dated 1 DEC 2022.

New information and changes are indicated by bold vertical lines.

■ 1. Notification of runway surface conditions through SNOWTAM

SNOWTAM regarding runway, includes Runway Condition Code(RWYCC) is disseminated. In Japan, downgrading is considered but upgrading is not when assigns RWYCC.
(See AIP AD1.2 for further information on SNOWTAM)

■ 2. Notification of taxiways and aprons conditions through NOTAM

In Japan, if the friction coefficient is less than 0.26 by using the friction measuring device agreed by the government for measurement, or if there is greater than 3mm SLUSH covering over 25% of surface of taxiways or aprons, NOTAM is issued as "POOR" in taxiways or aprons inspections.

If taxiways or aprons to be assessed are limited, taxiways and aprons to be assessed are published in AD 2.7 SEASONAL AVAILABILITY-CLEARING.

(See AIP AD1.2 for further information on NOTAM)

■ 3. Usage of pilot braking action report

Pilot braking action report based on ANNEX6 are used for;

- 1) Runway assessment by airport operator.
- 2) Information regarding runway condition provided by Air traffic service unit.

■ 4. Information regarding runway condition provided by Air traffic service unit

The following terms are used.

- 1) RWYCC.

Provided in order from the point in front of the aircraft.

RUNWAY [number] SURFACE CONDITION CODE,
[number], [number], [number] AT [time].

■ 2) Reported braking action by 3.2)

Air traffic service unit provide recent information on braking action with reported aircraft type and reported time until the condition of runway is reevaluated.

RUNWAY [number] BRAKING ACTION [condition]
REPORTED BY [type of aircraft] (AT) [time].

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

Nr 010/24
16 MAY 2024

010/24

アジアー北米間における高高度 User Preferred Route(UPR)の試行運用について

■ 令和 6 年 6 月 13 日 0000JST から、アジアー北米間（東西方向）における高高度 UPR^{*1}(User Preferred Route) の試行運用が以下のとおり行われる。

■ なお、同時刻をもって令和 2 年 3 月 26 日付 AIC NR020/20 を取り消す。
また、新情報及び変更部は太い縦棒により表示される。

*1: UPR とは洋上空域において運航者が運航機材、運航時刻、気象予報等を考慮して任意に飛行経路を作成する飛行計画方式である。

1. アジアー北米間（東行き）の航空機に係る飛行計画方式

- a) 福岡 FIR、オークランド FIR の空域内で計画すること。
- b) 東経160度においてFL390以上で飛行することが可能なこと。
- c) 各空域内での運航方法
福岡 FIR の国内空域 ^{*2} を飛行する場合は、適切な ATS 経路を計画し、引き続き次のいずれかの洋上転移経路 (OTR) へ接続すること。ただし、DOVAG 又は CANAI から洋上空域へ入域する場合、DOVAG-UKATA-33N150E を結ぶ線以南の空域で計画すること。

-ADNAP OTR5 KALNA
-ADNAP OTR7 EMRON
-AVBET OTR9 EMRON
-AVBET OTR11 LEPKI
-LAPIL OTR13 SEALS
-POVAL OTR15 MORAY
-BORDO Y74 AZAMA Y57 TAMAK V73 DOVAG
-BORDO Y74 TOPAT V75 CANAI
-SEDKU R595 MJC V91 NHC A582 ONC V73 DOVAG
-SEDKU R595 MJC V91 NHC V75 CANAI

*2: 硫黄島 TACAN を中心として半径 55NM 以内の範囲を除く QNH 適用区域内

- d) 使用中の軍用空域やロケットの影響空域を含む、NOTAM 等で公示された空域を避けて計画すること。
- e) 本 UPR を飛行する航空機は、PACOTS 経路又は CEP(Central East Pacific) 経路を飛行する航空機に対し飛行高度の割当について優先されるものではない。

2. 北米ーアジア間（西行き）の航空機に係る飛行計画方式

- a) 福岡 FIR、オークランド FIR の空域内で計画すること。

010/24

Operational Trial for the use of high altitude User Preferred Route (UPR) between Asia and North America

■ From 1500UTC 12 JUN 2024, Operational Trial for the use of high altitude User Preferred Route (UPR)^{*1} between Asia and North America for east-west bound will be underway. The following procedures must be adhered to when flight planning UPR.

■ AIC NR020/20 dated 26 MAR 2020 will be superseded at 1500UTC 12 JUN 2024.
New information and changes are indicated by bold vertical lines.

*1: UPR is a method of flight planning that allows oceanic airspace operators to choose random routes based on individual airframes, flight time, weather forecast etc.

1. For flight planning between Asia and North America for east bound

- a) The UPR must remain in the Fukuoka FIR and Oakland FIR.
- b) Flights must be capable of climbing to 160E at FL390 or above.

c) Rules of operation in each airspace

Operators shall flight plan appropriate ATS routes and connect to one of the following Oceanic Transition Routes (OTR) when entering domestic airspace^{*2}. When entering the oceanic airspace via DOVAG or CANAI, the high URPs must be planned within the airspace to the south of DOVAG - UKATA-33N150E.

- ADNAP OTR5 KALNA
- ADNAP OTR7 EMRON
- AVBET OTR9 EMRON
- AVBET OTR11 LEPKI
- LAPIL OTR13 SEALS
- POVAL OTR15 MORAY
- BORDO Y74 AZAMA Y57 TAMAK V73 DOVAG
- BORDO Y74 TOPAT V75 CANAI
- SEDKU R595 MJC V91 NHC A582 ONC V73 DOVAG
- SEDKU R595 MJC V91 NHC V75 CANAI

*2: Domestic airspace is QNH application area except as the area within 55NM radius of IWOTO TACAN.

- d) The UPR must be planned to avoid NOTAM and/or State published airspace including active military airspace and/or estimated rocket impact area.
- e) The UPR aircraft do not have priority for altitude assignment over aircraft on an existing PACOTS or Central East Pacific (CEP) Traffic.

2. For flight planning between North America and Asia for west bound

- a) The UPR must remain in the Fukuoka FIR and Oakland FIR.

- b) 東経180度においてFL380以上で飛行することが可能なこと。
- c) 東経 160 度を 1130JST から 1500JST の間に通過すること。
- d) 次のいずれかの洋上転移経路 (OTR) 等を計画し、引き続き適切な ATS 経路へ接続すること。

-KALNA OTR5 ADNAP
-EMRON OTR7 ADNAP
-EMRON OTR9 AVBET
-LEPKI OTR11 AVBET
-SEALS OTR13 LAPIL
-MORAY OTR15 POVAL
-FERAR OTR17 PIPIK
-TONIK G223 DAGDA

- e) 使用中の軍用空域やロケットの影響空域を含む、NOTAM 等で公示された空域を避けて計画すること。
- f) 適切な標準出発経路及び標準到着経路を計画すること。
- g) 本 UPR を飛行する航空機は、PACOTS 経路又は CEP (Central East Pacific) 経路を飛行する航空機に対し飛行高度の割当について優先されるものではない。

3. その他

オークランド FIR に関する詳細は、米国の発行する航空情報を参照すること。

4. 問い合わせ窓口

福岡航空交通管制部 (福岡 ACC)
管制官事務室 cab-facckansei-ocean@gxb.mlit.go.jp

- b) Flights must be capable of climbing to 180E at FL380 or above.
- c) Flights must cross 160E between 0230UTC and 0600UTC.
- d) Operators must flight plan one of the following Oceanic Transition Routes (OTR) or ATS route and connect to appropriate ATS routes.

-KALNA OTR5 ADNAP
-EMRON OTR7 ADNAP
-EMRON OTR9 AVBET
-LEPKI OTR11 AVBET
-SEALS OTR13 LAPIL
-MORAY OTR15 POVAL
-FERAR OTR17 PIPIK
-TONIK G223 DAGDA

- e) The UPR must be planned to avoid NOTAM and/or State published airspace including active military airspace and/or estimated rocket impact area.
- f) The UPR must be flight planned via the appropriate SID/STAR.
- g) The UPR aircraft do not have priority for altitude assignment over aircraft on an existing PACOTS or Central East Pacific (CEP) Traffic.

3. Others

Refer to aeronautical information published by the United States of America, for the detail about the Oakland FIR.

4. For further questions

Fukuoka ACC
Office cab-facckansei-ocean@gxb.mlit.go.jp

018/24

滑走路誤進入を防止するための基本動作及び手順等の徹底について

本航空情報サーキュラーは、我が国における滑走路誤進入を防止するため、AIP ENR 1.1 一般規則、ENR1.5.1.8 飛行場管制及びENR1.5.1.9 復唱要領について、補足するものである。

1. 管制官からは、航空機の離陸順序を示す情報（No.1、No.2等）が提供されることがある。その場合であっても、滑走路進入には、次の4つの許可又は指示のいずれかが必要になる。
 - (1) "Cleared for take-off"（離陸許可）
 - (2) "Cross runway"（滑走路横断指示）
 - (3) "Line up and wait"（滑走路路上における待機指示）
 - (4) "Taxi via runway / Backtrack runway"
（滑走路路上の地上走行指示）
2. 基本動作の徹底及び AIP ENR 1.5.1.9 復唱要領に従った管制承認、管制指示又は管制許可を受けた場合における確実な復唱を含む安全運航のための手順等を改めて徹底すること。
3. 管制官からの許可や指示について、的確に把握するよう努めた上で、その内容に疑問がある場合には、管制官に対して確認を行うこと。
4. 滑走路進入時及び着陸進入時において、特に注意して外部監視を行うこと。

018/24

Thorough implementation of basic operation and procedures pertaining to prevention of runway incursion

This Aeronautical Information Circular supplements AIP ENR 1.1 General Rules, ENR 1.5.1.8 Airport Traffic Control and ENR 1.5.1.9 Read Back Procedure to prevent runway incursion in Japan.

1. Pilots may receive information regarding the sequence of take-off, such as No.1 and No.2, from the controller. Even in this case, pilots need to be provided one of the following 4 clearances and instructions to enter the runway.
 - (1) "Cleared for take-off"
 - (2) "Cross runway"
 - (3) "Line up and wait"
 - (4) "Taxi via runway/Backtrack runway"
2. Pilots shall thoroughly implement again the basic operation and procedures for safe operations including definite readback when receiving clearances and instructions in accordance with AIP ENR 1.5.1.9 Read Back Procedure.
3. Pilots shall attempt to understand the content of the clearances and instructions from the controller accurately and shall confirm to the controller if there are any questions.
4. Pilots shall maintain vigilance to the outside of the aircraft with particular attention, especially when entering runway and approaching runway for landing.

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN
MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC
Nr 027/24
28 NOV 2024

027/24 027/24
SSR モード S 地上レーダーの運用開始について Commencement of SSR Mode S ground radar

1. 以下のとおり SSR モード S 地上レーダーの運用が開始される。 1. SSR Mode S ground radar will commence its operation as follows.
■ なお、本航空情報サーキュラー発行と同時に、令和 6 年 8 月 8 日付 AIC NR016/24 を取り消す。 ■ This AIC supersedes AIC NR016/24 dated 8 AUG 2024.
また、新情報及び変更部は太い縦線により表示される。 New information and changes are indicated by bold vertical lines.

施設名 Name of Facility	運用開始日時 Date/Time of commencing its operation
山田 A R S R YAMADA ARSR	平成 15 年 11 月 20 日 0000JST から From 1500UTC 19 NOV 2003
いわき O R S R IWAKI ORSR	平成 15 年 12 月 4 日 0000JST から From 1500UTC 3 DEC 2003
三国山 A R S R MIKUNISAN ARSR	平成 16 年 2 月 23 日 0000JST から From 1500UTC 22 FEB 2004
上品山 A R S R JOBONZAN ARSR	平成 18 年 2 月 8 日 0000JST から From 1500UTC 7 FEB 2006
八戸 A R S R HACHINOHE ARSR	平成 18 年 3 月 1 日 0000JST から From 1500UTC 28 FEB 2006
加世田 A R S R KASEDA ARSR	平成 19 年 3 月 8 日 0000JST から From 1500UTC 7 MAR 2007
福江 O R S R FUKUE ORSR	平成 22 年 4 月 26 日 0000JST から From 1500UTC 25 APR 2010
三河 A R S R MIKAWA ARSR	平成 23 年 3 月 7 日 0000JST から From 1500UTC 6 MAR 2011
久米島 O R S R KUMEJIMA ORSR	平成 24 年 7 月 9 日 0000JST から From 1500UTC 8 JUL 2012
箱根 A R S R HAKONE ARSR	平成 24 年 12 月 26 日 0000JST から From 1500UTC 25 DEC 2012
能登 A R S R NOTO ARSR	平成 25 年 3 月 17 日 0000JST から From 1500UTC 16 MAR 2013
宮古島 A R S R MIYAKOJIMA ARSR	平成 25 年 3 月 31 日 0000JST から From 1500UTC 30 MAR 2013
男鹿 O R S R OGA ORSR	平成 26 年 12 月 22 日 0000JST から From 1500UTC 21 DEC 2014
奄美 A R S R AMAMI ARSR	平成 27 年 1 月 29 日 0000JST から From 1500UTC 28 JAN 2015
三郡山 A R S R SANGUNZAN ARSR	平成 27 年 2 月 26 日 0000JST から From 1500UTC 25 FEB 2015
釧路 A R S R KUSHIRO ARSR	平成 29 年 3 月 28 日 0000JST から From 1500UTC 27 MAR 2017
八重岳 A R S R YAEDAKE ARSR	令和 2 年 3 月 26 日 0000JST から From 1500UTC 25 MAR 2020
八丈 O R S R HACHIJO ORSR	令和 6 年 8 月 8 日 0000JST から From 1500UTC 7 AUG 2024
横津岳 A R S R YOKOTSUDAKE ARSR	令和 6 年 11 月 28 日 0000JST から From 1500UTC 27 NOV 2024

但し書き：ただし、いわき ORSR については平成 18 年 2 月 8 日から当分の間モード A/3 及びモード C のみにより運用を行っている。
Note : IWAKI ORSR operate using only Mode A/3 and Mode C from 8 FEB 2006 until further notice.

2. SSR モード S 地上レーダーはモード S 用航空交通管制用自動応答装置のみならずモード A/3 及びモード C 用航空交通管制用自動応答装置を装備した航空機も捕捉することが出来る。

3. 以下のモード S 用航空交通管制用自動応答装置は ICAO 標準に適合しないことから SSR モード S 地上レーダーに捕捉されることが出来ず、管制運用に支障をきたす可能性がある。このため、当該航空交通管制用自動応答装置を装備した航空機は当該ブレイティンに基づく改修を実施した後に飛行することを強く要請する。

ハネウェル・ソフトウェア・ブレイティン MST67A-SW2 Rev.4 又はそれ以降の改訂版の適用を受けるハネウェル社製 MST67A モード S 用航空交通管制用自動応答装置であって、当該ブレイティンに基づく改修が未了のもの。

4. 日本において SSR モード S 地上レーダー運用開始後、特定のモード S 航空交通管制用自動応答装置（ロックウェルコリンズ社製 TPR-720 型及び同 TPR-900 型モード S 航空交通管制用自動応答装置）が経年変化により性能が劣化し、モード S 地上レーダーに正常に捕捉されない現象が多数観測されている。このような航空交通管制用自動応答装置を搭載した航空機は管制運用に支障をきたすおそれがある。

5. このため、当該モード S 航空交通管制用自動応答装置を搭載した航空機運航者は、当該装置の電波法第 38 条及び国際民間航空条約第 10 付属書に基づく基準への適合性を常に確保することが強く要求される。したがって、所有する全ての当該装置をロックウェルコリンズ社から平成 17 年 11 月 11 日に発行されたサービス・インフォメーション・レター 05-1（「TPR-720 ATC/MODE S TRANSPONDER」及び「TPR-900 ATC/MODE S TRANSPONDER」）を参照し、少なくとも 2 年ごとに点検すること。

6. CL-600-2B16 航空機とロックウェル・コリンズ社トランスポンダ TDR-94D P/N 622-9210-008 の組み合わせの航空機が福岡 FIR 内を飛行しようとする場合は、事前にボンバルディア社から発行されている SERVICE BULLETIN (SB604-34-054) に基づき必要な措置を講ずること。

2. SSR Mode S ground radar is able to acquire not only the aircraft equipped with a Mode S ATC transponder but also the aircraft equipped with an ATC transponder (Mode A/3 and Mode C).

3. Since the following Mode S transponder doesn't comply with ICAO standard, this transponder is not acquired by SSR Mode S ground radar. As a result, there is a potential threat which the airplane equipped with this transponder prevent air traffic control operation. Therefore, it is strongly recommended that the airplane equipped with this transponder fly after modification in accordance with appropriate Software Bullentin.

Honeywell MST67A Mode S transponders, as listed in Honeywell Software Bulletin No.MST67A-SW2, Revision 4, or later revision, that is not modified per Honeywell Software Bulletin No.MST67A-SW2, Revision 4, or later revision.

4. Since the commencement of SSR Mode S radar operation in Japan, a phenomenon that certain type of Mode S transponder (Rockwell Collins TPR-720 and 900 ATC/Mode S transponder) could not be correctly acquired by SSR Mode S ground radar due to performance degradation with age has been observed many times. There is a potential threat that the aircraft equipped with such transponder hinder air traffic control operation.

5. Therefore all the affected operators are required to secure them to comply at all times with the standards of the Article 38 of the Radio Law of Japan and Annex 10 to the Convention on International Civil Aviation.

Consequently, the operators are requested to perform the recertification test on the affected Mode S transponders no longer than every two years, referring to the Service Infomation Letters 05-1 for "TPR-720 ATC/MODE S TRANSPONDER" and "TPR-900 ATC/MODE S TRANSPONDER" both of which were released from Rockwell Collins Inc. on November 11, 2005.

6. If CL-600-2B16 aircraft equipped with Rockwell Collins TDR94D ATCRBS transponder (P/N622-9210-008) is to fly within Fukuoka FIR, necessary action as specified in SERVICE BULLETIN (SB604-34-054) issued by Bombardier Inc. should be taken in advance.

YAMADA ARSR COVERAGE CHART

Area within a radius of 250nm of YAMADA ARSR
(35°46'46"N/140°31'38"E)

IWAKI ORSR COVERAGE CHART

Area within a radius of 250nm of IWAKI ORSR
(37°06'43"N/140°47'44"E)

MIKUNISAN ARSR COVERAGE CHART

Area within a radius of 250nm of MIKUNISAN ARSR
(34°21'47"N/135°29'07"E)

JOBONZAN ARSR COVERAGE CHART

Area within a radius of 250nm of JOBONZAN ARSR
(38°30'03"N/141°21'31"E)

HACHINOHE ARSR COVERAGE CHART

Area within a radius of 250nm of HACHINOHE ARSR
(40°30'03"N/141°35'28"E)

KASEDA ARSR COVERAGE CHART

Area within a radius of 250nm of KASEDA ARSR
(31°22'50"N/130°16'02"E)

FUKUE ORSR COVERAGE CHART

Area within a radius of 250nm of FUKUE ORSR
(32°36'54"N/128°42'44"E)

MIKAWA ARSR COVERAGE CHART

Area within a radius of 250nm of MIKAWA ARSR
(34°52'07"N/137°12'55"E)

KUMEJIMA ORSR COVERAGE CHART

Area within a radius of 250nm of KUMEJIMA ORSR
(26°22'32"N/126°46'46"E)

YOKOTSUDAKE ARSR COVERAGE CHART

Area within a radius of 250nm of YOKOTSUDAKE ARSR
(41°56'16"N/140°46'17"E)

HAKONE ARSR COVERAGE CHART

Area within a radius of 250nm of HAKONE ARSR
(35°10'46"N/139°03'54"E)

NOTO ARSR COVERAGE CHART

Area within a radius of 250nm of NOTO ARSR
(37°17'45"N/136°57'17"E)

MIYAKOJIMA ARSR COVERAGE CHART

Area within a radius of 250nm of MIYAKOJIMA ARSR
(24°47'19"N/125°17'42"E)

OGA ORSR COVERAGE CHART

Area within a radius of 250nm of OGA ORSR
(39°58'40"N/139°42'35"E)

AMAMI ARSR COVERAGE CHART

Area within a radius of 250nm of AMAMI ARSR
(28°24'57"N/129°34'14"E)

SANGUNZAN ARSR COVERAGE CHART

Area within a radius of 250nm of SANGUNZAN ARSR
(33°33'20"N/130°35'00"E)

KUSHIRO ARSR COVERAGE CHART

Area within a radius of 250nm of KUSHIRO ARSR
(43°01'42"N/144°33'14"E)

YAEDAKE ARSR COVERAGE CHART

Area within a radius of 250nm of YAEDAKE ARSR
(26°38'11"N/127°55'45"E)

HACHIJO ORSR COVERAGE CHART

Area within a radius of 250nm of HACHIJO ORSR
(33°04'45"N/139°48'54"E)



測量法に基づく(国土地理院長承認(使用) R 6JHs 299

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

010/25

仙台空港におけるマルチラレーションの評価運用について

令和 11 年 3 月 31 日 2400JST まで、仙台空港におけるマルチラレーションの評価運用が以下のとおり実施される。

■ なお、本航空情報サーキュラー発行と同時に令和 3 年 2 月 25 日付 AIC NR005/21 を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. マルチラレーションシステムについて

AIP AD 1.1.6.11.1 を参照のこと。

2. 評価目的

新方式マルチラレーションシステム研究開発のための評価運用を行う。

3. 対象航空機

仙台空港内を自走するモード S トランスポンダ搭載機。

4. 操縦士のとるべき措置

AIP AD 1.1.6.11.2 に従って行うこと。

5. トランスポンダ応答の中止について

評価中に、空港面上からのトランスポンダ応答に起因する管制運用への影響が生じた場合は、航空機に対して以下のとおり通報される。

1) 管制官は、当該機に対し直ちにトランスポンダ応答の中止を指示する。

・ 不具合機が特定可能な場合
“(Call sign), STOP SQUAWK.”

・ 不具合機の特定が不可能な場合
“All Stations on the ground, stop squawk immediately.”

2) 評価中止及び地上でのトランスポンダ応答の中止が ATIS により放送される。

“Multi-Lateration trials are suspended.
Stop squawking on the ground.”

6. 問い合わせ窓口

国土交通省航空局交通管制部
管制技術課航行支援技術高度化企画室
電話：03-5253-8742

010/25

The trial of Multi-Lateration at Sendai AP/RJSS

■ Until 1500UTC 31 MAR 2029, the trial of Multi-Lateration is conducted at Sendai AP/RJSS as follows.

■ This AIC supersedes AIC NR005/21 dated 25 FEB 2021.

New information and changes are indicated by bold vertical lines.

1. Multi-Lateration system

See AIP AD 1.1.6.11.1

2. Objectives of the trial

The objective of the operational evaluation is to conduct the research and development of new type of Multi-Lateration system.

3. Applicable aircraft

Aircraft equipped with a Mode S transponder, taxiing on the maneuvering area of Sendai Airport.

4. The action that pilots should take

As AIP AD 1.1.6.11.2

5. Suspension of the trial

In the middle of the evaluation, if transponder responses by aircraft on the surface of the aerodrome impact ATC operation, ATC report to pilots as follows.

1) Controllers instruct pilots the suspension of the transponder response immediately.

・ When the aircraft in trouble is specified;
“(Call sign), STOP SQUAWK.”

・ When the aircraft in trouble is not specified;
“All Stations on the ground, stop squawk immediately.”

2) The suspension of the trial and transponder responses on the ground is broadcasted by ATIS.

“Multi-Lateration trials are suspended.
Stop squawking on the ground.”

6. For further information

CNS Planning Office, Air Navigation Services Engineering Division,
Air Navigation Services Department, Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism.
TEL : +81-3-5253-8742

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

011/25

飛行場等の周辺を有視界飛行方式により飛行する場合の安全対策について

本航空情報サーキュラー発行と同時に、令和4年10月6日付航空情報サーキュラー NR027/22 を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 飛行場、場外離着陸場又は、滑空場（以下「飛行場等」という。）の周辺を有視界飛行方式により飛行する場合には、他機との衝突防止のため、無線電話により自機の位置や進路等を飛行場等の管制機関等に通報するとともに、他機の交通情報を入手するよう努め、見張りを十分に行うことが重要である。

2. 飛行場管制業務が実施されている飛行場及び飛行場対空援助業務が実施されている飛行場において行われる無線電話による航空交通情報等の授受の要領は、AIP に記載のとおりである。

3. 飛行援助用航空局が運用されている飛行場等有視界飛行方式により飛行する航空機が着陸その他の目的で飛行場等の付近を飛行しようとするときは、現在位置、高度、機長の意向及びその他必要な事項を飛行援助用航空局に通報し、航空交通情報等に関する必要な情報を取得するよう努めること。
なお、飛行援助用航空局は、当該飛行場等の航空交通状況により運用されていないことがあるが、当該航空局からの応答がない場合であっても、自機の位置等について一方送信を行うことが望ましい。

注 1: AIP に記載される調布飛行場、但馬飛行場、岡南飛行場、天草飛行場、東京ヘリポート及び福岡空港(奈多地区)の他、飛行援助用航空局が設置されている飛行場等を別添に掲げる。飛行援助用航空局は、日本国内の全てが記載されているのではなく、通常、任意の提供が可能とされるものについて記載している。

注 2: 別添において示す範囲及び高度は、当該飛行援助用航空局が、通常、航空交通情報等を提供しているものである。航空交通管制圏又は航空交通情報圏と重複している空域においては、上記 2 によること。

注 3: 当該飛行場等が民間訓練試験空域内に位置する場合、連絡及び情報の聴取については、AIP に記載のとおりである。

注 4: 別添における滑空場の位置等については、AIP ENR5.5 に記載のとおりである。

011/25

Measures for the safety of VFR flight in the vicinity of aerodrome

This AIC supersedes AIC NR 027/22 dated 6 OCT 2022.

New information and changes are indicated by bold vertical lines.

1. To avoid mid-air collision in VFR flight in the vicinity of aerodromes, landing sites with special permission or glider sites (hereinafter in this AIC referred to as "an aerodrome and the like") it is important for a pilot to maintain a watch outside and to report his information such as position and course, and also to endeavor to obtain information of other traffic by radiotelephony with units such as air traffic control services.

2. The procedures for reporting and receiving of air traffic information by radiotelephony at aerodromes where aerodrome control service or AFIS (Aerodrome Flight Information Service) is provided are indicated in AIP.

3. At an aerodrome and the like where flight advisory service station is operated
When VFR flight is made in the vicinity of an aerodromes and the like for landing or other purposes, the pilot is recommended to report his present position, altitude, his intentions and other necessary items to the flight advisory service station.
Flight advisory service station is operated for its convenience.
If there is no answer from flight advisory service station, the pilot is recommended to transmit his information.

Note 1: In addition to CHOFU(RJTF), TAJIMA(RJBT), KOHNAN(RJBK), AMAKUSA(RJDA), TOKYO HELIPORT(RJTI) and NATA HELIPORT(RJFH), which are indicated in AIP, aerodromes and the like where flight advisory service station is usually operated are shown in the attachment. The listed stations are usually providing traffic information on a voluntary basis, and are not exclusive.

Note 2: Each station usually provides traffic information etc. in the radius and altitude shown in the attachment. When the airspace of the station is overlapping with control zone or information zone, the procedures of radio contact and monitor of information are shown in item 2 above.

Note 3: If aerodromes and the like are located within civil training and testing area, the procedures of radio contact and monitor of information are indicated in AIP.

Note 4: The position of glider sites, etc. are indicated in AIP ENR5.5.

Call sign 呼び出し符号	*[設置場所（所在地）]	FREQ 周波数	Area, ALT 範囲、高度	Phone 電話 *[連絡先]
BIEI FLIGHT SERVICE	[美瑛町滑空場 (北海道 上川郡 美瑛町)]	130.8MHz	5NM, below 3000FT	0166-92-0637 [美瑛航空協会]
TOHMA FLIGHT SERVICE	[当麻滑空場 (北海道 上川郡 当麻町)]	130.675MHz	5NM, below 5500FT	090-1641-9150 [旭川航空協会]
BETSUKAI FLIGHT SERVICE	[別海フライトパーク (北海道 野付郡 別海町)]	130.775MHz	5NM, below 3000FT	0153-77-3377 [別海フライトパーク 鳥になりたい会]
TAKIKAWA FLIGHT SERVICE	[たきかわスカイパーク (北海道 滝川市)]	130.65MHz	10NM, below 10000FT	0125-24-3255 [公益社団法人 滝川スカイスports 振興協会]
KITAMI FLIGHT SERVICE	[北見地区農道離着陸場 (北海道 北見市)]	130.75MHz	5NM, below 5000FT	0157-35-3400 [NPO 法人 エアロスportsきたみ]
SHIKABE FLIGHT SERVICE	[鹿部飛行場 (北海道 茅部郡 鹿部町)]	129.80MHz	5NM, below 3000FT	01372-7-3388 [朝日航空株式会社]
BIBAI FLIGHT SERVICE	[美唄市農道離着陸場 (北海道 美唄市)]	130.75MHz	5NM, below 3000FT	0126-65-4848 [美唄スカイパーク (Petair 合同会社)]
SHINSHINOTSU FLIGHT SERVICE	[新篠津滑空場 (北海道 石狩郡 新篠津村)]	130.675MHz	5NM, below 3000FT	080-6083-6302 [札幌航空協会]
KAKUDA FLIGHT SERVICE	[角田滑空場 (宮城県 角田市)]	130.80MHz	5NM, below 3000FT	022-294-1850 [公益社団法人 宮城県航空協会]
FUKUSHIMA FLIGHT SERVICE	[福島県飯坂地区農道離着陸場 (福島県 福島市)]	130.675MHz	5NM, below 3000FT	024-558-6880 [NPO 法人 ふくしま飛行協会]
TOCHIGI FLIGHT SERVICE	[栃木ヘリポート (栃木県 芳賀郡 芳賀町)]	130.8MHz	5NM, below 3000FT	028-677-4545 [栃木ヘリポート]
KINUGAWA FLIGHT SERVICE	[鬼怒川滑空場 (栃木県 宇都宮市)]	130.625MHz	5NM, below 3500FT	028-649-5072 [国立大学法人 宇都宮大学]
OHTONE FLIGHT SERVICE	[大利根場外離着陸場 (茨城県 稲敷郡 河内町)]	130.7MHz	5NM, below 3000FT	0297-86-8860 [一般社団法人 日本飛行連盟]
SHIMOZUMA FLIGHT SERVICE	[前山下妻ヘリポート (茨城県 下妻市)]	130.625MHz	5NM, below 3000FT	0297-36-8003 [前山倉庫株式会社 総務部]
RYUGASAKI FLIGHT SERVICE	[竜ヶ崎飛行場 (茨城県 竜ヶ崎市)]	129.9MHz	5NM, below 3000FT	0297-62-1271 [新中央航空株式会社]
GUNMA FLIGHT SERVICE	[群馬ヘリポート (群馬県 前橋市)]	130.775MHz	5NM, below 3000FT	027-265-0100 [群馬ヘリポート 管理事務所]
ITAKURA FLIGHT SERVICE	[板倉滑空場 (群馬県 邑楽郡 板倉町)]	130.675MHz	5NM, below 5000FT	0276-77-0830 [公益社団法人 日本グライダークラブ]
SEKIYADO FLIGHT SERVICE	[関宿滑空場 (千葉県 野田市)]	130.65MHz	5NM, EAST of Tone river below 4000FT WEST of Tone river below 6000FT	04-7198-1401 [NPO 法人 関宿滑空場]
(Blank)				

Call sign 呼び出し符号	*[設置場所 (所在地)]	FREQ 周波数	Area, ALT 範囲、高度	Phone 電話 *[連絡先]
OKEGAWA ADVISORY	[ホンダエアポート (埼玉県比企郡川島町)]	130.75MHz	5NM, below 3000FT	049-299-1115 [本田航空株式会社 運航管理課]
HANYU FLIGHT SERVICE	[羽生滑空場 (埼玉県羽生市)]	130.725MHz	5NM, below 3000FT	050-5849-8178 [NPO 法人 羽生ソアリングクラブ]
MENUMA FLIGHT SERVICE	[妻沼滑空場 (埼玉県熊谷市)]	130.5MHz	5NM, below 3000FT	03-6206-1235 [公益財団法人 日本学生航空連盟]
KAZO FLIGHT SERVICE	[読売加須滑空場 (埼玉県加須市)]	130.775MHz	5NM, below 3000FT	0480-48-6655 [NPO 法人学生航空連盟]
KASUMIGASEKI FLIGHT SERVICE	[中央合同庁舎 第2号館ヘリポート (東京都千代田区)]	130.625MHz	5NM, below 3000FT	03-5253-5147 [総務省大臣官房 会計課庁舎管理室]
NAGANO FLIGHT SERVICE	[長野市滑空場 (長野県長野市)]	130.65MHz	5NM, below 4000FT	026-282-3171 [公益社団法人 長野グライダー協会]
KIRIGAMINE FLIGHT SERVICE	[霧ヶ峰滑空場 (長野県諏訪市)]	130.625MHz	5NM, below 10000FT	080-5143-2434 [諏訪市グライダー協会]
FUTABA FLIGHT SERVICE	[日本航空学園 双葉場外離着陸場 (山梨県甲斐市)]	130.8MHz	5NM, below 4000FT	0551-28-3355 ext.298 [学校法人 日本航空学園]
SHIZUOKA FLIGHT SERVICE	[静岡ヘリポート (静岡県静岡市葵区)]	130.65MHz	3NM, below 3000FT	054-265-5500 [静岡ヘリポート]
FUJIKAWA FLIGHT SERVICE	[富士川滑空場 (静岡県静岡市清水区)]	130.775MHz	5NM, below 3000FT	0545-34-0822 [一般社団法人 静岡県航空協会]
HAMAKITA FLIGHT SERVICE	[天竜川浜北滑空場 (静岡県浜松市)]	130.675MHz	5NM, below 3000FT	050-5891-6369 [浜北スカイスports連盟]
OKAZAKI FLIGHT SERVICE	[岡崎滑空場 (愛知県岡崎市)]	130.775MHz	5NM, below 4500FT	070-8372-8401 [中部日本航空連盟 愛知支部]
HIDA FLIGHT SERVICE	[飛騨農道離着陸場 (岐阜県高山市)]	130.75MHz	5NM, below 5000FT	0577-78-2500 [一般社団法人 飛騨エアパーク協会]
OHNO FLIGHT SERVICE	[大野滑空場 (岐阜県揖斐郡大野町)]	130.65MHz	5NM, below 3000FT	090-1236-1731 [大野滑空場 管理運営委員会]
HINO FLIGHT SERVICE	[大阪航空日野ヘリポート (滋賀県蒲生郡日野町)]	129.0MHz	5NM, below 3000FT	0748-53-2310 [大阪航空株式会社 滋賀事業所]
OSAKA FLIGHT SERVICE	[大阪ヘリポート (大阪府大阪市)]	130.8MHz	5NM, below 1500FT	06-4804-1333 [小川航空株式会社 運航部]
HIROSHIMA FLIGHT SERVICE	[広島ヘリポート (広島県広島市西区)]	130.65MHz	5NM, below 3000FT	082-295-2650 [広島ヘリポート 管理事務所]
ASOJOGAI	[阿蘇場外離着陸場 (熊本県阿蘇市)]	130.75MHz	5NM, below 6000FT	090-4360-6631 [農事組合法人 山田東部牧場]
OITA KENOU FLIGHT SERVICE	[大分県央飛行場 (大分県豊後大野市)]	130.80MHz	5NM, below 4000FT	0974-34-4411 [大分県央飛行場 管理事務所]

Call sign 呼び出し符号	*[設置場所 (所在地)]	FREQ 周波数	Area, ALT 範囲、高度	Phone 電話 *[連絡先]
KUJU FLIGHT SERVICE	[久住滑空場 (大分県竹田市)]	130.625MHz	5NM, below 7000FT	03-6206-1235 [公益財団法人 日本学生航空連盟]

Remarks: * [] : Japanese only

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

020/25

遭難追跡装置等の装備義務化について

本航空情報サーキュラーは、遭難追跡装置等の装備義務化に係る概要、Location of an Aircraft in Distress Repository (LADR) への登録方法及び経過措置を周知するものである。

本航空情報サーキュラー発行と同時に令和 6 年 12 月 26 日付 AIC NR031/24 を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 概要

令和 6 年 11 月 8 日に航空法施行規則の一部を改正する省令が公布され、航空運送事業の用に供する最大離陸重量が 27,000kg を超える飛行機であって、最初の耐空証明等が令和 6 年 1 月 1 日以後になされたものは、航行中に通常では想定されない速度・姿勢・降下率等を検知した場合に毎分 1 回以上、航空機の位置を自動で送信する機能を有する遭難追跡装置又は衝撃により自動的に作動する航空機用救命無線機であってこれと同等以上の機能を有するもの（以下「遭難追跡装置等」という。）の装備が令和 7 年 1 月 1 日以降に義務化される。

また、遭難追跡装置等を装備する航空機を運航する航空運送事業者は、遭難追跡装置等から送信された航空機の位置を受信するため、事前に LADR(*) に登録する必要がある。

(*)LADR: 遭難した飛行機の位置に関連する全ての情報を保存し、利用可能にする手段を提供するシステム。

2. LADR への登録方法

LADR を利用するためには、以下の情報を aircrafttracking@icao.int 宛にメールで送付し、Focal Point（運航者の管理アカウント）を登録すること。

- ・ Focal Point の氏名
- ・ Focal Point のメールアドレス
- ・ 運航者の 3 文字略号
- ・ 運航者電話略号
- ・ 運航者名

3. 遭難追跡装置等の装備義務化に係る経過措置

「航空法施行規則第百五十条第四項の規定により同項に規定する遭難追跡装置又は航空機用救命無線機を装備しなければならない飛行機であって、技術上の理由その他のやむを得ない理由により同項に規定する遭難追跡装置又は航空機用救命無線機を装備することが困難な型式のもの及び当該飛行機が、同項の規定にかかわらず、同項に規定する遭難追跡装置又は航空機用救命無線機を装備しなくてよい期間を指定する告示」に規定する以下の型式の飛行機については令和 7 年 1 月 1 日から令和 7 年 8 月 31 日までの間、遭難追跡装置等を装備しなくてよい。

- ・ エアバス式 A320-251N 型
- ・ エンブラエル式 ERJ190-300 型、ERJ190-400 型

020/25

Requirement to equip Autonomous Distress Tracking Devices

This AIC provides the following information.

- Summary of the requirement to equip Autonomous Distress Tracking Devices
- Register for Location of an Aircraft in Distress Repository (LADR)
- Transitional measures for the installation of ADT Devices

This AIC supersedes AIC NR031/24 dated 26 DEC 2024.

New information and changes are indicated by bold vertical lines.

1. Summary:

The ministerial order amending the Civil Aeronautics Law Enforcement Regulations was issued on 8 November 2024.

The order mandates that the airplanes used for air transport services whose maximum certificated take-off mass is over 27,000 kg and to which the certificate of airworthiness was first issued on or after 1 January 2024 shall be equipped with Autonomous Distress Tracking Device or Automatic Emergency Locator Transmitter with equivalent function (hereinafter referred to as "ADT Devices") as of 1 January 2025.

The ADT Devices shall be capable of automatically transmitting aircraft position at least once every minute when it detects unusual speed, attitude, descent rate, etc. during flight.

In addition, air carriers operating aircraft equipped with ADT Devices should register for the LADR(*) in advance to receive position information transmitted from the ADT Devices.

(*) LADR is a system that provides the means to store and make available all information related to the position of an aircraft in distress.

2. Registration with LADR:

Operators need to register its Focal Point with LADR by sending an e-mail to "aircrafttracking@icao.int" with the following information.

- Full name of Focal Point
- Email address of Focal Point
- 3-letter designator(s) in use by the operator
- Telephony designator(s) in use by the operator
- Operator name

3. Transitional measures for the installation of ADT Devices:

The following types of aircraft which found difficult to equip ADT Devices for technical reasons by 1 January 2025 are not necessary to be equipped with ADT Devices from 1 January 2025 to 31 August 2025 in accordance with the Public Notice of the Ministry of Land, Infrastructure and Transport.

- Airbus A320-251N
- Embraer ERJ 190-300, ERJ 190-400

以下の型式の飛行機については、令和 7 年 1 月 1 日から令和 8 年 6 月 30 日までの間、遭難追跡装置等を装備しなくてよい。

・ボーイング式 737-8 型、737-8200 型、737-9 型、
767-300F 型、777-200LR 型、777-300ER 型、777F 型、
787-8 型、787-9 型、787-10 型

The following types of aircraft are not necessary to be equipped with ADT Devices from 1 January 2025 to 30 June 2026.

• Boeing 737-8, 737-8200, 737-9, 767-300F, 777-200LR, 777-300ER, 777F, 787-8, 787-9, 787-10

4. 問い合わせ先

国土交通省航空局安全部安全政策課

電話 : 03-5253-8737

FAX : 03-5253-1661

E-mail: hqt-unkoukijyun2@gxb.mlit.go.jp

4. For further information:

Flight Standards Division, Aviation Safety and Security
Department, Civil Aviation Bureau, Ministry of Land,
Infrastructure, Transport and Tourism

TEL: +81-3-5253-8737

FAX: +81-3-5253-1661

E-mail: hqt-unkoukijyun2@gxb.mlit.go.jp

021/25

空港使用に係る同意書及び運航者撤去作業計画の提出について

航空機が航空機移動区域又はその付近において航行不能となった場合に当該機の撤去作業を的確に実施するため、かつ、空港の機能を早期に回復するため、航空機の使用者は、各空港管理者（空港運営権者及び公共用ヘリポート管理者を含む。以下、本サーキュラーにおいて同じ。）から、空港使用の届出の際に空港使用にかかる同意書及び撤去作業の分類に応じた運航者撤去作業計画の提出を求められる。

1. 定義

- (1)「航行不能航空機」とは、航空機移動区域又はその付近において航行不能となった航空機をいう。
- (2)「航行不能航空機の撤去」とは、航行不能航空機の状態に応じて、以下のとおり分類する撤去作業をいう。
- a. 航空機移動作業（デバッグ：Aircraft debogging）：
航空機の損傷が比較的軽微である場合又は損傷が全くない状態で、滑走路又は誘導路等で航空機が動けなくなった状態や滑走路又は誘導路等から航空機が逸脱した状態における航空機の移動作業。
 - b. 航空機回収作業（リカバリー：Aircraft recovery）：
航空機の損傷等により、牽引車及び牽引バーの使用による移動ができない状態における航空機の回収作業。
 - c. 航空機機体撤去作業（サルベージ：Aircraft salvage）：
航空事故等により航空機が重大な損傷を受け、機体が全損したとみなされる状態における航空機の撤去作業。
- (3)「運航者撤去作業計画」とは、航空機の型式に応じて、運航者等が航行不能航空機を撤去するための準備及び撤去作業に係る具体的計画をいう。

2. 適用空港及びヘリポート

日本のすべての空港及び公共用ヘリポート

3. 対象となる航空機の使用者

次の者を除く、外国運航者を含むすべての航空機の使用者

- ・自衛隊（自衛隊より新造機製造又は自衛隊が所有する航空機の整備作業等を受託して当該航空機を運航する場合にあっては、当該受託者を含む。）
- ・軍
- ・国の行政機関から便宜供与依頼があった航空機の使用者（便宜供与依頼のあった飛行及び当該飛行に関する一連の飛行に限る。）

021/25

Regarding submission of consent form for conditions for the use of airports/heliports and aircraft operator's disabled aircraft removal operation plan

In order to accurately carry out removal operations in the event that an aircraft becomes disabled on or near the movement area, and in order to restore airport functions as quickly as possible, the aircraft operators shall be requested to submit each airport's/heliport's use consent form and aircraft operator's disabled aircraft removal operation plan for the removal operation category at the time of notification of use of the airport/heliport from each airport/heliport administrators (including the Operating Right Holder of a National Airport, the same shall apply hereinafter in this AIC).

1. Definition

- 1) "Disabled aircraft" means an aircraft disabled on or near to the movement area.
- 2) "Removal of disabled aircraft" means the process involving aircraft debogging, aircraft recovery or aircraft salvage.
- a. "Aircraft debogging" means the removal of an aircraft following an aircraft excursion event where the aircraft has become bogged down but has relatively little or no damage.
 - b. "Aircraft recovery" means the removal of any disabled aircraft that is unable to move under its own power or through the standard towing procedures specified in the aircraft type documentation.
 - c. "Aircraft salvage" means the removal of any aircraft following an accident or incident in which the aircraft sustains substantial damage, and the insurer considers the hull a total loss.
- 3) "Aircraft operator's disabled aircraft removal operation plan" means a specific plan for the preparation and removal operations for the aircraft operator to remove disabled aircraft, depending on the type of aircraft.

2. Applied Airports/Heliports

All airports and public heliports in JAPAN

3. Aircraft operators subject to submission

All aircraft operators, including foreign aircraft operators, except for the following.

- ・ JAPAN Self-Defense Forces (JSDF) (including in cases where contracted aircraft operators operate an aircraft under contract with the JSDF for the manufacture of new aircraft or for maintenance work, etc., of aircraft owned by the JSDF).
- ・ Military
- ・ Aircraft operators that have received a Provision of Facilities of Flights from the national administration (only these flights and limited to a series).

4. 航空機の利用者がとるべき措置

(1) 航空機の利用者は、空港利用の届出の際に「空港利用にかかる同意書」及び「運航者撤去作業計画」を作成し、使用する空港の各空港管理者に提出すること。また、作成に当たっては、各空港管理者に記載事項や提出方法等を確認すること。

(2) 航空機の利用者は、目的地変更先として通常想定する空港の空港管理者に対しても事前に「空港利用にかかる同意書」及び「運航者撤去作業計画」を作成し、当該空港管理者に提出すること。また、作成に当たっては、各空港管理者に記載事項や提出方法等を確認すること。

(3) 航空機の利用者は、飛行中、緊急着陸等のため目的地変更先として通常想定していない空港を使用することとなった場合は、着陸後に速やかに提出すること。

5. その他

空港管理者から、空港管理に必要な条件として「空港利用にかかる同意書」及び「運航者撤去作業計画」の提出を附される場合がある。

6. 問い合わせ先窓口

国土交通省航空局安全部
安全政策課空港安全室
TEL : 03-5253-8111 (内線 49556 or 49553)
E-mail: hqt-contact.kukoanzen04@gxb.mlit.go.jp

4.Action to be taken by aircraft operator

1) The aircraft operator shall prepare a "consent form for conditions for the use of airports/heliports" and "aircraft operator's disabled aircraft removal operation plan" at the time of notification of airport use, and submit them to the respective airport/heliport administrators of the airport to be used.

In addition, when preparing the forms, the aircraft operator shall confirm the items to be included and the method of submission with the respective airport/heliport administrator.

2) The aircraft operator shall also prepare and submit a "consent form for conditions for the use of airports/heliports" and an "aircraft operator's disabled aircraft removal operation plan" in advance to the administrator of the airport/heliport that is normally assumed to be an alternative airport/heliport. In addition, when preparing the forms, the aircraft operator shall confirm the items to be included and the method of submission with the respective airport/heliport administrator.

3) If, during the flight, the aircraft operator decides to use an airport not normally assumed to be an alternative airport/heliport due to an emergency landing, etc., the aircraft operator shall submit a "consent form for conditions for the use of airports/heliports" and an "aircraft operator's disabled aircraft removal operation plan" after landing.

5.Others

The airport/heliport administrator may require the submission of a "consent form for conditions for the use of airports/heliports" and an "aircraft operator's disabled aircraft removal operation plan" as a condition necessary for airport/heliport management.

6.Contact authority

Airport Safety Office, Flight Standards Division,
Aviation Safety and Security Department,
Civil Aviation Bureau,
Ministry of Land, Infrastructure, Transport and Tourism
TEL:+81-3-5253-8111(ex 49556 or 49553)
E-mail: hqt-contact.kukoanzen04@gxb.mlit.go.jp

024/25

航空法施行規則第 153 条の補足について

本サーキュラーは、航空法施行規則第 153 条の規定について、補足するものである。

本航空情報サーキュラー発行と同時に平成 21 年 8 月 27 日付航空情報サーキュラー NR036/09 を取り消す。

また、新情報及び変更部は太い縦線により表示される。

1. 航空法施行規則第 153 条の表区分 6 (計器飛行方式により飛行しようとする飛行機 (航空運送事業の用に供するものを除く。)) の「代替飛行場を飛行計画に表示しないもの」とは、次に掲げる条件が満たされている場合において、代替飛行場を飛行計画に表示しない飛行機をいう。

(1) 着陸地に計器進入方式が設定されていること

(2) 着陸地の到着予定時刻の前後それぞれ 2 時間の間 (飛行時間が 2 時間未満の場合は出発時刻から到着予定時刻の 2 時間後までの間)、次に掲げる気象条件が確保されることが、利用可能な気象情報により示されること

a. 雲高が、当該機に適用可能な計器進入方式の進入限界高度として定められた最小の高度より少なくとも 300m 高いこと

b. 視程が、当該機に適用可能な計器進入方式の最低気象条件として定められた最小の値より少なくとも 4,000m 以上上回る値を示すこと、又は 5,500m 以上の値を示すこと

2. 航空法施行規則第 153 条の表区分 7 (計器飛行方式により飛行しようとする回転翼航空機 (航空運送事業の用に供するものを除く。)) の「代替飛行場を飛行計画に表示しないもの」とは、次に掲げるいずれかの場合において、代替飛行場を飛行計画に表示しない回転翼航空機をいう。

(1) 次に掲げる条件が満たされている場合

a. 着陸地に計器進入方式が設定されていること

b. 着陸地の到着予定時刻の前後それぞれ 2 時間の間 (飛行時間が 2 時間未満の場合は出発時刻から到着予定時刻の 2 時間後までの間)、次に掲げる気象条件が確保されることが、利用可能な気象情報により示される場合

i) 雲高が、当該機に適用可能な計器進入方式の進入限界高度として定められた最小の高度より少なくとも 120m 高いこと

ii) 視程が、当該機に適用可能な計器進入方式の最低気象条件として定められた最小の値より少なくとも 1,500m 以上上回る値を示すこと

(2) 次に掲げる条件が満たされている場合

a. 着陸地が孤立しており代替飛行場に適した飛行場がないこと

b. 着陸地に計器進入方式が設定されていること

c. 着陸地が洋上の場合にあつては、不帰投点 (PNR) が設定されていること

024/25

Supplement to Article 153 of Civil Aeronautics Regulations of Japan

This AIC is to provide a supplementary explanation concerning Article 153 of Civil Aeronautics Regulations of Japan.

This AIC supersedes AIC NR036/09 dated 27 AUG 2009.

New information and changes are indicated by bold vertical lines.

1. In the sixth column of the Table of Article 153 which describes for an airplane (except in case of using for air transportation service) that intends to conduct a flight in accordance with instrument flight rules, "An airplane that shows no alternate aerodrome on its flight plan" means an airplane that shows no alternate aerodrome on its flight plan when following conditions are satisfied.

(1) an instrument approach procedure is prescribed for the aerodrome of intended landing; and

(2) available current meteorological information indicates that following meteorological conditions will exist from two hours before to two hours after the estimated time of arrival: or from the actual time of departure to two hours after the estimated time of arrival, whichever is the shorter period:

a. the ceiling of at least 300m above the lowest applicable minimum associated with the instrument approach procedure; and

b. visibility of at least 5,500m or of 4,000m more than the lowest applicable minimum associated with the procedure.

2. In the seventh column of the Table of Article 153 which describes for an airplane (except in case of using for air transportation service) that intends to conduct a flight in accordance with instrument flight rules, "A rotorcraft that shows no alternate aerodrome on its flight plan" means a rotorcraft that shows no alternate aerodrome on its flight plan when following conditions are satisfied.

(1) following conditions are satisfied:

a. an instrument approach procedure is prescribed for the aerodrome of intended landing; and

b. available current meteorological information indicates that following meteorological conditions will exist from two hours before to two hours after the estimated time of arrival: or from the actual time of departure to two hours after the estimated time of arrival, whichever is the shorter period:

i) the ceiling of at least 120m above the lowest applicable minimum associated with the instrument approach procedure; and

ii) visibility of at least 1,500m more than the lowest applicable minimum associated with the procedure.

or

(2) following conditions are satisfied:

a. the aerodrome of intended landing is isolated and no suitable alternate aerodrome is available; and

b. an instrument approach procedure is prescribed for the aerodrome of intended landing; and

c. a point of no return (PNR) is determined in case of an off-shore destination.

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU

AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 025/25
30 OCT 2025

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

025/25

成田国際空港における誘導路誤進入防止について

- 1. 付図に示すとおり、廃止された誘導路及び新設誘導路の形状が視認できる状態にあるので、航空機は当該誘導路に進入しないように注意すること。
■ 本航空情報サーキュラーは、令和 7 年 10 月 30 日 0000JST から適用される。
■ なお、同日時をもって令和 3 年 7 月 15 日付 AIC NR019/21 を取り消す。
また、新情報及び変更部は太い縦線により表示される。
2. 備考：
 - (1) 廃止された誘導路（誘導路 S2 と誘導路 S4 の間）は緑色に塗装される。（付図 1 参照）
 - (2) 廃止された誘導路（誘導路 B4 と誘導路 B5 の間）には禁止標識、禁止区域灯が設置され、緑色に塗装される。（付図 2 参照）
 - (3) 廃止された誘導路（誘導路 B6 と誘導路 B8 の間）には、禁止標識が設置され、緑色に塗装される。（付図 3 参照）
 - (4) 新設誘導路には禁止標識、禁止区域灯が設置される。（付図 4 参照）
 - (5) 新設誘導路の供用開始については、追って航空路誌改訂版によって通知される。

025/25

Prevention of TWY incursion at Narita INTL AP/ RJAA

- 1. The figures of the abolished TWY and the new TWY are visible as shown in ATTACHMENT. Accordingly, aircraft should pay special attention not to enter those TWYs.
■ This AIC will be effective from 1500UTC 29 OCT 2025, and will supersede AIC NR019/21 dated 15 JUL 2021 at the same time. New information and changes are indicated by bold vertical lines.
2. Remarks:
 - 1) Artificial turf marking is installed on the abolished TWY, between TWY S2 and TWY S4. (See Figure 1)
 - 2) Closed marking, unserviceability LGT and artificial turf marking are installed on the abolished TWY, between TWY B4 and TWY B5. (See Figure 2)
 - 3) Closed marking and artificial turf marking are installed on the abolished TWY, between TWY B6 and TWY B8. (See Figure 3)
 - 4) Closed marking and unserviceability LGT are installed on the new TWY. (See Figure 4)
 - 5) Commencement of operating the new TWY will be notified by further AIP AMDT.

Figure2

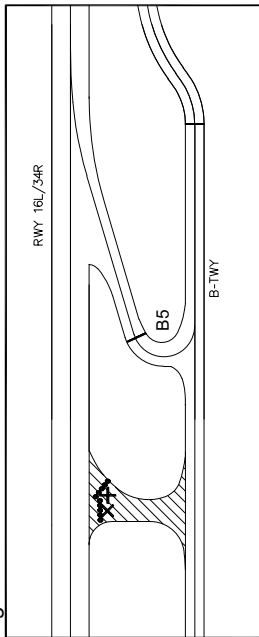


Figure3

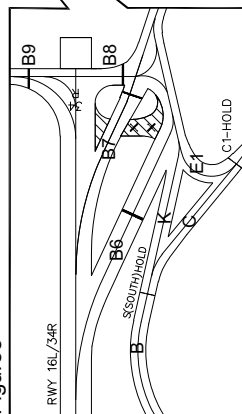


Figure1


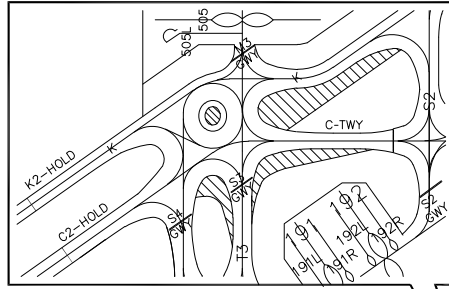


Figure4

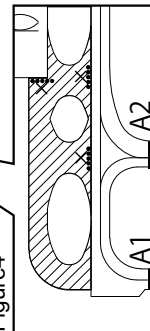

- ✕ CLOSED MARKING
- UNSERVICEABILITY LGT
- ▨ ARTIFICIAL TURF MARKING
- ▨ UNDER CONSTRUCTION TWY

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN
MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 028/25
27 NOV 2025

028/25
宮城 VOR/DME (MGE) の試験電波発射について

令和 7 年 12 月 25 日 0000JST から令和 8 年 7 月 8 日 2400JST
まで宮城 VOR/DME (MGE) において、次のとおり試験電波が発射
される。誤表示の可能性があり使用してはならない。供用開始日
時は追って通知される。

028/25
**Emitting of test signal from Miyagi VOR/DME
(MGE)**

From 1500UTC 24 DEC 2025 to 1500UTC 8 JUL 2026, test
signal will be emitted from Miyagi VOR/DME (MGE). Do not use.
False indications possible. Commencing date and time of the
official operation will be notified afterward.

名称 Name	宮城 VOR/DME Miyagi VOR/DME	
周波数 Frequency	CH-97X	VOR 115.0MHz DME 1184MHz
出力 Power	VOR 200W DME 3kW	
識別符号 ID	MGE	
試験電波発射時間 (UTC) Hours of emitting test signal (UTC)	H24	
位置 Coordinates	VOR : 380834.79N1405524.05E DME : 380835.28N1405524.77E	
DME 空中線高 (標高) Elevation of DME transmitting antenna	32ft	

備考 :
本 VOR/DME は仙台 VOR/DME (SDE) が運用休止する間、代替
装置として運用される。

Remarks:
This VOR/DME will be operated as an alternate RADIO
NAVIGATION AID during unseviceability of Sendai VOR/DME
(SDE).

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

029/25

北九州空港における滑走路誤認着陸防止及び新設誘導路への誤進入防止について

1. 現在、北九州空港において、滑走路延長工事が実施されており、付図に示すとおり、滑走路延伸部分の形状が視認できる状態にあるので、航空機は当該延伸部分に着陸しないように注意すること。

また、新設誘導路の一部形状が視認できる状態にあるので、航空機は当該誘導路に誤進入しないように注意すること。
本航空情報サーキュラー発行と同時に令和7年10月30日付AIC NR026/25を取り消す。

また、新情報及び変更部は太い縦線により表示される。

2. 備考

- (1) 滑走路延伸部分には、禁止標識が設置される。
- (2) 新設誘導路に禁止標識及び禁止区域灯が漸次設置される。
- (3) 滑走路延伸部分及び新設誘導路の供用開始については、追って航空路誌改訂版によって通知される。

029/25

Prevention of false recognition of RWY and landing and preventing new TWY incursion at Kitakyushu AP/RJFR

1. RWY extension work is in progress at Kitakyushu AP.

The extension portion of RWY are visible shown in ATTACHMENT. Aircraft which will land at Kitakyushu AP is required to pay special attention.

In addition, as parts of the new taxiway are visible, aircraft should use caution to avoid entering these taxiways.


This AIC supersedes AIC NR026/25 dated 30 OCT 2025.

New information and changes are indicated by bold vertical lines.

2. Remarks

- (1) Closed marking will be installed on the extension portion of RWY.
- (2) Closed marking and unserviceability LGT are gradually installed on new TWY.
- (3) Commencing date of the extension portion of RWY and new TWY will be notified by AIP AMDT.

ATTACHMENT

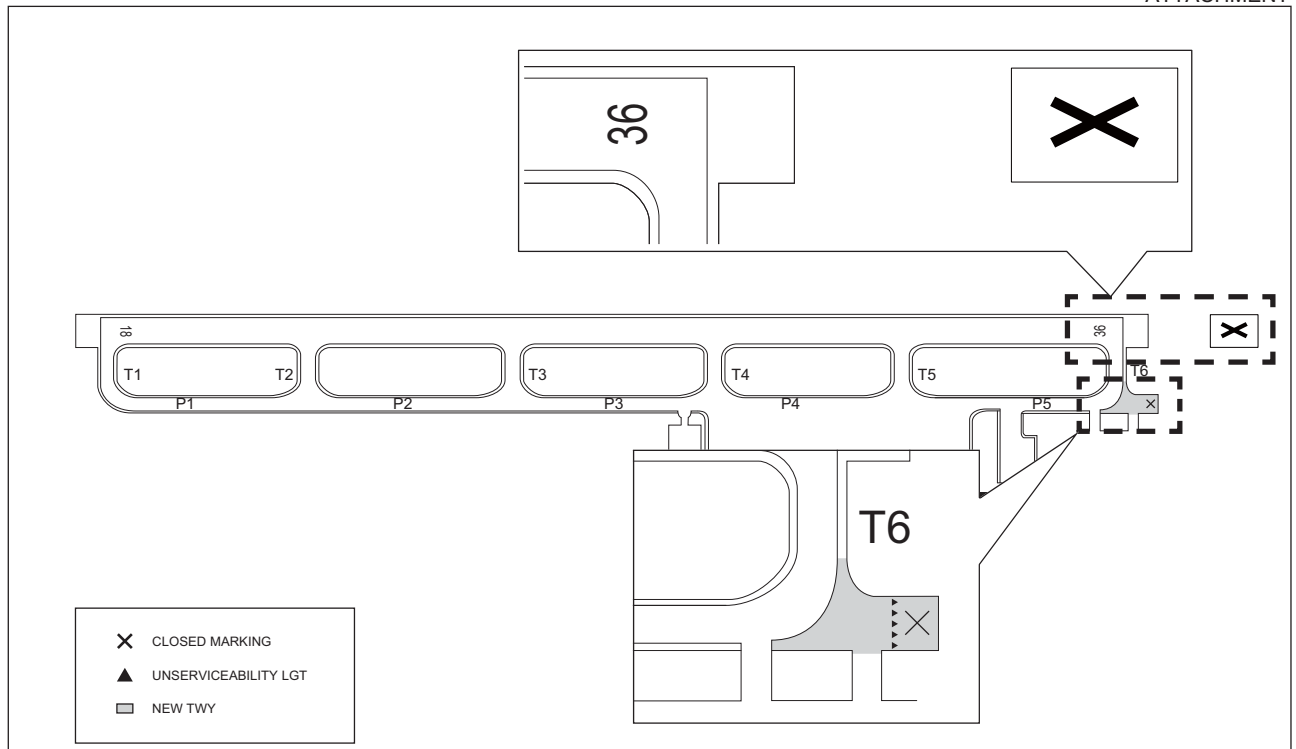

JAPAN

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 001/26
22 JAN 2026

001/26

航空情報サーキュラー照合表

令和 8 年 1 月 22 日 0900JST 現在、我が国で発行した有効な航空情報サーキュラーは次のとおりである。

2009

- NR033 有視界飛行方式により飛行する航空機の異常接近防止対策について
- NR034 出発及び到着の方式等を構成する航空保安無線施設の短時間(4 時間程度)停波及び突発的停波時における対応について
- NR053 大阪国際空港における滑走路誤進入防止について

2014

- NR034 航空安全情報自発報告制度(VOICES)について

2019

- NR013 航空機衝突防止装置(ACAS II)の運用について
- NR051 成田国際空港における離着陸制限時間の運用特例について

2020

- NR007 9GHz 帯航空機搭載型合成開口レーダーシステムに関する注意喚起
- NR015 東京国際空港における誘導路誤進入防止について

2021

- NR003 成田国際空港における飛行コースの監視について
- NR024 目視外飛行を行う無人航空機に関する飛行情報の提供について
- NR030 東京国際空港における滑走路誤進入防止について

2022

- NR002 多機能型地震計の運用について
- NR008 衝撃により自動的に作動する航空機用救命無線機(ELT)の装備を免除することについて
- NR010 航空機への鳥衝突(バードストライク)等が発生した場合の報告について
- NR011 航空機による危険物の安全輸送について
- NR012 自家用航空機による空港使用について
- NR013 MSAS による LP/LPV 進入の評価データの提供依頼について
- NR033 「特定操縦技能審査制度」の導入について

001/26

Check List for Aeronautical Information Circulars

List of Aeronautical Information Circulars still in force on 0000UTC 22 JAN 2026.

2009

- NR033 Countermeasures for the prevention of near collision of aircraft operating in accordance with Visual Flight Rules
- NR034 In case of short(for about 4 hours) or unexpected outage of Aeronautical Radio Navigational Aid(NAVAID) which composes departure or arrival procedures etc.
- NR053 Prevention of RWY incursion at Osaka INTL AP/RJOO

2014

- NR034 Voluntary Information Contributory to Enhancement of the Safety(VOICES)

2019

- NR013 Operation of the Airborne Collision Avoidance System(ACAS II)
- NR051 Special Provisions for Landing and Take-off Restrictions at Narita INTL AP/RJAA

2020

- NR007 9GHz AIRBORNE SYNTHETIC APERTURE RADAR NOTIFICATION
- NR015 Prevention of TWY incursion at Tokyo INTL AP/RJTT

2021

- NR003 Flight track monitoring at Narita INTL AP/RJAA
- NR024 Provision of flight information about unmanned aircraft flying beyond visual line of sight
- NR030 Prevention of RWY incursion at Tokyo INTL AP/RJTT

2022

- NR002 Operation of the Multifunctional Seismometer
- NR008 Exemption from equipping automatic ELT activated by impact
- NR010 BIRD STRIKE Reporting
- NR011 Safe transport of dangerous goods by air
- NR012 Regarding conditions for the use of aerodromes by private flights
- NR013 Request for an evaluation data of MSAS LP/LPV approach
- NR033 The introduction of "Pilot Competency Assessment system"

2023		2023	
NR005	日本の領域内における Boeing 737 MAX の運航について	NR005	Operation of Boeing 737 MAX within the territory of Japan
NR006	日本の領域内における PW4000 シリーズエンジンを搭載する Boeing777 型航空機の運航について	NR006	Operation of Boeing 777 equipped with PW4000 series engines within the territory of Japan
NR027	滑走路面状態評価及び報告方式の補足について	NR027	Supplemental of procedures for assessing and reporting runway surface conditions
2024		2024	
NR010	アジア — 北米間における高高度 User Preferred Route(UPR) の試行運用について	NR010	Operational Trial for the use of high altitude User Preferred Route (UPR) between Asia and North America
NR018	滑走路誤進入を防止するための基本動作及び手順等の徹底について	NR018	Thorough implementation of basic operation and procedures pertaining to prevention of runway incursion
NR027	SSR モード S 地上レーダーの運用開始について	NR027	Commencement of SSR Mode S ground radar
2025		2025	
NR010	仙台空港におけるマルチラテレーションの評価運用について	NR010	The trial of Multi-Lateration at Sendai AP/RJSS
NR011	飛行場等の周辺を有視界飛行方式により飛行する場合の安全対策について	NR011	Measures for the safety of VFR flight in the vicinity of aerodrome
NR020	遭難追跡装置等の装備義務化について	NR020	Requirement to equip Autonomous DistressTracking Devices
NR021	空港使用に係る同意書及び運航者撤去作業計画の提出について	NR021	Regarding submission of consent form for conditions for the use of airports/heliports and aircraft operator's disabled aircraft removal operation plan
NR024	航空法施行規則第 153 条の補足について	NR024	Supplement to Article 153 of Civil Aeronautics Regulations of Japan
NR025	成田国際空港における誘導路誤進入防止について	NR025	Prevention of TWY incursion at Narita INTL AP/RJAA
NR028	宮城 VOR/DME (MGE) の試験電波発射について	NR028	Emitting of test signal from Miyagi VOR/DME(MGE)
NR029	北九州空港における滑走路誤認着陸防止及び新設誘導路への誤進入防止について	NR029	Prevention of false recognition of RWY and landing and preventing new TWY incursion at Kitakyushu AP/RJFR
NR030	飛行計画経路の変更について	NR030	Change of Flight Planned Routes
2026		2026	
NR001	航空情報サーキュラー照合表	NR001	Check List for Aeronautical Information Circulars
NR002	あまの VOR/DME (ANE) の試験電波発射について	NR002	Emitting of test signal from Amano VOR/DME (ANE)
NR003	高知 VOR/DME (NAE) の試験電波発射について	NR003	Emitting of test signal from Kochi VOR/DME (NAE)

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 002/26
22 JAN 2026

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

002/26

あまの VOR/DME (ANE) の試験電波発射について

令和 8 年 2 月 19 日 0000JST から令和 8 年 9 月 30 日 2400JST
まであまの VOR/DME (ANE) において、次のとおり試験電波が発
射される。誤表示の可能性があり使用してはならない。供用開始
日時は追って通知される。

002/26

Emitting of test signal from Amano VOR/DME (ANE)

From 1500UTC 18 FEB 2026 to 1500UTC 30 SEP 2026, test
signal will be emitted from Amano VOR/DME (ANE). Do not use.
False indications possible. Commencing date and time of the
official operation will be notified afterward.

名称 Name	あまの VOR/DME Amano VOR/DME	
周波数 Frequency	CH-107Y	VOR 116.05MHz DME 1068MHz
出力 Power	VOR 200W DME 3kW	
識別符号 ID	ANE	
試験電波発射時間 (UTC) Hours of emitting test signal (UTC)	H24	
位置 Coordinates	VOR and DME : 352840.20N1350809.46E	
DME 空中線高 (標高) Elevation of DME transmitting antenna	2313ft	

備考 :

本 VOR/DME は宮津 VOR/DME (YME) が運用休止する間、代替
装置として運用される。

Remarks:

This VOR/DME will be operated as an alternate RADIO
NAVIGATION AID during unseviceability of Miyazu VOR/DME
(YME).

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

JAPAN
MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 003/26
22 JAN 2026

003/26
高知 VOR/DME (NAE) の試験電波発射について

令和 8 年 2 月 19 日 0000JST から令和 8 年 8 月 5 日 2400JST ま
で高知 VOR/DME (NAE) において、次のとおり試験電波が発射さ
れる。誤表示の可能性があります使用してはならない。供用開始日時
は追って通知される。

003/26
**Emitting of test signal from Kochi VOR/DME
(NAE)**

From 1500UTC 18 FEB 2026 to 1500UTC 5 AUG 2026, test
signal will be emitted from Kochi VOR/DME (NAE). Do not use.
False indications possible. Commencing date and time of the
official operation will be notified afterward.

名称 Name	高知 VOR/DME Kochi VOR/DME	
周波数 Frequency	CH-118X	VOR 117.1MHz DME 1205MHz
出力 Power	VOR 200W DME 3kW	
識別符号 ID	NAE	
試験電波発射時間 (UTC) Hours of emitting test signal (UTC)	H24	
位置 Coordinates	VOR and DME : 333303.27N1333932.80E	
DME 空中線高 (標高) Elevation of DME transmitting antenna	55ft	

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 004/26
19 FEB 2026

Tel: +81-50-3146-3195
AFTN:RJAAYNYX
E-mail:
helpdesk@ais.mlit.go.jp

004/26

白保 VOR/DME (SHE) の試験電波発射について

令和 8 年 3 月 19 日 0000JST から令和 8 年 9 月 2 日 2400JST ま
で白保 VOR/DME (SHE) において、次のとおり試験電波が発射さ
れる。誤表示の可能性があります使用してはならない。供用開始日時
は追って通知される。

004/26

Emitting of test signal from Shiraho VOR/DME (SHE)

From 1500UTC 18 MAR 2026 to 1500UTC 2 SEP 2026, test
signal will be emitted from Shiraho VOR/DME (SHE). Do not use.
False indications possible. Commencing date and time of the
official operation will be notified afterward.

名称 Name	白保 VOR/DME Shiraho VOR/DME	
周波数 Frequency	CH-96X	VOR 114.9MHz DME 1183MHz
出力 Power	VOR 200W DME 3kW	
識別符号 ID	SHE	
試験電波発射時間 (UTC) Hours of emitting test signal (UTC)	H24	
位置 Coordinates	VOR and DME : 242339N1241448E	
DME 空中線高 (標高) Elevation of DME transmitting antenna	143ft	

備考 :

本 VOR/DME は石垣島 VOR/DME (IGE) が運用休止する間、代
替装置として運用される。

Remarks:

This VOR/DME will be operated as an alternate RADIO
NAVIGATION AID during unseviceability of Ishigakijima VOR/
DME (IGE).

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

005/26

飛行計画経路の変更について

- 令和 8 年 5 月 14 日 0000JST から、飛行計画経路は 2. のとおり計画されたい。
- なお、同日時をもって令和 7 年 12 月 25 日付 AIC NR030/25 を取り消す。
- また、新情報及び変更部は太い縦線及び太字により表示される。

1. 掲載指針及び注意事項

- 1) 経路表には標準的な経路を掲載する。
- 2) General 経路表は、Domestic 及び International/Overflight 経路表に記載がない場合に使用する経路を掲載する。
- 3) 記載のない DEP, DEST の組み合わせについては、Domestic、International/Overflight 及び General 経路表記載の経路をそれぞれ接続して使用することが可能である。
- 4) DEP 欄に FIR 名が記載されている場合は、福岡 FIR への入域 FIR、DEST 欄に FIR 名が記載されている場合は、福岡 FIR からの出域 FIR を指す。
- 5) DEP 欄及び DEST 欄に "xxxx" と記載されている場合は、任意の地点略号を指す。
- 6) 地点略号中の x には任意のアルファベットが入る。
- 7) MEA による高度制限は Remarks 欄に記載しない。
- 8) RNAV1 又は RNP1 航行の許可を得た航空機は、RNAV1 又は RNP1 仕様の飛行方式に接続する経路を計画すること。
- 9) RNAV5 航行の許可を得た航空機は、RNAV5 経路を計画すること。
- 10) 調整経路の使用が可能である場合、RNAV 航行の許可を得た航空機は当該経路を計画すること。
- 11) 停波代替等の措置は、該当の航空路誌補足版等を参照すること。
- 12) 原則として飛行計画を避ける経路

005/26

Change of Flight Planned Routes

- WEF 1500UTC 13 MAY 2026, it is requested that flight planned routes are filed as Item 2.
- AIC NR030/25 dated 25 DEC 2025 will be superseded at the same time.
- New information and changes are indicated by bold vertical lines and bold font.

1. Rules

- 1) Tables of routes list standard routes.
- 2) General table is used only when not listed on the Domestic and International/Overflight tables.
- 3) For DEP and DEST combinations not described, the routes described in Domestic, International/Overflight, and General tables can be used by connecting them.
- 4) If the FIR name is written in the DEP column, it means FIR one before Fukuoka FIR. If the FIR name is written in the DEST column, it means FIR one after Fukuoka FIR.
- 5) "xxxx" in the DEP/DEST column means arbitrary location indicators.
- 6) Arbitrary alphabet can be applied to "x" in the location indicator.
- 7) Altitude restrictions by MEA are not described in the Remarks column.
- 8) RNAV1 or RNP1 capable aircraft should file routes connecting to RNAV1 or RNP1.
- 9) RNAV5 capable aircraft should file RNAV5 routes.
- 10) RNAV capable aircraft should flight plan CDR routes when CDR routes are available.
- 11) Alternate procedures by unserviceability of NAVAIDS, etc. will be established by AIP SUP.
- 12) Routes to avoid

Routes to avoid	Remarks
CHE V13 MRE (South Bound)	mainly used for North Bound
GTC V30 CHE (North Bound)	mainly used for South Bound
FKE V22 CHE (North Bound)	mainly used for South Bound
DGC V28 KCC (East Bound)	except from RKRR to RJBE mainly used for West Bound
HKC A1 SUC (East Bound)	mainly used for West Bound
KTE V40 TFE (West Bound)	mainly used for East Bound
NHC A582/Y45 ONC AZAMA Y579 ONC (North Bound)	except from ROAH mainly used for South Bound
RJFF-xxxx (FUKUOKA DEP/HAKATA DEP) (East Bound)	except for RJOC,RJOK,RJOS
RJFO-xxxx (EBOSHI DEP) (at or below 10,000ft)	mainly used for at or above 11,000ft

13) 承認されない経路

13) Unable Routes

DEP-DEST	Unable Routes
RJBB-xxxx (EOBT:1330z-2114z)	NANKO DEP SOVRI DEP LINDA DEP OMGOR DEP OBLUR DEP
RJBB-xxxx (EOBT:2115z-1329z)	(except for Domestic) SOVRI DEP
xxxx-RJBB (ETA:1345z-2144z)	KOHWA Y544 DUBKA
RJBE-xxxx (EOBT:1330z-1359z)	MUKRI DEP
RJTT-xxxx (ETD:1400z-2059z)	(other than below) OPPAR UTIBO OPPAR JYOGA
xxxx-RJTT (ETA:1400z-2059z)	(other than below) ARTIC Y71 XAC MENUR Y21 AKSEL TOPIT Y875 AROSA INUBO Y108 MESSE DOLBA Y824 AROSA

14) 経路に係る問い合わせ窓口

航空交通管理センター

Tel : 092-608-8870(航空交通管理管制官)

Mail : cab-atmc-atfm@gxb.mlit.go.jp

14) For inquires about Routes

Air Traffic Management Center

Tel: +81-92-608-8870 (Air Traffic Management Officer)

Mail: cab-atmc-atfm@gxb.mlit.go.jp

2. 経路表

2. Tables of routes

2.1 Domestic

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJAA	RJBB	ETA 2145-1344		PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y544 DUBKA
RJAA	RJBB	ETA 1345-2144		PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
RJAA	RJCC		FL250+	KIMIN Y117 LEKOL Y119 OHMAR Y13 SIRAO Y139 NAVER
RJAA	RJCC		FL240-	KIMIN Y117 LEKOL Y119 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJAA	RJCH			KIMIN Y117 NISEP Y304 YTE Y113 TAXIR
RJAA	RJEC			KIMIN Y117 JYONA Y11 NAVER Y139 ASIBE V7 AWE
RJAA	RJFF		FL240+ & for JET	ENPAR Y16 TEPEX Y88 SUGAL Y20 KIRIN
RJAA	RJFF		FL230- or for DH8D	ENPAR Y16 TEPEX Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJAA	RJFK			PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 SUC Y757 SPICA
RJAA	RJFM			PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 RUPAP Y244 GREEN Y24 SUC Y402 RYUGU
RJAA	RJFO			REDEK Y60 TOKOM Y604 WASYU Y28 MARCO Y45 YANAI BAIEN TFE
RJAA	RJFR			REDEK Y60 TOKOM Y604 WASYU Y28 MARCO Y285 ASARI
RJAA	RJFS			REDEK Y60 BALIE Y452 OOITA Y40 MILEP UGAMU SGE
RJAA	RJFT			REDEK Y60 BALIE Y452 OOITA Y40 KAZMA
RJAA	RJFU		FL240+	ENPAR Y16 TEPEX Y88 SUGAL Y20 KAMMY Y204 OHGIE
RJAA	RJFU		FL230-	ENPAR Y16 TEPEX Y88 KCC Y28 DGC Y204 OHGIE
RJAA	RJGG			PIGOK Y50 OLTOM
RJAA	RJKA			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y521 TUMGI
RJAA	RJNK			ENPAR Y16 TEPEX Y88 TENRU Y155 MBE Y884 KMC
RJAA	RJOA			ENPAR Y16 TEPEX Y88 SUGAL Y20 KAMMY Y202 AMURO
RJAA	RJOK			PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y24 TURFY Y242 PANCH
RJAA	RJOM			REDEK Y60 TOKOM Y604 WASYU Y28 BAMBO Y283 ITUKI
RJAA	RJOO			PIGOK Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJAA	RJOT			ENPAR Y16 TEPEX Y88 SUGAL Y20 WAKIT Y203 WIMPY
RJAA	RJSN			AGRIS Y37 GOSEN
RJAA	RJSS			KIMIN Y117 NIRAX Y15 OWLET
RJAA	RJSY			KIMIN Y117 NISEP Y304 YTE USUBA YSE
RJAA	RJTT			PEDLA Y824 AROSA
RJAA	ROAH		for JET	SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 IHEYA
RJAA	ROIG			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 KXC Y62 GANAS Y576 DIANA
RJAA	RORS			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 KXC Y62 GANAS Y576 DIANA
RJAF	RJBE			MBE Y12 TOLUM Y20 WAKIT Y201 TRACY

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJAF	RJCC			HAPPO Y155 HAKBA Y45 GTC Y312 UWE Y32 MRE Y13 SIRAO Y139 NAVER
RJAF	RJCO			HAPPO Y155 HAKBA Y45 GTC Y312 UWE Y32 MRE Y113 HWE V2 MOIWA
RJAF	RJFF		FL240+ & for JET	MBE Y12 TOLUM Y20 KIRIN
RJAF	RJFF		FL230- or for DH8D	MBE Y121 SWING Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJAF	RJOC			MBE Y121 SWING Y88 KCC Y295 YME Y18 RAKDA
RJAF	RJOO			MBE Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJAH	RJBE			OGITU Y887 DAIGO Y88 SUGAL Y20 WAKIT Y201 TRACY
RJAH	RJCC		FL250+	OGITU Y887 YAITA Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJAH	RJCC		FL240-	OGITU Y887 YAITA Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJAH	RJFF		FL240+ & for JET	OGITU Y887 DAIGO Y88 SUGAL Y20 KIRIN
RJAH	RJFF		FL230- or for DH8D	OGITU Y887 DAIGO Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJAH	ROAH		for JET	OGITU Y887 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 IHEYA
RJBB	RJAA	EOBT 2115-1329		TOMOH DOPDA KEC Y43 ISEBI Y81 RUTAS
RJBB	RJAA	EOBT 1330-2114		UPMIN DOPDA KEC Y43 ISEBI Y81 RUTAS
RJBB	RJCC	EOBT 2115-1329		NANKO NIKEX KYOTO SIGAK GUJYO Y13 SIRAO Y139 NAVER
RJBB	RJCH	EOBT 2115-1329		NANKO NIKEX KYOTO SIGAK GUJYO Y13 AKITA Y131 HINAI Y113 TAXIR
RJBB	RJCK	EOBT 2115-1329		SOVRI UPRAL UENOH KCC Y312 GTC Y124 MQE Y111 CRANE
RJBB	RJCM	EOBT 2115-1329		SOVRI UPRAL UENOH KCC Y312 GTC Y124 MQE Y111 OZORA
RJBB	RJEC	EOBT 2115-1329		NANKO NIKEX KYOTO SIGAK GUJYO Y13 CHE V7 AWE
RJBB	RJFF		FL240+ & for JET	MAIKO OSRIX GUMID SOUJA Y281 STOUT Y20 KIRIN
RJBB	RJFF		FL180-FL230 or for DH8D	LINDA SHION WASYU Y28 MARCO Y256 STOUT Y20 KIRIN
RJBB	RJFK	EOBT 2115-1329		OBLUR Y236 VEXOT Y756 VIRUD Y757 SPICA
RJBB	RJFM	EOBT 2115-1329		OBLUR Y236 VEXOT Y756 KRE Y232 SIROK Y402 RYUGU
RJBB	RJFR	EOBT 2115-1329		LINDA SHION WASYU Y28 MARCO Y285 ASARI
RJBB	RJFR	EOBT 1330-2114		MAIKO OSRIX SHION WASYU Y28 MARCO Y285 ASARI
RJBB	RJFU		FL240+	MAIKO OSRIX GUMID SOUJA Y281 UKELI Y204 OHGIE
RJBB	RJFU		FL230-	LINDA SHION WASYU Y28 DGC Y204 OHGIE
RJBB	RJGG	EOBT 2115-1329		TOMOH DOPDA KEC Y415 NATCH Y755 CARDS
RJBB	RJGG	EOBT 1330-2114		UPMIN DOPDA KEC Y415 NATCH Y755 CARDS
RJBB	RJKA	EOBT 2115-1329	FL220+	OBLUR Y236 MULAB Y75 ALTAI Y758 TUMGI
RJBB	RJKA	EOBT 2115-1329	FL210-	OBLUR Y236 VEXOT Y756 KRE V53 SUC B597 TUMGI
RJBB	RJOK	EOBT 2115-1329		OBLUR Y236 VEXOT Y756 KRE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJBB	RJOM			LINDA SHION WASYU Y28 BAMBO Y283 ITUKI
RJBB	RJSN	EOBT 2115-1329		NANKO NIKEX KYOTO SIGAK KCC Y312 MAGNA
RJBB	RJSS	EOBT 2115-1329		SOVRI UPRAL UENOH KCC Y88 TENRU Y15 OWLET
RJBB	RJTT	EOBT 1330-2114		UPMIN DOPDA KEC Y43 MENUR Y21 AKSEL
RJBB	RJTT	EOBT 2115-1329		SOVRI UPRAL YAGYU SHTLE Y71 XAC
RJBB	ROAH	EOBT 2115-1329	for JET	OBLUR Y236 MULAB Y75 ONC Y525 IHEYA
RJBB	ROAH	EOBT 1330-2114	for JET	UPMIN IVROG Y340 RUSUD Y75 ONC Y525 IHEYA
RJBB	ROIG	EOBT 2115-1329		OBLUR Y236 MULAB Y75 SWANO Y26 YURIX Y62 GANAS Y576 DIANA
RJBB	ROMY	EOBT 2115-1329		OBLUR Y236 MULAB Y75 SWANO Y26 YURIX Y62 GANAS Y576 YUTAH
RJBB	RORS	EOBT 2115-1329		OBLUR Y236 MULAB Y75 SWANO Y26 YURIX Y62 GANAS Y576 DIANA
RJBD	RJTT			KEC Y43 MENUR Y21 AKSEL
RJBE	RJAF	EOBT 2200-1329		MUKRI LANID REVUE HYOGO SANDA MIDER Y28 KCC Y88 SWING Y121 MBE
RJBE	RJAH	EOBT 2200-1329		MUKRI LANID REVUE HYOGO SANDA MIDER Y28 KCC Y88 DAIGO Y887 TATSU NAKAH
RJBE	RJCC	EOBT 2200-1329		MUKRI LANID PORUS TRIPY ASAGI YME Y381 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJBE	RJFK	EOBT 2200-1329		MUKRI ATKAS TANTA Y236 VEXOT Y756 VIRUD Y757 SPICA
RJBE	RJFU	EOBT 2200-1329	FL240+	MUKRI ATKAS GUMID SOUJA Y281 UKELI Y204 OHGIE
RJBE	RJFU	EOBT 2200-1329	FL230-	MUKRI ATKAS SHION WASYU Y28 DGC Y204 OHGIE
RJBE	RJOK	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 POPPY
RJBE	RJSA	EOBT 2200-1329		MUKRI LANID PORUS TRIPY ASAGI YME Y381 KMC Y45 GTC Y312 UWE HINAI Y113 MRE
RJBE	RJSI	EOBT 2200-1329		MUKRI LANID PORUS TRIPY ASAGI YME Y381 KMC Y45 GTC ELBOR YTE Y153 SIOMO
RJBE	RJSN	EOBT 2200-1329		MUKRI LANID REVUE HYOGO SANDA MIDER Y28 KCC Y312 MAGNA
RJBE	RJSS	EOBT 2200-1329		MUKRI LANID REVUE HYOGO SANDA MIDER Y28 KCC Y88 TENRU Y15 OWLET
RJBE	RJSS	EOBT 2200-1329	FL230-	MUKRI LANID REVUE HYOGO SANDA MIDER Y28 KCC Y88 GYODA Y882 ONUMA Y883 INAWA Y15 OWLET
RJBE	RJTT	EOBT 2200-1329		MUKRI LANID REVUE HYOGO SANDA Y289 SHTLE Y71 XAC
RJBE	ROAH	EOBT 2200-1329	for JET	MUKRI ATKAS TANTA Y75 ONC Y525 IHEYA
RJBE	RORS	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 SWANO Y26 YURIX Y62 GANAS Y576 DIANA
RJBT	RJOO			ROKKO KAMEO OTABE ABENO IKOMA
RJCB	RJGG			OBE MKE Y14 ARIKA Y12 MBE Y121 SWING
RJCB	RJTT	ETA 2100-1359		RACKO Y110 EPDOM Y112 OMGOL Y111 MQE Y106 RUBIS Y10 GODIN
RJCC	RJAA	EOBT 2201-1244	FL260+	TOBBY Y10 LARCH Y302 JUGEM Y30 SWAMP
RJCC	RJAA	EOBT 2201-1244	FL250-	DALBI Y120 RURUD Y125 JUGEM Y30 SWAMP
RJCC	RJAF	EOBT 2201-1244		DALBI Y120 TAPPI Y12 GTC Y312 AZUMI Y155 MBE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJCC	RJAH	EOBT 2201-1244	FL260+	TOBBY Y10 DAIGO Y887 TATSU NAKAH
RJCC	RJAH	EOBT 2201-1244	FL250-	DALBI Y120 RURUD Y125 METEL Y102 SDE Y106 RUBIS Y10 DAIGO Y887 TATSU NAKAH
RJCC	RJBB	EOBT 1245-2200		CHE MKE HWE Y14 GOLDO Y36 ATMUG
RJCC	RJBB	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y36 ATMUG
RJCC	RJBE	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y382 WAKIT Y201 TRACY
RJCC	RJCH		13,000ft -	HWE
RJCC	RJCH		FL150+	TEKKO V2 UPLOK
RJCC	RJCK			RAKNO V6 OBE IGAMO
RJCC	RJCM			RAKNO V6 OBE V4 GINGA
RJCC	RJCN			RAKNO V6 OBE IGAMO TCE V2 MASHU
RJCC	RJCW			KURIS V1 RUMOI Y10 YOROI V1 WKE
RJCC	RJER			KURIS V1 RUMOI Y10 YOROI A204 LEDAX
RJCC	RJFF	EOBT 2201-1244	FL260+ & for JET	DALBI Y120 TAPPI Y12 ARIKA Y14 STOUT Y20 KIRIN
RJCC	RJFF	EOBT 2201-1244	FL240 & for JET	DALBI Y120 TAPPI Y12 GTC Y45 MIHOU Y14 STOUT Y20 KIRIN
RJCC	RJFF	EOBT 2201-1244	FL230- or for DH8D	DALBI Y120 TAPPI Y12 GTC Y45 MARCO Y256 STOUT Y20 KIRIN
RJCC	RJFR			DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y382 WAKIT Y282 ASANO Y28 MARCO Y285 ASARI
RJCC	RJGG	EOBT 1245-2200		CHE MKE HWE Y122 GTC Y12 MBE Y121 SWING
RJCC	RJGG	EOBT 2201-1244		DALBI Y120 TAPPI Y12 MBE Y121 SWING
RJCC	RJNK	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 HIMMY
RJCC	RJNS	EOBT 2201-1244		DALBI Y120 TAPPI Y12 NAKTU Y126 KIKOL Y295 GAKKI Y551 ENSYU
RJCC	RJNT	EOBT 2201-1244		DALBI Y120 TAPPI Y12 GTC HISUI Y311 GENG
RJCC	RJOA	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y382 WAKIT Y20 KAMMY Y202 AMURO
RJCC	RJOB	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y382 WAKIT Y205 OYE
RJCC	RJOC	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 YME Y18 RAKDA
RJCC	RJOH	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 YME Y18 RAKDA
RJCC	RJOM	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y382 WAKIT Y282 ASANO Y28 BAMBO Y283 ITUKI
RJCC	RJOO	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y384 ROKKO KAMEO OTABE ABENO IKOMA
RJCC	RJOO	EOBT 2201-1244	FL250-	DALBI Y120 TAPPI Y12 GTC Y45 KMC Y384 ROKKO KAMEO OTABE ABENO IKOMA
RJCC	RJOS	EOBT 2201-1244		DALBI Y120 TAPPI Y12 KOHWA Y544 SINGU Y542 DATIS
RJCC	RJSA	EOBT 2201-1244		DALBI Y146 HIBAR Y113 BYOBU
RJCC	RJSC	EOBT 2201-1244	FL260+	TOBBY Y10 HPE V36 YTE
RJCC	RJSC	EOBT 2201-1244	FL250-	DALBI Y146 HIBAR Y113 MRE Y100 HPE V36 YTE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJCC	RJSF	EOBT 2201-1244	FL260+	TOBBY Y10 HPE Y102 HERON
RJCC	RJSF	EOBT 2201-1244	FL250-	DALBI Y120 RURUD Y125 METEL Y102 HERON
RJCC	RJSI	EOBT 2201-1244		DALBI Y146 HIBAR Y113 MRE Y100 ENBIM
RJCC	RJSK	EOBT 2201-1244		DALBI Y120 RURUD Y125 IWASE Y144 MAGGY
RJCC	RJSN	EOBT 2201-1244		DALBI Y120 OBAKO Y122 INAHO
RJCC	RJSS	EOBT 2201-1244	FL260+	TOBBY Y10 HPE Y102 SDE
RJCC	RJSS	EOBT 2201-1244	FL250-	DALBI Y120 RURUD Y125 METEL Y102 SDE
RJCC	ROAH		for JET	DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y45 ONC Y525 IHEYA
RJCC	RJTT	EOBT 2201-1244 &ETA 2100-1359	FL260+	TOBBY Y10 GODIN
RJCC	RJTT	EOBT 2201-1244 &ETA 2100-1359	FL250-	DALBI Y120 RURUD Y125 METEL Y102 SDE Y106 RUBIS Y10 GODIN
RJCH	RJAA			UWE Y32 YTE Y304 GUGBI Y30 SWAMP
RJCH	RJBB			TAPPI Y12 ARIKA Y14 GOLDO Y36 ATMUG
RJCH	RJCC		for JET	TIKYU Y13 SIRAO Y139 NAVER
RJCH	RJCC		for PROP	TIKYU Y138 NONUT Y11 NAVER
RJCH	RJGG			TAPPI Y12 MBE Y121 SWING
RJCH	RJOO			TAPPI Y12 ARIKA Y14 GOLDO Y381 KMC Y384 ROKKO KAMEO OTABE ABENO IKOMA
RJCH	RJTT	ETA 2100-1359		UWE Y320 RUBIS Y10 GODIN
RJCK	RJAA			ENTOD Y112 OMGOL Y111 MQE Y30 SWAMP
RJCK	RJBB			RUGMO Y101 MKE Y14 GOLDO Y36 ATMUG
RJCK	RJCC			RUGMO V4 OSROB V5 CHE
RJCK	RJGG			RUGMO Y101 MKE Y14 ARIKA Y12 MBE Y121 SWING
RJCK	RJOO			RUGMO Y101 MKE Y14 ARIKA Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJCK	RJTT	ETA 2100-1359		ENTOD Y112 OMGOL Y111 MQE Y106 RUBIS Y10 GODIN
RJCM	RJAA			MENIB Y112 OMGOL Y111 MQE Y30 SWAMP
RJCM	RJBB			OLDUS Y14 GOLDO Y36 ATMUG
RJCM	RJCC			OLDUS Y14 BOKSO V5 CHE
RJCM	RJGG			OLDUS Y14 ARIKA Y12 MBE Y121 SWING
RJCM	RJOO			OLDUS Y14 ARIKA Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJCM	RJTT	ETA 2100-1359		MENIB Y112 OMGOL Y111 MQE Y106 RUBIS Y10 GODIN
RJCN	RJCC			ENKAT Y134 NODUK Y14 BOKSO V5 CHE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJCN	RJTT	ETA 2100-1359		NOMOX Y112 OMGOL Y111 MQE Y106 RUBIS Y10 GODIN
RJCO	RJAF			MOIWA V2 HWE Y14 ARIKA Y12 GTC Y312 AZUMI Y155 MBE
RJCO	RJNA			MOIWA V2 HWE Y14 ARIKA Y12 MBE Y121 SWING
RJCO	RJNS			MOIWA V2 HWE Y14 ARIKA Y12 NAKTU Y126 KIKOL Y295 GAKKI Y551 ENSYU
RJCW	RJCC			YOROI Y10 RUMOI V1 CHE
RJCW	RJTT	ETA 2100-1359		YOROI Y10 GODIN
RJDB	RJFU			AKNAG Y251 OLE
RJDB	RJFU			IKE SALID OLE
RJDC	RJTT			KOHEI HIMEH FIATO Y61 KTE Y33 SHOOT Y71 XAC
RJDC	RJTT			FIATO Y61 KTE Y33 SHOOT Y71 XAC
RJDT	RJFF			FRAIZ Y209 SARUP
RJDT	RJFU			FRAIZ Y209 IKE Y251 OLE
RJDT	RJFU			IKE SALID OLE
RJEB	RJTT	ETA 2100-1359		LUBEK Y116 CHE Y10 GODIN
RJEC	RJAA			KAGRA Y103 TOBBY Y10 LARCH Y302 JUGEM Y30 SWAMP
RJEC	RJBB			KAGRA SUIKA V1 CHE Y12 HWE Y14 GOLDO Y36 ATMUG
RJEC	RJGG			KAGRA SUIKA V1 CHE Y12 HWE Y14 ARIKA Y12 MBE Y121 SWING
RJEC	RJOO			KAGRA SUIKA V1 CHE Y12 HWE Y14 ARIKA Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJEC	RJTT	ETA 2100-1359		KAGRA Y103 TOBBY Y10 GODIN
RJER	RJCC			LEDAX A204 YOROI Y10 RUMOI V1 CHE
RJFC	RJFF		FL 180-	AMMON Y145 HKC Y14 HINAG Y252 GOKYO Y25 ISKUP
RJFC	RJFK			AMMON Y455 KINKO
RJFC	RJOO			TGE B597 MADOG Y753 IZUMI
RJFE	RJFF			OLVIN Y253 ATSAG
RJFE	RJFF			IKE
RJFE	RJFU			AGRIT Y40 OLE
RJFE	RJFU			OLE
RJFF	RJAA			CARSE Y81 RUTAS
RJFF	RJAF			ENGID Y412 MYE Y33 LABEL Y121 MBE
RJFF	RJAH			ENGID Y412 MYE Y33 LABEL Y121 SWING Y88 DAIGO Y887 TATSU NAKAH
RJFF	RJBB			ENGID Y412 MYE Y401 SALTY Y35 IGLEV
RJFF	RJCC			BUTUR Y453 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJFF	RJDT			DGC A595 IKE HASMA AGATA
RJFF	RJFC			YAMGA VEMRA Y506 HKC Y145 ONSKE TOLOT
RJFF	RJFC			YAMGA VEMRA Y506 HKC AMMON ONSKE TOLOT
RJFF	RJFE			SGE OLE Y40 FUE
RJFF	RJFK			YAMGA KUE ESLIL HIGOH KGE
RJFF	RJFK		A120-	MIZMA G339 HKC KGE
RJFF	RJFM			YAMGA KUE ESKAP KROMA ENBEN MZE
RJFF	RJFM		A120-	MIZMA G339 SASIK LALAG MZE
RJFF	RJGG		FL210+	ENGID Y412 TARBY Y41 NATCH Y755 CARDS
RJFF	RJGG		FL200-	ENGID Y412 MYE V56 KRE V37 KEC Y415 NATCH Y755 CARDS
RJFF	RJKA			YAMGA VEMRA Y506 HKC Y45 BOMAP Y25 KANAH
RJFF	RJNA			BUTUR Y453 MARCO Y45 MIHOU Y38 MIDER Y28 KCC
RJFF	RJNK			BUTUR Y453 MARCO Y45 SONBU
RJFF	RJNS			IPRIR Y231 OMKAT Y235 FLUTE Y23 ENSYU
RJFF	RJOC		for PROP except DH8D	DGC V28 MARCO Y45 KYOKA V29 XZE
RJFF	RJOK			ENGID Y412 MYE BOTAN KABIL
RJFF	RJOK		FL150- & for PROP except DH8D	DGC V28 MARCO V56 MYE BOTAN KABIL KRE
RJFF	RJOM			ENGID Y412 MYE
RJFF	RJOO		for JET	IPRIR Y231 MIRIO Y401 KAINA Y753 IZUMI
RJFF	RJOO		for DH8D	ENGID Y412 MYE Y401 KAINA Y753 IZUMI
RJFF	RJOS			ENGID Y412 MYE Y33 KTE Y331 TSC
RJFF	RJOS		FL150- & for PROP except DH8D	DGC V28 MARCO V56 MYE Y33 KTE Y331 TSC
RJFF	RJSI		FL260+	BUTUR Y453 MARCO Y45 MIHOU Y14 SAMON Y142 GTC ELBOR YTE Y153 SIOMO
RJFF	RJSI		FL250-	BUTUR Y453 MARCO Y45 GTC ELBOR YTE Y153 SIOMO
RJFF	RJSN		FL260+	BUTUR Y453 MARCO Y45 MIHOU Y14 SAMON Y142 GTC
RJFF	RJSN		FL250-	BUTUR Y453 MARCO Y45 TERAD
RJFF	RJSS		FL240+	BUTUR Y453 MARCO Y45 KMC Y515 LANCE
RJFF	RJSS		FL230-	BUTUR Y453 MARCO Y45 GTC R217 SDE
RJFF	RJTT			IPRIR Y231 OMKAT Y235 FLUTE Y23 ARTIC Y71 XAC
RJFF	ROAH		for JET	YAMGA VEMRA Y506 HKC Y45 ONC Y525 IHEYA
RJFF	ROIG			YAMGA VEMRA Y506 HKC Y45 ANOXA Y26 YURIX Y62 GANAS Y576 DIANA
RJFF	ROMY			YAMGA VEMRA Y506 HKC Y45 ANOXA Y26 YURIX Y62 GANAS Y576 YUTAH

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJFF	RORS			YAMGA VEMRA Y506 HKC Y45 ANOXA Y26 YURIX Y62 GANAS Y576 DIANA
RJFG	RJFK			KAGYA KINKO
RJFG	RJOO			JACKY B597 MADOG Y753 IZUMI
RJFK	RJAA			MIDAI M750 MUKEP Y891 AGIMO Y89 GUPER Y81 RUTAS
RJFK	RJBB			MIDAI M750 MADOG Y53 NIXOV
RJFK	RJBE			MIDAI M750 MADOG Y53 SUC Y537 LOVGI Y353 AVKUL
RJFK	RJFC			HKC Y145 ONSKE TOLOT
RJFK	RJFC			HKC AMMON ONSKE TOLOT
RJFK	RJFF	FL180-	SASIK Y14 HINAG Y252 GOKYO Y25 ISKUP	
RJFK	RJFG			HKC Y14 TGE
RJFK	RJGG			MIDAI M750 IMPAL Y755 CARDS
RJFK	RJKA			HKC Y45 BOMAP Y25 KANAH
RJFK	RJKA			HKC Y45 ANOXA AME
RJFK	RJKA			HKC Y45 SAZMA Y456 RURIK B597 TUMGI
RJFK	RJKB			HKC Y45 HACHA TKE KUNIG ONC
RJFK	RJKI			HKC Y45 SAZMA Y456 POMAS
RJFK	RJKN			HKC Y45 ANOXA
RJFK	RJNS			MIDAI M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 MOSLO
RJFK	RJOM			HKC Y45 OOITA Y40 MYE
RJFK	RJOO			MIDAI M750 MADOG Y753 IZUMI
RJFK	RJTT			MIDAI M750 BILLY Y21 AKSEL
RJFK	ROAH		for JET	HKC Y45 ONC Y525 IHEYA
RJFK	RORY			HKC Y45 ONC ASATO YRE
RJFM	RJAA			MADOG M750 MUKEP Y891 AGIMO Y89 GUPER Y81 RUTAS
RJFM	RJBB			MADOG Y53 NIXOV
RJFM	RJFF	FL180-	LALAG Y252 GOKYO Y25 ISKUP	
RJFM	RJGG	FL210+	MADOG M750 IMPAL Y755 CARDS	
RJFM	RJGG	FL200-	MADOG Y753 JAKAL A1 ALBAT Y755 CARDS	
RJFM	RJOO			MADOG Y753 IZUMI
RJFM	RJTT			MADOG M750 BILLY Y21 AKSEL
RJFM	ROAH		for JET	JACKY B597 ONC Y525 IHEYA
RJFO	RJAA			FUSHA DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 ISEBI Y81 RUTAS

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJFO	RJGG		FL210+	FUSHA DONAR Y41 NATCH Y755 CARDS
RJFO	RJGG		FL200-	FUSHA DONAR URGIK BOTAN KABIL KRE V37 KEC Y415 NATCH Y755 CARDS
RJFO	RJOO		for JET	SPIDE Y231 MIRIO Y401 KAINA Y753 IZUMI
RJFO	RJOO		for DH8D	MYE Y401 KAINA Y753 IZUMI
RJFO	RJTT			FIATO Y61 KTE Y33 SHOOT Y71 XAC
RJFR	RJAA			KOHEI MYE V56 KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJFR	RJBB			KOHEI MYE Y401 SALTY Y35 IGLEV
RJFR	RJCC			FIATO Y61 KTE Y33 LABEL Y121 CBE V52 KCC Y312 UWE Y32 MRE Y13 SIRAO Y139 NAVER
RJFR	RJNA			KOHEI MYE V56 KRE V37 PADOC Y43 KEC Y12 SHIMA
RJFR	RJNS			FIATO Y61 KTE Y33 KOHWA Y55 GAKKI Y551 ENSYU
RJFR	RJTT			FIATO Y61 KTE Y33 SHOOT Y71 XAC
RJFR	ROAH		for JET	ONGHA V28 DGC Y14 HKC Y45 ONC Y525 IHEYA
RJFS	RJAA			OOITA Y41 DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJFS	RJAA			FS100 OOITA Y41 DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJFS	RJTT			FS100 OOITA Y23 ARTIC Y71 XAC
RJFT	RJAA			DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJFT	RJGG		FL210+	DONAR Y41 NATCH Y755 CARDS
RJFT	RJGG		FL200-	DONAR URGIK BOTAN KABIL KRE V37 KEC Y415 NATCH Y755 CARDS
RJFT	RJNA			DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 KEC Y12 SHIMA
RJFT	RJNS			SPIDE Y23 ENSYU
RJFT	RJOO		for JET	SPIDE Y231 MIRIO Y401 KAINA Y753 IZUMI
RJFT	RJOO		for DH8D	MYE Y401 KAINA Y753 IZUMI
RJFT	RJOO		for PROP except DH8D	DONAR URGIK BOTAN KABIL KRE KAIFU Y403 KAINA Y753 IZUMI
RJFT	RJTT			SPIDE Y23 ARTIC Y71 XAC
RJFT	ROAH		for JET	HKC Y45 ONC Y525 IHEYA
RJFU	RJAA			OOITA Y41 DONAR URGIK BOTAN KABIL KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJFU	RJBB			OOITA Y351 SALTY Y35 IGLEV
RJFU	RJBE			OOITA Y351 SALTY Y35 URDET Y353 AVKUL
RJFU	RJDB			AKNAG Y251 IKE
RJFU	RJDB			IKE
RJFU	RJDT			AKNAG Y255 OMDUK
RJFU	RJDT			IKE HASMA AGATA

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJFU	RJFE			AKMEP CARCO Y40 FUE
RJFU	RJFE			CARCO V40 FUE
RJFU	RJGG			OOITA Y41 NATCH Y755 CARDS
RJFU	RJOO		for DH8D	OOITA Y40 MYE Y401 KAINA Y753 IZUMI
RJFU	RJOO		for JET	OOITA Y23 SPIDE Y231 MIRIO Y401 KAINA Y753 IZUMI
RJFU	RJTT			OOITA Y23 ARTIC Y71 XAC
RJFU	ROAH		for JET	KAZSA A582 HKC Y45 ONC Y525 IHEYA
RJGG	RJBB	ETA 2145-1344		ESPAN KEC Y43 KISEI Y46 EVERT
RJGG	RJBB	ETA 1345-2144		ESPAN KEC Y43 KISEI Y46 CANDY
RJGG	RJAA	EOBT 1350-2050		CBE MORIZ Y295 GAKKI Y55 LELIN Y79 GUPER Y81 RUTAS
RJGG	RJAA	EOBT 2051-1349		BOGON Y79 GUPER Y81 RUTAS
RJGG	RJCB			KCC Y312 GTC Y124 MQE Y111 IGDIP Y110 OBE
RJGG	RJCC	EOBT 1350-2050		CBE KCC STRAW KROBE Y13 SIRAO Y139 NAVER
RJGG	RJCC	EOBT 2051-1349		KCC KROBE Y13 SIRAO Y139 NAVER
RJGG	RJCH			KCC KROBE Y13 AKITA Y131 HINAI Y113 TAXIR
RJGG	RJCK			KCC Y312 GTC Y124 MQE Y111 CRANE
RJGG	RJCM			KCC Y312 GTC Y124 MQE Y111 OZORA
RJGG	RJEC			KCC KROBE Y13 CHE V7 AWE
RJGG	RJFF		FL240+ & for JET	HIKNE Y207 ARASI Y20 KIRIN
RJGG	RJFF		FL230- or for DH8D	HIKNE WAKIT PIONE Y28 MARCO Y256 STOUT Y20 KIRIN
RJGG	RJFK			ESPAN KEC Y24 SUC Y757 SPICA
RJGG	RJFM			ESPAN KEC Y24 SUC Y402 RYUGU
RJGG	RJFO			HIKNE WAKIT PIONE Y28 MARCO Y45 YANAI BAIEN TFE
RJGG	RJFT		FL200+	HIKNE WAKIT PIONE Y28 ONDOC Y452 OOITA Y40 KAZMA
RJGG	RJFT		FL190-	HIKNE WAKIT PIONE Y28 MARCO Y45 OOITA Y40 KAZMA
RJGG	RJFU		FL240+	HIKNE Y207 ARASI Y20 KAMMY Y204 OHGIE
RJGG	RJFU		FL230-	HIKNE WAKIT PIONE Y28 DGC Y204 OHGIE
RJGG	RJOK			ESPAN KEC Y24 TURFY Y242 PANCH
RJGG	RJOM			HIKNE WAKIT PIONE Y28 BAMBO Y283 ITUKI
RJGG	RJSK			KCC Y312 YAYOI
RJGG	RJSN			KCC Y312 MAGNA
RJGG	RJSS		FL240+	MORIZ TSUGU CHAUS Y151 MYOGI Y15 OWLET

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJGG	RJSS		FL230-	MORIZ TSUGU CHAUS Y155 TENRU Y88 GYODA Y882 ONUMA Y883 INAWA Y15 OWLET
RJGG	RJTT	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC
RJGG	RJTT	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC
RJGG	ROAH		for JET	ESPAN KEC Y12 LAXEL Y52 TONAR Y525 IHEYA
RJGG	ROIG			ESPAN KEC Y12 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 DIANA
RJGG	ROMY			ESPAN KEC Y12 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 YUTAH
RJKA	RJAA			POMAS Y574 SHIBK Y57 YULIA Y89 GUPER Y81 RUTAS
RJKA	RJBB			RURIK Y53 NIXOV
RJKA	RJFF			RURIK Y532 HKC Y504 GOKYO Y25 ISKUP
RJKA	RJFK			RURIK B597 TGE Y14 KINKO
RJKA	RJKB			PINNE B597 ONC
RJKA	RJKI			MUCHA
RJKA	RJKI			IKEJI
RJKA	RJKI			AME
RJKA	RJKN			YUWAN
RJKA	RJOO			RURIK Y53 MADOG Y753 IZUMI
RJKA	RJTT			POMAS Y574 SHIBK Y57 SUKBO Y571 BILLY Y21 AKSEL
RJKA	ROAH			YUWAN B597 ONC A582 NHC LAVON
RJKB	RJFK			NEORI MEKAX Y45 BOMAP Y455 KINKO
RJKB	RJKA			YUWAN
RJKB	RJKN			HORAI
RJKB	ROAH			ASATO YRE OKUMA A582 NHC LAVON
RJKB	RORY			ASATO YRE
RJKI	RJFK			POMAS Y457 SEPIA B597 TGE Y14 KINKO
RJKI	RJKA			BOROS
RJKI	RJKA			IKYUN
RJKI	RJKA			AME
RJKN	RJFK			ANOXA Y45 BOMAP Y455 KINKO
RJKN	RJKA			KINEN YUWAN
RJKN	RJKA			AME
RJKN	RJKB			TKE KUNIG ONC
RJNA	RJCO			HOUBA STRAW KROBE Y13 MRE Y113 HWE V2 MOIWA

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJNA	RJFF		FL240+ & for JET	TALMI HEIAN KAMMY Y20 KIRIN
RJNA	RJFF		FL230- or for DH8D	TALMI HEIAN WAKIT PIONE Y28 MARCO Y256 STOUT Y20 KIRIN
RJNA	RJFR			TALMI HEIAN WAKIT PIONE Y28 MARCO Y285 ASARI
RJNA	RJFT		FL200+	TALMI HEIAN WAKIT PIONE Y28 ONDOC Y452 OOITA Y40 KAZMA
RJNA	RJFT		FL190-	TALMI HEIAN WAKIT PIONE Y28 MARCO Y45 OOITA Y40 KAZMA
RJNA	RJOC			MIDER Y38 TOZAN Y188 RAKDA
RJNA	RJOK			SHIMA Y12 KEC Y24 TURFY Y242 PANCH
RJNA	RJSA			HOUBA STRAW KROBE Y13 AKITA Y131 HINAI Y113 MRE
RJNA	RJSC			HOUBA STRAW KROBE GTC Y512 ELDAK
RJNA	RJSI			HOUBA STRAW KROBE GTC ELBOR YTE Y153 SIOMO
RJNA	RJSN			HOUBA STRAW KROBE GTC
RJNK	RJAA			SUMVU GINJO NTE Y311 HISUI Y31 SYOEN Y517 ESKAS Y303 ENTAK Y30 SWAMP
RJNK	RJAA		FL230-	SUMVU GINJO NTE Y311 HISUI GTC Y303 ENTAK Y30 SWAMP
RJNK	RJCC			SUMVU GINJO NTE GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJNK	RJFF		FL240+ & for JET	SONBU Y45 MIHOU Y14 STOUT Y20 KIRIN
RJNK	RJFF		FL230- or for DH8D	SONBU Y45 MARCO Y256 STOUT Y20 KIRIN
RJNK	RJSS			SUMVU GINJO NTE Y311 HISUI GTC R217 SDE
RJNK	RJTT			OHNN0 Y383 KCC Y295 GAKKI Y71 XAC
RJNK	ROAH		for JET	SONBU Y45 ONC Y525 IHEYA
RJNO	RJOC			NAKAU
RJNO	RJOC			OKUNI
RJNO	RJOC			DOZEN V29 XZE
RJNO	RJOO			TSUNO Y38 ROKKO KAMEO OTABE ABENO IKOMA
RJNS	RJCC		FL250+	FUJIK SZE CHAUS Y151 MYOGI Y15 HEIKE Y153 YTE Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJNS	RJCC		FL240-	FUJIK SZE CHAUS Y155 TENRU Y88 GYODA Y882 ONUMA Y883 YTE Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJNS	RJCC		FL250+	CHAUS Y151 MYOGI Y15 HEIKE Y153 YTE Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJNS	RJCC		FL240-	CHAUS Y155 TENRU Y88 GYODA Y882 ONUMA Y883 YTE Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJNS	RJCO		FL250+	FUJIK SZE CHAUS Y151 MYOGI Y15 HEIKE Y153 YTE Y113 HWE V2 MOIWA
RJNS	RJCO		FL240-	FUJIK SZE CHAUS Y155 TENRU Y88 GYODA Y882 ONUMA Y883 YTE Y113 HWE V2 MOIWA
RJNS	RJCO		FL250+	CHAUS Y151 MYOGI Y15 HEIKE Y153 YTE Y113 HWE V2 MOIWA
RJNS	RJCO		FL240-	CHAUS Y155 TENRU Y88 GYODA Y882 ONUMA Y883 YTE Y113 HWE V2 MOIWA
RJNS	RJFF		FL240+ & for JET	FUJIK GAKKI Y295 APILU Y207 ARASI Y20 KIRIN

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJNS	RJFF		FL240+ & for JET	SZE Y295 APILU Y207 ARASI Y20 KIRIN
RJNS	RJFF		FL230- or for DH8D	FUJIK GAKKI Y295 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJNS	RJFF		FL230- or for DH8D	SZE Y295 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJNS	RJFK			FUJIK GAKKI Y296 HANTO Y56 KEC Y24 SUC Y757 SPICA
RJNS	RJFK			SZE Y295 GAKKI Y296 HANTO Y56 KEC Y24 SUC Y757 SPICA
RJNS	RJFT		FL200+	FUJIK GAKKI Y295 KCC Y28 ONDOC Y452 OOITA Y40 KAZMA
RJNS	RJFT		FL190-	FUJIK GAKKI Y295 KCC Y28 MARCO Y45 OOITA Y40 KAZMA
RJNS	RJFT		FL200+	SZE Y295 KCC Y28 ONDOC Y452 OOITA Y40 KAZMA
RJNS	RJFT		FL190-	SZE Y295 KCC Y28 MARCO Y45 OOITA Y40 KAZMA
RJNS	RJOC			FUJIK GAKKI Y295 YME Y18 RAKDA
RJNS	RJOC			SZE Y295 YME Y18 RAKDA
RJNS	ROAH		for JET	MOSLO Y57 SUKBO Y52 TONAR Y525 IHEYA
RJNT	RJCC			NT001 HISUI Y311 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJNT	RJTT	ETA 2100-1359	FL240+	NT001 HISUI Y31 GUSGI Y10 GODIN
RJNT	RJTT	ETA 2100-1359	FL230-	NT001 HISUI GTC Y303 SASAP Y10 GODIN
RJNW	RJTT	ETA 2100-1359	FL240+	HISUI Y31 GUSGI Y10 GODIN
RJNW	RJTT	ETA 2100-1359	FL230-	HISUI GTC Y303 SASAP Y10 GODIN
RJOA	RJAA			BOLIG IKUNO MIDER Y71 SHTLE Y79 GUPER Y81 RUTAS
RJOA	RJCC			KIJYY TOZAN YME Y381 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJOA	RJSS			KIJYY TOZAN YME Y381 KMC Y515 LANCE
RJOA	RJTT			BOLIG IKUNO MIDER Y71 XAC
RJOA	ROAH		for JET	MARCO Y45 ONC Y525 IHEYA
RJOB	RJCC			CHIZU YME Y381 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJOB	RJTT			OLIVE HYOGO SANDA Y289 SHTLE Y71 XAC
RJOB	ROAH		for JET	WASYU Y28 MARCO Y45 ONC Y525 IHEYA
RJOC	RJCC			MIHOU Y45 KMC Y381 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJOC	RJFF		for PROP except DH8D	CARPS Y45 MARCO V28 DGC
RJOC	RJNA			TSUNO Y38 MIDER Y28 KCC
RJOC	RJNA			XZE G597 TRE TOZAN Y38 MIDER Y28 KCC
RJOC	RJNO			TAKHI
RJOC	RJNO			SAIGO
RJOC	RJNO			DOZEN V29 OIE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJOC	RJNS			TSUNO Y38 MIDER Y71 GAKKI Y551 ENSYU
RJOC	RJOO			TSUNO Y38 ROKKO KAMEO OTABE ABENO IKOMA
RJOC	RJSS			MIHOU Y45 KMC Y515 LANCE
RJOC	RJTT			TSUNO Y38 MIDER Y71 XAC
RJOH	RJCC			YAPPA INABA KUMIK KMC Y381 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RJOH	RJTT			YAPPA INABA YME Y295 GAKKI Y71 XAC
RJOI	RJTT			MALTA Y33 SHOOT Y71 XAC
RJOI	ROAH		for JET	MYE Y40 OOITA Y45 ONC Y525 IHEYA
RJOK	RJAA			MUROT MIYAT MERID KEC Y43 ISEBI Y81 RUTAS
RJOK	RJBB			KRE V53 KTE
RJOK	RJBE			RUSEV Y537 LOVGI Y353 AVKUL
RJOK	RJFF			OMOGO V56 MARCO Y256 STOUT Y20 KIRIN
RJOK	RJFF		for PROP except DH8D	KRE V56 MARCO V28 DGC
RJOK	RJGG			MUROT MIYAT MERID KEC Y415 NATCH Y755 CARDS
RJOK	RJNA			MUROT MIYAT MERID KEC Y12 SHIMA
RJOK	RJOO			KAIFU Y403 KAINA Y753 IZUMI
RJOK	RJTT			MUROT MIYAT MERID KEC Y43 MENUR Y21 AKSEL
RJOM	RJAA			SAKAR KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJOM	RJAA			MYE V56 KRE V37 PADOC Y43 ISEBI Y81 RUTAS
RJOM	RJBB			SAKAR JINBE URDET Y35 IGLEV
RJOM	RJCC			MYE Y33 LABEL Y121 CBE V52 KCC Y312 UWE Y32 MRE Y13 SIRAO Y139 NAVER
RJOM	RJFF			MARCO Y256 STOUT Y20 KIRIN
RJOM	RJFF		for PROP except DH8D	MYE V56 MARCO V28 DGC
RJOM	RJFK			SHONO Y40 OOITA Y45 HKC
RJOM	RJGG			SAKAR KRE V37 PADOC Y43 KEC Y415 NATCH Y755 CARDS
RJOM	RJGG			SAKAR KRE V37 KEC Y415 NATCH Y755 CARDS
RJOM	RJGG			MYE V56 KRE V37 PADOC Y43 KEC Y415 NATCH Y755 CARDS
RJOM	RJGG			MYE V56 KRE V37 KEC Y415 NATCH Y755 CARDS
RJOM	RJOO		FL160+ & for DH8D	SAKAR JINBE Y401 KAINA Y753 IZUMI
RJOM	RJOO		FL160+ & for DH8D	MYE Y401 KAINA Y753 IZUMI
RJOM	RJOO		FL160+ & for JET	SAKAR ROSIE Y231 MIRIO Y401 KAINA Y753 IZUMI
RJOM	RJOO		FL160+ & for JET	MYE Y412 ROSIE Y231 MIRIO Y401 KAINA Y753 IZUMI

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJOM	RJOO		FL150-	MYE V56 KRE KAIFU IZARI MIKAN IZUMI
RJOM	RJSS			MYE Y33 LABEL Y121 SWING Y88 TENRU Y15 OWLET
RJOM	RJTT			SAKAR KRE V37 PADOX Y43 MENUR Y21 AKSEL
RJOM	RJTT			MYE V56 KRE V37 PADOX Y43 MENUR Y21 AKSEL
RJOM	ROAH		for JET	SHONO Y40 OOITA Y45 ONC Y525 IHEYA
RJOO	RJAA			ASUKA SHTLE Y79 GUPER Y81 RUTAS
RJOO	RJAF			MINAC YOKKA KCC Y88 SWING Y121 MBE
RJOO	RJBT			TIGER ASAGI
RJOO	RJCC			MINAC GUJYO Y13 SIRAO Y139 NAVER
RJOO	RJCH			MINAC GUJYO Y13 AKITA Y131 HINAI Y113 TAXIR
RJOO	RJCK			MINAC YOKKA KCC Y312 GTC Y124 MQE Y111 CRANE
RJOO	RJCM			MINAC YOKKA KCC Y312 GTC Y124 MQE Y111 OZORA
RJOO	RJEC			MINAC GUJYO Y13 CHE V7 AWE
RJOO	RJFC			TIGER MAIKO AWAJI Y232 KRE V53 SUC B597 TGE
RJOO	RJFF		FL240+ & for JET	TIGER SUMAR AYAME SETOH SOUJA Y281 STOUT Y20 KIRIN
RJOO	RJFF		FL230- or for DH8D	TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 MARCO Y256 STOUT Y20 KIRIN
RJOO	RJFG			TIGER MAIKO AWAJI Y232 KRE V53 SUC B597 TGE
RJOO	RJFK			TIGER MAIKO AWAJI Y232 KRE Y756 VIRUD Y757 SPICA
RJOO	RJFM			TIGER MAIKO AWAJI Y232 SIROK Y402 RYUGU
RJOO	RJFO			TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 MARCO Y45 YANAI BAIEN TFE
RJOO	RJFT		FL200+	TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 ONDOC Y452 OOITA Y40 KAZMA
RJOO	RJFT		FL190-	TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 MARCO Y45 OOITA Y40 KAZMA
RJOO	RJFU		FL240+	TIGER SUMAR AYAME SETOH SOUJA Y281 UKELI Y204 OHGIE
RJOO	RJFU		FL230-	TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 DGC Y204 OHGIE
RJOO	RJGG			ITE MIDER Y28 BIWWA
RJOO	RJKA		FL220+	TIGER MAIKO Y75 ALTAI Y758 TUMGI
RJOO	RJKA		FL210-	TIGER MAIKO AWAJI Y232 KRE V53 SUC B597 TUMGI
RJOO	RJNA			ITE MIDER Y28 KCC
RJOO	RJNO			TIGER ASAGI TOZAN Y38 TSUNO
RJOO	RJOC			TIGER ASAGI TOZAN Y188 RAKDA
RJOO	RJOK			TIGER SUMAR AYAME Y282 POPPY
RJOO	RJOM			TIGER SUMAR AYAME SETOH ONOPA WASYU Y28 BAMBO Y283 ITUKI

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJOO	RJOW			TIGER ASAGI TOZAN Y38 ADLEB Y143 SAMBA BLUES
RJOO	RJSA			MINAC GUJYO Y13 AKITA Y131 HINAI Y113 MRE
RJOO	RJSC			MINAC YOKKA KCC Y312 GTC Y512 ELDAK
RJOO	RJSF			MINAC YOKKA KCC Y88 DAIGO
RJOO	RJSI			MINAC YOKKA KCC Y312 GTC ELBOR YTE Y153 SIOMO
RJOO	RJSK			MINAC YOKKA KCC Y312 YAYOI
RJOO	RJSM			MINAC YOKKA KCC Y312 GTC Y124 HANKA Y11 SAMBO V10 MIS
RJOO	RJSN			MINAC YOKKA KCC Y312 MAGNA
RJOO	RJSS			MINAC YOKKA KCC Y88 TENRU Y15 OWLET
RJOO	RJSS		FL230-	MINAC YOKKA KCC Y88 GYODA Y882 ONUMA Y883 INAWA Y15 OWLET
RJOO	RJTT			ASUKA SHTLE Y71 XAC
RJOO	ROAH		for JET	TIGER MAIKO Y75 ONC Y525 IHEYA
RJOO	ROIG			TIGER MAIKO Y75 SWANO Y26 YURIX Y62 GANAS Y576 DIANA
RJOR	RJTT			MARUB YME Y295 GAKKI Y71 XAC
RJOS	RJFF			KTE UTAZU WASYU Y28 MARCO Y256 STOUT Y20 KIRIN
RJOS	RJFF		for PROP except DH8D	TSC KULUL KTE UTAZU WASYU V28 DGC
RJOS	RJTT			HONMA KMANO KILAP Y43 MENUR Y21 AKSEL
RJOT	RJAA			OLIVE HYOGO SANDA Y289 SHTLE Y79 GUPER Y81 RUTAS
RJOT	RJTT			OLIVE HYOGO SANDA Y289 SHTLE Y71 XAC
RJOT	ROAH		for JET	WASYU Y28 MARCO Y45 ONC Y525 IHEYA
RJOW	RJOO			VIBEL Y143 ADLEB Y38 ROKKO KAMEO OTABE ABENO IKOMA
RJOW	RJTT			VIBEL Y143 ADLEB Y38 MIDER Y71 XAC
RJSA	RJBE			UWE V31 GTC Y45 KMC Y382 WAKIT Y201 TRACY
RJSA	RJCC			OHMAR Y13 SIRAO Y139 NAVER
RJSA	RJCC		for PROP	OHMAR Y13 MEKAB Y137 NONUT Y11 NAVER
RJSA	RJNA			UWE V31 GTC Y12 MBE Y121 SWING
RJSA	RJOO			UWE V31 GTC Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSA	RJOO		FL230-	UWE V31 GTC Y312 AZUMI Y155 MBE Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSA	RJTT	ETA 2100-1359		UWE Y320 RUBIS Y10 GODIN
RJSC	RJCC		FL250+	HANKA Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJSC	RJCC		FL240-	HANKA Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJSC	RJNA			GTC Y12 MBE Y121 SWING

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJSC	RJOO			GTC Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSC	RJTT	ETA 2100-1359		RUBIS Y10 GODIN
RJSF	RJBB	ETA 2145-1344		NASNO Y880 NIKKO Y88 NAKTU Y12 KOHWA Y544 DUBKA
RJSF	RJBB	ETA 1345-2144		NASNO Y880 NIKKO Y88 NAKTU Y12 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
RJSF	RJCC		FL250+	HATRI Y115 SHIRO Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJSF	RJCC		FL240-	HATRI Y115 SHIRO Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJSF	RJCC		for PROP	HATRI Y115 SHIRO Y11 SAMBO Y135 MRE Y13 MEKAB Y137 NONUT Y11 NAVER
RJSF	RJOO			NASNO Y880 NIKKO Y88 NAKTU Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSI	RJBE			HANKA Y124 GTC Y45 KMC Y382 WAKIT Y201 TRACY
RJSI	RJCC			SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJSI	RJFF		FL260+ & for JET	HANKA Y124 GTC Y142 SAMON Y14 STOUT Y20 KIRIN
RJSI	RJFF		FL240 & for JET	HANKA Y124 GTC Y45 MIHOU Y14 STOUT Y20 KIRIN
RJSI	RJFF		FL230- or for DH8D	HANKA Y124 GTC Y45 MARCO Y256 STOUT Y20 KIRIN
RJSI	RJNA			HANKA Y124 GTC Y12 MBE Y121 SWING
RJSI	RJOO			HANKA Y124 GTC Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSK	RJCC			MRE Y13 SIRAO Y139 NAVER
RJSK	RJCC		for PROP	MRE Y13 MEKAB Y137 NONUT Y11 NAVER
RJSK	RJGG			GTC Y312 AZUMI Y155 MBE Y121 SWING
RJSK	RJOO			GTC Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSK	RJOO			GTC Y312 AZUMI Y155 MBE Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSK	RJTT	ETA 2100-1359		YTE Y32 RUBIS Y10 GODIN
RJSM	RJOO			HPE Y124 GTC Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSM	RJTT	ETA 2100-1359		HPE Y10 GODIN
RJSN	RJAA			MOKBA TAMBO VIKET Y303 ENTAK Y30 SWAMP
RJSN	RJBB			MOKBA TERAD Y45 KMC Y386 PEPAR Y36 ATMUG
RJSN	RJBE			MOKBA TERAD Y45 KMC Y382 WAKIT Y201 TRACY
RJSN	RJCC			KENSI Y312 UWE Y32 MRE Y13 SIRAO Y139 NAVER
RJSN	RJCC		for PROP	KENSI Y312 UWE Y32 MRE Y13 MEKAB Y137 NONUT Y11 NAVER
RJSN	RJFF		FL240+ & for JET	MOKBA TERAD Y45 MIHOU Y14 STOUT Y20 KIRIN
RJSN	RJFF		FL230- or for DH8D	MOKBA TERAD Y45 MARCO Y256 STOUT Y20 KIRIN
RJSN	RJGG			MOKBA NAEBA Y312 AZUMI Y155 MBE Y121 SWING
RJSN	RJNA			MOKBA NAEBA Y312 AZUMI Y155 MBE Y121 SWING

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJSN	RJOO			MOKBA NAEBA Y312 AZUMI Y155 MBE Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSN	ROAH		for JET	MOKBA TERAD Y45 ONC Y525 IHEYA
RJSR	RJTT	ETA 2100-1359		UWE Y320 RUBIS Y10 GODIN
RJSS	RJBB	ETA 2145-1344		RIKYU Y882 GYODA Y88 NAKTU Y12 KOHWA Y544 DUBKA
RJSS	RJBB	ETA 1345-2144		RIKYU Y882 GYODA Y88 NAKTU Y12 KEC Y43 KISEI Y46 CANDY
RJSS	RJAA			IXE R211 SWAMP
RJSS	RJBE			RIKYU Y882 GYODA Y88 SUGAL Y20 WAKIT Y201 TRACY
RJSS	RJCC		FL250+	SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJSS	RJCC		FL240-	SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJSS	RJCC		for PROP	SAMBO Y135 MRE Y13 MEKAB Y137 NONUT Y11 NAVER
RJSS	RJCC			SDE TAKRA YTE V13 KAMDO KOJYO NAVER
RJSS	RJFF		FL260+ & for JET	GTC Y142 SAMON Y14 STOUT Y20 KIRIN
RJSS	RJFF		FL240 & for JET	GTC Y45 MIHOU Y14 STOUT Y20 KIRIN
RJSS	RJFF		FL230- or for DH8D	GTC Y45 MARCO Y256 STOUT Y20 KIRIN
RJSS	RJGG			RIKYU Y882 GYODA Y88 SUGAL Y881 SLIDE
RJSS	RJNK			GTC Y45 IMIZU
RJSS	RJOA			GTC Y45 KMC Y382 WAKIT Y20 KAMMY Y202 AMURO
RJSS	RJOC			GTC Y45 KMC Y381 YME Y18 RAKDA
RJSS	RJOM			GTC Y45 KMC Y382 WAKIT Y282 ASANO Y28 BAMBO Y283 ITUKI
RJSS	RJOO			RIKYU Y882 GYODA Y88 NAKTU Y12 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJSS	ROAH		for JET	RIKYU Y882 GYODA Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 IHEYA
RJSY	RJTT	ETA 2100-1359		ZUNDA Y32 RUBIS Y10 GODIN
RJTH	RJTT			TOPIT Y875 AROSA
RJTT	RJBB	EOBT 2051-1339 &ETA 1345-2144		LAXAS Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
RJTT	RJBB	EOBT 2051-1339 &ETA 2145-1344		LAXAS Y56 TOHME Y54 KOHWA Y544 DUBKA
RJTT	RJBB	EOBT 1340-2050 &ETA 1345-2144		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
RJTT	RJBB	EOBT 1340-2050 &ETA2145-1344		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y544 DUBKA
RJTT	RJAA	EOBT 2051-1339		RUTAS
RJTT	RJAA	EOBT 1340-2050		OPPAR UTIBO RUTAS

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJTT	RJBD	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 RAYJO
RJTT	RJBE	EOBT 2051-1339		NINOX Y28 IPLES Y207 ARASI Y20 WAKIT Y201 TRACY
RJTT	RJCB	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y111 IGDIP Y110 OBE
RJTT	RJCC	EOBT 1340-2050	FL250+	OPPAR JYOGA Y371 YONOH Y373 SANOH Y882 ONUMA Y883 YTE Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJTT	RJCC	EOBT 1340-2050	FL240-	OPPAR JYOGA Y371 YONOH Y373 SANOH Y882 ONUMA Y883 YTE Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJTT	RJCC	EOBT 2051-1339	FL250+	BRUCE AGRIS Y11 SAMBO Y119 OHMAR Y13 SIRAO Y139 NAVER
RJTT	RJCC	EOBT 2051-1339	FL240-	BRUCE AGRIS Y11 SAMBO Y135 MRE Y13 SIRAO Y139 NAVER
RJTT	RJCH	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y113 TAXIR
RJTT	RJCK	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y111 CRANE
RJTT	RJCM	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y111 OZORA
RJTT	RJCN	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y111 TCE V2 MASHU
RJTT	RJCW	EOBT 2051-1339		BRUCE AGRIS Y11 CHE Y10 YOROI V1 WKE
RJTT	RJDC	EOBT 2051-1339		NINOX Y28 MARCO Y284 UBE
RJTT	RJEB	EOBT 2051-1339		BRUCE AGRIS Y11 NAVER Y139 ASIBE Y116 AWE V8 MVE
RJTT	RJEC	EOBT 2051-1339		BRUCE AGRIS Y11 NAVER Y139 ASIBE V7 AWE
RJTT	RJFF	EOBT 2051-1339	FL240+ & for JET	TIARA GUSRO Y20 KIRIN
RJTT	RJFF	EOBT 2051-1339	FL240+ & for JET only for pre-coordination flight	GUSRO Y20 KIRIN
RJTT	RJFF	EOBT 2051-1339	FL240+ & for JET only for pre-coordination flight	LAYER TIARA GUSRO Y20 KIRIN
RJTT	RJFF	EOBT 2051-1339	FL230- or for DH8D	TIARA GUSRO Y20 SUGAL Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJTT	RJFF	EOBT 2051-1339	FL230- or for DH8D only for pre-coordination flight	GUSRO Y20 SUGAL Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJTT	RJFF	EOBT 2051-1339	FL230- or for DH8D only for pre-coordination flight	LAYER TIARA GUSRO Y20 SUGAL Y88 KCC Y28 MARCO Y256 STOUT Y20 KIRIN
RJTT	RJFK	EOBT 2051-1339		LAXAS Y56 TOHME Y54 TURFY Y24 SUC Y757 SPICA
RJTT	RJFK	EOBT 2051-1339	FL250-	LAXAS Y56 TOHME Y54 KOHWA Y12 KEC Y24 SUC Y757 SPICA
RJTT	RJFM	EOBT 2051-1339		LAXAS Y56 TOHME Y54 RUPAP Y244 GREEN Y24 SUC Y402 RYUGU
RJTT	RJFM	EOBT 2051-1339	FL250-	LAXAS Y56 TOHME Y54 KOHWA Y12 KEC Y24 SUC Y402 RYUGU
RJTT	RJFO	EOBT 2051-1339		NINOX Y28 MARCO Y45 YANAI BAIEN TFE
RJTT	RJFR	EOBT 2051-1339		NINOX Y28 MARCO Y285 ASARI
RJTT	RJFR	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y38 MIDER Y28 MARCO Y285 ASARI
RJTT	RJFS	EOBT 2051-1339	FL200+	NINOX Y28 ONDOC Y452 OOITA Y40 MILEP UGAMU SGE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJTT	RJFS	EOBT 2051-1339	FL190-	NINOX Y28 MARCO Y45 OOITA Y40 MILEP UGAMU SGE
RJTT	RJFT	EOBT 2051-1339	FL200+	NINOX Y28 ONDOC Y452 OOITA Y40 KAZMA
RJTT	RJFT	EOBT 2051-1339	FL190-	NINOX Y28 MARCO Y45 OOITA Y40 KAZMA
RJTT	RJFU	EOBT 2051-1339	FL240+	TIARA GUSRO Y20 KAMMY Y204 OHGIE
RJTT	RJFU	EOBT 2051-1339	FL230-	TIARA GUSRO Y20 SUGAL Y88 KCC Y28 DGC Y204 OHGIE
RJTT	RJFU	EOBT 2051-1339	only for pre-coordination flight	GUSRO Y20 KAMMY Y204 OHGIE
RJTT	RJFU	EOBT 2051-1339	only for pre-coordination flight	LAYER TIARA GUSRO Y20 KAMMY Y204 OHGIE
RJTT	RJGG	EOBT 2051-1339		BEKLA Y18 PIGAP Y88 SUGAL Y881 SLIDE
RJTT	RJGG	EOBT 1340-2050		OPPAR JYOGA Y371 YONOH Y373 SANOH Y882 GYODA Y88 SUGAL Y881 SLIDE
RJTT	RJKA	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y521 TUMGI
RJTT	RJNK	EOBT 2051-1339	FL240+	BEKLA Y884 KMC
RJTT	RJNK	EOBT 2051-1339	FL230-	BEKLA Y18 PIGAP Y88 KCC Y383 KMC
RJTT	RJNT	EOBT 2051-1339	FL240+	BEKLA Y885 URUSI
RJTT	RJNT	EOBT 2051-1339	FL230-	BEKLA Y18 PIGAP Y88 KCC Y383 KMC Y45 URUSI
RJTT	RJNW	EOBT 2051-1339	FL240+	BEKLA Y885 AZUMI Y155 HAPPO
RJTT	RJNW	EOBT 2051-1339	FL230-	BEKLA Y18 PIGAP Y88 KCC Y383 KMC Y45 URUSI NTE
RJTT	RJOA	EOBT 2051-1339		TIARA GUSRO Y20 KAMMY Y202 AMURO
RJTT	RJOA	EOBT 2051-1339	only for pre-coordination flight	GUSRO Y20 KAMMY Y202 AMURO
RJTT	RJOA	EOBT 2051-1339	only for pre-coordination flight	LAYER TIARA GUSRO Y20 KAMMY Y202 AMURO
RJTT	RJOB	EOBT 2051-1339		NINOX Y28 IPLES Y207 ARASI Y20 WAKIT Y205 OYE
RJTT	RJOC	EOBT 2051-1339		BEKLA Y18 RAKDA
RJTT	RJOC	EOBT 2051-1339		BEKLA Y18 YME Y186 TRE G597 XZE
RJTT	RJOH	EOBT 2051-1339		BEKLA Y18 RAKDA
RJTT	RJOI	EOBT 2051-1339		NINOX Y28 MARCO
RJTT	RJOK	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 KEC Y24 TURFY Y242 PANCH
RJTT	RJOM	EOBT 2051-1339		NINOX Y28 BAMBO Y283 ITUKI
RJTT	RJOO	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y546 AGPUK MIRAI ABENO IKOMA
RJTT	RJOR	EOBT 2051-1339		BEKLA Y18 YME Y186 TRE
RJTT	RJOS	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y544 SINGU Y542 DATIS
RJTT	RJOT	EOBT 2051-1339		NINOX Y28 IPLES Y207 ARASI Y20 WAKIT Y203 WIMPY
RJTT	RJOW	EOBT 2051-1339		BEKLA Y18 ORUDA Y143 SAMBA BLUES
RJTT	RJSA	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y113 MRE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
RJTT	RJSC	EOBT 2051-1339		BRUCE AGRIS Y11 SHIRO Y157 IBELU
RJTT	RJSK	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y32 CHOKA
RJTT	RJSM	EOBT 2051-1339		BRUCE AGRIS Y11 SAMBO V10 MIS
RJTT	RJSR	EOBT 2051-1339		BRUCE AGRIS Y11 YTE Y32 UWE Y312 ODE
RJTT	RJSY	EOBT 2051-1339		BRUCE AGRIS Y11 SHIRO Y115 USUBA YSE
RJTT	RJTH	EOBT 2051-1339		VAMOS XAC V18 HCE
RJTT	ROAH	EOBT 2051-1339	for JET	LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 IHEYA
RJTT	ROAH	EOBT 1340-2050	for JET	OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 IHEYA
RJTT	ROIG	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 DIANA
RJTT	ROKJ	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC A582 NHC LAVON GURUX DORIS
RJTT	ROMY	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 YUTAH
RJTT	RORS	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 DIANA
ROAH	RJAA			AMAMI Y574 SHIBK Y57 YULIA Y89 GUPER Y81 RUTAS
ROAH	RJAH			AMAMI Y574 SHIBK Y57 YULIA Y575 ALBAT Y755 CARDS HIOTI CBE Y121 SWING Y88 DAIGO Y887 TATSU NAKAH
ROAH	RJBB			AMAMI Y53 NIXOV
ROAH	RJBE			AMAMI Y53 SUC Y537 LOVGI Y353 AVKUL
ROAH	RJCC			AMAMI Y25 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
ROAH	RJFF			AMAMI Y25 ISKUP
ROAH	RJFK			AMAMI Y25 BOMAP Y455 KINKO
ROAH	RJFM			AMAMI Y53 RURIK B597 JACKY MZE
ROAH	RJFR			AMAMI Y25 BOMAP Y45 HKC Y14 DGC V28 SWE
ROAH	RJFT			AMAMI Y25 KOSHI Y501 SASIK Y14 HINAG
ROAH	RJFU			AMAMI Y25 KOSHI Y501 ADNOK Y504 HONDO OLE
ROAH	RJGG			AMAMI Y574 SHIBK Y57 YULIA Y575 ALBAT Y755 CARDS
ROAH	RJKA			ONC B597 YUWAN
ROAH	RJKB			ONC
ROAH	RJNK			AMAMI Y25 BOMAP Y45 SONBU
ROAH	RJNS			AMAMI Y574 SHIBK Y57 MOSLO
ROAH	RJOA			AMAMI Y25 BOMAP Y45 MARCO Y453 SUNFL MISEN HGE
ROAH	RJOB			AMAMI Y25 BOMAP Y45 OOITA Y40 MYE Y283 KINOE Y288 INOOK OYE
ROAH	RJOI			AMAMI Y25 BOMAP Y45 OOITA Y40 MYE
ROAH	RJOM			AMAMI Y25 BOMAP Y45 OOITA Y40 MYE

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
ROAH	RJOO		AMAMI Y53 MADOG Y753 IZUMI	
ROAH	RJOT		AMAMI Y25 BOMAP Y45 OOITA Y40 MYE Y283 KINOE Y288 TAKMA KTE	
ROAH	RJSN		AMAMI Y25 BOMAP Y45 MIHOU Y14 SAMON Y142 GTC	
ROAH	RJSS		AMAMI Y574 SHIBK Y57 YULIA Y575 ALBAT Y755 CARDS HIOTI CBE Y121 SWING Y88 TENRU Y15 OWLET	
ROAH	RJTT		AMAMI Y574 SHIBK Y57 SUKBO Y571 BILLY Y21 AKSEL	
ROAH	ROIG		GANJU Y576 DIANA	
ROAH	ROIG		OLVAL V91 MJC V90 IGE	
ROAH	ROKJ		DORIS	
ROAH	ROMD		ESKOB V75 BUICK Q1 WHALE	
ROAH	ROMD		LAVON NHC V75 MDE	
ROAH	ROMY		GANJU Y576 YUTAH	
ROAH	ROMY		OLVAL V91 MJC	
ROAH	RORK		ESKOB V75 BUICK Q1 WHALE	
ROAH	RORK		LAVON NHC V75 MDE	
ROAH	RORS		GANJU Y576 DIANA	
ROAH	RORY		YRE	
ROAH	ROYN		GANJU Y576 IGE KOHAM AYAKA	
ROIG	RJAA		MJC Y57 YULIA Y89 GUPER Y81 RUTAS	
ROIG	RJBB		MJC Y57 TAMAK AME B597 RURIK Y53 NIXOV	
ROIG	RJFF		MJC Y62 BOMAP Y25 ISKUP	
ROIG	RJGG		MJC Y57 YULIA Y575 ALBAT Y755 CARDS	
ROIG	RJOO		MJC Y57 TAMAK AME B597 RURIK Y53 MADOG Y753 IZUMI	
ROIG	RJTT		MJC Y57 SUKBO Y571 BILLY Y21 AKSEL	
ROIG	ROAH		MJC Y57 VELNO	
ROIG	ROAH		GUSUK V90 MJC V91 OLVAL	
ROIG	ROMY		GAHRA MJC	
ROIG	ROYN		AYAKA	
ROKJ	RJTT		DORIS GURUX LAVON NHC Y74 AZAMA Y57 SUKBO Y571 BILLY Y21 AKSEL	
ROKJ	ROAH		DORIS GURUX LAVON	
ROMD	ROAH		CORCO Q1 BUICK V75 NHC LAVON	
ROMD	ROAH		TOPAT V75 NHC LAVON	
ROMY	RJBB		FREED Y57 TAMAK AME B597 RURIK Y53 NIXOV	

CHANGE OF FLIGHT PLANNED ROUTES (Domestic)

DEP	DEST	Time Restriction	Remarks	Routes
ROMY	RJFF			FREED Y57 TAMAK AME ANOXA Y45 BOMAP Y25 ISKUP
ROMY	RJGG			FREED Y57 YULIA Y575 ALBAT Y755 CARDS
ROMY	RJTT			FREED Y57 SUKBO Y571 BILLY Y21 AKSEL
ROMY	ROAH			FREED Y57 VELNO
ROMY	ROAH			PAYAO V91 OLVAL
ROMY	ROIG			UMAKI
ROMY	RORT			UMAKI
RORK	ROAH			CORCO Q1 BUICK V75 NHC LAVON
RORK	ROAH			MDE V75 NHC LAVON
RORS	RJAA			FREED Y57 YULIA Y89 GUPER Y81 RUTAS
RORS	RJBB			FREED Y57 TAMAK AME B597 RURIK Y53 NIXOV
RORS	RJBE			FREED Y57 TAMAK AME B597 RURIK Y53 SUC Y537 LOVGI Y353 AVKUL
RORS	RJTT			FREED Y57 SUKBO Y571 BILLY Y21 AKSEL
RORS	RJFF			FREED Y57 TAMAK AME ANOXA Y45 BOMAP Y25 ISKUP
RORS	ROAH			FREED Y57 VELNO
RORT	ROMY			GAHRA MJC
RORY	RJFK			ONC Y45 BOMAP Y455 KINKO
RORY	RJKB			MARIX
RORY	ROAH			OKUMA A582 NHC LAVON
ROYN	ROAH			AYAKA KOHAM IGE V90 MJC Y57 VELNO
ROYN	ROIG			AYAKA KOHAM IGE

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJAA	PAZA			GULBO Y808 IGARA Y815 MAKMU R580 OMOTO
RJAA	PAZA			GULBO Y808 PUTER A590 PASRO
RJAA	PAZA / KZAK			GULBO Y808 NOLAX Y812 ADNAP
RJAA	KZAK			GULBO Y808 NOLAX Y814 AVBET
RJAA	KZAK			BORLO Y830 LAPIL OTR13 SEALS
RJAA	KZAK			BORLO Y830 IPROS Y832 POVAL OTR15 MORAY
RJAA	KZAK			BORLO Y830 IPROS Y834 PIPIK OTR17 FERAR
RJAA	KZAK			OLVAN Y823 MERED Y821 DAGDA G223 TONIK
RJAA	KZAK			OLVAN Y823 MERED Y821 DAGDA A337 NOGAK
RJAA	KZAK			SAMUS Y84 HCE Y840 SABRI B586 UKATA
RJAA	KZAK			SAMUS Y84 HCE Y82 BOLED A339 TAXON
RJAA	UHHH			AGRI Y37 AVGOK
RJAA	UHHH			AGRI Y37 HAJI Y375 IGROD
RJAA	UHHH			KIMIN Y117 LEKOL Y119 SAMBO Y11 CHE Y10 LUMIN
RJAA	RKRR			ENPAR Y16 MADUL Y333 KAPPA Y332 IGRAS
RJAA	RKRR			ENPAR Y16 SAPRA
RJAA	RKRR			ENPAR Y16 TEPEX Y22 MIHOU Y206 KALEK
RJAA	RKRR			ENPAR Y16 TEPEX Y88 SUGAL Y20 IKE A595 SAMDO
RJAA	RKRR			REDEK Y60 ISAKY Y592 ONIKU
RJAA	RCAA			PIGOK Y50 IGMON A1 BULAN
RJAA	RCAA			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 KXC Y62 GANAS Y576 LILRA Y573 SEDKU
RJAA	RCAA			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y52 IGURU
RJAA	RPHI			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJAA	RPHI			SAMUS Y84 HCE Y86 YULIA Y293 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJAA	RPHI			SAMUS Y84 BUBDO A590 GURAG
PAZA	RJAA			NANAC Y810 OLDIV Y809 SUPOK
PAZA	RJAA			IPGUD Y802 OLDIV Y809 SUPOK
PAZA / KZAK	RJAA			ADNAP Y807 NOGIX Y802 OLDIV Y809 SUPOK
KZAK	RJAA			AVBET Y809 SUPOK
KZAK	RJAA			SEALS OTR13 LAPIL Y811 POROT Y809 SUPOK
KZAK	RJAA			MORAY ORT15 POVAL Y813 LUBLA
KZAK	RJAA			FERAR OTR17 SMOLT Y824 OLVEK Y817 MENIX Y813 LUBLA

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
KZAK	RJAA			BEGAD Y817 MENIX Y813 LUBLA
KZAK	RJAA			DAGDA Y819 OLVEK Y817 MENIX Y813 LUBLA
KZAK	RJAA			OMLET B586 SABRI Y873 FITTO Y87 BAFFY Y81 RUTAS
KZAK	RJAA			TAXON A339 MAPDO Y85 MOE Y81 RUTAS
UHHH	RJAA		FL330+	IGROD Y304 GUGBI Y30 SWAMP
UHHH	RJAA		FL320-	IGROD Y301 YTE Y304 GUGBI Y30 SWAMP
UHHH	RJAA		FL260+	LUMIN Y10 LARCH Y302 JUGEM Y30 SWAMP
UHHH	RJAA			BISIV Y116 CHE Y10 LARCH Y302 JUGEM Y30 SWAMP
UHHH	RJAA			ODERI Y109 UBRAS Y118 NOMOX Y112 OMGOL Y111 MQE Y30 SWAMP
RKRR	RJAA			IGRAS Y332 KAPPA Y333 DISSH Y51 SAMON Y517 ESKAS Y303 ENTAK Y30 SWAMP
RKRR	RJAA			LANAT Y51 SAMON Y517 ESKAS Y303 ENTAK Y30 SWAMP
RKRR	RJAA			KALEK Y206 MIHOU Y45 KMC Y515 ZUWAI Y517 ESKAS Y303 ENTAK Y30 SWAMP
RKRR	RJAA			SAMDO A595 DGC V28 MARCO V56 MYE Y412 ROSIE Y43 ISEBI Y81 RUTAS
RKRR	RJAA			BEDAR Y591 FUE Y23 KASTE Y81 RUTAS
RCAA	RJAA			MOLKA M750 MUKEP Y891 AGIMO Y89 GUPER Y81 RUTAS
RCAA	RJAA			IGURU Y57 YULIA Y89 GUPER Y81 RUTAS
RPHI	RJAA			MEVIN B462 KAZIK Y59 AZAMA Y57 YULIA Y89 GUPER Y81 RUTAS
RPHI	RJAA			LEBIX N884 ALBAX Y533 AZAMA Y57 YULIA Y89 GUPER Y81 RUTAS
RPHI	RJAA			GURAG A590 BUBDO Y83 MOE Y81 RUTAS
RJBB	PAZA	EOBT 2115-1329	for Eastern part of North America	NANKO NIKEX KYOTO SIGAK KCC Y88 DAIGO Y889 OATIS R580 OMOTO
RJBB	PAZA	EOBT 2115-1329	for Eastern part of North America	NANKO NIKEX KYOTO SIGAK KCC Y88 DAIGO Y889 PUTER A590 PASRO
RJBB	PAZA / KZAK	EOBT 2115-1329	for Eastern part of North America	NANKO NIKEX KYOTO SIGAK KCC Y88 DAIGO Y886 ADNAP
RJBB	PAZA	EOBT 2115-1329	for North America / Hawaii / Europe	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT Y577 MAKMU R580 OMOTO
RJBB	PAZA	EOBT 1330-2114	for North America / Hawaii / Europe	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT Y577 MAKMU R580 OMOTO
RJBB	PAZA	EOBT 2115-1329	for North America / Hawaii / Europe	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 PUTER A590 PASRO
RJBB	PAZA	EOBT 1330-2114	for North America / Hawaii / Europe	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 PUTER A590 PASRO
RJBB	PAZA / KZAK	EOBT 2115-1329	for North America / Hawaii / Europe	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT Y809 IDLAN Y812 ADNAP
RJBB	PAZA / KZAK	EOBT 1330-2114	for North America / Hawaii / Europe	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT Y809 IDLAN Y812 ADNAP

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJBB	KZAK	EOBT 2115-1329	for North America / Hawaii / Europe	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT OTR11 AVBET
RJBB	KZAK	EOBT 1330-2114	for North America / Hawaii / Europe	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 POROT OTR11 AVBET
RJBB	KZAK	EOBT 2115-1329	for North America / Hawaii	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RJBB	KZAK	EOBT 1330-2114	for North America / Hawaii	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RJBB	KZAK	EOBT 2115-1329	for North America / Hawaii	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RJBB	KZAK	EOBT 1330-2114	for North America / Hawaii	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RJBB	KZAK	EOBT 2115-1329	for North America / Hawaii	TOMOH DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RJBB	KZAK	EOBT 1330-2114	for North America / Hawaii	UPMIN DOPDA KEC Y43 ISEBI Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RJBB	KZAK	EOBT 2115-1329	for South Pacific / Australia	TOMOH DOPDA KEC Y47 BUBDO A597 TAXON
RJBB	KZAK	EOBT 1330-2114	for South Pacific / Australia	UPMIN DOPDA KEC Y47 BUBDO A597 TAXON
RJBB	UHHH	EOBT 2115-1329	for Europe	NANKO NIKEX KYOTO SIGAK GUJYO Y13 BASIN R211 AVGOK
RJBB	UHHH	EOBT 2115-1329	for Europe	NANKO NIKEX KYOTO SIGAK GUJYO Y13 BASIN R211 KADBO B451 IGROD
RJBB	UHHH		for Middle East / Korea / China / Europe	MAIKO AVLEX OLIVE V38 YME Y381 KMC Y45 GTC R211 AVGOK
RJBB	UHHH		for Middle East / Korea / China / Europe	MAIKO AVLEX OLIVE V38 YME V38 KMC V30 GTC R211 AVGOK
RJBB	UHHH		for Middle East / Korea / China / Europe	MAIKO AVLEX OLIVE V38 YME Y381 KMC Y45 GTC R211 KADBO B451 IGROD
RJBB	UHHH		for Middle East / Korea / China / Europe	MAIKO AVLEX OLIVE V38 YME V38 KMC V30 GTC R211 KADBO B451 IGROD
RJBB	RKRR		for Middle East / Korea / China / Europe	MAIKO OSRIX GUMID SOUJA Y324 STAGE Y38 SAPRA
RJBB	RKRR		for Middle East / Korea / China / Europe	MAIKO OSRIX GUMID SOUJA Y324 YAKMO Y206 KALEK
RJBB	RKRR	EOBT2115-1329	for VVNB / Korea / China	LINDA SHION HABAR Y60 ISAKY Y592 ONIKU
RJBB	RKRR	EOBT1330-2114	for Middle East / VVNB / Korea / China	MAIKO OSRIX SHION HABAR Y60 ISAKY Y592 ONIKU
RJBB	RKRR		for Middle East / Korea / China / Europe	MAIKO OSRIX GUMID SOUJA Y287 MIHOU Y332 IGRAS
RJBB	RCAA	EOBT 2115-1329	for Middle East/ Southeast Asia /-Taiwan	OMGOR Y34 HKC Y50 IGMON A1 BULAN
RJBB	RCAA	EOBT 2115-1329	Macau / Hong kong	OBLUR Y236 IVTER Y34 HKC Y50 IGMON A1 BULAN
RJBB	RCAA	EOBT 2115-1329	for Middle East/ Southeast Asia / Taiwan	OMGOR Y34 IVTER Y236 MULAB Y75 SWANO Y26 LILRA Y573 SEDKU
RJBB	RCAA	EOBT 2115-1329	Macau / Hong kong	OBLUR Y236 IVTER Y236 MULAB Y75 SWANO Y26 LILRA Y573 SEDKU

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJBB	RCAA	EOBT 2115-1329	for Middle East/ Southeast Asia / Taiwan	OMGOR Y34 IVTER Y236 MULAB Y75 SWANO Y26 IGURU
RJBB	RCAA	EOBT 2115-1329	Macau / Hong kong	OBLUR Y236 IVTER Y236 MULAB Y75 SWANO Y26 IGURU
RJBB	RCAA	EOBT 1330-2114	for Middle East/ Southeast Asia / Macau / Hong kong / Taiwan	UPMIN IVROG Y340 RUSUD Y75 IGBOD Y34 HKC Y50 IGMON A1 BULAN
RJBB	RCAA	EOBT 1330-2114	for Middle East/ Southeast Asia / Macau / Hong kong / Taiwan	UPMIN IVROG Y340 RUSUD Y75 SWANO Y26 LILRA Y573 SEDKU
RJBB	RCAA	EOBT 1330-2114	for Middle East/ Southeast Asia / Macau / Hong kong / Taiwan	UPMIN IVROG Y340 RUSUD Y75 SWANO Y26 IGURU
RJBB	RPHI	EOBT 2115-1329	for Middle East/ Southeast Asia / Taiwan	OMGOR Y34 IVTER Y236 MULAB Y75 SWANO Y26 YURIX Y62 KAZIK B462 MEVIN
RJBB	RPHI	EOBT 1330-2114	for Middle East/ Southeast Asia/Macau/Hong kong/Taiwan	UPMIN IVROG Y340 RUSUD Y75 SWANO Y26 YURIX Y62 KAZIK B462 MEVIN
RJBB	RPHI	EOBT 2115-1329	for Middle East/ Southeast Asia / Taiwan	OMGOR Y34 IVTER Y236 MULAB Y75 ONC Y579 SAKON A582 BISIG
RJBB	RPHI	EOBT 1330-2114	for Middle East/ Southeast Asia / Macau / Hong kong / Taiwan	UPMIN IVROG Y340 RUSUD Y75 ONC Y579 SAKON A582 BISIG
RJBB	RPHI	EOBT 2115-1329	for Southeast Asia / Taiwan	TOMOH DOPDA KEC Y47 BUBDO A590 GURAG
RJBB	RPHI	EOBT 1330-2114	for Southeast Asia / Macau / Hong kong / Taiwan	UPMIN DOPDA KEC Y47 BUBDO A590 GURAG
PAZA	RJBB	ETA 2145-1344		NANAC R220 IXE Y88 NAKTU Y12 KEC Y43 KISEI Y46 EVERT
PAZA	RJBB	ETA 1345-2144		NANAC R220 IXE Y88 NAKTU Y12 KEC Y43 KISEI Y46 CANDY
PAZA	RJBB	ETA 2145-1344		IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 KEC Y43 KISEI Y46 EVERT
PAZA	RJBB	ETA 1345-2144		IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 KEC Y43 KISEI Y46 CANDY
PAZA / KZAK	RJBB	ETA 2145-1344		ADNAP Y886 DAIGO Y88 NAKTU Y12 KEC Y43 KISEI Y46 EVERT
PAZA / KZAK	RJBB	ETA 1345-2144		ADNAP Y886 DAIGO Y88 NAKTU Y12 KEC Y43 KISEI Y46 CANDY
PAZA / KZAK	RJBB	ETA 2145-1344		ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
PAZA / KZAK	RJBB	ETA 1345-2144		ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
KZAK	RJBB	ETA 2145-1344		AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
KZAK	RJBB	ETA 1345-2144		AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
KZAK	RJBB	ETA 2145-1344		SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
KZAK	RJBB	ETA 1345-2144		SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
KZAK	RJBB	ETA 2145-1344		MORAY OTR15 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
KZAK	RJBB	ETA 1345-2144		MORAY OTR15 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
KZAK	RJBB	ETA 2145-1344		FERAR OTR17 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
KZAK	RJBB	ETA 1345-2144		FERAR OTR17 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
KZAK	RJBB	ETA 2145-1344		DAGDA Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 EVERT
KZAK	RJBB	ETA 1345-2144		DAGDA Y821 UTIBO Y502 TOKIS Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 KEC Y43 KISEI Y46 CANDY
KZAK	RJBB	ETA 2145-1344		BUBDO Y47 TAPOP Y46 EVERT
KZAK	RJBB	ETA 1345-2144		BUBDO Y47 TAPOP Y46 CANDY
UHHH	RJBB			IGROD Y347 GOLDO Y36 ATMUG
UHHH	RJBB			LUMIN Y10 CHE Y12 HWE Y14 GOLDO Y36 ATMUG
RKRR	RJBB			LANAT Y597 MIHOU Y361 SAEKI Y36 ATMUG
RKRR	RJBB			KALEK Y206 MIHOU Y361 SAEKI Y36 ATMUG
RKRR	RJBB			IGRAS Y332 MIHOU Y361 SAEKI Y36 ATMUG
RKRR	RJBB			BEDAR Y591 FUE Y35 IGLEV
RCAA	RJBB			MOLKA M750 MADOG Y53 NIXOV
RCAA	RJBB			IGURU Y26 SEPIA B597 MADOG Y53 NIXOV
RPHI	RJBB			MEVIN B462 KAZIK Y62 YURIX Y26 SEPIA B597 MADOG Y53 NIXOV
RPHI	RJBB			LEBIX N884 ALBAX Y531 YURIX Y26 SEPIA B597 MADOG Y53 NIXOV
RPHI	RJBB	ETA 2145-1344		GURAG A590 BUBDO Y47 TAPOP Y46 EVERT
RPHI	RJBB	ETA 1345-2144		GURAG A590 BUBDO Y47 TAPOP Y46 CANDY
RJBE	RKRR	EOBT 2200-1329		MUKRI ATKAS GUMID SOUJA Y324 STAGE Y38 SAPRA
RJBE	RKRR	EOBT 2200-1329		MUKRI ATKAS GUMID SOUJA Y324 YAKMO Y206 KALEK
RJBE	RKRR	EOBT 2200-1329		MUKRI ATKAS SHION WASYU Y28 ISAKY Y592 ONIKU
RJBE	RKRR	EOBT 2200-1329		MUKRI ATKAS GUMID SOUJA Y287 MIHOU Y332 IGRAS
RJBE	RCAA	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 IGBOD Y34 HKC Y50 IGMON A1 BULAN
RJBE	RCAA	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 SWANO Y26 LILRA Y573 SEDKU
RJBE	RCAA	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 SWANO Y26 IGURU
RJBE	RPHI	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 SWANO Y26 YURIX Y62 KAZIK B462 MEVIN
RJBE	RPHI	EOBT 2200-1329		MUKRI ATKAS TANTA Y75 ONC Y579 SAKON A582 BISIG
RKRR	RJBE			LANAT Y597 MIHOU Y39 OYE V28 OMBIP
RKRR	RJBE			KALEK Y206 MIHOU Y39 OYE V28 OMBIP
RKRR	RJBE			IGRAS Y332 MIHOU Y39 OYE V28 OMBIP

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RKRR	RJBE			BEDAR Y591 FUE Y35 URDET Y353 AVKUL
RCAA	RJBE			MOLKA M750 MADOG Y53 SUC Y537 LOVGI Y353 AVKUL
RCAA	RJBE			IGURU Y26 SEPIA B597 MADOG Y53 SUC Y537 LOVGI Y353 AVKUL
RPHI	RJBE			MEVIN B462 KAZIK Y62 YURIX Y26 SEPIA B597 MADOG Y53 SUC Y537 LOVGI Y353 AVKUL
RPHI	RJBE			LEBIX N884 ALBAX Y531 YURIX Y26 SEPIA B597 MADOG Y53 SUC Y537 LOVGI Y353 AVKUL
RJCC	PAZA / KZAK			RAKNO V6 OBE OTR1 NANNO
RJCC	RKRR	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y332 IGRAS
RJCC	RKRR	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 SUGNO Y16 SAPRA
RJCC	RKRR	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y206 KALEK
RJCC	RKRR	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y14 DGC Y28 ISAKY Y592 ONIKU
RJCC	RKRR	EOBT 1245-2200		CHE MKE HWE Y14 MIHOU Y332 IGRAS
RJCC	RKRR	EOBT 1245-2200		CHE MKE HWE Y14 SUGNO Y16 SAPRA
RJCC	RKRR	EOBT 1245-2200		CHE MKE HWE Y14 MIHOU Y206 KALEK
RJCC	RKRR	EOBT 1245-2200		CHE MKE HWE Y14 DGC Y28 ISAKY Y592 ONIKU
RJCC	RCAA	EOBT 2201-1244		DALBI Y120 TAPPI Y12 AYANO Y128 LAXEL Y52 IGURU
RJCC	RCAA	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN
RJCC	RCAA	EOBT 2201-1244		DALBI Y120 TAPPI Y12 ARIKA Y14 MIHOU Y45 BOMAP Y62 YURIX Y26 LILRA Y573 SEDKU
RJCC	RCAA	EOBT 1245-2200		CHE MKE HWE Y12 AYANO Y128 LAXEL Y52 IGURU
RJCC	RCAA	EOBT 1245-2200		CHE MKE HWE Y12 ARIKA Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN
RJCC	RCAA	EOBT 1245-2200		CHE MKE HWE Y12 ARIKA Y14 MIHOU Y45 BOMAP Y62 YURIX Y26 LILRA Y573 SEDKU
RJCC	RPHI	EOBT 2201-1244		DALBI Y120 TAPPI Y12 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJCC	RPHI	EOBT 2201-1244		DALBI Y120 TAPPI Y12 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJCC	RPHI	EOBT 2201-1244		DALBI Y120 TAPPI Y12 KEC Y47 BUBDO A590 GURAG
RJCC	RPHI	EOBT 1245-2200		CHE MKE HWE Y12 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJCC	RPHI	EOBT 1245-2200		CHE MKE HWE Y12 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJCC	RPHI	EOBT 1245-2200		CHE MKE HWE Y12 KEC Y47 BUBDO A590 GURAG
PAZA / KZAK	RJCC			NANNO OTR1 OBE V6 CHE
RKRR	RJCC			LANAT Y51 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RKRR	RJCC			BEDAR Y591 BESMU Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RCAA	RJCC			MOLKA M750 MOMP Y451 HKC Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RCAA	RJCC			IGURU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER
RPHI	RJCC			MEVIN B462 KAZIK Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RPHI	RJCC		LEBIX N884 ALBAX Y531 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 SIRAO Y139 NAVER	
RJFF	RKRR		DGC G339 BEETL Y208/G339 INVOK	
RJFF	RKRR		SGE OLE Y40 FUE Y60 POTET Y592 ONIKU	
RJFF	RKRR		YAMEK SGE OLE Y40 FUE Y60 POTET Y592 ONIKU	
RJFF	RCAA		YAMGA VEMRA Y506 HKC A1 BULAN	
RJFF	RCAA		YAMGA VEMRA Y506 HKC Y45 BOMAP Y62 YURIX Y26 IGURU	
RJFF	RPHI		YAMGA VEMRA Y506 HKC Y45 BOMAP Y62 KAZIK B462 MEVIN	
RJFF	RPHI		YAMGA VEMRA Y506 HKC Y45 ONC Y579 SAKON A582 BISIG	
RKRR	RJFF		BESNA Y209 SARUP	
RKRR	RJFF		APELA A582 IKE	
RKRR	RJFF		BEDAR Y591 FUE Y253 ATSAG	
RCAA	RJFF		MOLKA M750 MOMPA Y25 ISKUP	
RCAA	RJFF		IGURU Y26 YURIX Y62 BOMAP Y25 ISKUP	
RPHI	RJFF		MEVIN B462 KAZIK Y62 BOMAP Y25 ISKUP	
RPHI	RJFF		LEBIX N884 ALBAX Y531 YURIX Y62 BOMAP Y25 ISKUP	
RJFK	RKRR		SASIK Y208/G339 INVOK	
RKRR	RJFK		BESNA Y209 IKE A582 HKC	
RCAA	RJFK		MOLKA M750 MOMPA Y25 KOSHI A1 HKC	
RJFM	RKRR		LALAG Y252 HINAG G339 INVOK	
RJFM	RCAA		MZE JINGU A1 HKC Y50 IGMON A1 BULAN	
RKRR	RJFM		APELA A582 IKE Y251 OLE KAZSA SASIK LALAG MZE	
RKRR	RJFM		BESNA Y209 IKE Y251 OLE KAZSA SASIK LALAG MZE	
RCAA	RJFM		MOLKA M750 MOMPA Y451 HKC A1 JINGU MZE	
RJFO	RKRR		TFE V40 WOODY Y40 TAIME Y14 DGC G339 BEETL Y208/G339 INVOK	
RJFO	RKRR		OOITA Y40 TAIME Y14 DGC G339 BEETL Y208/G339 INVOK	
RKRR	RJFO		BESNA Y209 IKE Y251 OLE Y40 OOITA	
RJFT	RKRR		KUE TAIME Y14 DGC G339 BEETL Y208/G339 INVOK	
RKRR	RJFT		BESNA Y209 IKE Y251 OLE Y40/V40 KUE	
RKRR	RJFT		APELA A582 IKE Y251 OLE Y40/V40 KUE	
RJFU	RKRR		DGC G339 BEETL Y208/G339 INVOK	
RJGG	PAZA	EOBT 2051-1349	BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y577 MAKMU R580 OMOTO	
RJGG	PAZA	EOBT 2051-1349	BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT A590 PASRO	

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJGG	PAZA / KZAK	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y809 IDLAN Y812 ADNAP
RJGG	KZAK	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y809 AVBET
RJGG	KZAK	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RJGG	KZAK	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RJGG	KZAK	EOBT 2051-1349		BOGON Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RJGG	KZAK	EOBT 2051-1349		BOGON Y79 LELIN Y55 SABRI B586 UKATA
RJGG	PAZA			CBE MORIZ TSUGU CHAUS Y155 TENRU Y88 DAIGO Y889 OATIS R580 OMOTO
RJGG	PAZA			CBE MORIZ TSUGU CHAUS Y155 TENRU Y88 DAIGO Y889 PUTER A590 PASRO
RJGG	PAZA/ KZAK			CBE MORIZ TSUGU CHAUS Y155 TENRU Y88 DAIGO Y886 ADNAP
RJGG	PAZA	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y577 MAKMU R580 OMOTO
RJGG	PAZA	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT A590 PASRO
RJGG	PAZA / KZAK	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y809 IDLAN Y812 ADNAP
RJGG	KZAK	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y803 POROT Y809 AVBET
RJGG	KZAK	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RJGG	KZAK	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RJGG	KZAK	EOBT 1350-2050		MODEL ENSYU Y23 ARTIC Y71 XAC Y233 UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RJGG	KZAK	EOBT 1350-2050		CBE MORIZ Y295 GAKKI Y55 SABRI B586 UKATA
RJGG	KZAK			ESPAN KEC Y47 BUBDO A597 TAXON
RJGG	UHHH		For Europe	CBE KCC STRAW KROBE Y13 BASIN R211 AVGOK
RJGG	UHHH		For Europe	CBE KCC V31 GTC R211 AVGOK
RJGG	UHHH		For Europe	CBE KCC STRAW KROBE Y13 BASIN R211 KADBO B451 IGROD
RJGG	UHHH		For Europe	CBE KCC V31 GTC R211 KADBO B451 IGROD
RJGG	UHHH		For Europe	CBE KCC STRAW KROBE Y13 CHE Y10 LUMIN
RJGG	UHHH		for Europe/North America	CBE KCC STRAW KROBE Y13 CHE Y116 BISIV
RJGG	RKRR	EOBT 2051-1349		HIKNE PUDAN YME Y18 MIHOU Y38 SAPRA
RJGG	RKRR	EOBT 2051-1349		HIKNE Y207 ARASI Y20 KAMMY Y204 DGC Y28 ISAKY Y592 ONIKU
RJGG	RKRR	EOBT 1350-2050		CBE HIKNE KOSEI YME Y18 MIHOU Y38 SAPRA
RJGG	RKRR	EOBT 1350-2050		CBE HIKNE Y207 ARASI Y20 KAMMY Y204 DGC Y28 ISAKY Y592 ONIKU
RJGG	RKRR		for Europe	CBE HIKNE KOSEI YME Y18 MIHOU Y38 SAPRA
RJGG	RCAA			ESPAN KEC Y24 KOSHI Y50 IGMON A1 BULAN
RJGG	RCAA			ESPAN KEC Y12 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 LILRA Y573 SEDKU
RJGG	RCAA			ESPAN KEC Y12 LAXEL Y52 IGURU

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJGG	RPHI			ESPAN KEC Y12 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJGG	RPHI			ESPAN KEC Y12 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJGG	RPHI			ESPAN KEC Y47 BUBDO A590 GURAG
PAZA	RJGG			NODAN R217 GTC Y12 MBE Y121 SWING
PAZA	RJGG			NANAC R220 IXE Y88 SUGAL Y881 SLIDE
PAZA	RJGG			IPGUD Y800 MUBTO Y889 DAIGO Y88 SUGAL Y881 SLIDE
PAZA / KZAK	RJGG			ADNAP Y512 SDE R217 GTC Y12 MBE Y121 SWING
PAZA / KZAK	RJGG			ADNAP Y886 DAIGO Y88 SUGAL Y881 SLIDE
PAZA / KZAK	RJGG			ADNAP Y807 LALID Y804 INUBO Y50 OLTOM
KZAK	RJGG			AVBET Y809 LESPO Y806 INUBO Y50 OLTOM
KZAK	RJGG			SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 OLTOM
KZAK	RJGG			MORAY OTR15 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 OLTOM
KZAK	RJGG			FERAR OTR17 SMOLT Y824 DOLBA Y818 LIGNI Y821 UTIBO Y502 TOKIS Y50 OLTOM
KZAK	RJGG			DAGDA Y821 UTIBO Y502 TOKIS Y50 OLTOM
KZAK	RJGG			UKATA B586 XAC V17 TRIKE
KZAK	RJGG			BUBDO Y47 KEC Y415 NATCH Y755 CARDS
UHHH	RJGG			IGROD Y301 REALU Y305 FINGA Y12 MBE Y121 SWING
UHHH	RJGG			LUMIN Y10 CHE Y12 HWE Y14 ARIKA Y12 MBE Y121 SWING
RKRR	RJGG			IGRAS Y332 KAPPA Y333 DISSH Y51 SAMON Y511 CHESS
RKRR	RJGG			LANAT Y51 SAMON Y511 CHESS
RKRR	RJGG			KALEK Y206 MIHOU Y45 SONBU TRUGA Y511 CHESS
RKRR	RJGG			BEDAR Y591 FUE Y23 OOITA Y41 NATCH Y755 CARDS
RCAA	RJGG			MOLKA M750 IMPAL Y755 CARDS
RCAA	RJGG			IGURU Y57 YULIA Y575 ALBAT Y755 CARDS
RPHI	RJGG			MEVIN B462 KAZIK Y59 AZAMA Y57 YULIA Y575 ALBAT Y755 CARDS
RPHI	RJGG			LEBIX N884 ALBAX Y533 AZAMA Y57 YULIA Y575 ALBAT Y755 CARDS
RPHI	RJGG			GURAG A590 BUBDO Y47 KEC Y415 NATCH Y755 CARDS
RJNK	RKRR			SONBU Y45 MADUL Y16 SAPRA
RJNK	RCAA			SONBU Y45 HKC Y50 IGMON A1 BULAN
RKRR	RJNK			LANAT Y51 DISSH Y333 MADUL Y45 SONBU
RCAA	RJNK			MOLKA M750 MOMPA Y451 HKC Y45 SONBU
RJNT	RKRR			URUSI Y45 MADUL Y16 SAPRA

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJNT	RCAA		URUSI Y45 HKC Y50 IGMON A1 BULAN	
RKRR	RJNT		LANAT Y51 SAMON Y513 KMC Y45 URUSI	
RCAA	RJNT		MOLKA M750 MOMPA Y451 HKC Y45 URUSI	
RJOA	RKRR		SINFO STAGE Y38 SAPRA	
RKRR	RJOA		LANAT Y597 KABKI STAGE OPERA AKANA MIYOS HGE	
RJOH	RKRR		STAGE Y38 SAPRA	
RKRR	RJOH		LANAT Y597 PEPOS	
RJOS	RKRR		KTE OYE Y39 MIHOU Y38 SAPRA	
RKRR	RJOS		LANAT Y597 MIHOU Y39 OYE KTE Y331 TSC	
RJTA / RJTJ / RJTY	PAZA		KOGAR Y808 INUBO Y808 IGARA Y815 MAKMU R580 OMOTO	
RJTA / RJTJ / RJTY	PAZA		KOGAR Y808 INUBO Y808 PUTER A590 PASRO	
RJTA / RJTJ / RJTY	PAZA / KZAK		KOGAR Y808 INUBO Y808 NOLAX Y812 ADNAP	
RJTA / RJTJ / RJTY	KZAK		KOGAR Y808 INUBO Y808 NOLAX Y814 AVBET	
RJTA / RJTJ / RJTY	KZAK		KOGAR Y808 INUBO Y830 LAPIL OTR13 SEALS	
RJTA / RJTJ / RJTY	KZAK		KOGAR Y808 INUBO Y830 IPROS Y832 POVAL OTR15 MORAY	
RJTA / RJTJ / RJTY	KZAK		KOGAR Y808 INUBO Y830 IPROS Y834 PIPIK OTR17 FERAR	
RJTA / RJTJ / RJTY	KZAK		KOGAR Y808 INUBO Y820 DAGDA	
RJTA / RJTJ / RJTY	KZAK		KOSKA Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY	
RJTA / RJTJ / RJTY	KZAK		KOSKA Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR	
RJTA / RJTJ / RJTY	KZAK		KOSKA Y821 LIGNI Y821 DAGDA G223 TONIK	
RJTA / RJTJ / RJTY	KZAK		KOSKA Y821 LIGNI Y821 DAGDA A337 NOGAK	
RJTA / RJTJ / RJTY	KZAK		KOSKA ZUSHI HATSU XAC NAGRA KAMOG GUTLO SUNNS OTR16 SMOLT OTR15 MORAY	
RJTA / RJTJ / RJTY	KZAK		KOSKA ZUSHI HATSU XAC NAGRA KAMOG GUTLO SUNNS OTR16 SMOLT OTR17 FERAR	
RJTA / RJTJ / RJTY	KZAK		KOSKA ZUSHI HATSU XAC NAGRA KAMOG GUTLO SUNNS OTR20 ADKAK G223 TONIK	
RJTA / RJTJ / RJTY	KZAK		KOSKA ZUSHI HATSU XAC NAGRA KAMOG GUTLO SUNNS OTR20 ADKAK G223 DAGDA A337 NOGAK	
PAZA	RJTA / RJTJ / RJTY		NANAC R220 IXE Y88 NIKKO Y90 HAILY	
PAZA	RJTA / RJTJ / RJTY		IPGUD Y800 MUBTO Y889 DAIGO Y88 NIKKO Y90 HAILY	
PAZA / KZAK	RJTA / RJTJ / RJTY		ADNAP Y886 DAIGO Y88 NIKKO Y90 HAILY	
KZAK	RJTA / RJTJ / RJTY		AVBET Y809 OLDIV Y802 LIGNI Y821 KOSKA	
KZAK	RJTA / RJTJ / RJTY		SEALS OTR13 LAPIL Y830 IPROS Y816 LIGNI Y821 KOSKA	
KZAK	RJTA / RJTJ / RJTY		MORAY OTR15 SMOLT Y824 DOLBA Y818 LIGNI Y821 KOSKA	
KZAK	RJTA / RJTJ / RJTY		FERAR OTR17 SMOLT Y824 DOLBA Y818 LIGNI Y821 KOSKA	

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
KZAK	RJTA / RJTJ / RJTY			NOGAK A337 DAGDA Y821 KOSKA
KZAK	RJTA / RJTJ / RJTY			SUNNS GUTLO KAMOG NAGRA XAC HATSU ZUSHI KOSKA
RJTT	PAZA	EOBT 2051-1339		INUBO Y808 IGARA Y815 MAKMU R580 OMOTO
RJTT	PAZA	EOBT 2051-1339		INUBO Y808 PUTER A590 PASRO
RJTT	PAZA / KZAK	EOBT 2051-1339		INUBO Y808 NOLAX Y812 ADNAP
RJTT	KZAK	EOBT 2051-1339		INUBO Y808 NOLAX Y814 AVBET
RJTT	KZAK	EOBT 2051-1339		INUBO Y830 LAPIL OTR13 SEALS
RJTT	KZAK	EOBT 2051-1339		INUBO Y830 IPROS Y832 POVAL OTR15 MORAY
RJTT	KZAK	EOBT 2051-1339		INUBO Y830 IPROS Y834 PIPIK OTR17 FERAR
RJTT	KZAK	EOBT 2051-1339		INUBO Y820 DAGDA G223 TONIK
RJTT	KZAK	EOBT 2051-1339		INUBO Y820 DAGDA A337 NOGAK
RJTT	KZAK	EOBT 2051-1339		VAMOS XAC B586 UKATA
RJTT	PAZA	EOBT 1340-2050		OPPAR UTIBO Y803 POROT Y577 MAKMU R580 OMOTO
RJTT	PAZA	EOBT 1340-2050		OPPAR UTIBO Y803 POROT A590 PASRO
RJTT	PAZA / KZAK	EOBT 1340-2050		OPPAR UTIBO Y803 POROT A590 DOVIX Y886 ADNAP
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y803 POROT Y809 AVBET
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y821 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y821 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y821 DAGDA G223 TONIK
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y821 DAGDA A337 NOGAK
RJTT	KZAK	EOBT 1340-2050		OPPAR UTIBO Y87 FITTO Y873 SABRI B586 UKATA
RJTT	UHHH	EOBT 2051-1339		SPOON AKAGI Y372 KALON Y37 AVGOK
RJTT	UHHH	EOBT 2051-1339		SPOON AKAGI Y372 KALON Y37 HAJI Y375 IGROD
RJTT	UHHH	EOBT 2051-1339		SPOON AGRIS Y11 CHE Y10 LUMIN
RJTT	UHHH	EOBT 2051-1339		SPOON AGRIS Y11 CHE Y116 BISIV
RJTT	UHHH	EOBT 1340-2050		OPPAR JYOGA Y371 KALON Y37 AVGOK
RJTT	UHHH	EOBT 1340-2050		OPPAR JYOGA Y371 KALON Y37 HAJI Y375 IGROD
RJTT	UHHH	EOBT 1340-2050		OPPAR JYOGA Y371 YONOH Y373 SANOH Y882 ONUMA Y883 YTE Y11 CHE Y10 LUMIN
RJTT	UHHH	EOBT 1340-2050		OPPAR JYOGA Y371 YONOH Y373 SANOH Y882 ONUMA Y883 YTE Y11 CHE Y116 BISIV
RJTT	RKRR	EOBT 2051-1339		BEKLA Y18 PIGAP Y182 BIDIK Y16 SAPRA
RJTT	RKRR	EOBT 2051-1339		NINOX Y28 ISAKY Y592 ONIKU

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RJTT	RKRR	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y38 SAPRA
RJTT	RKRR	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y38 MIDER Y28 ISAKY Y592 ONIKU
RJTT	RCAA	EOBT 2051-1339		LAXAS Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN
RJTT	RCAA	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 LILRA Y573 SEDKU
RJTT	RCAA	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
RJTT	RCAA	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN
RJTT	RCAA	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 KXC Y62 GANAS Y576 LILRA Y573 SEDKU
RJTT	RCAA	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
RJTT	RPHI	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJTT	RPHI	EOBT 2051-1339		LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJTT	RPHI	EOBT 2051-1339		LAXAS Y56 NADAR Y562 MAYON Y47 BUBDO A590 GURAG
RJTT	RPHI	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
RJTT	RPHI	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RJTT	RPHI	EOBT 1340-2050		OPPAR JYOGA Y566 LAXAS Y56 NADAR Y562 MAYON Y47 BUBDO A590 GURAG
PAZA	RJTT	ETA 2100-1359		NANAC Y810 AKRIT Y807 POLIX
PAZA	RJTT	ETA 2100-1359		IPGUD Y800 ESNIP Y810 AKRIT Y807 POLIX
PAZA / KZAK	RJTT	ETA 2100-1359		ADNAP Y807 POLIX
KZAK	RJTT	ETA 2100-1359		AVBET Y809 POROT Y811 NOGIX Y807 POLIX
KZAK	RJTT	ETA 2100-1359		SEALS OTR13 LAPIL Y811 NOGIX Y807 POLIX
PAZA	RJTT	ETA 1400-2059		NANAC Y810 AKRIT Y807 LALID Y804 INUBO Y108 MESSE
PAZA	RJTT	ETA 1400-2059		IPGUD Y800 ESNIP Y810 AKRIT Y807 LALID Y804 INUBO Y108 MESSE
PAZA / KZAK	RJTT	ETA 1400-2059		ADNAP Y807 LALID Y804 INUBO Y108 MESSE
KZAK	RJTT	ETA 1400-2059		AVBET Y809 POROT Y811 NOGIX Y807 LALID Y804 INUBO Y108 MESSE
KZAK	RJTT	ETA 1400-2059		SEALS OTR13 LAPIL Y811 NOGIX Y807 LALID Y804 INUBO Y108 MESSE
KZAK	RJTT			MORAY OTR15 POVAL OTR15 SMOLT Y824 AROSA
KZAK	RJTT			FERAR OTR17 SMOLT Y824 AROSA
KZAK	RJTT			TONIK G223 BEGAD Y817 OLVEK Y824 AROSA
KZAK	RJTT			NOGAK A337 DAGDA Y819 OLVEK Y824 AROSA
KZAK	RJTT			UKATA B586 SABRI Y873 FITTO Y87 TOPIT Y875 AROSA
KZAK	RJTT			BUBDO Y527 BILLY Y21 AKSEL
UH HH	RJTT	ETA 2100-1359		IGROD Y301 VIROP Y307 VIKET Y303 SASAP Y10 GODIN
UH HH	RJTT	ETA 2100-1359		LUMIN Y10 GODIN

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
UHHH	RJTT	ETA 2100-1359		BISIV Y116 CHE Y10 GODIN
UHHH	RJTT	ETA 2100-1359		ODERI Y109 UBRAS Y118 NOMOX Y112 OMGOL Y111 MQE Y106 RUBIS Y10 GODIN
UHHH	RJTT	ETA 1400-2059		IGROD Y301 VIROP Y307 VIKET Y303 SASAP Y10 DAIGO Y108 MESSE
UHHH	RJTT	ETA 1400-2059		LUMIN Y10 DAIGO Y108 MESSE
UHHH	RJTT	ETA 1400-2059		BISIV Y116 CHE Y10 DAIGO Y108 MESSE
UHHH	RJTT	ETA 1400-2059		ODERI Y109 UBRAS Y118 NOMOX Y112 OMGOL Y111 MQE Y106 RUBIS Y10 DAIGO Y108 MESSE
RKRR	RJTT			LANAT Y71 XAC
RKRR	RJTT			KALEK Y206 MIHOU Y38 MIDER Y71 XAC
RKRR	RJTT			BEDAR Y591 FUE Y23 ARTIC Y71 XAC
RCAA	RJTT			MOLKA M750 BILLY Y21 AKSEL
RCAA	RJTT			IGURU Y57 SUKBO Y571 BILLY Y21 AKSEL
RPHI	RJTT			MEVIN B462 KAZIK Y59 AZAMA Y57 SUKBO Y571 BILLY Y21 AKSEL
RPHI	RJTT			LEBIX N884 ALBAX Y533 AZAMA Y57 SUKBO Y571 BILLY Y21 AKSEL
RPHI	RJTT			GURAG A590 BUBDO Y527 BILLY Y21 AKSEL
ROAH	RKRR	odd thousand foot altitude/ flight level		ONC Y579 RUGMA
ROAH	RKRR	odd thousand foot altitude/ flight level		LAVON NHC A582 ONC A586 RUGMA
ROAH	RCAA			GANJU Y576 LILRA Y573/R595 SEDKU
ROAH	RCAA			GANJU Y576 LILRA Y26 IGURU
ROAH	RPHI			GANJU Y576 GANAS Y62 KAZIK B462 MEVIN
ROAH	RPHI			GANJU Y576 GANAS MJC R595 SAKON A582 BISIG
RKRR	ROAH	for JET		RUGMA Y579 ONC Y525 IHEYA
RKRR	ROAH			RUGMA Y579 ONC A582 NHC LAVON
RCAA	ROAH			SEDKU Y573 MJC Y57 VELNO
RCAA	ROAH			IGURU Y57 VELNO

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
ROIG	RCAA		MJC G581 IGURU	
RCAA	ROIG		IGURU G581 MJC V90 IGE	
RPHI	ROAH		MEVIN B462 KAZIK Y62 MJC Y57 VELNO	
KZAK	ROAH		KEITH R595 SAKON R595 MJC Y57 VELNO	
RORS	RCAA		MJC G581 IGURU	
RCAA	RORS		IGURU G581 MJC SJE	
RKRR	UHHH		LANAT Y51 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO	
RKRR	UHHH		LANAT Y51 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV	
RKRR	UHHH		LANAT Y51 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI	
RKRR	PAZA		LANAT Y51 SAMON Y142 GTC Y512 OATIS R580 OMOTO	
RKRR	PAZA		LANAT Y51 INUBO Y808 IGARA Y815 MAKMU R580 OMOTO	
RKRR	PAZA		LANAT Y51 SAMON Y142 GTC Y512 OATIS Y889 PUTER A590 PASRO	
RKRR	PAZA		LANAT Y51 INUBO Y808 PUTER A590 PASRO	
RKRR	PAZA / KZAK		LANAT Y51 INUBO Y808 NOLAX Y812 ADNAP	
RKRR	KZAK		LANAT Y51 INUBO Y808 NOLAX Y814 AVBET	
RKRR	KZAK		LANAT Y51 INUBO Y830 LAPIL OTR13 SEALS	
RKRR	KZAK		LANAT Y51 INUBO Y830 IPROS Y832 POVAL OTR15 MORAY	
RKRR	KZAK		LANAT Y51 INUBO Y830 IPROS Y834 PIPIK OTR17 FERAR	
RKRR	KZAK		LANAT Y51 INUBO Y820 DAGDA	
RKRR	KZAK		BESNA Y209 IKE A582 HKC Y14 TGE G339 BIXAK	
RKRR	UHHH		BEDAR Y591 BESMU Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO	
RKRR	UHHH		BEDAR Y591 BESMU Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV	
RKRR	UHHH		BEDAR Y591 BESMU Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI	
RKRR	PAZA		BEDAR Y591 BESMU Y14 SAMON Y142 GTC Y512 OATIS R580 OMOTO	
RKRR	PAZA		BEDAR Y591 BESMU Y14 SAMON Y51 INUBO Y808 IGARA Y815 MAKMU R580 OMOTO	
RKRR	PAZA		BEDAR Y591 BESMU Y14 SAMON Y142 GTC Y512 OATIS Y889 PUTER A590 PASRO	
RKRR	PAZA		BEDAR Y591 BESMU Y14 SAMON Y51 INUBO Y808 PUTER A590 PASRO	
RKRR	PAZA		BEDAR Y591 BESMU Y14 SAMON Y51 INUBO Y808 NOLAX Y812 ADNAP	
RKRR	KZAK		BEDAR Y591 FUE Y23 KASTE Y81 TASOT Y57 POROT Y809 IDLAN Y812 ADNAP	
RKRR	KZAK		BEDAR Y591 FUE Y23 KASTE Y81 TASOT Y57 POROT OTR11 AVBET	

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RKRR	KZAK			BEDAR Y591 FUE Y23 KASTE Y81 TASOT Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RKRR	KZAK			BEDAR Y591 FUE Y23 KASTE Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RKRR	KZAK			BEDAR Y591 FUE Y23 KASTE Y81 TASOT Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RKRR	PAZA / KZAK			BEDAR Y591 FUE Y40 OLE HONDO HKC Y14 TGE G339 BIXAK
RCAA	UHHH			MOLKA M750 MOMPA Y451 HKC Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO
RCAA	UHHH			MOLKA M750 MOMPA Y451 HKC Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV
RCAA	UHHH			MOLKA M750 MOMPA Y451 HKC Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI
RCAA	PAZA			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 POROT Y577 MAKMU R580 OMOTO
RCAA	PAZA			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 PUTER A590 PASRO
RCAA	PAZA			MOLKA M750 IMPAL Y755 CARDS HIOTI CBE Y121 SWING Y88 DAIGO Y889 OATIS R580 OMOTO
RCAA	PAZA			MOLKA M750 IMPAL Y755 CARDS HIOTI CBE Y121 SWING Y88 DAIGO Y889 PUTER A590 PASRO
RCAA	PAZA			MOLKA M750 MOMPA Y451 HKC Y45 OOITA Y40 MYE Y33 LABEL Y121 SWING Y88 DAIGO Y889 OATIS R580 OMOTO
RCAA	PAZA			MOLKA M750 MOMPA Y451 HKC Y45 OOITA Y40 MYE Y33 LABEL Y121 SWING Y88 DAIGO Y889 PUTER A590 PASRO
RCAA	PAZA / KZAK			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 POROT Y809 IDLAN Y812 ADNAP
RCAA	PAZA / KZAK			MOLKA M750 IMPAL Y755 CARDS HIOTI CBE Y121 SWING Y88 DAIGO Y886 ADNAP
RCAA	PAZA / KZAK			MOLKA M750 MOMPA Y451 HKC Y45 OOITA Y40 MYE Y33 LABEL Y121 SWING Y88 DAIGO Y886 ADNAP
RCAA	KZAK			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 POROT OTR11 AVBET
RCAA	KZAK			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RCAA	KZAK			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RCAA	KZAK			MOLKA M750 MUKEP Y891 OVSUN Y893 IGMIS Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RCAA	UHHH			BORDO Y74 KAORU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO
RCAA	UHHH			BORDO Y74 KAORU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV
RCAA	UHHH			BORDO Y74 KAORU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI
RCAA	PAZA			BORDO Y74 AZAMA Y57 POROT Y577 MAKMU R580 OMOTO
RCAA	PAZA			BORDO Y74 AZAMA Y57 PUTER A590 PASRO
RCAA	PAZA / KZAK			BORDO Y74 AZAMA Y57 POROT Y809 IDLAN Y812 ADNAP
RCAA	KZAK			BORDO Y74 AZAMA Y57 POROT OTR11 AVBET
RCAA	KZAK			BORDO Y74 AZAMA Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RCAA	KZAK			BORDO Y74 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RCAA	KZAK			BORDO Y74 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RCAA	KZAK			BORDO Y74 AZAMA Y57 TAMAK V73 DOVAG
RCAA	KZAK			BORDO Y74 TOPAT V75 CANAI

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RCAA	KZAK		SEDKU R595 TUNTO	
RCAA	UHHH		IGURU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO	
RCAA	UHHH		IGURU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV	
RCAA	UHHH		IGURU Y26 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI	
RCAA	PAZA		IGURU Y57 POROT Y577 MAKMU R580 OMOTO	
RCAA	PAZA		IGURU Y57 PUTER A590 PASRO	
RCAA	PAZA / KZAK		IGURU Y57 POROT Y809 IDLAN Y812 ADNAP	
RCAA	KZAK		IGURU Y57 POROT OTR11 AVBET	
RCAA	KZAK		IGURU Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS	
RCAA	KZAK		IGURU Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY	
RCAA	KZAK		IGURU Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR	
RCAA	KZAK		IGURU Y57 TAMAK V73 DOVAG	
RCAA	KZAK		IGURU Y57 AZAMA Y74 TOPAT V75 CANAI	
RCAA	KZAK		IGURU Y57 MJC R595 TUNTO	
RCAA	KZAK		GUMBO MAGMA NIMOX TUNTO	
RPHI	UHHH		MEVIN B462 KAZIK Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO	
RPHI	UHHH		MEVIN B462 KAZIK Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV	
RPHI	UHHH		MEVIN B462 KAZIK Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI	
RPHI	PAZA		MEVIN B462 KAZIK Y59 AZAMA Y57 POROT Y577 MAKMU R580 OMOTO	
RPHI	PAZA		MEVIN B462 KAZIK Y59 AZAMA Y57 PUTER A590 PASRO	
RPHI	PAZA / KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 POROT Y809 IDLAN Y812 ADNAP	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 POROT OTR11 AVBET	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y57 TAMAK V73 DOVAG	
RPHI	KZAK		MEVIN B462 KAZIK Y59 AZAMA Y74 TOPAT V75 CANAI	
RPHI	UHHH		LEBIX N884 ALBAX Y531 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE Y114 ANIMO	
RPHI	UHHH		LEBIX N884 ALBAX Y531 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 BISIV	
RPHI	UHHH		LEBIX N884 ALBAX Y531 YURIX Y62 BOMAP Y45 MARCO Y141 SAMON Y14 GOLDO Y19 MRE Y13 CHE Y116 AWE V7 TBE Y109 ODERI	
RPHI	PAZA		LEBIX N884 ALBAX Y533 AZAMA Y57 POROT Y577 MAKMU R580 OMOTO	
RPHI	PAZA		LEBIX N884 ALBAX Y533 AZAMA Y57 PUTER A590 PASRO	

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
RPHI	PAZA / KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 POROT Y809 IDLAN Y812 ADNAP
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 POROT OTR11 AVBET
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR15 MORAY
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 LIGNI Y818 DOLBA Y824 SMOLT OTR17 FERAR
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y57 TAMAK V73 DOVAG
RPHI	KZAK			LEBIX N884 ALBAX Y533 AZAMA Y74 TOPAT V75 CANAI
RPHI	PAZA			GURAG A590 BUBDO Y527 DOMBI Y57 POROT Y577 MAKMU R580 OMOTO
RPHI	PAZA			GURAG A590 BUBDO Y527 DOMBI Y57 PUTER A590 PASRO
RPHI	PAZA / KZAK			GURAG A590 BUBDO Y527 DOMBI Y57 POROT Y809 IDLAN Y812 ADNAP
RPHI	KZAK			GURAG A590 BUBDO Y527 DOMBI Y57 POROT OTR11 AVBET
RPHI	KZAK			GURAG A590 BUBDO Y527 DOMBI Y57 LIGNI Y816 IPROS Y830 LAPIL OTR13 SEALS
UHHH	RKRR			AKSUN Y104 YOROI Y10 CHE Y12 HWE Y14 SUGNO Y16 SAPRA
UHHH	RKRR			AKSUN Y104 YOROI Y10 CHE Y12 HWE Y14 DGC Y28 ISAKY Y592 ONIKU
UHHH	RKRR			ANIMO Y114 AWE Y116 CHE Y12 HWE Y14 SUGNO Y16 SAPRA
UHHH	RKRR			ANIMO Y114 AWE Y116 CHE Y12 HWE Y14 DGC Y28 ISAKY Y592 ONIKU
UHHH	RKRR			BISIV Y116 CHE Y12 HWE Y14 SUGNO Y16 SAPRA
UHHH	RKRR			BISIV Y116 CHE Y12 HWE Y14 DGC Y28 ISAKY Y592 ONIKU
UHHH	RKRR			ODERI Y109 TBE V7 AWE Y116 CHE Y12 HWE Y14 SUGNO Y16 SAPRA
UHHH	RKRR			ODERI Y109 TBE V7 AWE Y116 CHE Y12 HWE Y14 DGC Y28 ISAKY Y592 ONIKU
PAZA	RKRR			NODAN R217 GTC Y142 SAMON Y14 SUGNO Y16 SAPRA
PAZA	RKRR			NODAN R217 GTC Y142 SAMON Y14 DGC Y28 ISAKY Y592 ONIKU
PAZA	RKRR			NANAC R220 BEKEN Y512 GTC Y142 SAMON Y14 SUGNO Y16 SAPRA
PAZA	RKRR			NANAC R220 BEKEN Y512 GTC Y142 SAMON Y14 DGC Y28 ISAKY Y592 ONIKU
PAZA	RKRR			NANAC R220 IXE Y88 TEPEX Y16 SAPRA
PAZA	RKRR			NANAC R220 IXE Y88 KCC Y28 ISAKY Y592 ONIKU
PAZA	RKRR			IPGUD Y800 SOVMO Y512 GTC Y142 SAMON Y14 SUGNO Y16 SAPRA
PAZA	RKRR			IPGUD Y800 SOVMO Y512 GTC Y142 SAMON Y14 DGC Y28 ISAKY Y592 ONIKU
PAZA	RKRR			IPGUD Y800 MUBTO Y889 DAIGO Y88 TEPEX Y16 SAPRA
PAZA	RKRR			IPGUD Y800 MUBTO Y889 DAIGO Y88 KCC Y28 ISAKY Y592 ONIKU
PAZA / KZAK	RKRR			ADNAP Y886 DAIGO Y88 TEPEX Y16 SAPRA
PAZA / KZAK	RKRR			ADNAP Y807 LALID Y804 INUBO Y16 SAPRA

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
PAZA / KZAK	RKRR		ADNAP Y807 LALID Y804 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		AVBET Y809 LESPO Y806 INUBO Y16 SAPRA	
KZAK	RKRR		AVBET Y809 LESPO Y806 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y16 SAPRA	
KZAK	RKRR		SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y16 SAPRA	
KZAK	RKRR		MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y16 SAPRA	
KZAK	RKRR		FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		DAGDA Y820 INUBO Y16 SAPRA	
KZAK	RKRR		DAGDA Y820 INUBO Y60 ISAKY Y592 ONIKU	
KZAK	RKRR		BIXAK G339 LUKRA Y208 INVOK	
KZAK	RKRR		BIXAK G339 TGE Y14 HKC HONDO OLE Y40 FUE Y60 POTET Y592 ONIKU	
UH HH	RCAA		AKSUN Y104 YOROI Y10 CHE Y12 HWE Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN	
UH HH	RCAA		AKSUN Y104 YOROI Y10 CHE Y12 AYANO Y128 LAXEL Y52 IGURU	
UH HH	RCAA		ANIMO Y114 AWE Y116 CHE Y12 HWE Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN	
UH HH	RCAA		ANIMO Y114 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 IGURU	
UH HH	RCAA		BISIV Y116 CHE Y12 HWE Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN	
UH HH	RCAA		BISIV Y116 CHE Y12 AYANO Y128 LAXEL Y52 IGURU	
UH HH	RCAA		ODERI Y109 TBE V7 AWE Y116 CHE Y12 HWE Y14 MIHOU Y45 HKC Y50 IGMON A1 BULAN	
UH HH	RCAA		ODERI Y109 TBE V7 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 IGURU	
PAZA	RCAA		NANAC R220 IXE Y88 NAKTU Y12 KOHWA Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
PAZA	RCAA		IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 KOHWA Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
PAZA	RCAA		NANAC R220 IXE Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 IGURU	
PAZA	RCAA		IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 IGURU	
PAZA / KZAK	RCAA		ADNAP Y886 DAIGO Y88 NAKTU Y12 KOHWA Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
PAZA / KZAK	RCAA		ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
PAZA / KZAK	RCAA		ADNAP Y886 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 IGURU	
PAZA / KZAK	RCAA		ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU	
KZAK	RCAA		AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
KZAK	RCAA		SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	
KZAK	RCAA		MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN	

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
KZAK	RCAA			FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN
KZAK	RCAA			DAGDA Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 TURFY Y24 KOSHI Y50 IGMON A1 BULAN
KZAK	RCAA			AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
KZAK	RCAA			SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
KZAK	RCAA			MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
KZAK	RCAA			FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
KZAK	RCAA			DAGDA Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 IGURU
KZAK	RCAA	FL380+ & not for airports in RCAA		CANAI V75 TOPAT Y74 BORDO
KZAK	RCAA			TUNTO R595 SEDKU
KZAK	RCAA			TUNTO R595 MJC G581 IGURU
KZAK	RCAA			TUNTO NIMOX MAGMA GUMBO
UHHH	RPHI			AKSUN Y104 YOROI Y10 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
UHHH	RPHI			ANIMO Y114 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
UHHH	RPHI			BISIV Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
UHHH	RPHI			ODERI Y109 TBE V7 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
UHHH	RPHI			AKSUN Y104 YOROI Y10 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
UHHH	RPHI			ANIMO Y114 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
UHHH	RPHI			BISIV Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
UHHH	RPHI			ODERI Y109 TBE V7 AWE Y116 CHE Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
PAZA	RPHI			NANAC R220 IXE Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
PAZA	RPHI			NANAC Y810 OLDIV Y802 LIGNI Y84 BUBDO A590 GURAG
PAZA	RPHI			IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
PAZA	RPHI			IPGUD Y800 MUBTO Y889 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
PAZA	RPHI			IPGUD Y802 LIGNI Y84 BUBDO A590 GURAG
PAZA / KZAK	RPHI			ADNAP Y886 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
PAZA / KZAK	RPHI			ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
PAZA / KZAK	RPHI			ADNAP Y886 DAIGO Y88 NAKTU Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
PAZA / KZAK	RPHI			ADNAP Y807 LALID Y804 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
PAZA / KZAK	RPHI			ADNAP Y807 NOGIX Y802 LIGNI Y84 BUBDO A590 GURAG
KZAK	RPHI			AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN

CHANGE OF FLIGHT PLANNED ROUTES (International / Overflight)

DEP	DEST	Time Restriction	Remarks	Routes
KZAK	RPHI			AVBET Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
KZAK	RPHI			AVBET Y809 OLDIV Y802 LIGNI Y84 BUBDO A590 GURAG
KZAK	RPHI			SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
KZAK	RPHI			SEALS OTR13 LAPIL Y811 POROT Y809 LESPO Y806 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
KZAK	RPHI			SEALS OTR13 LAPIL Y811 POROT Y57 LIGNI Y84 BUBDO A590 GURAG
KZAK	RPHI			MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
KZAK	RPHI			MORAY OTR15 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
KZAK	RPHI			FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
KZAK	RPHI			FERAR OTR17 SMOLT Y824 ANSAD Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
KZAK	RPHI			DAGDA Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y45 NHC V91 MJC Y62 KAZIK B462 MEVIN
KZAK	RPHI			DAGDA Y820 INUBO Y50 ELNIS Y564 IBENO Y56 TOHME Y54 KOHWA Y12 AYANO Y128 LAXEL Y52 TONAR Y525 ONC Y579 SAKON A582 BISIG
RKRR	RPHI			RUGMA Y579 RUSAR Y27 YURIX Y62 KAZIK B462 MEVIN
RKRR	RPHI			RUGMA Y579 RUSAR Y27 SAKON A582 BISIG
RPHI	RKRR			MEVIN B462 KAZIK Y62 YURIX Y27 RUSAR Y579 RUGMA
RPHI	RKRR			LEBIX N884 ALBAX Y531 YURIX Y27 RUSAR Y579 RUGMA
RPHI	RKRR			BISIG A582 SAKON Y27 RUSAR Y579 RUGMA
RKRR	RCAA		FL320+	MUGUS Y742 SALMI
RKRR	RCAA		FL310-	ATOTI B576 SALMI
RCAA	RKRR		FL310+	LIPLO Y741 ATOTI
RCAA	RKRR		FL310+	SALMI Y743 BOLUT Y741 ATOTI
RCAA	RKRR		FL300-	SALMI B576 ATOTI

2.3 General

CHANGE OF FLIGHT PLANNED ROUTES (General)

DEP	DEST	Time Restriction	Remarks	Routes
RJBB	xxxx	EOBT 2115-1329	only for RJCW	NANKO NIKEX KYOTO SIGAK GUJYO
RJBB	xxxx	EOBT 2115-1329	for RJCx / RJEx / RJSx except for RJCC/RJCH/RJEC/RJC W	SOVRI UPRAL UENOH KCC
RJBB	xxxx	EOBT 1330-2114	for RJCx / RJEx / RJSx	MAIKO AVLEX OLIVE V38 YME Y381/V38 KMC
RJBE	xxxx			MAIKO KAWAT OMBIP YME
RJBE	xxxx			MAIKO KAWAT KTE V53 KRE
RJBE	xxxx		FL210-	MAIKO KAWAT KTE V53 SUC B597 TGE
RJBE	xxxx			MAIKO Y75 TANTA
xxxx	RJBE			MIDER V28 OMBIP
xxxx	RJBE			SUC V53 KTE
xxxx	RJBE			V40 KTE
RJCB / RJCK/ RJCM / RJCN	xxxx		for AP located west of 139E including RJSN	Y14 HWE Y14/Y122/V30
RJCB / RJCK/ RJCM / RJCN	xxxx		for AP located east of 139E except RJSN	Y112 OMGOL Y111 MQE Y106/Y124/V22/V34
xxxx	RJCB / RJCK / RJCM / RJCN			MQE Y111
RJCC	xxxx	EOBT 2201-1244	FL260+	TOBBY V22
RJCC	xxxx	EOBT 2201-1244	FL140-	HWE V31
RJCC	xxxx	EOBT 1245-2200	FL260+	CHE MKE TOBBY Y10/V22
RJCC	xxxx	EOBT 1245-2200	FL250-	CHE MKE HWE Y113
RJCC	xxxx	EOBT 1245-2200		CHE MKE HWE V30
xxxx	RJCH			HINAI V13/Y113 MRE V31/Y113 HWE
xxxx	RJCO			HWE V2 SPE
RJFF	xxxx			TFE DONKO MARCO
xxxx	RJFF		for PROP except DH8D	MARCO V28 SWE EBISU
xxxx	RJFF			MARCO Y256 STOUT Y20 KIRIN
xxxx	RJFF			Y20 EBISU
xxxx	RJFF			KOSHI Y25 ISKUP
xxxx	RJFF			HKC Y504 GOKYO Y25 ISKUP
xxxx	RJFK			A582 HKC KGE
xxxx	RJFK			TGE G339 HKC KGE
xxxx	RJFK			AMMON HKC KGE

CHANGE OF FLIGHT PLANNED ROUTES (General)

DEP	DEST	Time Restriction	Remarks	Routes
xxxx	RJFM		SUC SIROK RYUGU	
RJFO	xxxx		TFE V40 MYE	
RJFO	xxxx		OOITA Y45 HKC	
RJFO	xxxx		TFE V40 WOODY V54 HKC	
xxxx	RJFO		HKC Y45 OOITA	
xxxx	RJFO		HKC A1 JINGU MZE SIIBA ABUMI TFE	
xxxx	RJFS		MOMPA Y25 KOSHI Y501 SASIK Y14 TAIME Y40 MILEP UGAMU SGE	
xxxx	RJFS		V28 MARCO DONKO TFE V40 MILEP UGAMU SGE	
xxxx	RJFS		HKC G339 TAIME V40 MILEP UGAMU SGE	
xxxx	RJFT		Y28 ONDOC Y452 OOITA Y40 KUE	
xxxx	RJFT		MOMPA Y25 KOSHI Y501 SASIK Y14 HINAG	
xxxx	RJFT		HKC G339 HINAG	
RJFU	xxxx		OLE V40 TFE	
RJFU	xxxx		OLE Y40 OOITA	
xxxx	RJFU		HKC HONDO OLE	
RJGG	xxxx	EOBT 2051-1349	KCC KROBE Y13	
RJGG	xxxx	EOBT 2051-1349	KCC STRAW KROBE Y13	
RJGG	xxxx	EOBT 2051-1349	KCC Y312/V31 GTC	
RJGG	xxxx	EOBT 2051-1349	HIKNE KOSEI YME G597/Y18	
RJGG	xxxx		FTAMI ESPAN KEC	
RJGG	xxxx	EOBT 2051-1349	ANJYO MORIZ TSUGU CHAUS Y151	
xxxx	RJGG		A597 KEC Y415 NATCH Y755 CARDS	
xxxx	RJGG		A597 KEC NATCH CARDS	
xxxx	RJGG		FL240+ GTC MBE MAPLE MAMLA SWING	
xxxx	RJGG		GTC V31 AZUMI V57 MBE MAPLE MAMLA SWING	
RJNA	xxxx		TALMI HEIAN	
xxxx	RJNA		MIDER Y28 KCC	
RJNS	xxxx		FL250- FUJIK GAKKI Y55 KOHWA Y12 KEC	
RJNS	xxxx		FL250- SZE Y295 GAKKI Y55 KOHWA Y12 KEC	
RJNS	xxxx		FUJIK GAKKI Y295 YME Y18 MIHOU	
RJNS	xxxx		SZE Y295 YME Y18 MIHOU	
xxxx	RJNK		MIHOU Y45 SONBU	

CHANGE OF FLIGHT PLANNED ROUTES (General)

DEP	DEST	Time Restriction	Remarks	Routes
xxxx	RJOA			Y20 CLOVE RYUOH KANBE HGE
xxxx	RJOA			V28 OYE RYUOH KANBE HGE
xxxx	RJOA			HKC V54 WOODY V40 TFE DONKO MARCO V28 HGE
RJOB	xxxx			CHIZU YME V38 KMC
RJOB	xxxx			OYE V28 MARCO
xxxx	RJOB			MIDER V28 OYE
xxxx	RJOB			HKC V54 WOODY V40 MYE V56 KRE V53 KTE OYE
RJOK	xxxx			KRE V37
xxxx	RJOK			KEC A1/Y24 JAKAL PANCH KRE
xxxx	RJOK			OOITA Y41 DONAR URGIK BOTAN KABIL
xxxx	RJOK			OOITA Y41 DONAR URGIK BOTAN KABIL KRE
RJOM	xxxx			MYE V40 WOODY V54 HKC
xxxx	RJOM			V28 HGE BAMBO KINOE ITUKI MYE
xxxx	RJOM			HKC V54 WOODY V40 MYE
RJOO	xxxx			TIGER BUMER V28 OYE
xxxx	RJOO			KOHWA Y546 AGPUK IKOMA
xxxx	RJOO			KEC V55 IZUMI
xxxx	RJOO			ROKKO V55 IZUMI
xxxx	RJOO		for PROP except DH8D	KRE KAIFU Y403 KAINA Y753 IZUMI
xxxx	RJOO			JAKAL Y753 IZUMI
xxxx	RJOS			KEC OTLIB JOSIN TSC
RJOT	xxxx			KTE UTAZU WASYU V28/Y28 MARCO
RJOT	xxxx			TAROH MIHOU
RJOT	xxxx			OYE YUBAR XZE
xxxx	RJOT			MIDER V28 OLIVE V38 KTE
xxxx	RJOT			HKC V54 WOODY V40 MYE V56 KRE V53 KTE
RJSA	xxxx			TIKYU V13
RJSA	xxxx			GONOU UWE V32/Y32
xxxx	RJSI			Y312/V31 GTC ELBOR YTE Y153/V36 HPE
RJSM	xxxx			HPE V33/V34
RJSS	xxxx			SDE R217 GTC
xxxx	RJSS			IXE SDE

CHANGE OF FLIGHT PLANNED ROUTES (General)

DEP	DEST	Time Restriction	Remarks	Routes
ROAH	xxxx			LAVON NHC A582 BOMAP
ROAH	xxxx			LAVON NHC A582 ONC V71
xxxx	ROAH		for PROP	A582 NHC LAVON
xxxx	ROAH		for PROP	A582 OKUMA
PAZA	xxxx			NODAN R217 ASTER Y514 SDE
xxxx	PAZA / KZAK			SDE Y512 ADNAP
xxxx	PAZA / KZAK			A590 BUBDO Y527 DOMBI Y57 LIGNI
xxxx	KZAK			LIGNI Y84

JAPAN

MINISTRY OF LAND, INFRASTRUCTURE,
TRANSPORT AND TOURISM
CIVIL AVIATION BUREAU
AERONAUTICAL INFORMATION SERVICE CENTER

AIC

Nr 007/26
14 MAY 2026

Tel: +81-50-3146-3195
AFTN:RJAAANYX
E-mail:
helpdesk@ais.mlit.go.jp

007/26

熊野VOR/DME (KME) の試験電波発射について

令和8年6月11日0000JSTから令和8年11月25日2400JSTまで熊野VOR/DME (KME) において、次のとおり試験電波が発射される。誤表示の可能性があります使用してはならない。供用開始日時は追って通知される。

007/26

Emitting of test signal from Kumano VOR/DME (KME)

From 1500UTC 10 JUN 2026 to 1500UTC 25 NOV 2026, test signal will be emitted from Kumano VOR/DME (KME). Do not use. False indications possible. Commencing date and time of the official operation will be notified afterward.

名称 Name	熊野 VOR/DME Kumano VOR/DME	
周波数 Frequency	CH-106X	VOR 115.9MHz DME 1193MHz
出力 Power	VOR 100W DME 1.5kW	
識別符号 ID	KME	
試験電波発射時間 (UTC) Hours of emitting test signal (UTC)	H24	
位置 Coordinates	VOR and DME : 333952.39N 1352127.95E	
DME 空中線高 (標高) Elevation of DME transmitting antenna	389ft	

備考:

本 VOR/DME は南紀VOR/DME(NKE)が運用休止する間、代替装置として運用される。

Remarks:

This VOR/DME will be operated as an alternate RADIO NAVIGATION AID during unserviceability of Nanki VOR/ DME (NKE).

Tel: +81-50-3146-3195
AFTN:RJAANYX
E-mail:
helpdesk@ais.mlit.go.jp

008/26

中部国際空港における新しい滑走路および誘導路への誤進入防止について

1. 現在、中部国際空港において滑走路を新設する工事が実施されており、付図に示すとおり、滑走路部分および接続する誘導路の一部形状が視認できる状態にあるので、航空機は当該部分に進入しないように注意すること。

なお、同日時をもって令和8年4月16日付AIC NR006/26を取り消す。

※AIC発行時点において、航空路誌補足版「中部国際空港における運用制限について」により誘導路A3S、A3、B3、A8、A8N、B8は閉鎖されている。

2. 備考

- (1) 新しい滑走路部分および接続する誘導路に禁止標識及び禁止区域灯が設置される。
- (2) 新しい滑走路の供用開始については、追って航空路誌改訂版によって通知される。

008/26

Prevention of new RWY and TWY incursion at Chubu Centrair INTL AP/RJGG

1. New RWY work is in progress at Chubu Centrair INTL AP. As the parts of the RWY and connecting TWY are visible, aircraft should use caution to avoid entering there.
AIC NR006/26 dated 16 APR 2026 will be superseded at the same time.

*At the time the AIC is issued, TWY A3S, A3, B3, A8, A8N and B8 are closed in accordance with AIP SUP "Operational restrictions at Chubu Centrair INTL AP/ RJGG".

2. Remarks

- (1) Closed marking and unserviceability LGT are installed on new RWY and connecting TWY.
- (2) Commencing date of the new RWY will be notified by AIP AMDT.

ATTACHMENT

