MESSER CUTTING SYSTEMS GMBH
Otto-Hahn-Strasse 2-4
D-64823 Gross-Umstadt
Germany

GLOBAL CONTROL

GCs_Modular_eco 3600

289.168

MBG Poulina

ePLAN electric P8
P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	cover sheet
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page		total pages 190	last editor	I.Wund		

drawing number | page 1
Function category = AA0 | location + S1
last page 1 | continuation page =AA1/1

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
AA0	S1	1	cover sheet		16.01.2014	INGO.WUNDERLE
AA1	S1	1	table of contents : =AA0+S1/1 - =BA1+S1/3		10.02.2014	INGO.WUNDERLE
	S1	2	table of contents : =BA2+S1/1 - =CA2+S1/13		10.02.2014	INGO.WUNDERLE
	S1	3	table of contents : =CA41+S41/1 - =MB1+S1/1		10.02.2014	INGO.WUNDERLE
	S1	4	table of contents : =VA0+S1/1 - =W2+S1/19		10.02.2014	INGO.WUNDERLE
	S1	5	table of contents : =W2+S1/20 - =W2+S1/47		10.02.2014	INGO.WUNDERLE
	S1	6	table of contents : =W2+S1/48 - =X2+S1/15		10.02.2014	INGO.WUNDERLE
	S1	7	table of contents : =X2+S1/16 - =Z1+S1/12		10.02.2014	INGO.WUNDERLE
AA2	S1	1	Structure identifier overview		28.01.2014	INGO.WUNDERLE
	S1	2	Structure identifier overview		10.02.2014	INGO.WUNDERLE
AA3	S1	1	potential equalization		16.01.2014	INGO.WUNDERLE
	S1	2	assembly technology diagram		16.01.2014	INGO.WUNDERLE
AA5	S1	1	mounting arrangement		16.01.2014	INGO.WUNDERLE
AB1	S1	1	power infeed		16.01.2014	INGO.WUNDERLE
	S1	2	drives		16.01.2014	INGO.WUNDERLE
	S1	3	drives		16.01.2014	INGO.WUNDERLE
	S1	4	actor-sensor-box		16.01.2014	INGO.WUNDERLE
	S1	5	operation desk		16.01.2014	INGO.WUNDERLE
	S1	6	height adjustment OMNILIFT		16.01.2014	INGO.WUNDERLE
	S1	7	Plasma Interlock		16.01.2014	INGO.WUNDERLE
	S1	8	MESITT		16.01.2014	INGO.WUNDERLE
	S1	9	emergency cord		28.01.2014	INGO.WUNDERLE
	S1	10	foot protection		28.01.2014	INGO.WUNDERLE
	S1	11	foot protection		28.01.2014	INGO.WUNDERLE
BA0	S1	1	infeed AC 400 V		16.01.2014	INGO.WUNDERLE
BA1	S1	1	infeed AC 230 V		16.01.2014	INGO.WUNDERLE
	S1	2	AC 55 V control voltage		16.01.2014	INGO.WUNDERLE
	S1	3	DC 24 V control voltage		16.01.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
BA2	S1	1	DC 24 V potential distribution		16.01.2014	INGO.WUNDERLE
	S1	2	DC 24 V potential distribution		16.01.2014	INGO.WUNDERLE
	S1	3	interface operation panel		16.01.2014	INGO.WUNDERLE
	S1	4	interface plasma interlock		16.01.2014	INGO.WUNDERLE
	S1	5	front door cooling unit		16.01.2014	INGO.WUNDERLE
	S1	6	pressure monitoring		16.01.2014	INGO.WUNDERLE
	S41	1	voltage supply		16.01.2014	INGO.WUNDERLE
	S41	2	interlock emergency stop		16.01.2014	INGO.WUNDERLE
	S41	3	interlock emergency stop		16.01.2014	INGO.WUNDERLE
BA3	S1	1	watchdog		16.01.2014	INGO.WUNDERLE
BA4	S1	1	emergency stop loop		28.01.2014	INGO.WUNDERLE
CA0	S1	1	bus configuration		16.01.2014	INGO.WUNDERLE
	P1	1	panel PLC		16.01.2014	INGO.WUNDERLE
	P1	2	interface operation panel		16.01.2014	INGO.WUNDERLE
	P1	3	network connection		16.01.2014	INGO.WUNDERLE
CA2	S1	1	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	2	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	3	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	4	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	5	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	6	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	7	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	8	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	9	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	10	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	11	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	12	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S1	13	bus terminal overview		16.01.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
CA41	S41	1	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S41	2	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S41	3	bus terminal overview		16.01.2014	INGO.WUNDERLE
	S41	4	bus terminal overview		16.01.2014	INGO.WUNDERLE
EM1	F1	1	MESITT		16.01.2014	INGO.WUNDERLE
FK1	S1	1	bus terminals		16.01.2014	INGO.WUNDERLE
	S1	2	bus terminals		16.01.2014	INGO.WUNDERLE
	S1	3	common ignition		16.01.2014	INGO.WUNDERLE
	S1	4	common ignition		16.01.2014	INGO.WUNDERLE
	F1	1	height adjustment OMNILIFT		16.01.2014	INGO.WUNDERLE
	F1	2	height adjustment OMNILIFT		16.01.2014	INGO.WUNDERLE
HX1	S1	1	power component		16.01.2014	INGO.WUNDERLE
	S1	2	control component		16.01.2014	INGO.WUNDERLE
	S1	3	control component		16.01.2014	INGO.WUNDERLE
HX2	S1	1	power component		16.01.2014	INGO.WUNDERLE
	S1	2	control component		16.01.2014	INGO.WUNDERLE
	S1	3	control component		16.01.2014	INGO.WUNDERLE
HY1	S1	1	power component		16.01.2014	INGO.WUNDERLE
	S1	2	control component		16.01.2014	INGO.WUNDERLE
	S1	3	control component		16.01.2014	INGO.WUNDERLE
IM1	S41	1	interlock		16.01.2014	INGO.WUNDERLE
	S41	2	interlock		16.01.2014	INGO.WUNDERLE
	S41	3	interlock		16.01.2014	INGO.WUNDERLE
	S41	4	interlock		16.01.2014	INGO.WUNDERLE
	I1	1	HPR 130/260XD		16.01.2014	INGO.WUNDERLE
JB1	S1	1	punch marking		16.01.2014	INGO.WUNDERLE
LD1	S1	1	laserpointer		16.01.2014	INGO.WUNDERLE
MB1	S1	1	exhaust		16.01.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
VA0	S1	1	actor-sensor-box		16.01.2014	INGO.WUNDERLE
	S1	2	actor-sensor-box		16.01.2014	INGO.WUNDERLE
VNA0	M2	1	safety loop emergency stop		28.01.2014	INGO.WUNDERLE
	M2	2	safety loop emergency stop		28.01.2014	INGO.WUNDERLE
VNA1	M1	1	foot protection		28.01.2014	INGO.WUNDERLE
VNA2	M2	1	foot protection		28.01.2014	INGO.WUNDERLE
W1	S1	1	cable overview : =BA0+S1-WX00 - =HX2+S1-WXMR1		28.01.2014	INGO.WUNDERLE
	S1	2	cable overview : =HX2+S1-WXMR2 - =VNA2+M2-WS2		28.01.2014	INGO.WUNDERLE
	S1	3	cable overview : =VNA2+M2-WS3 - =VNA2+M2-WVNA		28.01.2014	INGO.WUNDERLE
W2	S1	1	Cable diagram =BA0+S1-WX00		16.01.2014	INGO.WUNDERLE
	S1	2	Cable diagram =BA2+S41-WX41		28.01.2014	INGO.WUNDERLE
	S1	3	Cable diagram =BA2+S41-WX42		28.01.2014	INGO.WUNDERLE
	S1	4	Cable diagram =BA2+S41-WX422		28.01.2014	INGO.WUNDERLE
	S1	5	Cable diagram =BA4+S1-WKNA		28.01.2014	INGO.WUNDERLE
	S1	6	Cable diagram =BA6+M2-WSRL1		10.02.2014	INGO.WUNDERLE
	S1	7	Cable diagram =BA6+M2-WSRL2		10.02.2014	INGO.WUNDERLE
	S1	8	Cable diagram =CA0+P1-WNET		10.02.2014	INGO.WUNDERLE
	S1	9	Cable diagram =CA0+P1-WX40		10.02.2014	INGO.WUNDERLE
	S1	10	Cable diagram =CA0+P1-WX40M		10.02.2014	INGO.WUNDERLE
	S1	11	Cable diagram =EM1+F1-M77070171-WXS3		10.02.2014	INGO.WUNDERLE
	S1	12	Cable diagram =EM1+F1-M77070171-WXS4		10.02.2014	INGO.WUNDERLE
	S1	13	Cable diagram =EM1+F1-WXS1		10.02.2014	INGO.WUNDERLE
	S1	14	Cable diagram =FK1+F1-WPA		10.02.2014	INGO.WUNDERLE
	S1	15	Cable diagram =FK1+F1-WX1		28.01.2014	INGO.WUNDERLE
	S1	16	Cable diagram =FK1+F1-WXS1		10.02.2014	INGO.WUNDERLE
	S1	17	Cable diagram =FK1+F1-WXU		10.02.2014	INGO.WUNDERLE
	S1	18	Cable diagram =HX1+S1-WV1		10.02.2014	INGO.WUNDERLE
	S1	19	Cable diagram =HX1+S1-WV2		10.02.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
W2	S1	20	Cable diagram =HX1+S1-WXMR1		10.02.2014	INGO.WUNDERLE
	S1	21	Cable diagram =HX1+S1-WXMR2		10.02.2014	INGO.WUNDERLE
	S1	22	Cable diagram =HX1+M1-WB1		28.01.2014	INGO.WUNDERLE
	S1	23	Cable diagram =HX1+M1-WB3		10.02.2014	INGO.WUNDERLE
	S1	24	Cable diagram =HX1+M1-WB5		10.02.2014	INGO.WUNDERLE
	S1	25	Cable diagram =HX1+M1-WCN2		10.02.2014	INGO.WUNDERLE
	S1	26	Cable diagram =HX1+M1-WXM		28.01.2014	INGO.WUNDERLE
	S1	27	Cable diagram =HX2+S1-WXMR1		10.02.2014	INGO.WUNDERLE
	S1	28	Cable diagram =HX2+S1-WXMR2		10.02.2014	INGO.WUNDERLE
	S1	29	Cable diagram =HX2+M2-WCN2		10.02.2014	INGO.WUNDERLE
	S1	30	Cable diagram =HX2+M2-WXM		28.01.2014	INGO.WUNDERLE
	S1	31	Cable diagram =HY1+S1-WXMR1		10.02.2014	INGO.WUNDERLE
	S1	32	Cable diagram =HY1+S1-WXMR2		10.02.2014	INGO.WUNDERLE
	S1	33	Cable diagram =HY1+F1-WCN2		10.02.2014	INGO.WUNDERLE
	S1	34	Cable diagram =HY1+F1-WXM		28.01.2014	INGO.WUNDERLE
	S1	35	Cable diagram =HY1+O1-WB2		28.01.2014	INGO.WUNDERLE
	S1	36	Cable diagram =HY1+O1-WB4		10.02.2014	INGO.WUNDERLE
	S1	37	Cable diagram =HY1+O1-WB6		10.02.2014	INGO.WUNDERLE
	S1	38	Cable diagram =IM1+S41-WBUS2		10.02.2014	INGO.WUNDERLE
	S1	39	Cable diagram =IM1+S41-WXRS		10.02.2014	INGO.WUNDERLE
	S1	40	Cable diagram =IM1+S41-1X3M-WX90		10.02.2014	INGO.WUNDERLE
	S1	41	Cable diagram =IM1+S41-1X3M-WXRS		10.02.2014	INGO.WUNDERLE
	S1	42	Cable diagram =IM1+I1-WHPR		10.02.2014	INGO.WUNDERLE
	S1	43	Cable diagram =IM1+I1-WHPR		10.02.2014	INGO.WUNDERLE
	S1	44	Cable diagram =IM1+I1-WREM		10.02.2014	INGO.WUNDERLE
	S1	45	Cable diagram =IM1+I1-WWST		28.01.2014	INGO.WUNDERLE
	S1	46	Cable diagram =LD1+F1-WX1		10.02.2014	INGO.WUNDERLE
	S1	47	Cable diagram =MB1+A1-WS8		28.01.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
W2	S1	48	Cable diagram =VA0+M1-WX1		28.01.2014	INGO.WUNDERLE
	S1	49	Cable diagram =VNA0+M2-WSNA		28.01.2014	INGO.WUNDERLE
	S1	50	Cable diagram =VNA1+M1-WS1		28.01.2014	INGO.WUNDERLE
	S1	51	Cable diagram =VNA1+M1-WS2		28.01.2014	INGO.WUNDERLE
	S1	52	Cable diagram =VNA1+M1-WS3		28.01.2014	INGO.WUNDERLE
	S1	53	Cable diagram =VNA1+M1-WS4		28.01.2014	INGO.WUNDERLE
	S1	54	Cable diagram =VNA1+M1-WVNA		28.01.2014	INGO.WUNDERLE
	S1	55	Cable diagram =VNA2+M2-WS1		28.01.2014	INGO.WUNDERLE
	S1	56	Cable diagram =VNA2+M2-WS2		28.01.2014	INGO.WUNDERLE
	S1	57	Cable diagram =VNA2+M2-WS3		28.01.2014	INGO.WUNDERLE
	S1	58	Cable diagram =VNA2+M2-WS4		28.01.2014	INGO.WUNDERLE
	S1	59	Cable diagram =VNA2+M2-WVNA		28.01.2014	INGO.WUNDERLE
X1	S1	1	Terminal-strip overview : =BA0+S1-X00 - =VA0+S1-X1		16.01.2014	INGO.WUNDERLE
X2	S1	1	Terminal diagram =BA0+S1-X00		16.01.2014	INGO.WUNDERLE
	S1	2	Terminal diagram =BA1+S1-X230L1		28.01.2014	INGO.WUNDERLE
	S1	3	Terminal diagram =BA1+S1-X230L2		28.01.2014	INGO.WUNDERLE
	S1	4	Terminal diagram =BA1+S1-XL24		28.01.2014	INGO.WUNDERLE
	S1	5	Terminal diagram =BA1+S1-XP24		28.01.2014	INGO.WUNDERLE
	S1	6	Terminal diagram =BA1+S1-XT		28.01.2014	INGO.WUNDERLE
	S1	7	Terminal diagram =BA2+S1-X40		28.01.2014	INGO.WUNDERLE
	S1	8	Terminal diagram =BA2+S1-X41		28.01.2014	INGO.WUNDERLE
	S1	9	Terminal diagram =BA2+S1-X42		16.01.2014	INGO.WUNDERLE
	S1	10	Terminal diagram =BA2+S1-X422		16.01.2014	INGO.WUNDERLE
	S1	11	Terminal diagram =BA2+S1-XL0		28.01.2014	INGO.WUNDERLE
	S1	12	Terminal diagram =BA2+S41-X24L		28.01.2014	INGO.WUNDERLE
	S1	13	Terminal diagram =BA2+S41-X41		28.01.2014	INGO.WUNDERLE
	S1	14	Terminal diagram =BA2+S41-X42		28.01.2014	INGO.WUNDERLE
	S1	15	Terminal diagram =BA2+S41-X43		28.01.2014	INGO.WUNDERLE

table of contents

P8GC_INH

plant funktion	Mounting location	Page	Page description	Supplementary page field	date	Edited by
X2	S1	16	Terminal diagram =BA2+S41-X422		28.01.2014	INGO.WUNDERLE
	S1	17	Terminal diagram =BA2+S41-XL0		28.01.2014	INGO.WUNDERLE
	S1	18	Terminal diagram =FD+S1-X24		28.01.2014	INGO.WUNDERLE
	S1	19	Terminal diagram =FD+S1-XGND		28.01.2014	INGO.WUNDERLE
	S1	20	Terminal diagram =FH1+S1-XZ11		28.01.2014	INGO.WUNDERLE
	S1	21	Terminal diagram =FH1+S1-XZ21		28.01.2014	INGO.WUNDERLE
	S1	22	Terminal diagram =FK1+S1-XVH		28.01.2014	INGO.WUNDERLE
	S1	23	Terminal diagram =HX1+S1-XMR distribution terminals		28.01.2014	INGO.WUNDERLE
	S1	24	Terminal diagram =IM1+S41-X90		28.01.2014	INGO.WUNDERLE
	S1	25	Terminal diagram =VA0+S1-X1		28.01.2014	INGO.WUNDERLE
Z1	S1	1	Parts list : FERRITRING - 5X20 T10A		28.01.2014	INGO.WUNDERLE
	S1	2	Parts list : ZSI 2.5 - TRAFO 850/2700		28.01.2014	INGO.WUNDERLE
	S1	3	Parts list : PK 75 - 3RH1911-1FA22		28.01.2014	INGO.WUNDERLE
	S1	4	Parts list : RN202-1/02 - 8027481		10.02.2014	INGO.WUNDERLE
	S1	5	Parts list : 8027481 - EL1008		10.02.2014	INGO.WUNDERLE
	S1	6	Parts list : EL2008 - EL1008		10.02.2014	INGO.WUNDERLE
	S1	7	Parts list : EL2622 - 76801001		10.02.2014	INGO.WUNDERLE
	S1	8	Parts list : 4571103 - SGDV-5R5A01A		10.02.2014	INGO.WUNDERLE
	S1	9	Parts list : 0026250 - Diode ZPD15		10.02.2014	INGO.WUNDERLE
	S1	10	Parts list : Diode ZPD15 - 0026231		10.02.2014	INGO.WUNDERLE
	S1	11	Parts list : 99 0437 12 05 - 8027481		28.01.2014	INGO.WUNDERLE
	S1	12	Parts list : 8027481 - M72291951		28.01.2014	INGO.WUNDERLE

Structure identifier overview

P8GC_STRKT

Full designation	labeling	Structure description
=AA0	plant	
=AA1	plant	
=AA2	plant	
=AA3	plant	
=AA5	plant	
=AB1	plant	
=BA0	plant	
=BA1	plant	
=BA2	plant	
=BA3	plant	
=BA4	plant	
=BA6	plant	
=CA0	plant	
=CA2	plant	
=CA41	plant	
=EM1	plant	
=FD	plant	
=FH1	plant	
=FK1	plant	
=HX1	plant	
=HX2	plant	
=HY1	plant	
=IM1	plant	
=JB1	plant	
=LD1	plant	
=MB1	plant	
=VA0	plant	
=VNA0	plant	

With structure identification the configuration
of function categories and mounting locations are appointed.

The complete designation of functions or parts of sites is the euqual sign (=).

Function categories can be entire sites or parts of sites..

Function categories can be machines or parts of machines, too..

For complete designation of local relation or mounting position the plus sign (+) is preceded.

Mounting locations (+) can be defined areas inside plants.

Mounting locations (+) can be also Mounting positions on a machine or at periphery.

An overview of function categories (=) and their mounting positions contains circuit chapter =AA3.

The present circuit diagram is subdevided into function categories (=) and mounting locations (+) used on the cutting machine.


The function categories (=) are represented as circuit diagram chapters cohered.

The installed equipment shown in circuit diagrams is labelled with structure identifiers.

Example 1:

The motor (-M1) of left longitudinal axis X1 belongs to fuction category =HX1.

The complete designation for longitudinal drive X1 reads as follows:

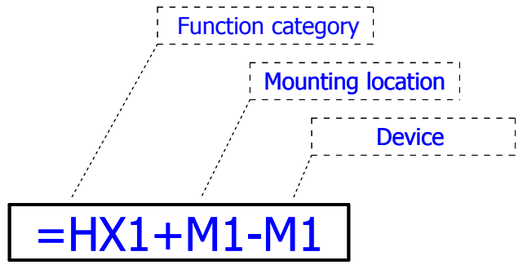

The structure identifier overview becomes generated automatically by project evaluation and contains just those identifiers which are used actually

Structure identifier overview

P8GC_STRKT

Full designation	labeling	Structure description
=VNA1	plant	
=VNA2	plant	
=W1	plant	
=W2	plant	
=X1	plant	
=X2	plant	
=Z1	plant	
+S1	Mounting location	
+F1	Mounting location	
+P1	Mounting location	
+O1	Mounting location	
+S41	Mounting location	
+I1	Mounting location	
+M2	Mounting location	
+M1	Mounting location	
+A1	Mounting location	
+EXT	Mounting location	

With structure identification the configuration
of function categories and mounting locations are appointed.

The complete designation of functions or parts of sites is the euqual sign (=).

Function categories can be entire sites or parts of sites..

Function categories can be machines or parts of machines, too..

For complete designation of local relation or mounting position the plus sign (+) is preceded.

Mounting locations (+) can be defined areas inside plants.

Mounting locations (+) can be also Mounting positions on a machine or at periphery.

An overview of function categories (=) and their mounting positions contains circuit chapter =AA3.

The present circuit diagram is subdevided into function categories (=) and mounting locations (+) used on the cutting machine.


The function categories (=) are represented as circuit diagram chapters cohered.

The installed equipment shown in circuit diagrams is labelled with structure identifiers.

Example 1:

The motor (-M1) of left longitudinal axis X1 belongs to fuction category =HX1.

The complete designation for longitudinal drive X1 reads as follows:

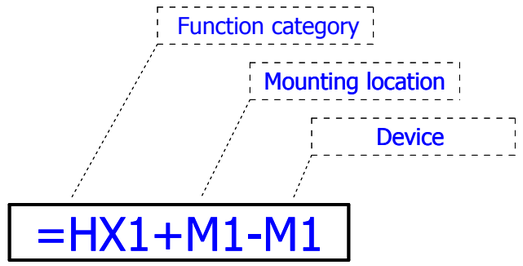

The structure identifier overview becomes generated automatically by project evaluation and contains just those identifiers which are used actually

* supplier customer

35mm² per Plasma-Plant
16mm² per Autogen-Plant

PE Protective wire
FPE Functional Earthing
77070130 16mm² FPE Functional Earthing
77005938 35mm² FPE Functional Earthing
77005939 70mm² FPE Functional Earthing

Customer *
equipotential bondig
FPE
OMNIFLOW
ground strap 0,3m 77005034
control cabinet
equipotential bondig
FPE 16mm² 2,8m
FPE 70mm² 2,2m
FPE 70mm² < KU Länge >
Ignition console Plasma
ground strap
HPR
Gas console Plasma
ground strap 0,2m 77005033
ground strap 0,2m 77005033
KJ
Gas console Plasma
ground strap 0,2m 77005033
machine body
ground strap 0,1m 77005032
Off-valve console Plasma
HPR. 0,1m 77005032
KJ. 0,3m 77005034
ground strap
drive regulator
ground strap 0,3m 77005034
FPE 35mm² 6m
Plasma
FPE
ground strap 0,3m 77005035
Sensomat Alfa/Pan
ground strap 0,3m 77005034
FPE 16mm² 6m
ALFA/PAN
ground strap 0,3m 77005035
ground strap 0,1m 77005032
wheel housing left
ground strap 0,1m 77005032
wheel housing right
FPE 16mm² 2,6m
Messer
0 1
operation desk

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=AA2/2	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

potential equalization

drawing number		page	1
plant	= AA3	location	+ S1
last page	2	continuation page	2




Technologieschema auftragsbezogen anpassen !

P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	assembly technology diagram
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 1		total pages 190	last editor I.Wund				

drawing number		page	2
plant	= AA3	location	+ S1
last page 2		continuation page	=AA5/1

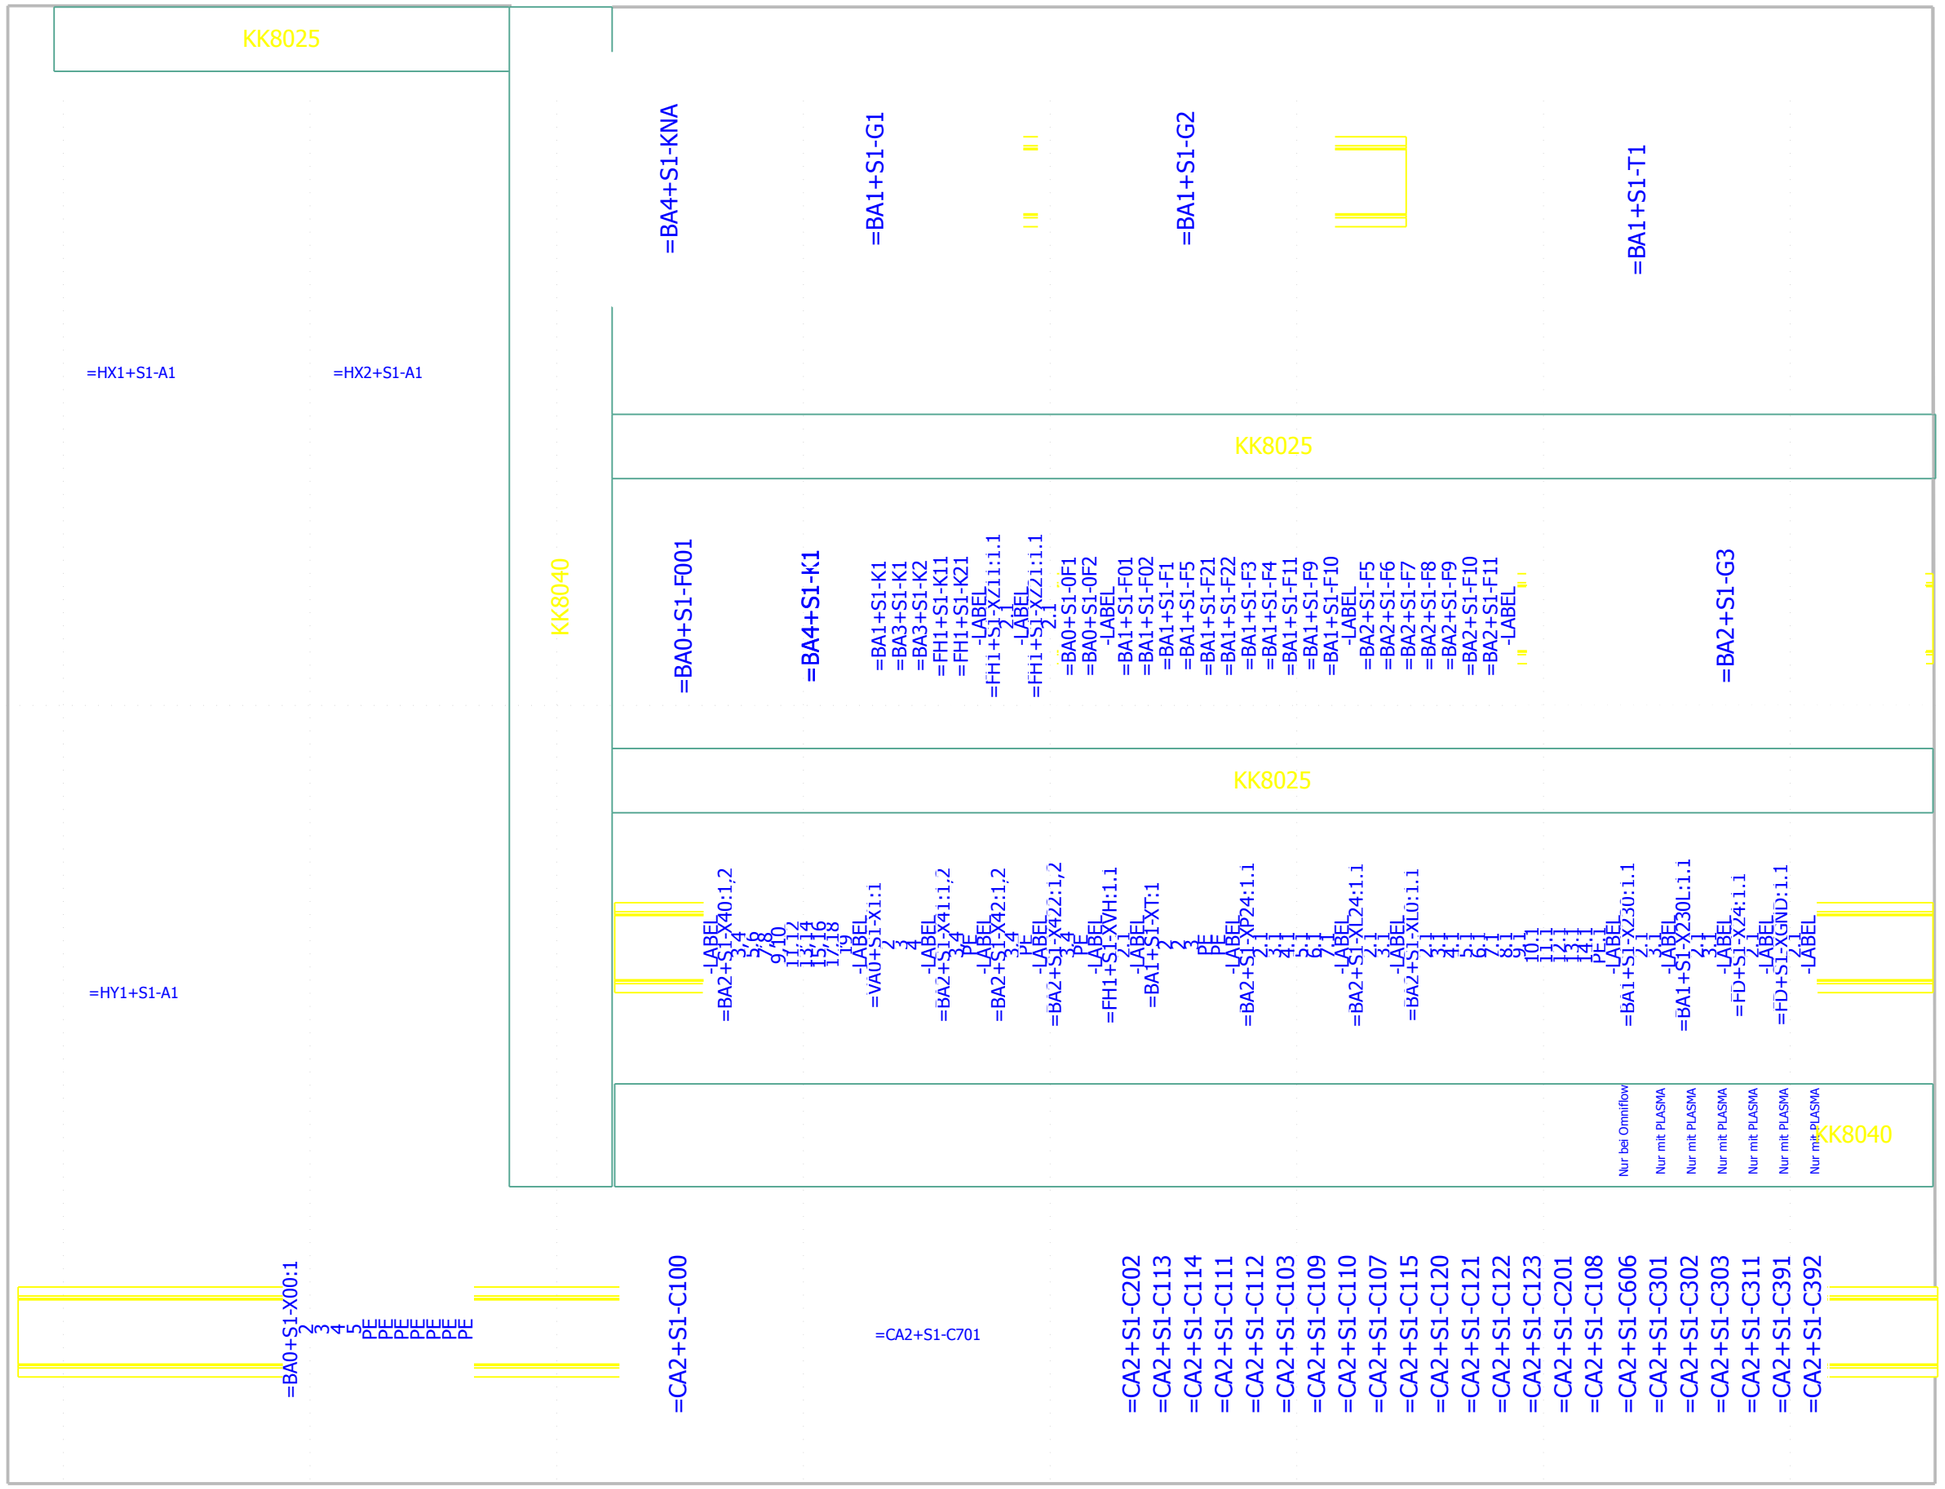

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	mounting arrangement	drawing number / page 1
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = AA5 / location + S1
change	date	name	revisor				
previous page =AA3/2		total pages 190	last editor I.Wund				last page 1 / continuation page =AB1/1

MESSER Cutting Systems

+S1

=LD1+S1-T1
=LD1/1.2

TCL24-112DC 24W
output

=BA0/1.0
=BA0-X00

=LD1+F1-WX1
Ölflex FD Classic 810 CY
3x0,5 mm²
77070094
12 m
=LD1/1.2

=BA0-WX00
ÖLFLEX FD CLASSIC 810
3x2,5 mm²
571223
25 m
=BA0/1.3

infeed AC 400 V

* Drucküberwachung immer wenn:
- Wagenpositionierung
- Pressluftkühlung
- SKEW ROTATOR
- SKEW Delta
- DAFL
- DKS
- Technifor
- Sandstrahleinrichtung
- Lärmschutzhaube
- Bohraggregat
- Monoflow
- EFI-Agr.
- Indexer mit Wechseltisch
- Starkschneidbrenner
- ALFA Luftspülung

-X1
plug connection
=LD1/1.2
77005997
4

-X2
plug connection
=LD1/1.2
77070092
4

-X2 = plug connection

Geflechtschlauch CU
0546032
0,5m

-KLD
Ferrite
77004659

S

=LD1/1.1

-H1
laserpointer

=LD1+F1

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=AA5/1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

power infeed

drawing number		page	1
plant	= AB1	location	+ S1
last page	11	continuation page	2

+S1

SGDM-08ADA

=HX1-XM
=HX1-CN2
=HX2-XM
=HX2-CN2

SH
SH

-WXM
Yaskawa System
4x1,0 mm²
77005913
10 m
=HX1/1.2

-WCN2
Flexible Type
3x2x0,34 mm²
77005911
10 m
=HX1/1.5

*cable kit 72291954

-XM =HX1/1.1
SH
-CN2 =HX1/1.4

M
YASKAWA
G

drive
resolver

-M1
longitudinal drive
=AA3/2.0

=HX1+M1

-WXM
Yaskawa System
4x1,0 mm²
77005913
10 m
=HX2/1.2

-WCN2
Flexible Type
3x2x0,34 mm²
77005911
10 m
=HX2/1.5

*cable kit 72291954

-XM =HX2/1.1
SH
-CN2 =HX2/1.4

M
YASKAWA
G

drive
resolver

-M1
longitudinal drive
=AA3/2.9

=HX2+M2

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

drives

drawing number		page	2
plant	= AB1	location	+ S1
last page	11	continuation page	3

+S1

SGDM-08ADA

=HY1-XM

=HY1-CN2

SH

-WXM
Yaskawa System
4x1,0 mm²
77005913
10 m
=HY1/1.2

-WCN2
Flexible Type
3x2x0,34 mm²
77005911
10 m
=HY1/1.5

*cable kit 72291954

-XM =HY1/1.1

SH

-CN2 =HY1/1.4

M

YASKAWA

G

drive

resolver

-M1

transversal drive

=AA3/2.1

=HY1+F1

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 2		total pages 190	last editor I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

drives

drawing number		page	3
plant	= AB1	location	+ S1
last page 11		continuation page	4

+S1

=BA1/3.3
=BA1-XL24

-WX1 *
16x+5x0,34+0,75 mm²
77003999
10 m
=VA0/1.2

BOX & CABLE

* cable kit 72291726

=HX1+M1-WB1 *
PUR/PVC
4x0,34 mm²
77004462
1 m
=VA0/1.2

=HX1+M1-B1
=VA0/1.2
+ overtravel X

=HX1+M1-WB3 *
PUR/PVC
4x0,34 mm²
77004462
1 m
=VA0/1.4

=HX1+M1-B3
=VA0/1.4
- overtravel X

=HX1+M1-WB5 *
PUR/PVC
4x0,34 mm²
77004462
1 m
=VA0/1.6

=HX1+M1-B5
=VA0/1.6
home switch X

5.8 / =CA0+P1-P1M1
operation desk cooler

-P1 M12 =VA0/1.1
-P2 M12 =VA0/2.1
-P3 M12 =VA0/1.3
-P4 M12 =VA0/2.3
-P5 M12 =VA0/1.5
-P6 M12 =VA0/2.5
-P7 M12 =VA0/1.7
-P8 M12 =VA0/2.7

actor-sensor-box
-X1
=AA3/2.0

=HY1+O1-WB2 *
PUR/PVC
5x0,34 mm²
77004903
10 m
=VA0/2.2

=HY1+O1-B2
=VA0/2.2
+ overtravel Y

=HY1+O1-WB4 *
PUR/PVC LiF9YH11YH
5x0,34 mm²
77004903
10 m
=VA0/2.4

=HY1+O1-B4
=VA0/2.4
- overtravel Y

=HY1+O1-WB6 *
PUR/PVC LiF9YH11YH
5x0,34 mm²
77004903
10 m
=VA0/2.6

=HY1+O1-B6
=VA0/2.6
home switch Y

77002800
=MB1+A1-XS8 *
plug connection
-XS8 plug connection
=VA0/2.8

=MB1+A1-WS8
Ölflex FD Classic 810 CY
3x1 mm²
0551042
=VA0/2.8
Customer

=MB1+A1
-S8
=AA3/2.1
exhaust

=VA0+M1

P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	3	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

actor-sensor-box

drawing number		page	4
plant	= AB1	location	+ S1
last page	11	continuation page	5

=CA2-C100
=CA0/1.3

IN BUS
OUT BUS

+S1

=BA2/3.0
=BA2-X40

-U1
Ferrite
77004659

7.0
+S41-BUS

Längen für Datenleitung vom Kunden
77004562 20m
77004661 30m
77004662 40m
77004663 50m

customers periphery
-N1
77004661 30m

Optional
Virtual Service
dann FKT-Gruppe
=BC4 verwenden !

=CA0-WNET
CAT5
4x2x0,14 mm²
77005811
10 m

*

-XMG2
=CA0+P1/3.1
BUS IN
OUT BUS

-WMG2
Datenleitung
4x2x0,14 mm²
77005783
3 m
=CA0+P1/3.1
additional with panel stand

-U9
=CA0+P1/1.0
Ferrite
77004659

-U2
Ferrite
77004659

BUS IN
BUS OUT
BUS OUT
-X106
-X105
-X104

=CA0+P1-CA0
=CA0/1.0

Pultvariante mit Standfuss
den Grundlagen für FiberBlade
oder MetalMaster entnehmen

-P1
=AA3/2.0
Control Panel

*** cable kit 72291726**

-WX40
SAIB-M23-19P-(S)-ST
16x+3x0,5+1,0 mm²
77004829
10 m
=CA0+P1/1.9*

Bis Spur 5000 = 10m

=CA0+P1-X40 8
=CA0+P1/1.1

4.3
-P1M1

-WX40M
PUR/PVC
4x0,34 mm²
77070067
4 m
=CA0+P1/2.1

=CA0+P1-XM1
=CA0+P1/2.2

Fan + cable
72291920

M

-M1
=CA0+P1/2.1
DC 24 V

operation desk cooler

=CA0+P1

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	operation desk
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 4		total pages 190	last editor I.Wund			

MESSER Cutting Systems

drawing number		page	5
plant	= AB1	location	+ S1
last page	11	continuation page	6

+S1

=BA1/2.0
=BA1-XT

=FK1/3.1
=FH1-XZ11

=BA1/3.9
=BA1-XP24

-WX1
Chainflex Hybrid TP
12x+4x0,25+0,5 mm²
72291716
9 m
=FK1+F1/1.9

-X1

-MOT
=FK1+F1/1.0
76801001
drive regulator

A1

-X4

-X2

-FE
Funktionserdung

-MA1
ground
77005034
Masseband 2x6mm Bohrung 0,3m

+O1

-PE

-WPA
ESUY Kupfer-Erdungsseil
1x35 mm²
77005938
6 m
polarity balance

Nur bei Plasma
1/2 Portalbreite +4m

-WXU
Ölflex FD Classic 810 CY
3x1,5 mm²
72291723
9 m
=FK1+F1/2.1

-XU

-XM

55V

M

-M1
=AA3/2.2
height adjustment
OL200/300

-B1
10...30VDC
150mA
collision

-WXS1
PUR/PVC
5x0,34 mm²
77004903
10 m
=FK1/2.2

-XS1
77002800

-S1
tactile switch

=FK1+F1

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	5	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

height adjustment
OMNILIFT

drawing number		page	6
plant	= AB1	location	+ S1
last page	11	continuation page	7

+S1

=BA2/4.0
=BA2-X41

=BA2/4.3
=BA2-X42

=BA2/4.6
=BA2-X422

5.4
+S41-BUS

-WBUS2
SFTP HIROSE/AMP/SUN/
4x2x0,14 mm²
77004661
30 m

77004561 10m
77004562 20m
77004661 30m
77004662 40m
77004663 50m

Längen kommissionsbezogen eintragen!

=BA2-WX41
ÖLFLEX FD CLASSIC 810 CY
5x1,5 mm²
0571423
30 m
=BA2+S41/1.3

=BA2-WX42
ÖLFLEX FD CLASSIC 810 CY
5x1,5 mm²
0571423
30 m
=BA2+S41/2.3

=BA2-WX422
Ölflex FD Classic 810 CY
5x1,5 mm²
0571423
30 m
=BA2+S41/2.7

=BA2-X41
=BA2+S41/1.0

=BA2-X42
=BA2+S41/2.0

=BA2-X422
=BA2+S41/2.5

BUS IN
BUS OUT
=CA41+S41-C400
=CA0/1.7

Digital input terminal
EL1008
=CA41-C401
=CA41+S41/1.4
I1
1
=AB1+S1/7.2

RS 422 / RS 485
EL6021
=CA41-C416
=CA41+S41/4.7
I1
1
=AB1+S1/7.2

-1X3M
=IM1+I1/1.0

-WX90
UNITRONIC LiYCY
18x0,5
=IM1+I1/1.4

-WXRS
UNITRONIC LiYCY
8x0,25
=IM1+I1/1.6

=IM1+I1/1.0
+S41-1X3

=IM1+I1/1.0
+S41-1X3

=IM1+S41

=BA2+S41/3.1
=BA2-X43

=IM1+S41/2.1
-X90

-WHPR
US Steuerleitung 22 AWG
37x22 AWG
72423104
4,5 m
=IM1+I1/1.1
-J300
Sub D 37

-WREM
Ölflex FD Classic 810 CY
3x1 mm²
72416403
4,5 m
=IM1+I1/1.8
-TB2

-WWST
Ölflex FD Classic 810 CY
3x1,5 mm²
72416401
4,5 m
=IM1+I1/1.9
-XW+/-


=IM1+I1

=AA3/2.3

HPR 130/260/400 XD
plasma current source
=IM1-A1

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Plasma Interlock
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	6	total pages	190	last editor	I.Wund		

drawing number			page	7
plant	=	AB1	location	+ S1
last page	11	continuation page		8

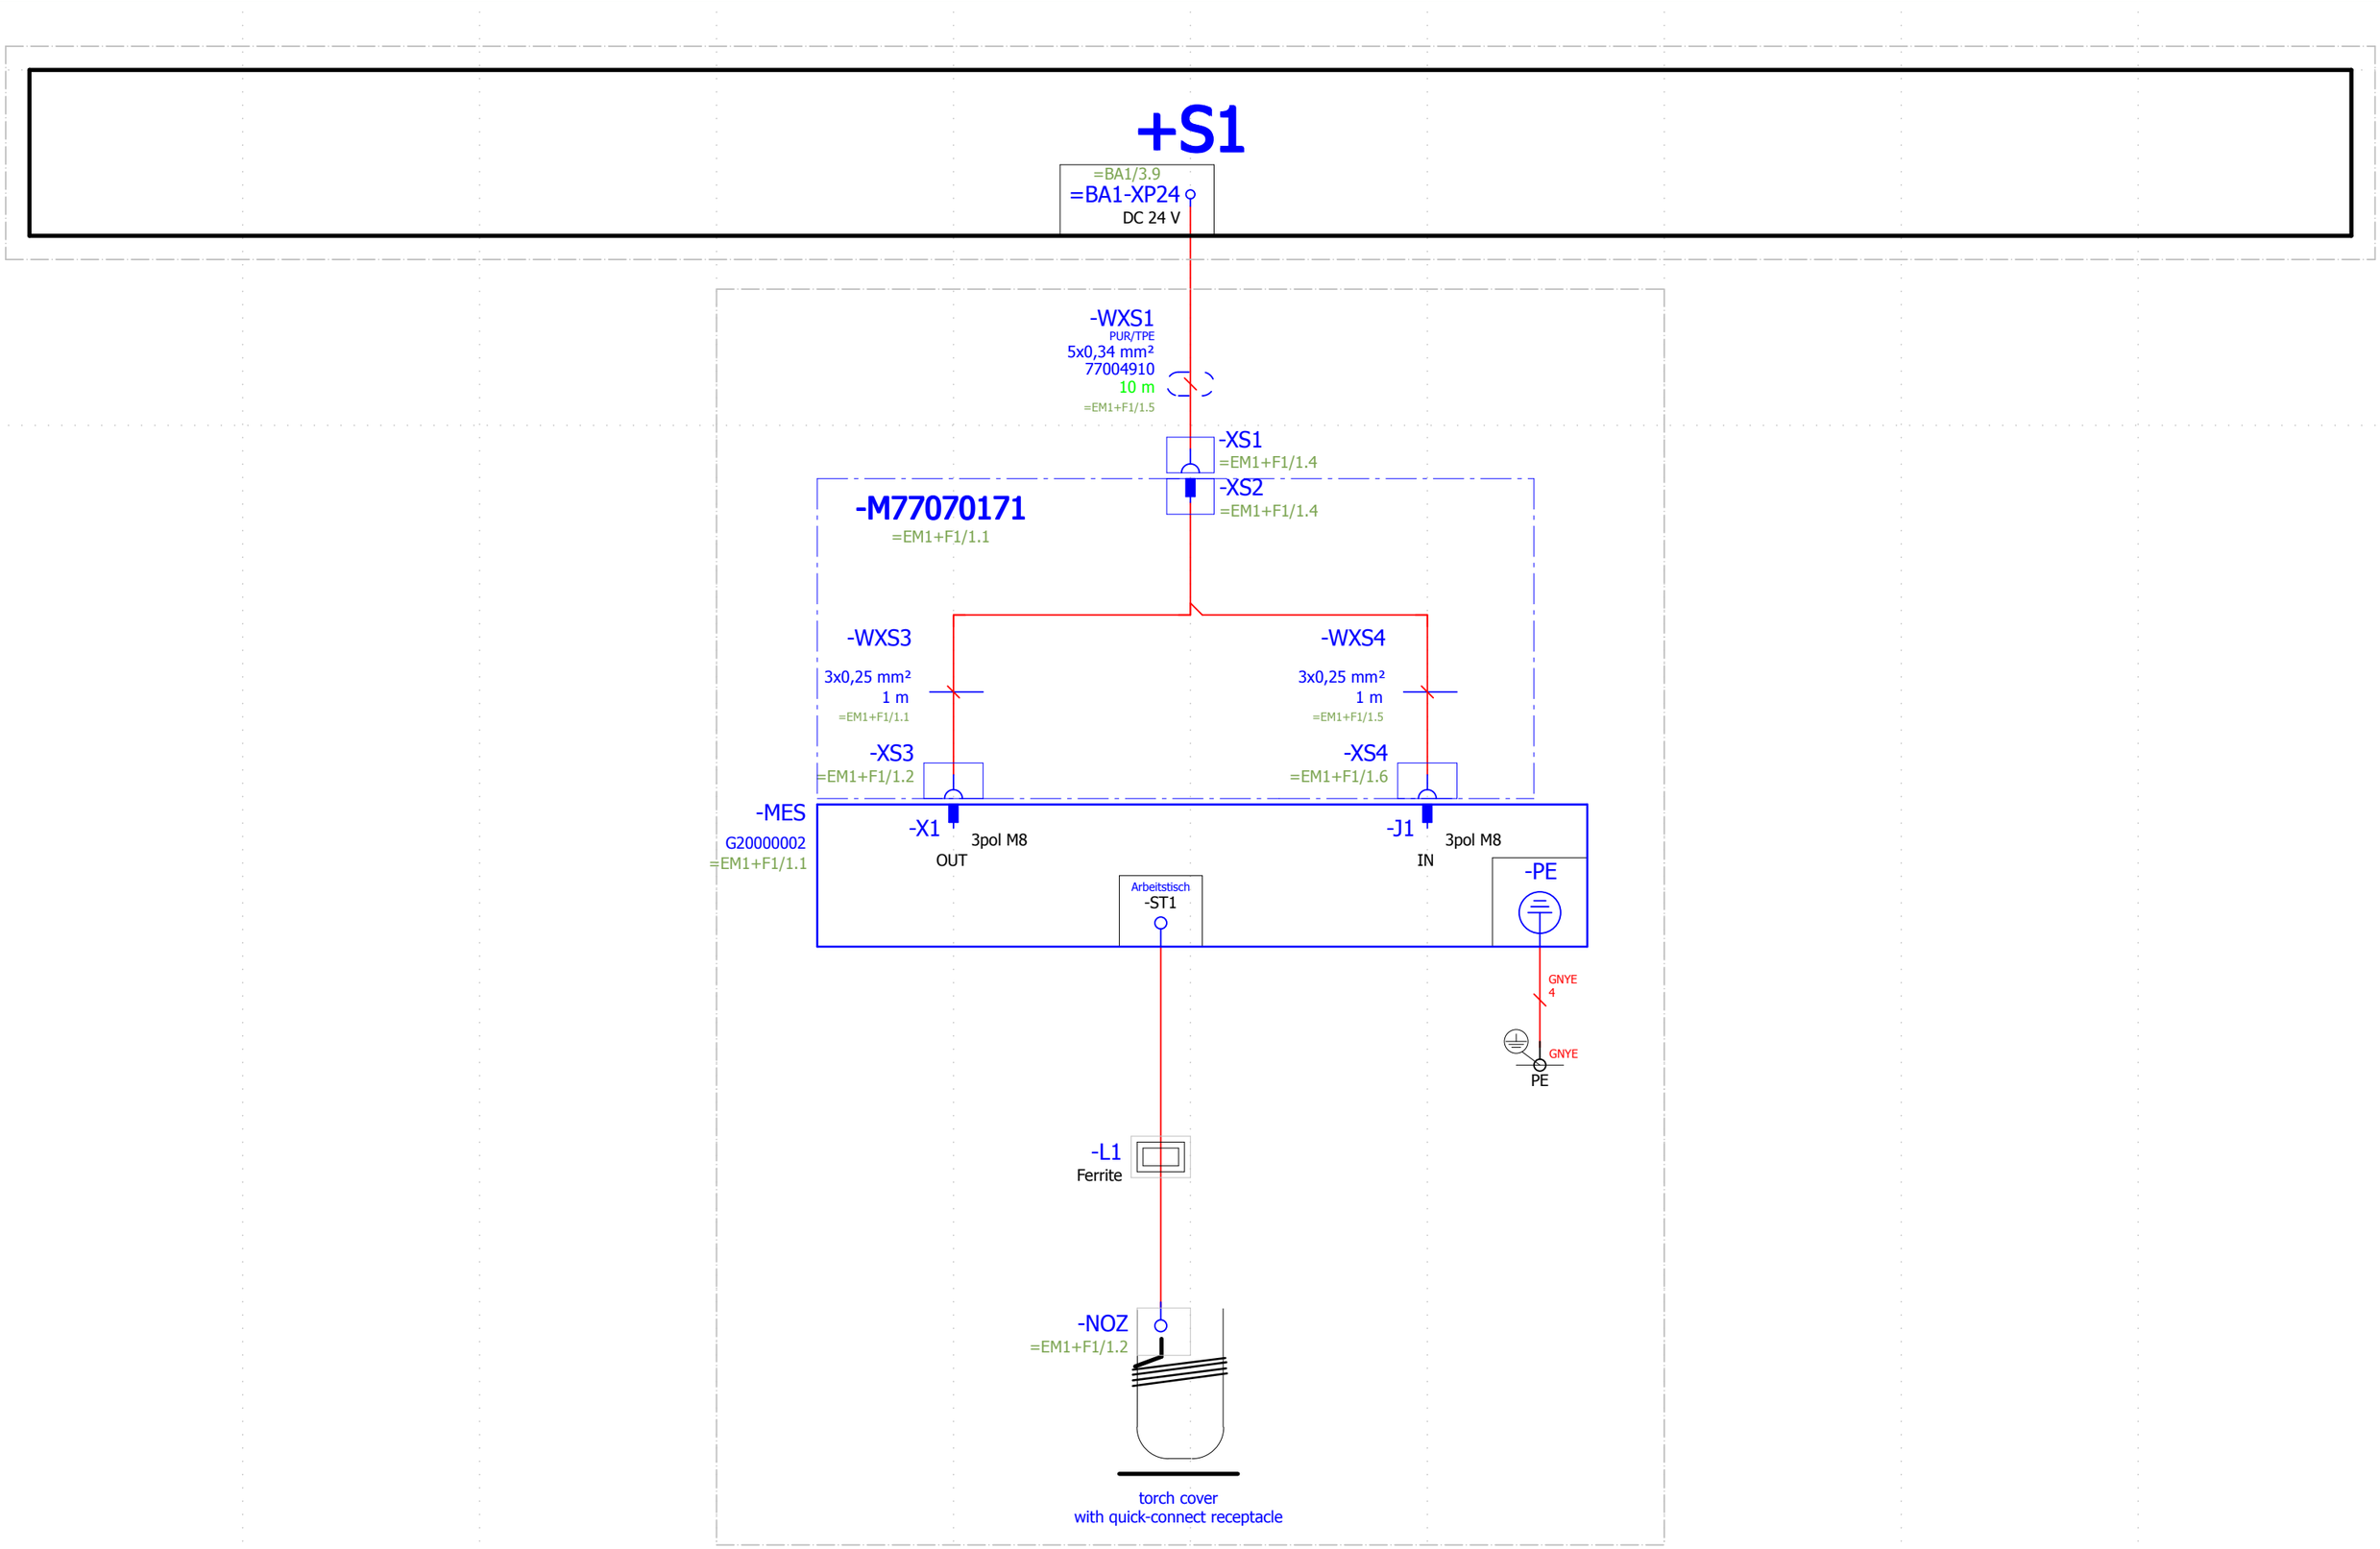

=EM1+F1

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 7		total pages 190	last editor I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

MESITT

drawing number		page	8
plant	= AB1	location	+ S1
last page 11		continuation page	9

+S1

M12 befestigungsclip
77005649

=BA4-SNA
=BA4/1.2

-WSNA
PUR/PVC
4x0,34 mm²
** 77003736
3 m
=VNA0+M2/1.1

** Bei Schaltschrank Links 77003737

* Bereits bei Mechanik enthalten.

Anbauort IMMER
an gegenüberliegender Bedienseite.
Auf die Länge achten.

=BA6+M2-SRL1
=VNA0+M2/1.1
ZANDER LIFELINE4 901164
72243601
Emergency cord front

=BA6+M1-XSRL1
=BA6+M1-XSRL1 = plug connection
77005407 *

=BA6+M2-WSRL1
PUR/PVC
4x0,34 mm²
77003736
3 m
=VNA0+M2/1.2

2
-P0
=VNA0+M2/1.1

-P1
1
M12
=VNA0+M2/1.1

-P2
1
M12
=VNA0+M2/2.1

=BA6+M2-WSRL2
PUR/PVC
4x0,34 mm²
*** 77003736
3 m
=VNA0+M2/2.2

*** Bei Bedienseite Links 77003736

=BA6+M1-XSRL2
=BA6+M1-XSRL2 = plug connection
* 77005407

=BA6+M2-SRL2
=VNA0+M2/2.1
ZANDER LIFELINE4 901164
72243601
emergency cord rear

Optional
Fussschutzsicherung
left
10.4 / =VNA1+M1-X2

Optional
Fussschutzsicherung
right
=VNA2+M2-X4 / 11.4

-P3
1
M12
=VNA0+M2/1.3

-P4
1
M12
=VNA0+M2/2.3

=VNA0+M2-XP5
=VNA0+M2/1.5
jumper plug

77005150

-P5
1
M12
=VNA0+M2/1.5

-P6
1
M12
=VNA0+M2/2.5

77005150

=VNA0+M2-XP6
=VNA0+M2/2.5
jumper plug

72291950

not connected

-P7
1
M12
=VNA0+M2/1.7

-P8
1
M12
=VNA0+M2/2.7

emergency stop periphery

-X1
=VNA0+M2/1.0


=VNA0+M2

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	emergency cord
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 8		total pages 190	last editor I.Wund			

MESSER Cutting Systems

drawing number		page	9
plant	= AB1	location	+ S1
last page 11		continuation page	10

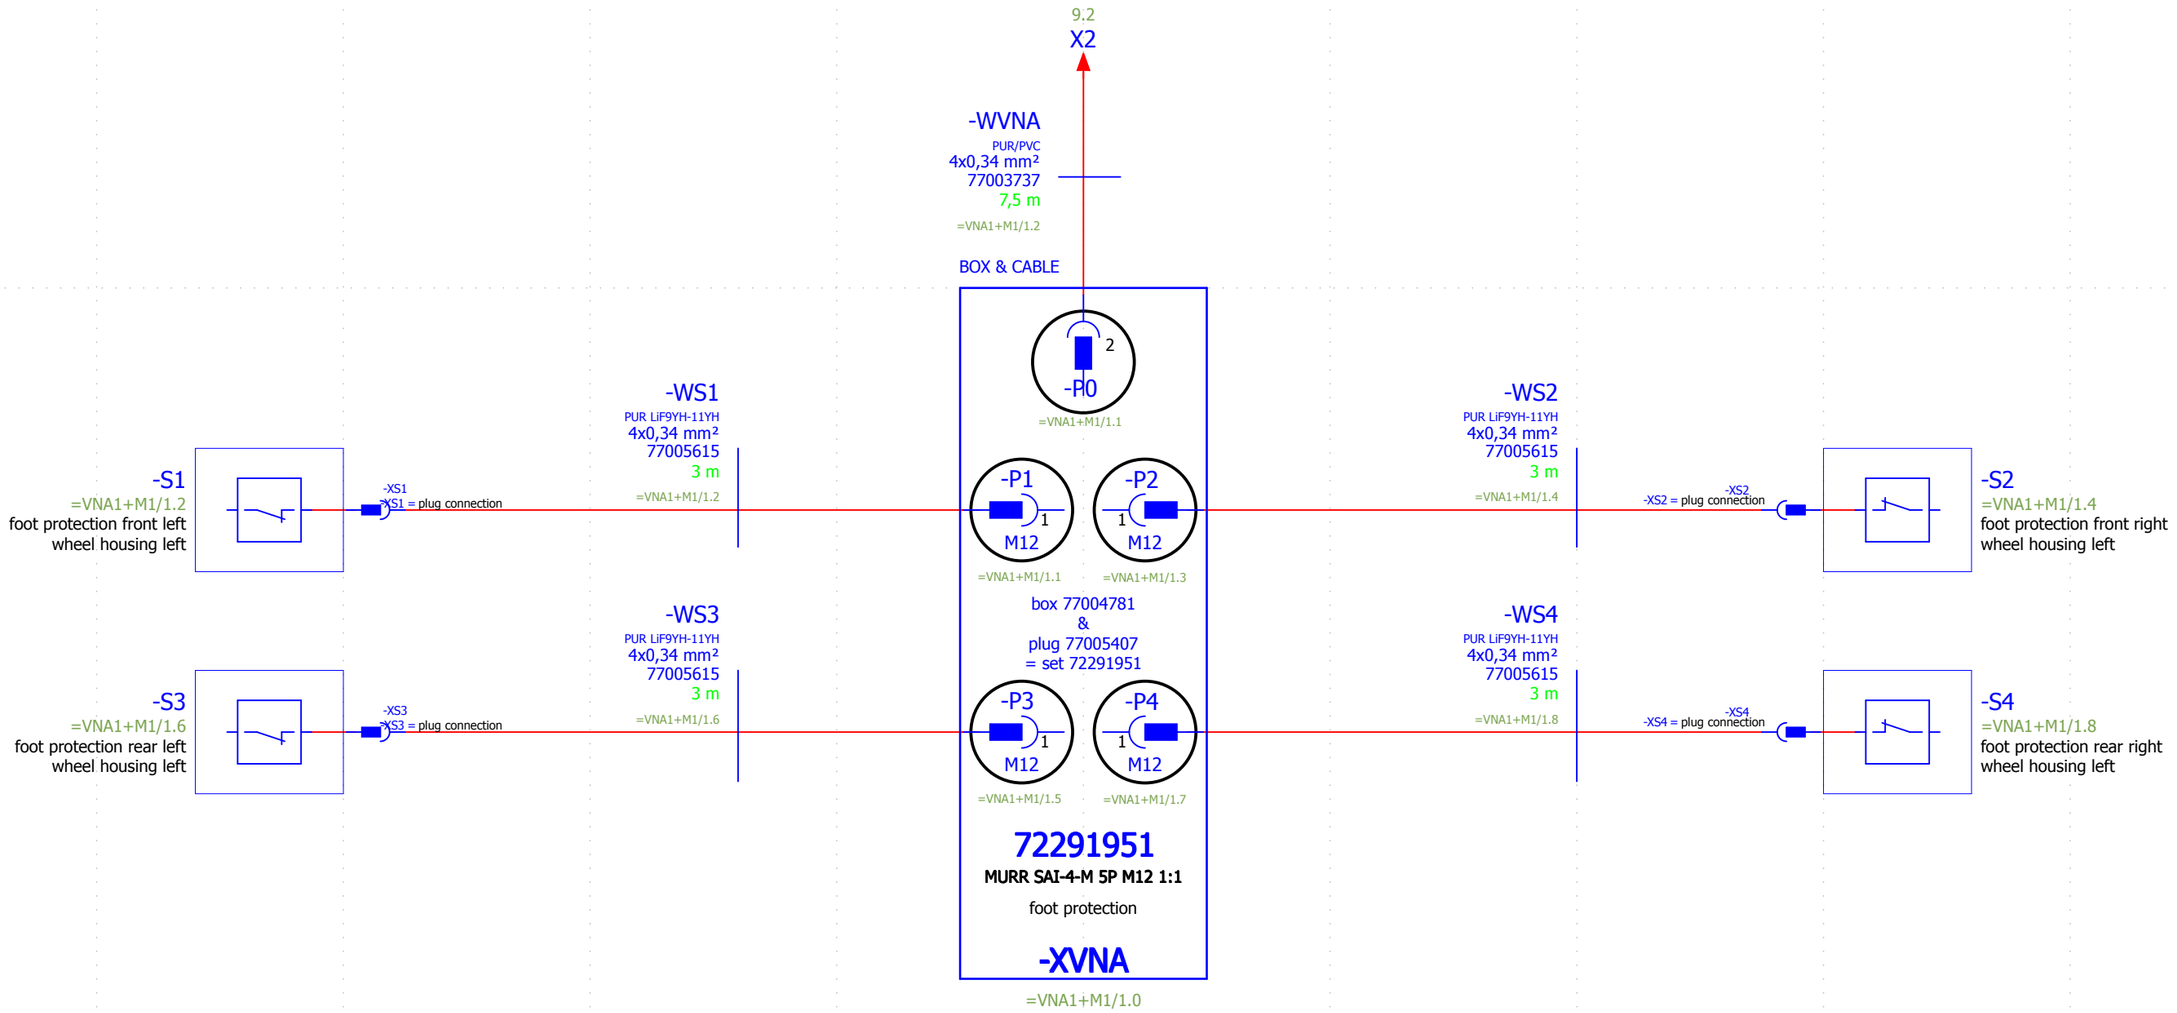

=VNA1+M1

P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	9	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

foot protection

drawing number		page	10
plant	= AB1	location	+ S1
last page	11	continuation page	11

9.7
X4

-WVNA
PUR/PVC
4x0,34 mm²
77004462
1 m
=VNA2+M2/1.2

BOX & CABLE

2
-P0
=VNA2+M2/1.1

-S1
=VNA2+M2/1.2
foot protection front left
wheel housing right

-XS1
-XS1 = plug connection

-WS1
PUR LiF9YH-11YH
4x0,34 mm²
77005615
3 m
=VNA2+M2/1.2

-P1
1
M12
=VNA2+M2/1.1

-P2
1
M12
=VNA2+M2/1.3

box 77004781
&
plug 77005407
= set 72291951

-WS2
PUR LiF9YH-11YH
4x0,34 mm²
77005615
3 m
=VNA2+M2/1.4

-XS2
-XS2 = plug connection

-S2
=VNA2+M2/1.4
foot protection front right
wheel housing right

-S3
=VNA2+M2/1.6
foot protection rear left
wheel housing right

-XS3
-XS3 = plug connection

-WS3
PUR LiF9YH-11YH
4x0,34 mm²
77005615
3 m
=VNA2+M2/1.6

-P3
1
M12
=VNA2+M2/1.5

-P4
1
M12
=VNA2+M2/1.7

72291951
MURR SAI-4-M 5P M12 1:1
foot protection

-XVNA
=VNA2+M2/1.0

-WS4
PUR LiF9YH-11YH
4x0,34 mm²
77005615
3 m
=VNA2+M2/1.8

-XS4
-XS4 = plug connection

-S4
=VNA2+M2/1.8
foot protection rear right
wheel housing right

=VNA2+M2

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	10	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

foot protection

drawing number		page	11
plant	= AB1	location	+ S1
last page	11	continuation page	=BA0/1

infeed AC 400 V
customers charge

AC 230 V

-F001
B20A
pre fuse
1 3 5
2 4 6

=BA1-L1 / =BA1/1.1

=BA1-N / =BA1/1.1

to main switch

2,5
BK

4
BK

4
BU

2,5
BK

2,5
BK

-0F1
10A
fuse
1
2

-0F2
10A
fuse
1
2

=BA1/1.3
=BA1-X230L2 2.2

PE
GNYE

PE
GNYE

6
GNYE

-X00 = power infeed
-X00 1 2 3 4 5 PE PE PE PE PE PE PE PE

PEN link
option

=BA0-WX00
ÖLFLEX FD CLASSIC 810
3x2,5 mm²
=AB1/1.2

1
2,5

2
2,5

GNYE
2,5

SH
SH

+EXT
L1
N
PE
-X:1
-X:2
-X:3

infeed AC 400 V customers charge

at main switch infeed
connected
short-circuit-proof
marked

danger
high voltage
if main switch
is disconnected !


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=AB1/11	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

infeed AC 400 V

drawing number		page	1
plant	= BA0	location	+ S1
last page	1	continuation page	=BA1/1

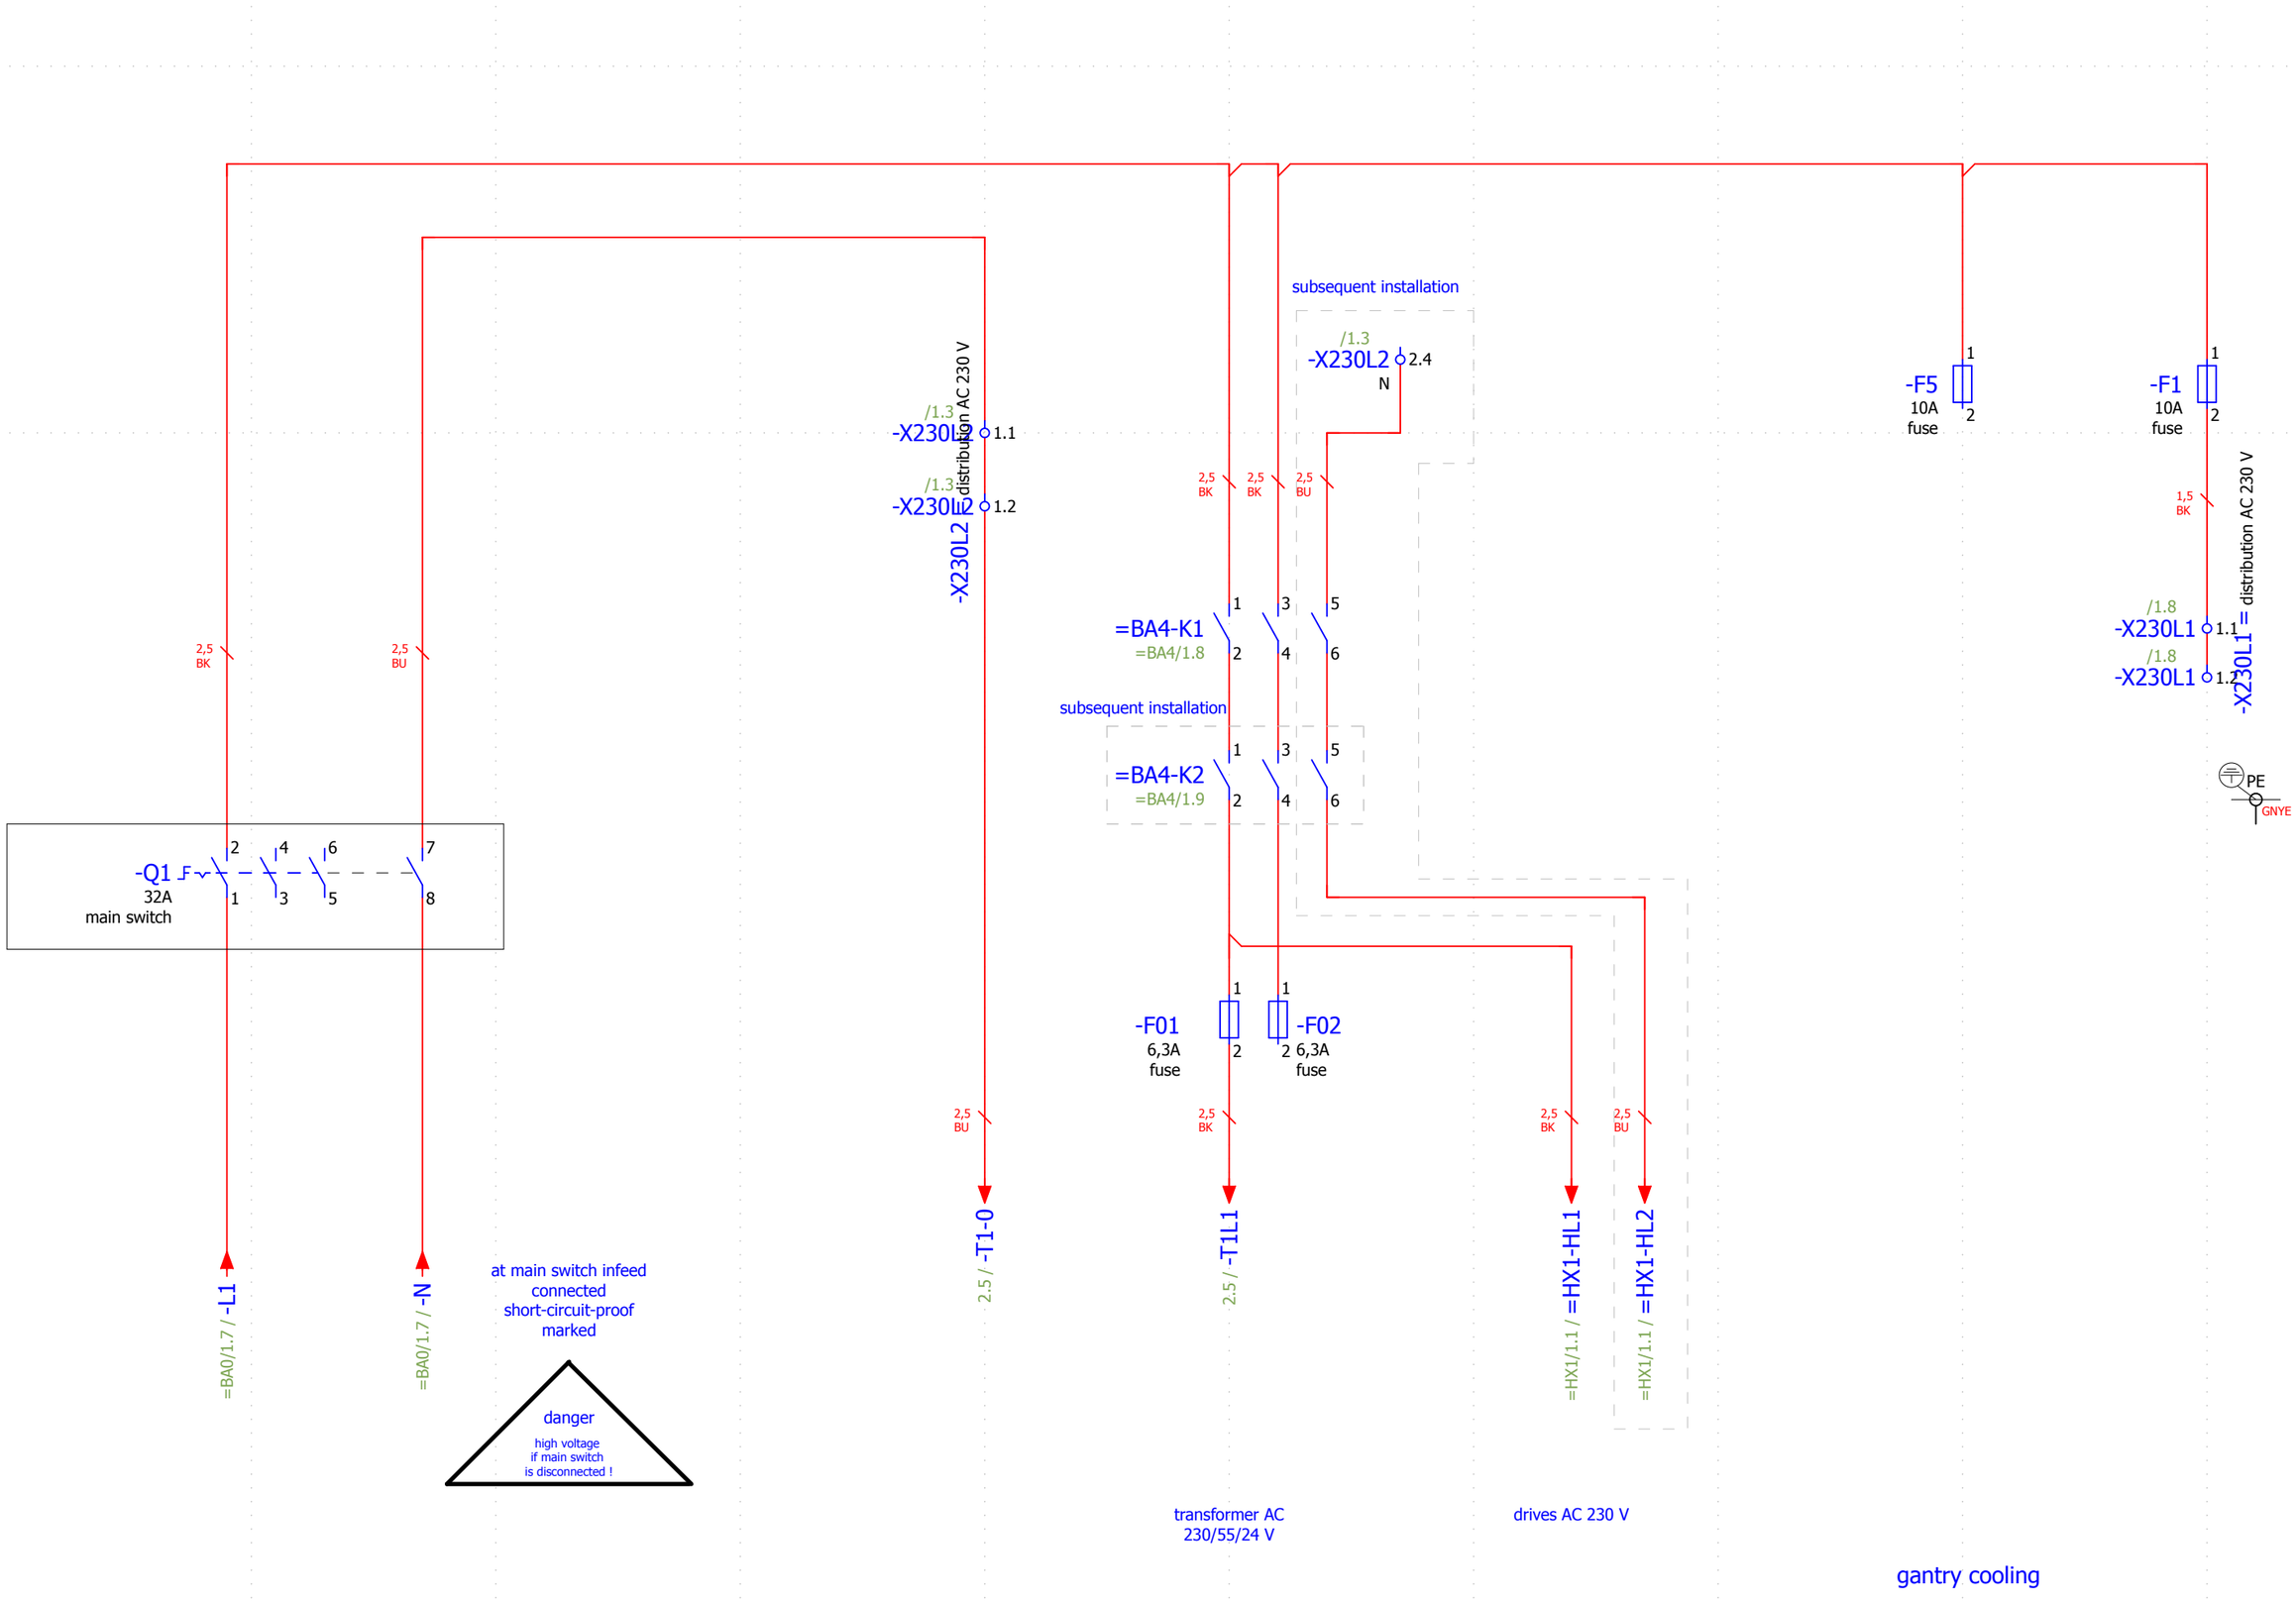

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=BA0/1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

infeed AC 230 V

drawing number		page	1
plant	= BA1	location	+ S1
last page	3	continuation page	2

-T1L1 / 1.4
-T1-0 / 1.4

-T1
230VAC
55VAC
24VAC

L1 N
AC 230 V
L55 N55 L24 N24
AC 55 V
AC 24 V

GNYE
PE

MACRO TGC5524

keep floating
!¶AC 55 V
potential free

-F21
10A
fuse

-F22
10A
fuse

-F3
6,3A
fuse

RD
1,5

2,5 GNYE

-XT = distribution terminals
-XT 1 1 3 3 2 2 2 2 PE PE PE PE
1 2 GNYE

=FK1+F1/2.2 / =FK1+F1-551L

1 RD
13 14
=BA4-K1
=BA4/1.8
AC 24 V
valves

=BA4-K2
=BA4/1.9
AC 24 V
valves
Nachrüsten

1 RD
24VAC
=FK1/3.0 / =FK1-24VAC

ignition

/3.1
=BA2-XL0 1.2
DC 0 V

=FD-X24 = distribution terminals
=FD-X24 1.1 2.1
AC 24 V

=FD-XGND = distribution terminals
=FD-XGND 1.1 2.1 2.4
AC GND

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

AC 55 V control voltage

drawing number		page	2
plant	= BA1	location	+ S1
last page	3	continuation page	3

DC 24 V

/1.3
-X230L2 1.4

/1.8
-X230L1 1.3

T10A intern
-G1
24VDC 20A
L N - +

T10A intern
-G2
24VDC 20A
L N - +

GNYE
PE

2,5 BU

=BA4-K1
=BA4/1.8
23
24

33
34

-F9
6,3A fuse
1
2

Option
customers request
subsequent installation

-F10
6,3A fuse
1
2

-F4
10A fuse
1
2

-F11
6,3A fuse
1
2

/3.1
=BA2-XL0 4.1
DC 0 V

/3.3
-XL24 1.1 2.1 2.2 2.3
DC 24 V

-XL24 = distribution DC 24 V

=BA2-XL0 = distribution DC 0 V

/3.1
=BA2-XL0 1.1
DC 0 V

/3.1
=BA2-XL0 PE.1
DC 0 V

/3.1
=BA2-XL0 1.3
DC 0 V

emergency stop cut off
=BA2/1.1 / =BA2-F5
PAN supply

=BA2/5.3 / =BA2+S1-A1:1+

=BA2/3.1 / =BA2-X40:19

=VA0/1.8 / =VA0-X1:15

-XP24 = DC 24 V permanent

/3.9
-XP24 2.4
DC 24 V permanent

DC 24 V control voltage

DC 24 V control voltage

front door cooling unit

voltage supply touch screen

operation desk cooler

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 2		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina


DC 24 V control voltage

drawing number		page	3
plant	= BA1	location	+ S1
last page	3	continuation page	=BA2/1

DC 24 V

periphery line protection

emergency stop cut off

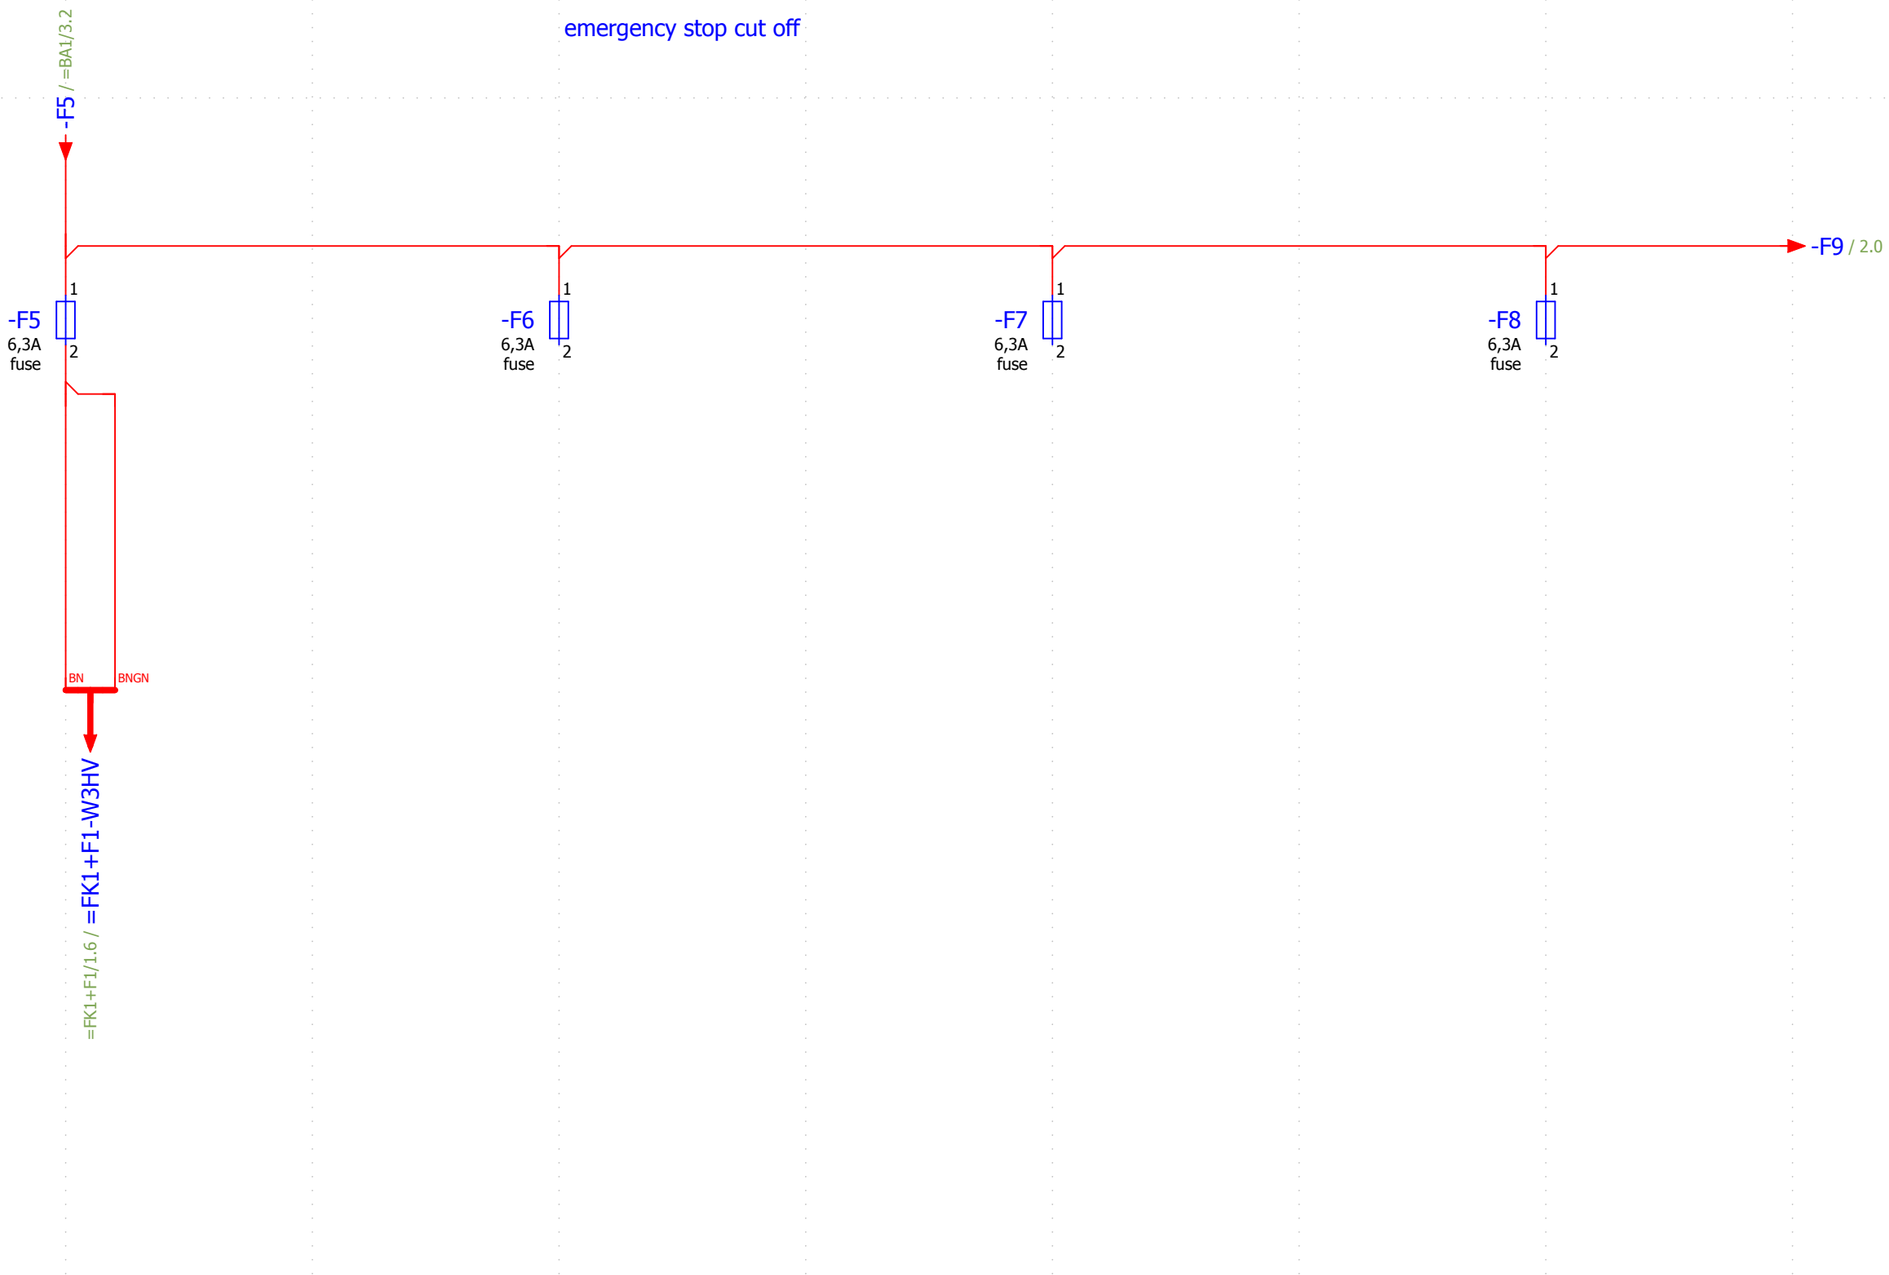

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=BA1/3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina


DC 24 V potential distribution

drawing number		page	1
plant	= BA2	location	+ S1
last page	6	continuation page	2

DC 24 V

periphery line protection

emergency stop cut off

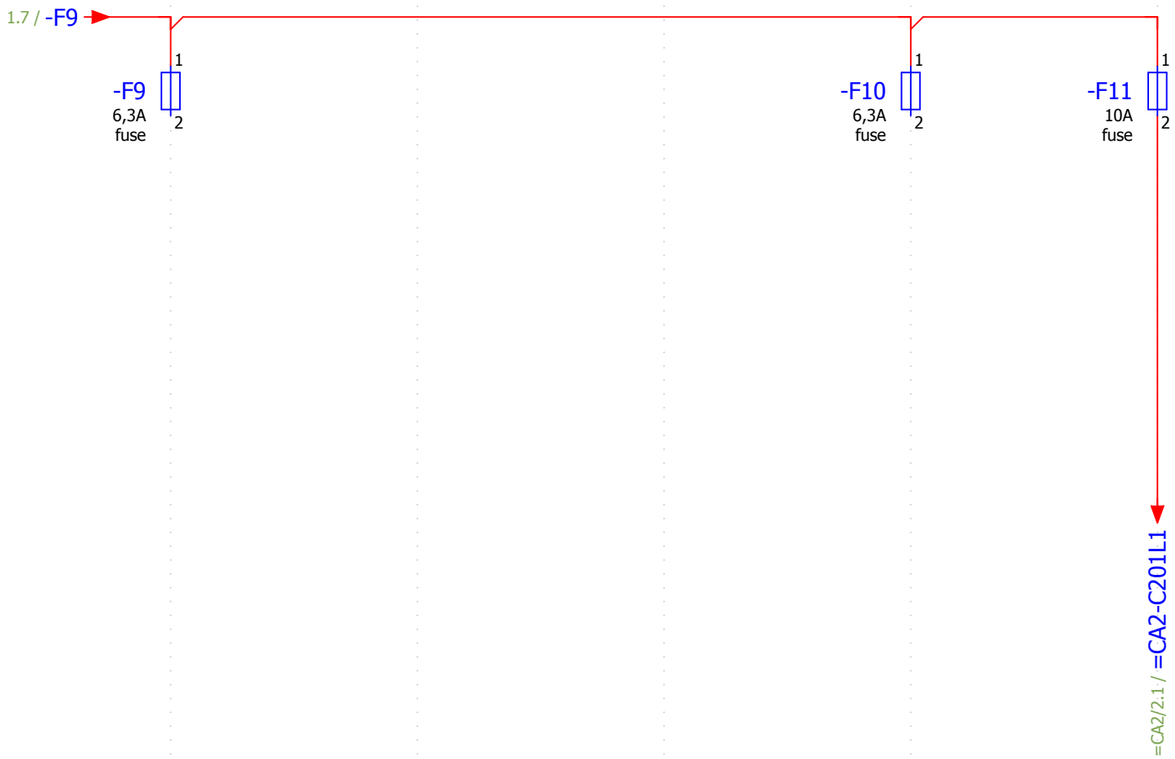

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

DC 24 V potential distribution

drawing number		page	2
plant	= BA2	location	+ S1
last page	6	continuation page	3

digital output terminals EL2008
=CA2-C110
=CA2/9.1
up
O3
2 =BA2+S1/3.4

Digital input terminal EL1008
=CA2-C109
=CA2/8.7
push button power on
I6
7 =BA2+S1/3.4

digital output terminals EL2008
=CA2-C110
=CA2/9.1
indicator stop
O4
6 =BA2+S1/3.5

digital output terminals EL2008
=CA2-C110
=CA2/9.1
up
O5
3 =BA2+S1/3.6

Digital input terminal EL1008
=CA2-C109
=CA2/8.7
stop
I4
6 =BA2+S1/3.7

Digital input terminal EL1008
=CA2-C109
=CA2/8.7
start
I5
3 =BA2+S1/3.8

-G3
Accu-Pack
24V/3,4Ah
GND 1
DC 24 V 2
PE 3
4
5
GNYE
PE

=BA1/3.1
-XL0 1.4
DC 0 V

subsequent installation

-X40:15 / =BA4/1.5
-X40:5 / =BA4/1.6
-X40:19 / =BA1/3.7
-X40:3 / =BA4/1.5
-X40:4 / =BA4/1.5
-X40:1 / 4.7
-X40:2 / =BA4/1.3

voltage supply touch screen

ST-COMBI pluggable
-X40
-X40 = interface operation panel
15 5 19 6 3 4 1 2 8 11 7 18 12 13 14 9 10 17 16 20 PE PE

WH GN BN BU GY RDBU VT RD WHGN BK GYPK GYBN YEBN BNGN WHYE WHGY PK YE GNYE


PE
GNYE


=CA0+P1-WX40
=CA0+P1/1.4


P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	interface operation panel	drawing number	page 3
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = BA2	location + S1
change	date	name	revisor				last page 6	continuation page 4
previous page 2		total pages 190	last editor	I.Wund				

MESSER Cutting Systems

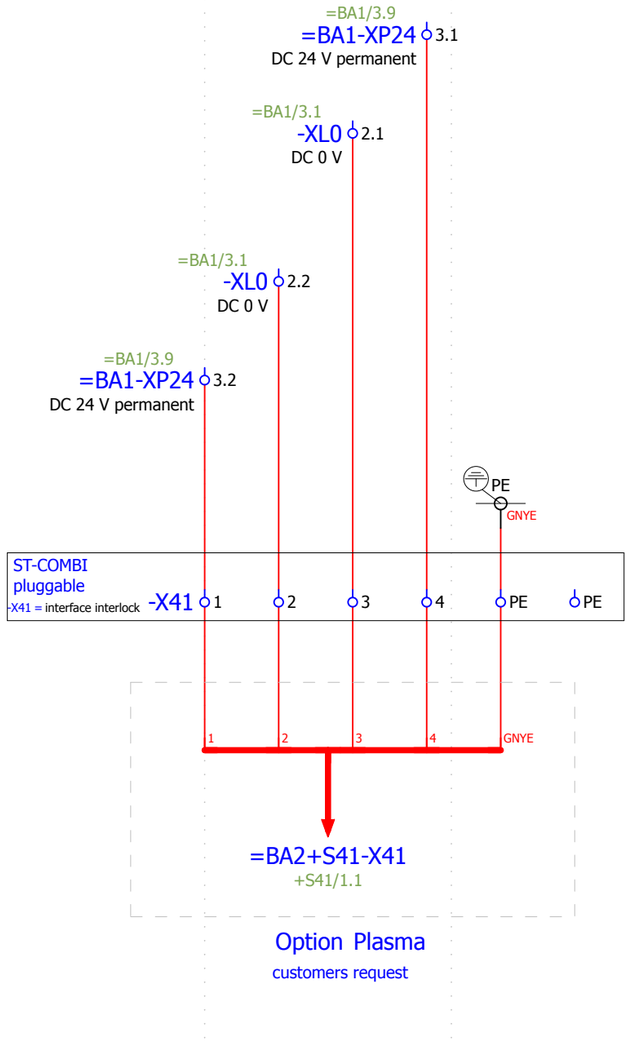

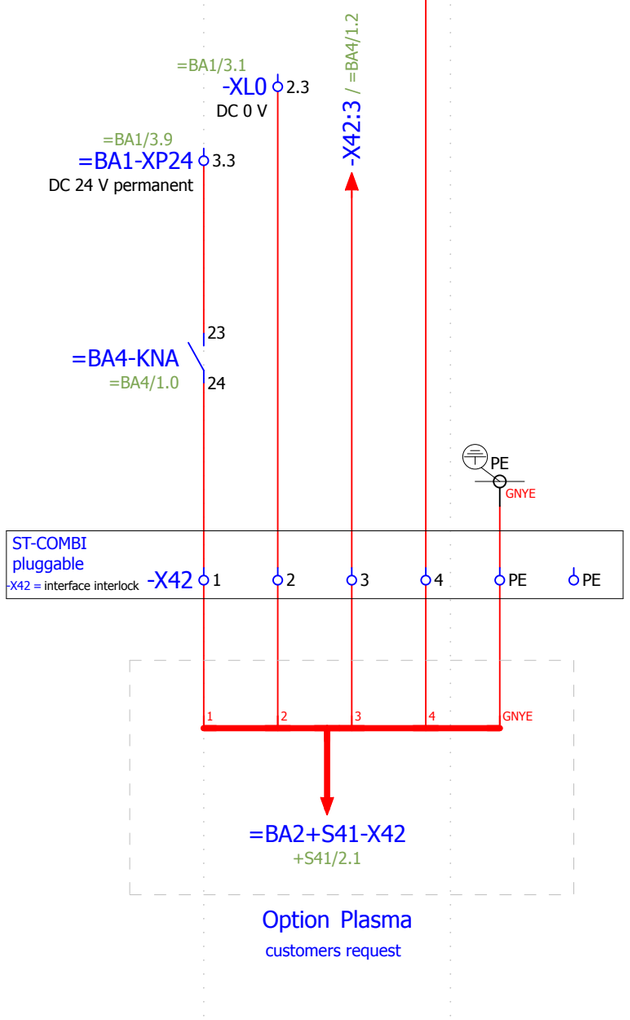

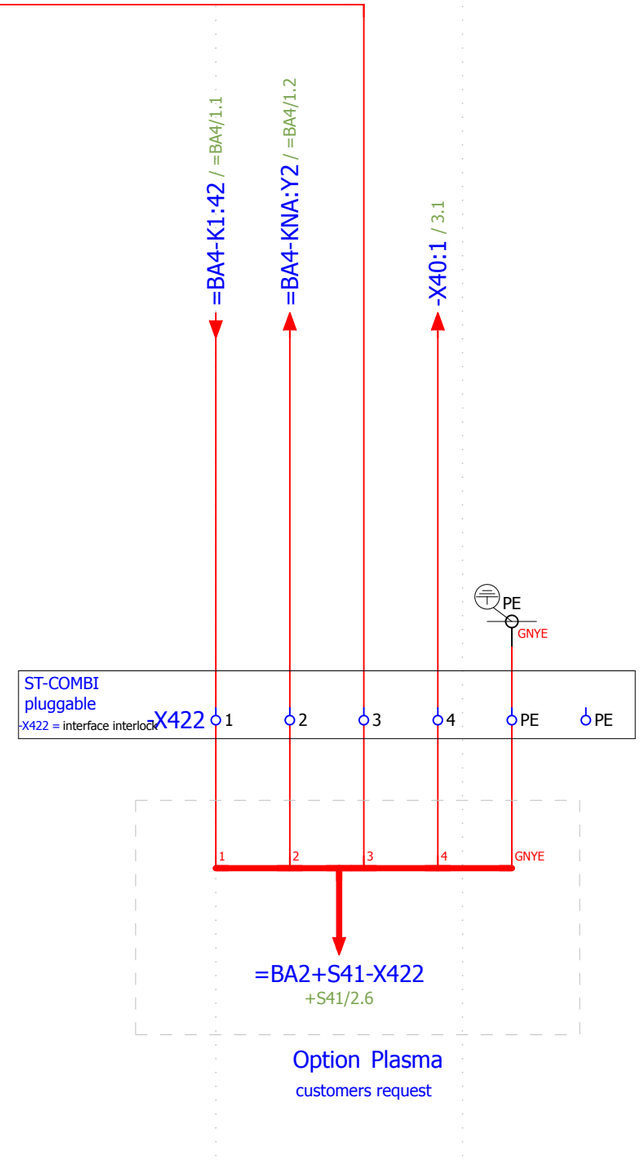


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interface plasma interlock

drawing number		page	4
plant	= BA2	location	+ S1
last page	6	continuation page	5

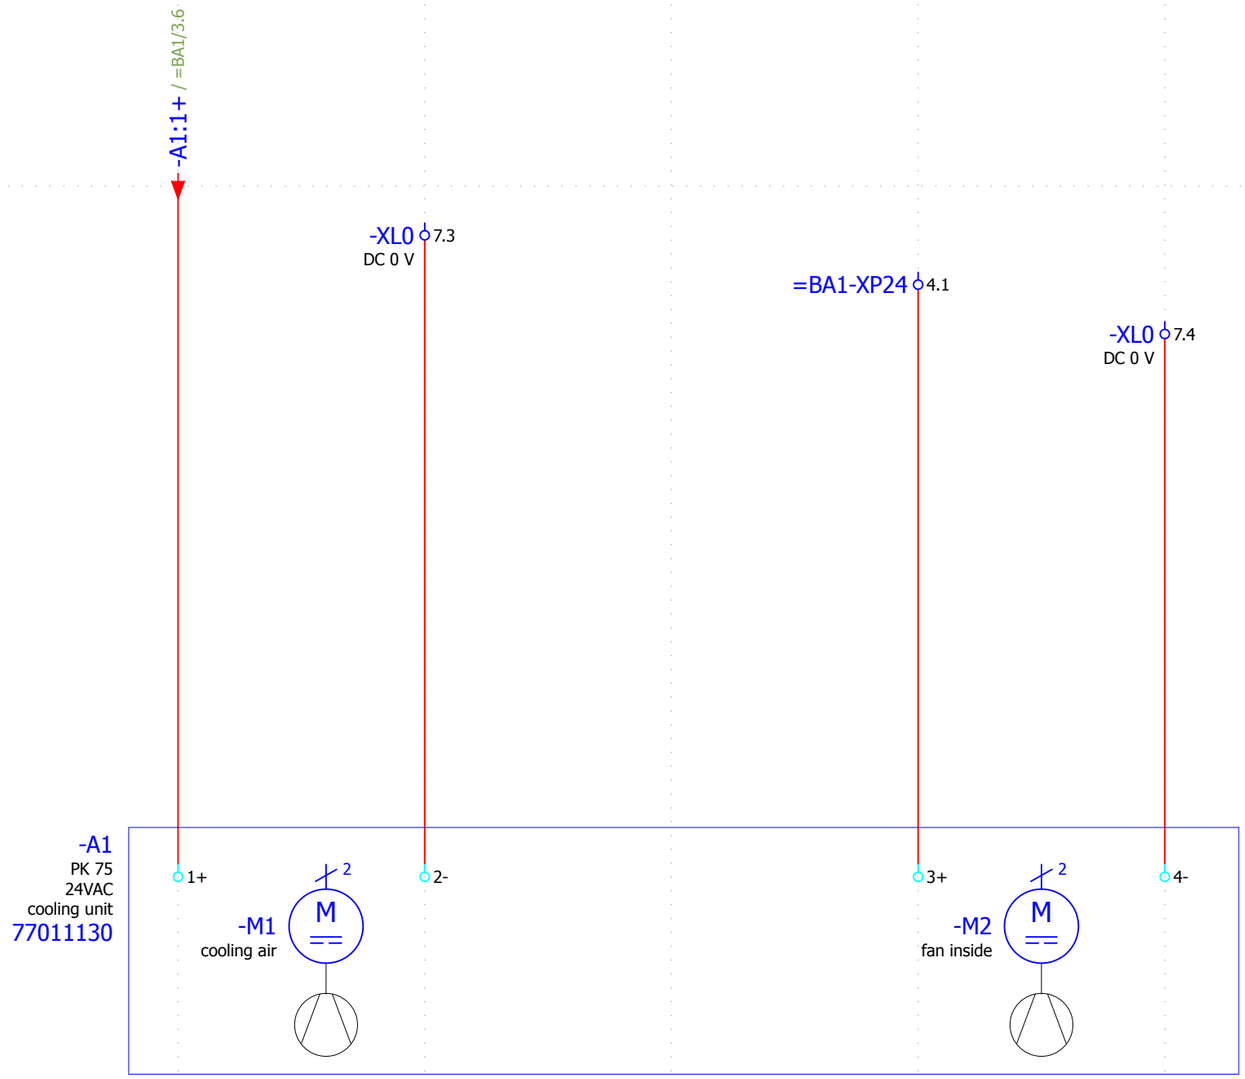

OPTION

customers request

subsequent installation


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	4	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

front door cooling unit

drawing number		page	5
plant	= BA2	location	+ S1
last page	6	continuation page	6

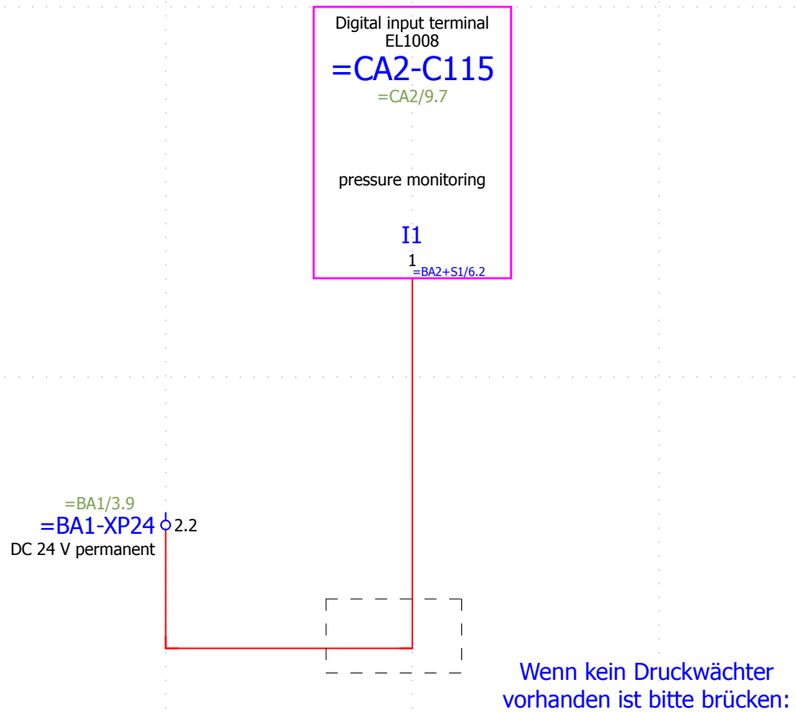

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	5	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

pressure monitoring

drawing number		page	6
plant	= BA2	location	+ S1
last page	6	continuation page	+S41/1

BUS TERMINAL
EK1100
=CA41-C400
=CA0+S1/1.7

NET IN

NET OUT

bus coupler supply

EtherCAT

BECKHOFF
EK1100

infeed power contacts

DC 24 V permanent
DC 0 V
DC 24 V
DC 24 V
DC 0 V
DC 0 V
PE
PE
1 24V
5 0V
2 +
6 +
3 -
7 -
4 PE
8 PE

PE
GNYE

EL9410
=CA41-C410
=CA41/4.4
infeed terminal

Diagnostics

DC 24 V
DC 0 V
power supply DC 24 V
power supply DC 24 V
infeed DC 0 V
infeed DC 0 V
PE
PE
+24V
0V
Uo
Uo
0V
0V
PE
PE
1 5 2 6 3 7 4 8

PE
GNYE

-L1 1 2 3 4
-L2 1 2 3 4

PE
GNYE

ST-COMBI pluggable
-X41 = interface interlock
-X41 1 3 2 4 PE PE

-WX41
ÖLFLEX FD CLASSIC 810 CY
5x1,5 mm²
=AB1+S1/7.4
1 1,5 2 1,5 4 1,5 3 1,5 GNYE
1 2 4 3 GNYE

-X41
+S1/4.1

/1.4
-X24L 1.1 1.4
DC 24 V
-X24L = distribution DC 24 V

/1.7
-XL0 1.1 1.2 1.4 2.2
DC 0 V
-XL0 = distribution DC 0 V
/1.7
-XL0 PE

PE
GNYE

caution

removing link needs
insulation
leakage monitoring

DIN EN 61557-2
VDE 0413-2:2008-02

P8 2.2.5


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	+S1/6	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

voltage supply

drawing number		page	1
plant	= BA2	location	+ S41
last page	3	continuation page	2

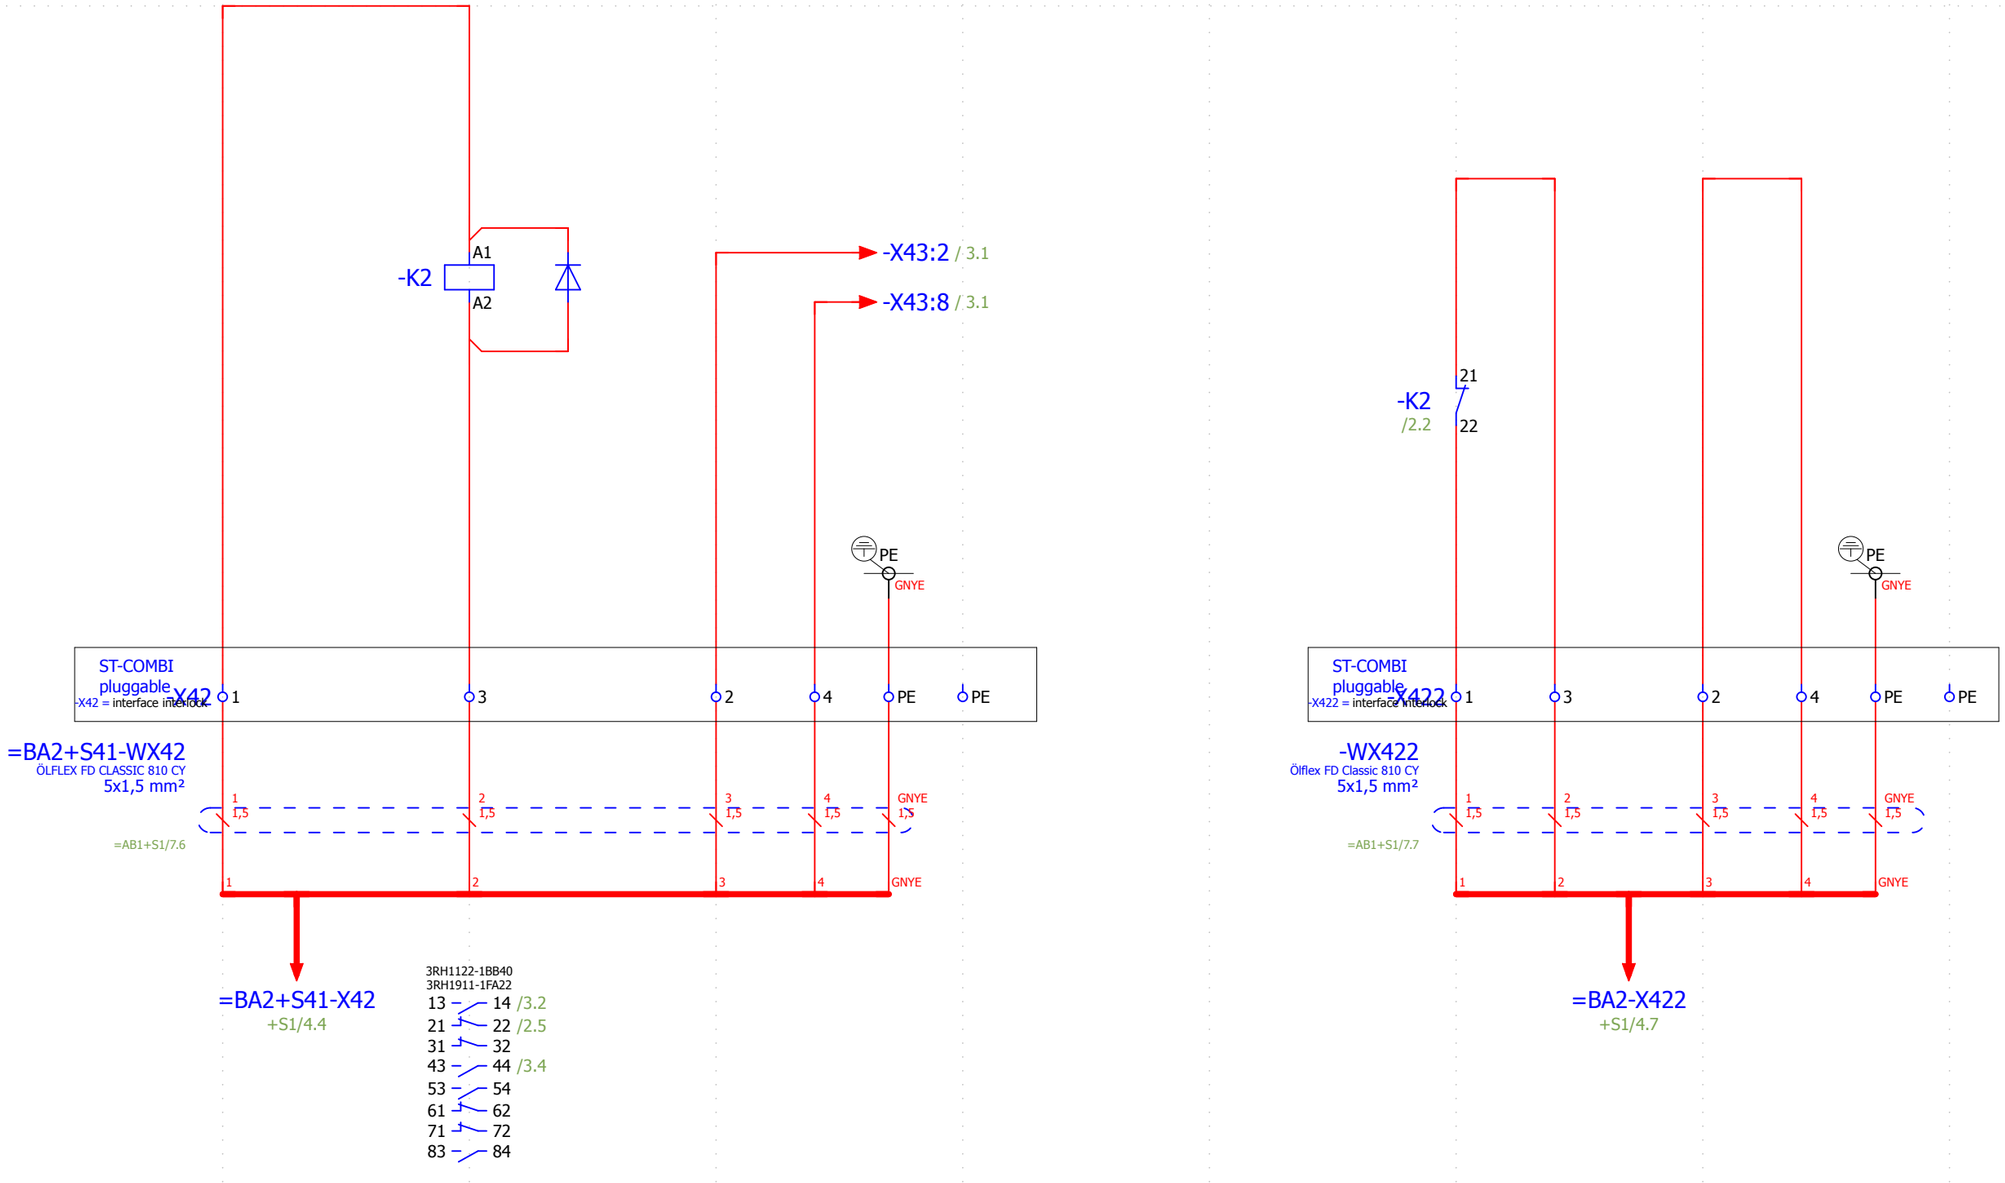

P8 2.2.5


			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	1	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interlock emergency stop

drawing number		page	2
plant	= BA2	location	+ S41
last page	3	continuation page	3

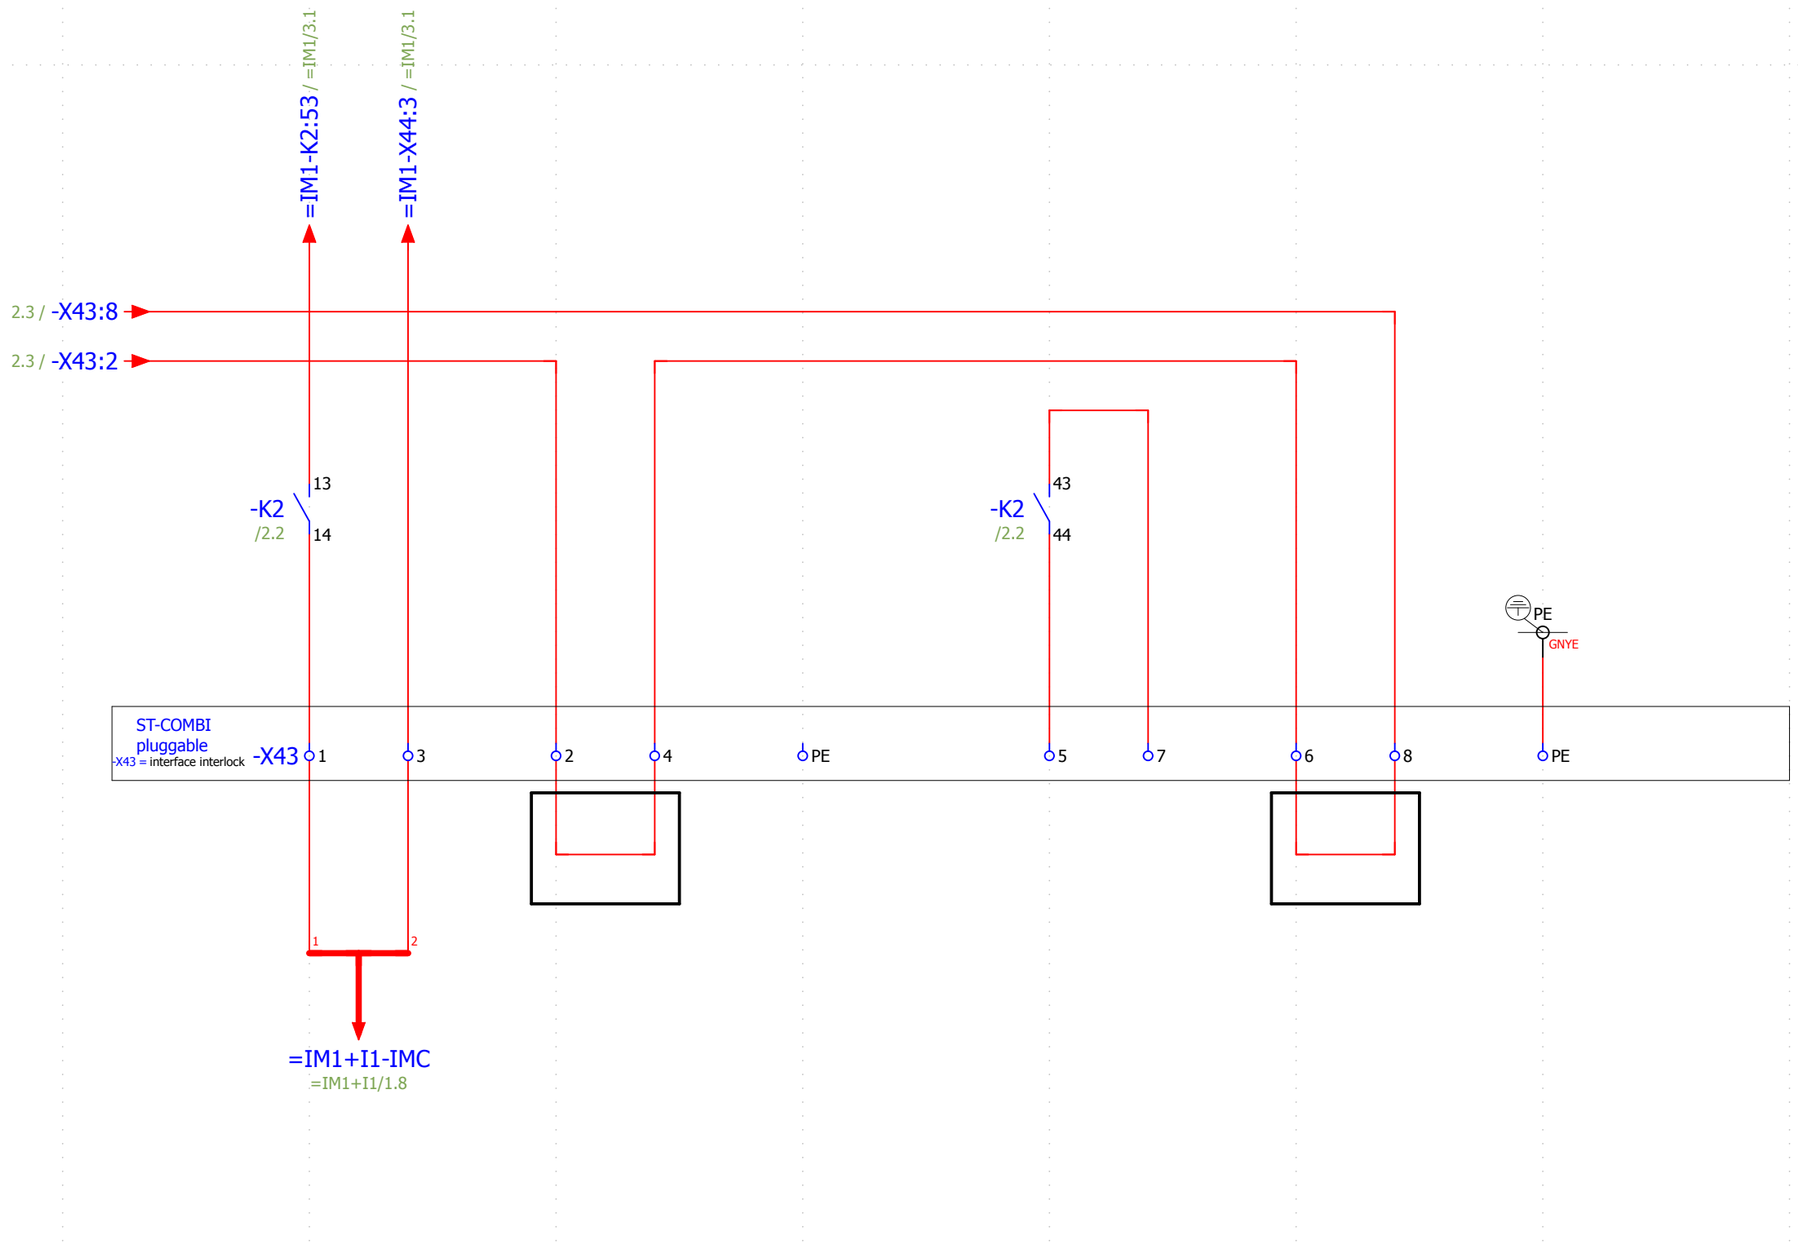

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	interlock emergency stop
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 2		total pages 190	last editor	I.Wund		

MESSER Cutting Systems

drawing number		page	3
plant	= BA2	location	+ S41
last page	3	continuation page	=BA3+S1/1

digital output terminals
EL2008
=CA2-C110
=CA2/9.1
up
O1
1
=BA3+S1/1.1

digital output terminals
EL2008
=CA2-C110
=CA2/9.1
up
O7
4
=BA3+S1/1.2

Digital input terminal
EL1008
=CA2-C109
=CA2/8.7
push button power on
I1
1
=BA3+S1/1.4

=BA1/1.8
=BA1-X230L1 1.4
1
sw/bk

=BA1/3.9
=BA1-XP24 4.4

12 14
=BA1-K1
/1.4
11

A1
=BA1-K1
A2

DC 24 V
DC monitoring

1
sw/bk

=BA1/3.9
=BA1-XP24 1.1

=BA1/1.3
=BA1-X230L2 2.1

A1
-K1
A2

A1
-K2
A2

=BA1/3.1
=BA2-XL0 4.4
DC 0 V

=BA4-0VDC / =BA4/1.6

2966265
14
12 11
=BA4/1.2

2966265
14
12 11
=BA4/1.4

2966294
14
12 11
/1.3

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	watchdog	drawing number / page 1
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = BA3 / location + S1
change	date	name	revisor				
previous page	=BA2+S41/3	total pages	190	last editor I.Wund			last page 1 / continuation page =BA4/1

MESSER Cutting Systems

=VNA0+M2/1.2
=BA4+S1-WSNA
subsequent installation

-SNA = plug connection
-SNA 2 1 5 3 4

WH BN BU BK

1 BN
2 WH
3 BU
4 BK
5 GY

M12 befestigungsclip
* 77005649

* -WKNA
PUR/PVC
4x0,34 mm²
77004462
1 m

WH 0,34 BN 0,34 BU 0,34 BK 0,34

* Bei Not-Aus Funktion wird extra bestellt.

Digital input terminal
EL1008
=CA2-C109
=CA2/8.7
push button power on
I3
2
=BA4+S1/1.8

-K1:42 / =BA2/4.6
-KNA:Y2 / =BA2/4.7
=BA2-X42:3 / =BA2/4.4
=BA2-X40:2 / =BA2/3.2
=BA2-X40:3 / =BA2/3.1
=BA2-X40:4 / =BA2/3.1
=BA2-X40:15 / =BA2/3.0
=BA2-X40:5 / =BA2/3.0

=BA1/3.9
=BA1-XP24 3.4
DC 24 V permanent

-K1 /1.8 41 42
-K2 /1.9 41 42
subsequent installation

main contactor monitoring

=BA3-K1
=BA3/1.1
watchdog
12 14 11

=BA3-K2
=BA3/1.2
watchdog
12 14 11

-KNA /1.0 13 14
-KNA /1.0 37 38

-KNA
emergency stop relay
MSR138DP

Y1 feedback loop
Y2 feedback loop
S11 channel 1
S12 channel 1
S52 channel 1
S21 channel 2
S22 channel 2
S33 start
S34 start
power on
Y39 time reset
Y40 time reset
A1 A2

subsequent installation
-K1 A1 A2
-K2 A1 A2

=BA3/1.2 / =BA4-0VDC

MSR138DP
A1 A2
13 14 /1.8
23 24 =BA2/4.4
37 38 /1.8
47 48
57 58

3RT1026-1BB40
3RH1921-1FA31
1 2 =BA1/1.4
3 4 =BA1/1.5
5 6 =BA1/1.5
13 14 =BA1/2.6
23 24 =BA1/3.2
33 34 =BA1/3.4
41 42 /1.1

3RT1026-1BB40
3RH1921-1FA31
1 2 =BA1/1.4
3 4 =BA1/1.5
5 6 =BA1/1.5
13 14 =BA1/2.6
23 24
33 34
41 42 /1.1


			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=BA3/1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

emergency stop loop

drawing number		page	1
plant	= BA4	location	+ S1
last page	1	continuation page	=CA0/1

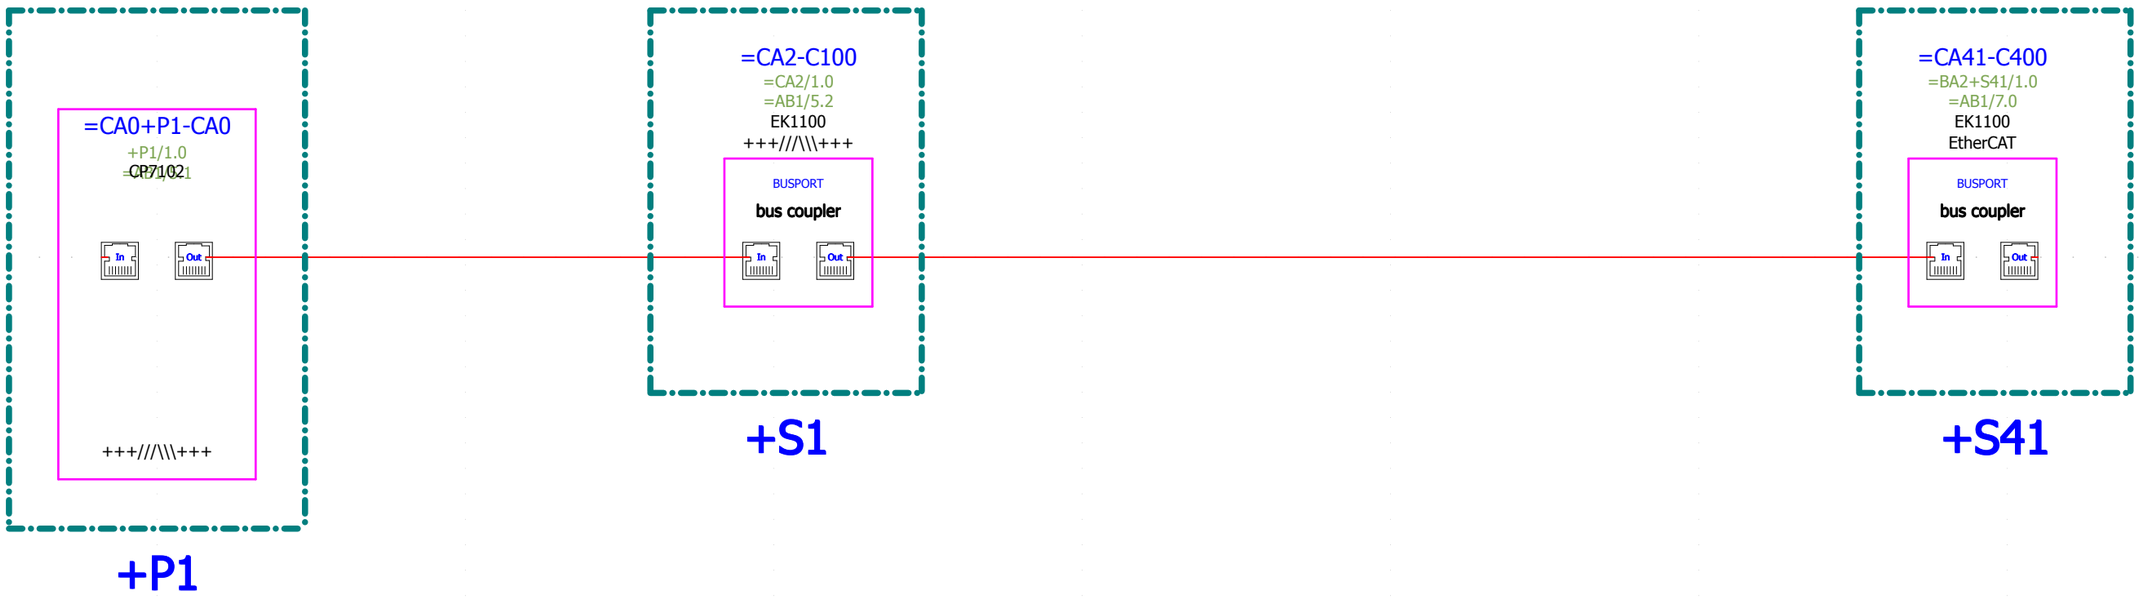

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	=BA4/1	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus configuration

drawing number		page	1
plant	= CA0	location	+ S1
last page	1	continuation page	+P1/1

-P1

=AA3+S1/2.0

Control Panel

BECKHOFF

GND - | ACCU + | PE | GND - | 24VDC +

power is on

-S1
weiss
white

11 12 14 | 21 22 24 | 3 1 2 | A1 A2 | A1 A2 | 11 12 14 | 21 22 24

-XB 1 2 3 4 6 5

-XA 1 2 5 6 3 4

-SNA
emergency stop

12 11 22 21

-X 1 2 5 6

stop

-S2
rot
red

13 14 23 24

-X 1 2 5 6 3 4

start

-S3
weiss
white

13 14 23 24

-X 1 2 5 6 3 4

DC 24 V ACCU

DC 24 V

-X40 8 11 6 19 1 2 3 4 13 14 9 17 7 18 5 15 10 16 12

-X40 = plug connection

In LAN | Out LAN | IN LAN

-CA0
+S1/1.0

=CA0+P1-WX40
SAIB-M23-19P-(S)-ST
16x+3x0,5+1,0 mm²

10 m
=AB1+S1/5.6

WHGN	BK	BU	BN	VT	RD	GY	RDBU	YEBN	BNGN	WHYE	PK	GYPK	GYBN	GN	WH	WHGY	YE	GNYE
0,5	0,5	1,0	1,0	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	0,5	1,0

-U9
=AB1+S1/5.2
Ferrite

-MG_IN
3.1

-WX40
=BA2+S1/3.4

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	+S1/1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

panel PLC

drawing number		page	1
plant	= CA0	location	+ P1
last page	3	continuation page	2

OPTION
customers request

subsequent installation

=VA0+S1/1.8
-VA0-P7

BN BU

-WX40M
PUR/PVC
4x0,34 mm²
BN 0,34 BU 0,34

4 m
=AB1+S1/5.8

-XM1
=AB1+S1/5.8
1 3
BK+ RD-
-XM1 = Device connection point

M M
-M1
DC 24 V

operation desk cooler
=AB1+S1/5.8

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interface operation panel


drawing number		page	2
plant	= CA0	location	+ P1
last page	3	continuation page	3

Option



Achtung!
Blatt entfällt bei
Virtual Service

customers periphery

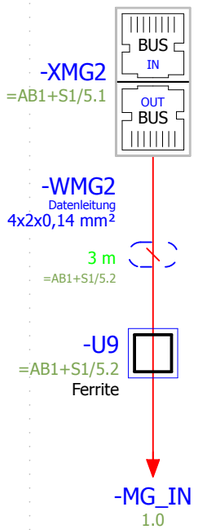

GCS Control Panel PC

Verlängerungen, Zwischenstecker etc.
bitte der Übersicht =AB1 entnehmen!

			creation date	16.01.2014	289.168	network connection	drawing number	page 3
			editor	INGO.WUNDERLE	GCs_Modular_eco 3600			
001	10.02.2014	Wun	printout	10.02.2014	MBG Poulina		plant = CA0	location + P1
change	date	name	revisor					
previous page 2		total pages 190	last editor I.Wund				last page 3	continuation page =CA2+S1/1

MESSER Cutting Systems

BUS TERMINAL
EK1100
-C100
=CA0/1.3

NET IN
NET OUT
bus coupler supply
infeed power contacts
EtherCAT
BECKHOFF EK1100

DC 24 V permanent 1 24V
DC 0 V 5 0V
DC 24 V 2 +
DC 24 V 6 +
DC 0 V 3 -
DC 0 V 7 -
PE 4 PE
PE 8 PE

GNYE
PE

EM7004
-C701
/4.0
4-axis interface

power supply DC 24 V
24/230V
X8:
=CA2+S1/1.4
DC 0 V
0V
X8:
=CA2+S1/1.5

EL9100
-C202
/6.7
infeed terminal AC/DC max. 10A

power supply DC 24 V 24/230V 2
power supply DC 24 V 24/230V 6
DC 0 V 0V/N 3
DC 0 V 0V/N 7
PE PE 4
PE PE 8

GNYE
PE

-C301_0V / 2.1
-C301_24V / 2.1

=BA1/3.9
=BA1-XP24 1.2
DC 24 V permanent

=BA1/3.9
=BA1-XP24 1.3
DC 24 V permanent

=BA1/3.1
=BA2-XL0 2.4
DC 0 V

=BA1/3.1
=BA2-XL0 3.1
DC 0 V

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=CA0+P1/3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	1
plant	= CA2	location	+ S1
last page	13	continuation page	2

EL9100
-C201
/11.4
infeed terminal
AC/DC max. 10A

	power supply DC 24 V	power supply DC 24 V	DC 0 V	DC 0 V	PE	PE
	24/230V	24/230V	0V/N	0V/N	PE	PE
	2	6	3	7	4	8

GNYE
PE

1.8 / -C301_0V
1.8 / -C301_24V

emergency stop cut off
=BA2/2.4 / -C201L1

EL9100
-C301
/12.1
infeed terminal
AC/DC max. 10A

Nur mit PLASMA

	power supply DC 24 V	power supply DC 24 V	DC 0 V	DC 0 V	PE	PE
	24/230V	24/230V	0V/N	0V/N	PE	PE
	2	6	3	7	4	8

GNYE
PE

Option
customers request
subsequent installation


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	2
plant	= CA2	location	+ S1
last page	13	continuation page	3

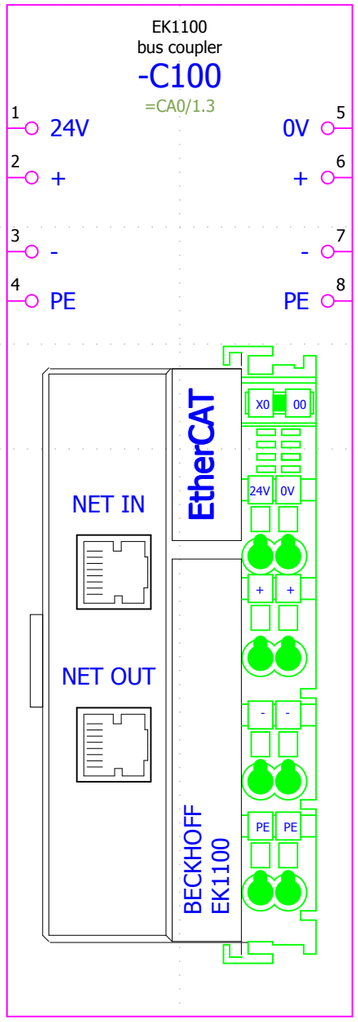

DC 24 V permanent

DC 24 V

DC 0 V

PE

DC 0 V

DC 24 V

DC 0 V

PE

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	bus terminal overview
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 2		total pages 190	last editor I.Wund			

MESSER Cutting Systems

drawing number		page	3
plant	= CA2	location	+ S1
last page	13	continuation page	4


EM7004
4-axis interface

=CA2+S1-C701

/1.3

X0:24V
24 =HX1/2.8 DC 24 V
0
I0 =HX1/2.1 ready
1
I1 =HX1/2.1 failure
2
I2 =HX2/2.1 ready
3
I3 =HX2/2.1 failure
4
I4
5
I5
6
I6
7
I7
0V
0V =HX1/2.9 GND
=HX1/2.6
0V.
0V =HX1/2.7 GND
=HX1/2.7
=HX1/2.7
=HX1/2.7

X1:24V
24
0
I8 =HY1/2.1 ready
1
I9 =HY1/2.1 failure
2
I10
3
I11
4
I12
5
I13
6
I14
7
I15
0V
0V =HX2/2.8 GND
0V.
0V =HX2/2.6 GND

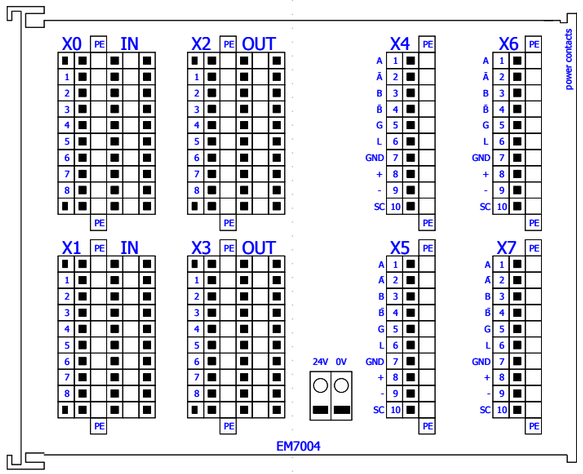

nur ECO

X2:24V
24 =HX1/2.8 DC 24 V
0
O0 =HX1/3.4 enable
1
O1 =HX1/3.5 reset
2
O2 =HX2/3.4 enable
3
O3 =HX2/3.5 reset
4
O4
5
O5
6
O6
7
O7
0V
0V =HX1/2.9 GND

X3:24V
24
0
O8 =HY1/3.4 enable
1
O9 =HY1/3.5 reset
2
O10
3
O11
4
O12
5
O13
6
O14
7
O15
0V
0V =HX2/2.9 GND

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	4
plant	= CA2	location	+ S1
last page	13	continuation page	5

EM7004
4-axis interface

=CA2+S1-C701

X4:1


A	1	=HX1/2.3	increment_A
/A	2	=HX1/2.3	increment /A
B	3	=HX1/2.4	increment_B
/B	4	=HX1/2.4	increment /B
C	5	=HX1/2.5	gate
/C	6	=HX1/2.5	latch
GND	7	=HX1/2.6	GND
+10V	8	=HX1/3.3	nominal value
-10V	9	=HX1/3.3	nominal value GND
SH	10	=HX1/2.6	SH

X6:1

A	1	=HY1/2.3	increment_A
/A	2	=HY1/2.3	increment /A
B	3	=HY1/2.4	increment_B
/B	4	=HY1/2.4	increment /B
C	5	=HY1/2.5	gate
/C	6	=HY1/2.5	latch
GND	7	=HY1/2.6	GND
+10V	8	=HY1/3.3	nominal value
-10V	9	=HY1/3.3	nominal value GND
SH	10	=HY1/2.6	SH

X5:1

A	1	=HX2/2.3	increment_A
/A	2	=HX2/2.3	increment /A
B	3	=HX2/2.4	increment_B
/B	4	=HX2/2.4	increment /B
C	5	=HX2/2.5	gate
/C	6	=HX2/2.5	latch
GND	7	=HX2/2.6	GND
+10V	8	=HX2/3.3	nominal value
-10V	9	=HX2/3.3	nominal value GND
SH	10	=HX2/2.6	SH

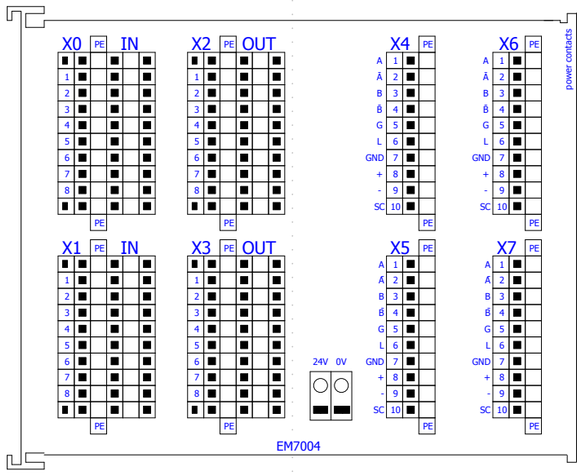

X7:1

A	1	
/A	2	
B	3	
/B	4	
C	5	
/C	6	
GND	7	
+10V	8	
-10V	9	
SH	10	

nur ECO

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	4	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	5
plant	= CA2	location	+ S1
last page	13	continuation page	6

power supply DC 24 V

DC 0 V

PE

EL9100


-C202

2 24V/230V
24V/230V 6

3 0V/N
0V/N 7

infeed terminal
AC/DC max. 10A

4 PE
PE 8

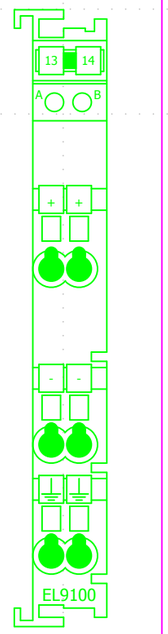

power supply DC 24 V

DC 0 V

PE

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	5	total pages	190	last editor	I.Wund	

MESSER Cutting Systems


289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	6
plant	= CA2	location	+ S1
last page	13	continuation page	7


EL2008
Digital output terminal
-C113

1 O1 O2 5
2 O3 O4 6
3 O5 O6 7
4 O7 O8 8



EL1008
Digital input terminal
-C114


1 I1 I2 5
2 I3 I4 6
3 I5 I6 7
4 I7 I8 8



EL2008
Digital output terminal
-C111

up =FK1/1.4
auto hight =FK1/1.5

1 O1 O2 5 =FK1/1.4 down
2 O3 O4 6 =FK1/1.6 set height
3 O5 O6 7
4 O7 O8 8



P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 6		total pages 190	last editor	I.Wund

MESSER Cutting Systems


289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	7
plant	= CA2	location	+ S1
last page 13		continuation page	8


EL1008
Digital input terminal
-C112

height found =FK1/1.1
collision =FK1/1.3
=FK1/1.2 upper limit

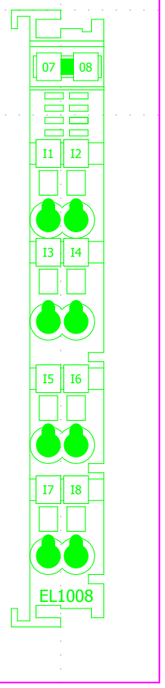


EL2008
Digital output terminal
-C103

PAN/ALFA =FK1/1.8
=FK1/3.1 up
=FK1/3.4 up



EL1008
Digital input terminal
-C109

push button power on =BA3/1.4
push button power on =BA4/1.8
start =BA2/3.8
=BA2/3.7 stop
=BA2/3.4 push button power on



P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 7	total pages 190	last editor I.Wund		

MESSER Cutting Systems


289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	8
plant	= CA2	location	+ S1
last page 13		continuation page	9


EL2008
Digital output terminal
-C110

up	=BA3/1.1	1 O1	O2 5			
up	=BA2/3.4	2 O3	O4 6	=BA2/3.5	indicator stop	
up	=BA2/3.6	3 O5	O6 7			
up	=BA3/1.2	4 O7	O8 8	=FK1/4.7	up	




EL1008
Digital input terminal
-C107

+ overtravel X	=HX1/3.8	1 I1	I2 5	=HX1/3.7	- overtravel X	
home switch X	=HX1/3.2	2 I3	I4 6			
+ overtravel Y	=HY1/3.7	3 I5	I6 7	=HY1/3.8	- overtravel Y	
home switch Y	=HY1/3.2	4 I7	I8 8	=MB1/1.2	push button power on	



EL1008
Digital input terminal
-C115

pressure monitoring	=BA2/6.2	1 I1	I2 5			
1 internal Plasma Stromrelais		2 I3	I4 6			4 internal Plasma Stromrelais
		3 I5	I6 7			
		4 I7	I8 8			



P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	8	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview


drawing number		page	9
plant	= CA2	location	+ S1
last page	13	continuation page	10

spare =JB1/1.1

EL2622
relay outputs
-C120

1 O1 O2 5
2 L1 L2 6
3 N N 7
4 PE PE 8

without power contacts




internal Plasma
1 Plasma Start
internal Plasma

EL2622
relay outputs
-C121

1 O1 O2 5
2 L1 L2 6
3 N N 7
4 PE PE 8

without power contacts


internal Plasma
4 Plasma Start
internal Plasma



EL2612
relay outputs
-C122

1 O1 O2 5
2 O1 O2 6
3 O1 O2 7
4 PE PE 8

without power contacts



P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	9	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina


bus terminal overview

drawing number		page	10
plant	= CA2	location	+ S1
last page	13	continuation page	11

EL2622
relay outputs
-C123

1 O1 O2 5
2 L1 L2 6
3 N N 7
4 PE PE 8

without power contacts



power supply DC 24 V

DC 0 V


PE

EL9100
-C201

2 24V/230V 24V/230V 6
3 0V/N 0V/N 7

infeed terminal
AC/DC max. 10A

4 PE PE 8



power supply DC 24 V


DC 0 V

PE

EL2008
Digital output terminal
-C108

1 O1 O2 5
2 O3 O4 6
3 O5 O6 7
4 O7 O8 8

=LD1/1.1 up



P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 10		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview


drawing number		page	11
plant	= CA2	location	+ S1
last page 13		continuation page	12

power supply DC 24 V

DC 0 V

PE

EL9100
-C301
2 24V/230V 6
3 0V/N 0V/N 7
infeed terminal
AC/DC max. 10A
4 PE PE 8

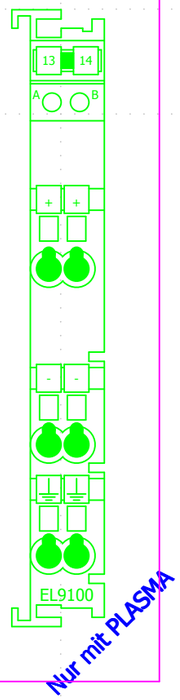

Nur mit PLASMA


power supply DC 24 V

DC 0 V

PE

EL1008
Digital input terminal
-C302


torch touch	=EM1+F1/1.5	1 I1	I2 5	=FK1/2.3	height found
torch touch	=EM1+F1/1	2 I3	I4 6	=FK1/2	height found
torch touch	=EM1+F1/1	3 I5	I6 7	=FK1/2	height found
torch touch	=EM1+F1/1	4 I7	I8 8	=FK1/2	height found



Nur mit PLASMA

EL1008
Digital input terminal
-C303

1 I1 I2 5
2 I3 I4 6
3 I5 I6 7
4 I7 I8 8



Nur mit PLASMA

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	11	total pages	190	last editor	I.Wund

MESSER Cutting Systems


289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	12
plant	= CA2	location	+ S1
last page	13	continuation page	13

EL2008
Digital output terminal
-C311

torch touch enable =EM1+F1/1.6 — 1 O1 — O2 5
torch touch enable =EM1+F1/1 — 2 O3 — O4 6
torch touch enable =EM1+F1/1 — 3 O5 — O6 7
torch touch enable =EM1+F1/1 — 4 O7 — O8 8

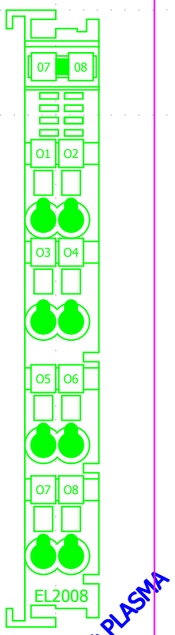


Nur mit PLASMA

EL4034
analog output
-10/10...10V
-C391

analog OUT =FK1/2.1 — 1 O1+ — O2+ 5 — =FK1/2 analog OUT
2 GND — GND 6
analog OUT =FK1/2 — 3 O3+ — O4+ 7 — =FK1/2 analog OUT
4 GND — GND 8

power contacts




Nur mit PLASMA

EL4034
analog output
-10/10...10V
-C392

1 O1+ — O2+ 5
2 GND — GND 6
3 O3+ — O4+ 7
4 GND — GND 8

power contacts



Nur mit PLASMA

EL9011
Cover plate
-EL1

without electrical function

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 12		total pages 190	last editor	I.Wund

MESSER Cutting Systems


289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	13
plant	= CA2	location	+ S1
last page 13		continuation page	=CA41+S41/1

EK1100
bus coupler
-C400
=CA0+S1/1.7


DC 24 V permanent	1 24V	0V 5	DC 0 V	
DC 24 V	2 +	+ 6	DC 24 V	
DC 0 V	3 -	- 7	DC 0 V	
PE	4 PE	PE 8	PE	

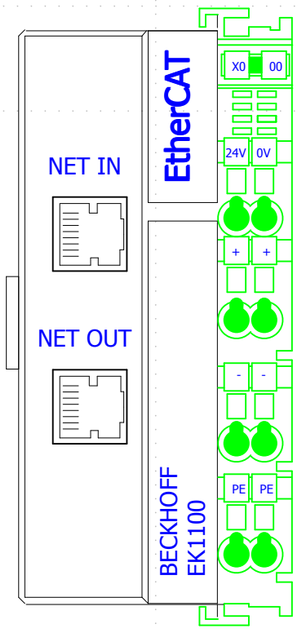

EL1008
Digital input terminal
-C401

=AB1+S1/7.2
=IM1/1.1

1 I1	I2 5	=IM1/1.2	plasma ready
2 I3	I4 6		
3 I5	I6 7		
4 I7	I8 8		




EL2622
relay outputs
-C402

plasma start =IM1/1.2

1 O1	O2 5	=IM1/1.3	plasma hold
2 L1	L2 6		
3 N	N 7		
4 PE	PE 8		


without power contacts



P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	bus terminal overview	drawing number / page 1
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = CA41 / location + S41
change	date	name	revisor				
previous page =CA2+S1/13		total pages 190		last editor I.Wund			last page 4 / continuation page 2

MESSER Cutting Systems

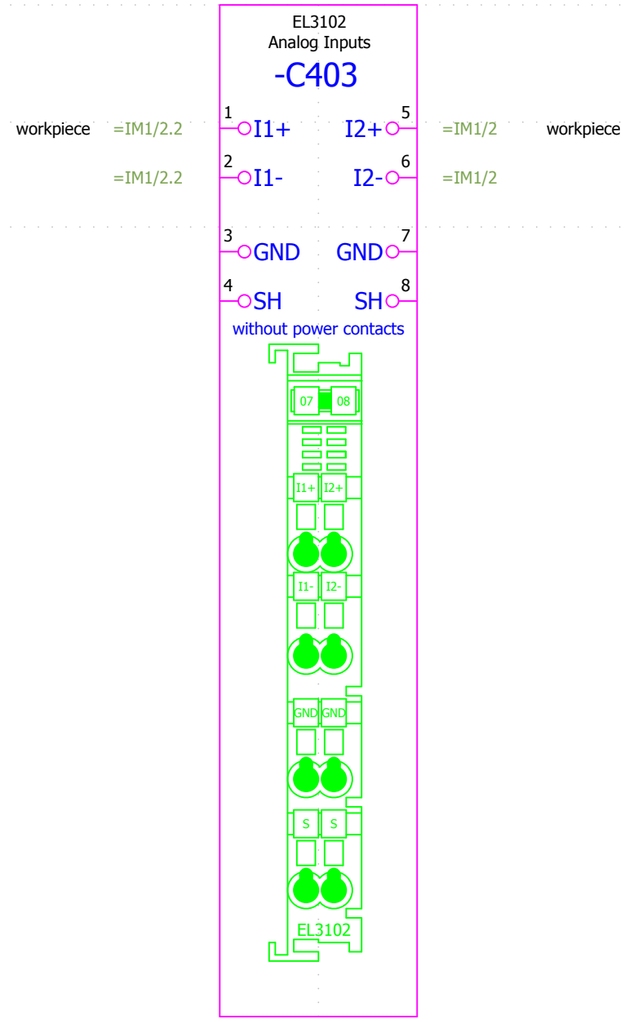


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	2
plant	= CA41	location	+ S41
last page	4	continuation page	3

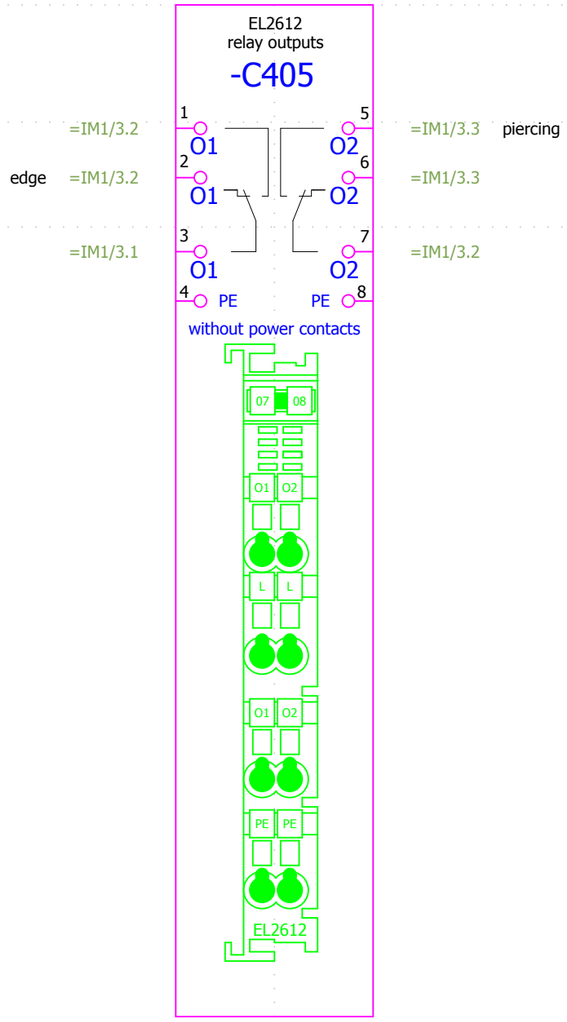

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 2		total pages 190		last editor I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview


drawing number		page	3
plant	= CA41	location	+ S41
last page	4	continuation page	4

EL2612
relay outputs
-C406

=IM1/3.1
remote ON =IM1/3.1
=IM1/3.0

1 O1 O2 5
2 O1 O2 6
3 O1 O2 7
4 PE PE 8


without power contacts



EL9410
infeed terminal
-C410

DC 24 V
power supply DC 24 V
infeed DC 0 V
PE

1 E-Bus +24V E-Bus 0V 5
2 +24V +24V 6
power infeed
3 0V 0V 7
4 PE PE 8



Diagnostics

DC 0 V
power supply DC 24 V
infeed DC 0 V
PE


EL6021
RS 422 / RS 485
-C416

Serial Interface =IM1/4.1
=IM1/4.1
GND
shield

1 TXD+ TXD- 5
2 RXD+ RXD- 6
3 GND GND 7
4 SH SH 8

=IM1/4.2 Serial Interface
=IM1/4.3
GND
shield

without power contacts



EL9011
Cover plate
-EL1

without electrical function

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	3	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminal overview

drawing number		page	4
plant	= CA41	location	+ S41
last page	4	continuation page	=EM1+F1/1

#<Plug:EP>

+S1

Digital input terminal
EL1008
=CA2C302
=CA2+S1/12.4
1
torch touch
I1
1
=EM1+F1/1.5

Digital output terminal
EL2008
=CA2C311
=CA2+S1/13.1
1
torch touch enable
O1
1
=EM1+F1/1.6

plasma height adjustment 1

=BA1+S1/3.9
=BA1-XP24
5.4
DC 24 V

=BA1+S1/3.1
=BA2-XL0
11.4
DC 0 V

-WXS1
PUR/TPE
5x0,34 mm²
10 m
=AB1+S1/8.5
BN 0,34
BU 0,34
BK 0,34
WH 0,34
SH

-XS1 = appliance plug
1 3 4 2
-XS1
=AB1+S1/8.4
SH

-XS2 = appliance plug
1 3 4 2
-XS2
=AB1+S1/8.4

-M77070171
=AB1+S1/8.3

-WXS3
3x0,25 mm²
=AB1+S1/8.3
BN 0,25
BU 0,25
BK 0,25

-XS3 = appliance plug
-XS3
=AB1+S1/8.3
1 3 4

-WXS4
3x0,25 mm²
=AB1+S1/8.5
BN 0,25
BU 0,25
BK 0,25

-XS4 = appliance plug
-XS4
=AB1+S1/8.5
1 3 4

-MES
=AB1+S1/8.3
G20000002

OUT -X1
-X1 = appliance plug
1 3 4
3pol M8
BN 0,34
BU 0,34
BK 0,34
-X1:4
DC 24 V
-X1:1
GND
-X1:3
TOUCH_TOR

IN -J1
-J1 = Device connection point
1 3 4
3pol M8
BN 0,34
BU 0,34
BK 0,34
24V 20mA
-J1:2
GND
-J1:1
TAC_ON

Arbeitstisch
-ST1

-PE
GNYE
4
GNYE
PE

-L1
Ferrite

-NOZ
=AB1+S1/8.4

torch cover
with quick-connect receptacle

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=CA41+S41/4	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

MESITT

drawing number		page	1
plant	= EM1	location	+ F1
last page	1	continuation page	=FK1+S1/1

Digital input terminal EL1008	Digital input terminal EL1008	Digital input terminal EL1008	Digital output terminal EL2008	Digital output terminal EL2008	Digital output terminal EL2008	Digital output terminal EL2008	Digital output terminal EL2008
=CA2-C112	=CA2-C112	=CA2-C112	=CA2-C111	=CA2-C111	=CA2-C111	=CA2-C111	=CA2-C103
=CA2/8.1	=CA2/8.1	=CA2/8.1	=CA2/7.7	=CA2/7.7	=CA2/7.7	=CA2/7.7	=CA2/8.4
height found	upper limit	collision	up	down	auto hight	set height	PAN/ALFA
I1	I2	I3	O1	O2	O3	O4	O1
1 =FK1+S1/1.1	5 =FK1+S1/1.2	2 =FK1+S1/1.3	1 =FK1+S1/1.4	5 =FK1+S1/1.4	2 =FK1+S1/1.5	6 =FK1+S1/1.6	1 =FK1+S1/1.8
BK	YEBN	RDBU	WHYE	VT	RD	WHGN	

=FK1+F1-W1HV
+F1/1.8 /

height found upper limit collision up down auto hight set height

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	bus terminals
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	=EM1+F1/1	total pages 190	last editor	I.Wund		

MESSER Cutting Systems

drawing number		page	1
plant	= FK1	location	+ S1
last page	4	continuation page	2

analog output
-10/10...10V
EL4034
=CA2-C391
=CA2/13.4
power contacts
1

analog OUT
O1+ GND
1 2
=FK1+S1/2.1 =FK1+S1/2.1

Digital input terminal
EL1008
=CA2-C302
=CA2/12.4
1

height found
I2
5
=FK1+S1/2.3

Bauteilbezeichnung
und Kontaktbelegung
gemäß Wagenzuordnung
anpassen!

=BA1/3.9
=BA1-XP24 4.3

-WXS1
PUR/PVC
5x0,34 mm²
10 m
=AB1/6.8

BN
0,34
WH
0,34

GY PK

+F1/1.7 / -W4HV

-XS1 = port socket
-XS1 1 3 5 2 4

13 14
13
14
=AB1/6.8
-S1
height found

Zuordnung über Anbauort
+F1.....+F6

+F1

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

bus terminals

drawing number		page	2
plant	= FK1	location	+ S1
last page	4	continuation page	3

digital output terminals
EL2008
=CA2-C103
=CA2/8.4
up
O6
7
=FK1+S1/3.1

digital output terminals
EL2008
=CA2-C103
=CA2/8.4
up
O8
8
=FK1+S1/3.4

=BA1/3.1
=BA2-XL0 5.1
DC 0 V

=FH1-K11 A1 A2

=FH1-K21 A1 A2

AC 24 V

=BA1/2.6 / -24VAC

-24VAC / =JB1/1.1

=FH1-K11 /3.1 12 14 11

=FH1-K21 /3.4 12 14 11

terminal type
Weidmüller ZDU 1,5/4 AN
1775580000

=FH1-XZ11 1.1 1.2 1.3 1.4 2.1 2.2 2.3 2.4
=FH1-XZ11 = distribution terminals

=FH1-XZ21 1.1 1.2 1.3 1.4 2.1 2.2 2.3 2.4
=FH1-XZ21 = distribution terminals

GN

BU

=FK1-W2HV / 4.1

2966265
14 12 11 /3.1
ignition
1-6
1 2 3 4 5 6

2966265
14 12 11 /3.3
ignition valve
1-6
1 2 3 4 5 6

spare

creep speed

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 2		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

common ignition

drawing number		page	3
plant	= FK1	location	+ S1
last page	4	continuation page	4

digital output terminals
EL2008
=CA2-C110
=CA2/9.1

up

O8
8
=FK1+S1/4.7

=BA1/2.8
=FD-XGND 1.2
AC GND

AC GND 1.3

AC GND 1.4

AC GND 2.2

=BA1/2.7
=FD-X24 1.3
AC 24 V

AC 24 V 1.4

AC 24 V 2.2

AC 24 V 2.3

-XVH 1.1 1.2 1.3 1.4 2.1 2.2 2.3 2.4
-XVH = distribution terminals

=BA1/3.1
=BA2-XL0 3.4 3.3 4.2
DC 0 V

5.2 5.3 5.4

6.1 6.2 6.3

6.4 7.1 7.2

3.8 / =FK1-W2HV

WH YE

GYPK

=FK1+F1-W2HV / +F1/1.6

vgl. =FKx, PK und GY werden umverdrahtet,
wenn Motorregler und Sollwert verwendet.

spare

creep speed

P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	3	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

common ignition

drawing number		page	4
plant	= FK1	location	+ S1
last page	4	continuation page	+F1/1

=BA2+S1/1.1
-W3HV

BN
BNGN

+S1/4.8
-W2HV

+S1/2.1
-W4HV

+S1/1.4
-W1HV

WH YE BU GYPK GN | PK GY | RD VT BK YEBN RDBU WHGN WHYE

-WX1
Chainflex Hybrid TP
12x+4x0,25+0,5 mm²

WH 0,5 | BN 0,5 | YE 0,5 | BU 0,25 | GYPK 0,25 | GN 0,5 | BNGN 0,25 | PK 0,25 | GY 0,25 | RD 0,25 | VT 0,25 | BK 0,25 | YEBN 0,25 | RDBU 0,25 | WHGN 0,25 | WHYE 0,25

=AB1+S1/6.4

-X1 1 7 11 10 2 16 14 8 3 4 5 6 9 12 13 15
-X1 = appliance plug

DC 0 V
DC 24 V
N24VAC
ignition valve
creep speed
ignitor on
switch over set value
analog signal ground
nominal value
auto hight
down
height found
upper limit
collision
set height
up

-MOT

=AB1+S1/6.1
76801001
drive regulator

G H A M C B 24VDC A1 D K L E F F1 u4/8a u4/16a PE

protective tubing

2.5 / -XM_A1
2.5 / -XM_C1
2.6 / -XM_A6
2.6 / -XM_A7
2.6 / -XM_B6
2.5 / -XM_B5
2.5 / -XM_A3
2.5 / -XM_C3
2.5 / -XM_A4
2.6 / -XM_B4
2.6 / -XM_C4
2.5 / -XM_C8
2.5 / -XM_B8
2.5 / -XM_PE

24VDC
GND
collision
analog gnd
analog +/-10V
GND

-X4 1 3 2 4 6 5
-X4 = appliance plug

-X2 1 6 7 2 3 8 4 5 9
-X2 = appliance plug ignition

-B1
10...30VDC
150mA
collision

1 2 3

P8 2.2.5


			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	+S1/4	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

height adjustment
OMNILIFT

drawing number		page	1
plant	= FK1	location	+ F1
last page	2	continuation page	2

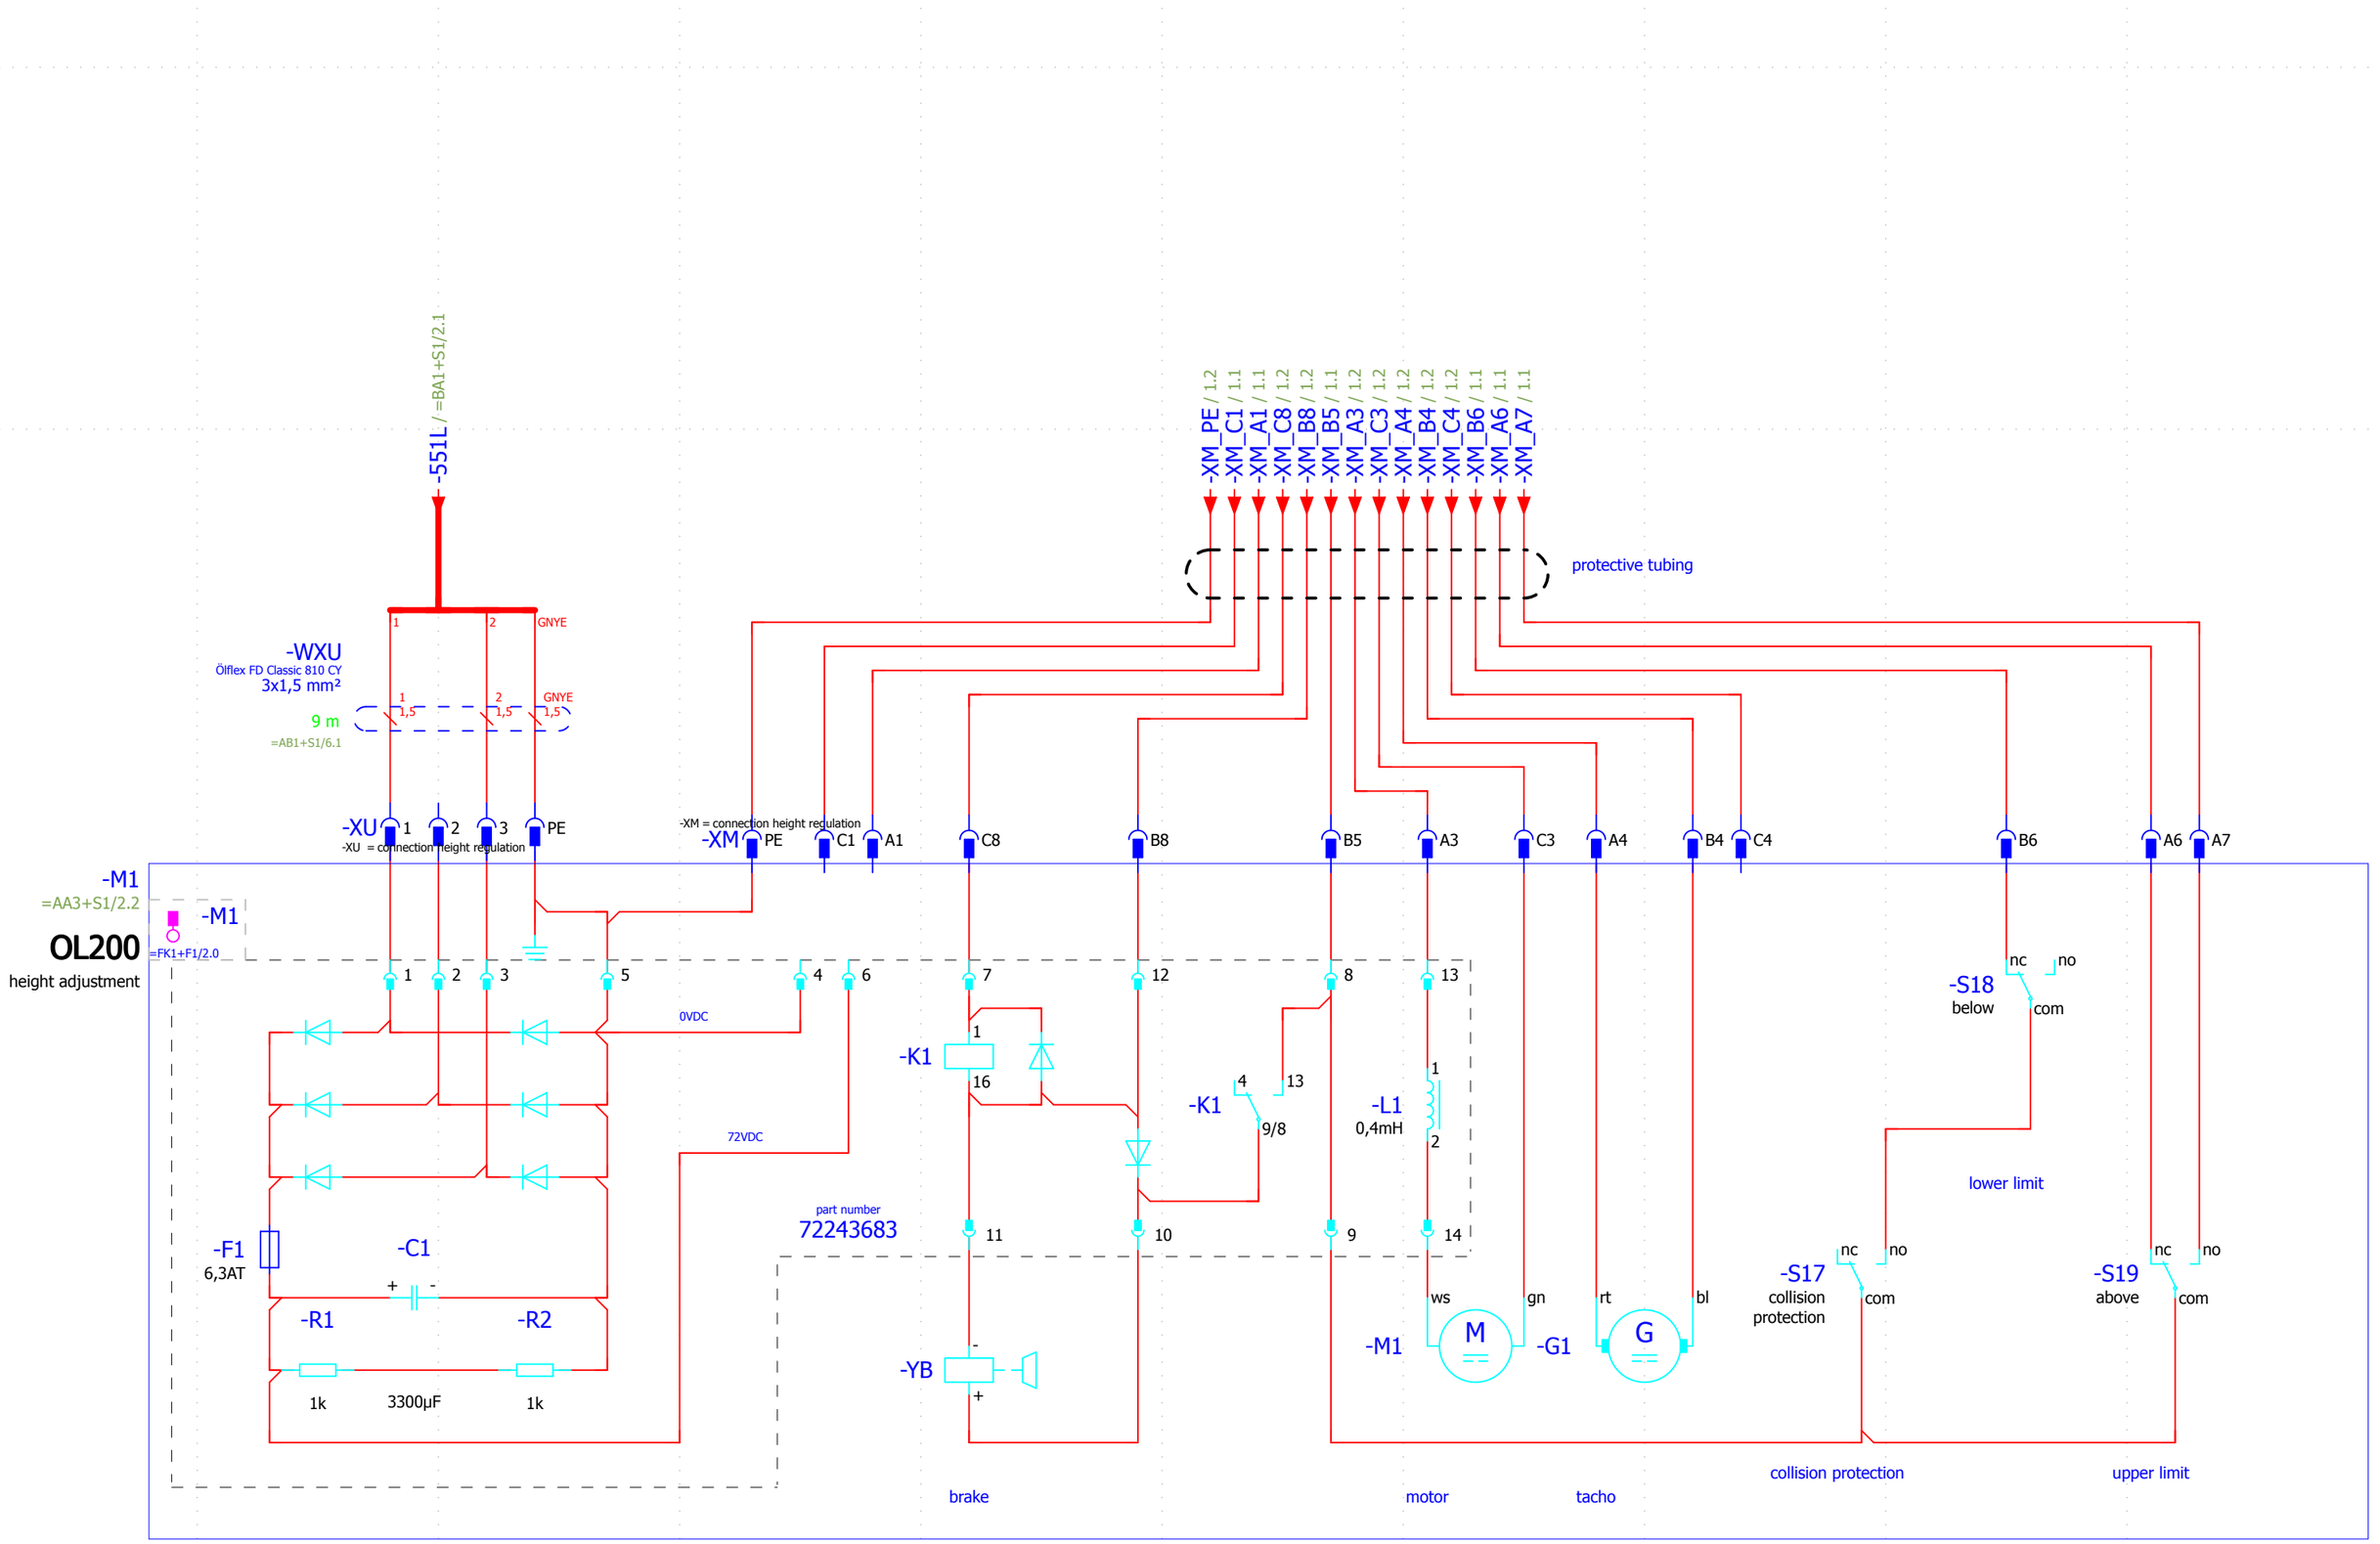

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

height adjustment
OMNILIFT

drawing number		page	2
plant	= FK1	location	+ F1
last page	2	continuation page	=HX1+S1/1

-HL2 / =BA1/1.6
-HL1 / =BA1/1.6
U.S. only
-F2 C10A
-F1 C10A
230VAC
-V1
SCHURTER 5500.2070
77070154
Funk-Entstörfilter 250VAC 16A
PE GNYE
-WV1
ÖLFLEX FD CLASSIC 810 CY
3x2,5 mm²
-XMR = distribution terminals
shield to the Mounting Panel
-XMR
-WXMR1
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076
-A1 = Device connection point
L1 L3 L2 SH 1+ 2+ -
230VAC POWER IN


=BA1/1.8 =BA1-X230L1 2.1
=BA1/1.3 =BA1-X230L2 3.1
subsequent installation
4-fach Potezialklemmen 2,5mm²
Kabelschirme auflegen
-V2
SCHURTER 5500.2068
77070131
Funk-Entstörfilter 250VAC 8A
-WV2
ÖLFLEX FD CLASSIC 810 CY
3x2,5 mm²
/1.2
-XMR
-WXMR2
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076
Shields grounded on mounting plate
L1C L2C SH
230VAC CONTROL IN
external brake resistor, only
B1 B2 B3



#<Plug:EP>
-A1
YASKAWA SERVOPACK 77005909
SGDV-5R5A01A
/1.2



Shield connection to motor regulator

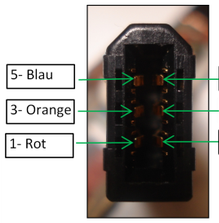


-FPE
ground strap
Functional Earthing, Ground Strap
FPE

COMBICON
U V W PE PE
-XM
-XM = motor connection
Shield connection to motor regulator

5VDC 0VDC BAT(+) BAT(-) PS /PS
-CN2
-CN2 = incremental encoder interface, 5V
SH

+M1

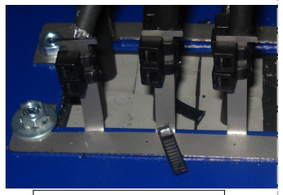


Shield connection at cable inlet in the cabinet

-WXM
Yaskawa System
4x1,0 mm²
10 m
=AB1/2.2
3 1,0 | 2 1,0 | 1 1,0 | GNYE 1,0
Shield connection at cable inlet in the cabinet
SH

-WCN2
Flexible Type
3x2x0,34 mm²
=AB1/2.3
RD 0,34 | BK 0,34 | OG 0,34 | WH/OG 0,34 | BU 0,34 | WH/BU 0,34
Shieldconnection at cable inlet in the cabinet
SH

Shield connection to motor & resolver.

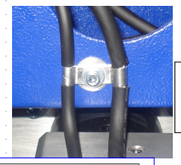


Shield connection to motor & resolver.

U V W FG
-XM
-XM = motor connection
4 3 2 1 5 6
SH

-CN2
-CN2 = incremental encoder interface, 5V
6 3 9 8 4 5
SH

-M1
=AA3/2.0

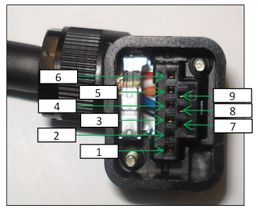

YASKAWA
SGMJV-08AA61
AC servo motor
0,75kW 3000rpm
Do not connect internal shields at motor

motor: u1 v1 w1 — M 3~ — PE
resolver: 5VDC 0VDC PS /PS — G

P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	=FK1+F1/2	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

power component

drawing number		page	1
plant	= HX1	location	+ S1
last page	3	continuation page	2

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

	ready	failure	increment_A	increment /A	increment_B	increment /B	gate	latch	GND	SH	GND	GND	GND	GND	DC 24 V	DC 24 V	GND	GND
	I0	I1	A	/A	B	/B	C	/C	GND	SH	0V	0V	0V	0V	24	24	0V	0V
	X0: 0	X0: 1	X4: 1	X4: 2	X4: 3	X4: 4	X4: 5	X4: 6	X4: 7	X4: 10	X0: 0V.	X0: 0V.	X0: 0V.	X0: 0V.	X0: 24V	X2: 24V	X0: 0V	X2: 0V
	=HX1+S1/2.1	=HX1+S1/2.1	=HX1+S1/2.3	=HX1+S1/2.3	=HX1+S1/2.4	=HX1+S1/2.4	=HX1+S1/2.5	=HX1+S1/2.5	=HX1+S1/2.6	=HX1+S1/2.6	=HX1+S1/2.6	=HX1+S1/2.7	=HX1+S1/2.7	=HX1+S1/2.7	=HX1+S1/2.8	=HX1+S1/2.8	=HX1+S1/2.9	=HX1+S1/2.9

SH

=BA1/3.9
=BA1-XP24 2.1
DC 24 V permanent

=BA1/3.1
=BA2-XL0 8.4
DC 0 V

=HX2-CN1:47
=HY1-CN1:47
=HX2-CN1:29 / =HX2/2.8
=HX2-0VDC / =HX2/2.6

=BA1/3.1
=BA2-XL0 9.2
DC 0 V

=BA1/3.9
=BA1-XP24 2.3
DC 24 V permanent

	YE	PK	BU	RD	BK	VT	YEBN	GN	GY
	0,14	0,14	0,14	0,14	0,14	0,14	0,14	0,14	0,14
							DC 0 V	24VDC	

-CN1	30	32	33	34	35	36	19	20	47	1	29	31
-CN1 = Device connection point	S-RDY-	ALM-	increment_A	increment /A	increment_B	increment /B	increment_C	increment /C	0VDC IN	signal common	S-RDY+	ALM+

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	control component	drawing number / page 2
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = HX1 / location + S1
change	date	name	revisor				
previous page 1		total pages 190	last editor I.Wund				last page 3 / continuation page 3

MESSER Cutting Systems

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

home switch X

I3
2
=HX1+S1/3.2

=VA0/1.6 / =VA0+S1-X1:13

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

nominal value
+10V
-X4: 8
=HX1+S1/3.3

nominal value GND
-10V
-X4: 9
=HX1+S1/3.3

SH

enable
O0
-X2: 0
=HX1+S1/3.4

reset
O1
-X2: 1
=HX1+S1/3.5

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

- overtravel X

I2
5
=HX1+S1/3.7

/3.7
=VA0-X1 2

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

+ overtravel X

I1
1
=HX1+S1/3.8

/3.7
=VA0-X1 1

=VA0-X1 = distribution terminals

=VA0/1.4 / =VA0+S1-X1:11

=VA0/1.2 / =VA0+S1-X1:9

WH
0,14

BN
0,14

GYPK
0,14

BNGN
0,14

WHGN
0,14

RDBU
0,14

=HX2-CN1:42 / =HX2/3.7
=HX2-CN1:43 / =HX2/3.7

-CN1 5 V-REF
6 signal ground
40 S-ON
44 ALM-RST
43 N-OT
42 P-OT

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	2	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

control component

drawing number		page	3
plant	= HX1	location	+ S1
last page	3	continuation page	=HX2/1

subsequent installation

4-fach Potezialklemmen 2,5mm²
Kabelschirme auflegen

=HX1/1.2
-WXMR1
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076
=HX1-XMR 3 4
SH
Shields grounded on mounting plate
1 1,5
2 1,5
-A1 = Device connection point
L1 L3 L2 SH 1+ 2+ -
230VAC POWER IN




=HX1/1.2
-WXMR2
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076
=HX1-XMR 1 2
SH
Shields grounded on mounting plate
1 1,5
2 1,5
L1C L2C SH B1 B2 B3
230VAC CONTROL IN

external brake resistor, only

#<Plug:EP>
-A1
YASKAWA SERVOPACK 77005909
SGDV-5R5A01A
/1.2



Shield connection to motor regulator

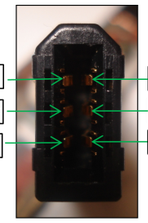


-FPE
ground strap
M
Functional Earthing, Ground Strap
FPE

COMBICON
U V W PE PE
-XM U V W
-XM = motor connection

Shield connection to motor regulator

5VDC 0VDC BAT(+) BAT(-) PS /PS
-CN2 1 2 3 4 5 6 SH
-CN2 = incremental encoder interface, 5V

+M2
-WXM
Yaskawa System
4x1,0 mm²
10 m
=AB1/2.6
3 1,0 2 1,0 1 1,0 GNYE 1,0
SH
Shield connection at cable inlet in the cabinet

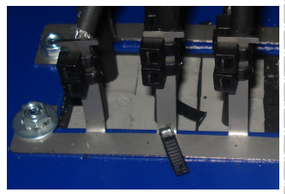


Shield connection at cable inlet in the cabinet

-M1
=AA3/2.9

Shield connection to motor & resolver.

-WCN2
Flexible Type
3x2x0,34 mm²
=AB1/2.7
RD 0,34 BK 0,34 OG 0,34 WH/OG 0,34 BU 0,34 WH/BU 0,34
SH
Shield connection at cable inlet in the cabinet

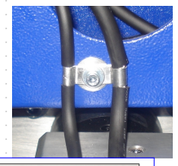

Shield connection to motor & resolver.


U V W FG
-XM 4 3 2 1 5 6
-XM = motor connection
SH

-CN2 6 3 9 8 4 5 SH
-CN2 = incremental encoder interface, 5V
5VDC 0VDC PS /PS

#<Plug:EP>
u1 v1 w1
motor
M 3~
PE

YASKAWA
SGMJV-08AA61
AC servo motor
0,75kW 3000rpm
Do not connect internal shields at motor

resolver
G

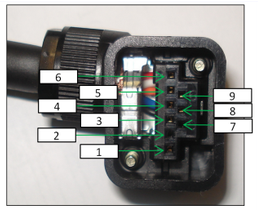

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	power component	drawing number / page 1
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = HX2 / location + S1
change	date	name	revisor				
previous page =HX1/3		total pages 190	last editor I.Wund				last page 3 / continuation page 2

MESSER Cutting Systems

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

	ready	failure	increment_A	increment /A	increment_B	increment /B	gate	latch	GND	SH	GND	GND	GND
	I2	I3	A	/A	B	/B	C	/C	GND	SH	0V	0V	0V
	X0: 2	X0: 3	X5: 1	X5: 2	X5: 3	X5: 4	X5: 5	X5: 6	X5: 7	X5: 10	X1: 0V.	X1: 0V	X3: 0V
	=HX2+S1/2.1	=HX2+S1/2.1	=HX2+S1/2.3	=HX2+S1/2.3	=HX2+S1/2.4	=HX2+S1/2.4	=HX2+S1/2.5	=HX2+S1/2.5	=HX2+S1/2.6	=HX2+S1/2.6	=HX2+S1/2.6	=HX2+S1/2.8	=HX2+S1/2.9

SH

=HX1/2.9 / -0VDC

-CN1:47 / =HX1/2.7

-CN1:29 / =HX1/2.8

=HY1-CN1:29 / =HY1/2.8

=HY1/2.6 / =HY1-0VDC

	YE 0,14	PK 0,14	BU 0,14	RD 0,14	BK 0,14	VT 0,14	YEBN 0,14	GN 0,14	GY 0,14
							0VDC	24VDC	

-CN1 30 32 33 34 35 36 19 20 47 1 29 31

-CN1 = Device connection point

S-RDY-	ALM-	increment_A	increment /A	increment_B	increment /B	increment_C	increment /C	0VDC IN	signal common	S-RDY+	ALM+

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	control component	drawing number / page 2
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = HX2 / location + S1
change	date	name	revisor				last page 3 / continuation page 3
previous page 1		total pages 190	last editor I.Wund				

MESSER Cutting Systems

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

nominal value
+10V
-X5: 8
=HX2+S1/3.3

nominal value GND
-10V
-X5: 9
=HX2+S1/3.3

enable
O2
-X2: 2
=HX2+S1/3.4

reset
O3
-X2: 3
=HX2+S1/3.5

SH

WH 0,14
BN 0,14
GYPK 0,14
BNGN 0,14

=HX1/3.8 / -CN1:43
=HX1/3.8 / -CN1:42
WHGN 0,14
RDBU 0,14

-CN1
5 V-REF
6 signal ground
40 S-DN
44 ALM-RST
43 N-OT
42 P-OT

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	control component	drawing number / page 3
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = HX2 / location + S1
change	date	name	revisor				
previous page 2		total pages 190	last editor I.Wund				last page 3 / continuation page =HY1/1

MESSER Cutting Systems

subsequent installation

4-fach Potezialklemmen 2,5mm²
Kabelschirme auflegen



-WXMR1
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076

=HX1/1.2
=HX1-XMR 3 4
1 1,5
2 1,5
SH
Shields grounded on mounting plate
-A1 = Device connection point
L1 L3 L2 SH 1+ 2+ -
230VAC POWER IN

-WXMR2
Ölflex FD Classic 810 CY
3x1,5 mm²
0551076


=HX1/1.2
=HX1-XMR 1 2
1 1,5
2 1,5
SH
Shields grounded on mounting plate
L1C L2C SH B1 B2 B3
230VAC CONTROL IN

external brake resistor, only


#<Plug:EP>
-A1
YASKAWA SERVOPACK 77005909

SGDV-5R5A01A

/1.2

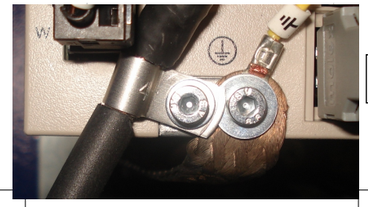

Shield connection to motor regulator

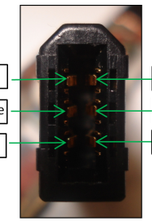

5- Blau
3- Orange
1- Rot
6- Weis/Blau
4- Weis/Orange
2- Schwarz

-FPE
ground strap
M
Functional Earthing, Ground Strap
FPE

COMBICON
U V W PE PE
-XM U V W
-XM = motor connection

Shield connection to motor regulator

5VDC 0VDC BAT(+) BAT(-) PS /PS
-CN2 1 2 3 4 5 6 SH
-CN2 = incremental encoder interface, 5V

+F1



Shield connection at cable inlet in the cabinet

-WXM
Yaskawa System
4x1,0 mm²
10 m
=AB1/3.2


3 1,0 | 2 1,0 | 1 1,0 | GNYE 1,0
Shield connection at cable inlet in the cabinet
SH

Shield connection to motor & resolver.

U V W FG
-XM 4 3 2 1 5 6
-XM = motor connection
SH


-WCN2
Flexible Type
3x2x0,34 mm²
=AB1/3.3

RD 0,34 | BK 0,34 | OG 0,34 | WH/OG 0,34 | BU 0,34 | WH/BU 0,34
Shield connection at cable inlet in the cabinet
SH

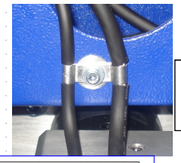

Shield connection to motor & resolver.

-CN2 6 3 9 8 4 5 SH
-CN2 = incremental encoder interface, 5V
5VDC 0VDC PS /PS

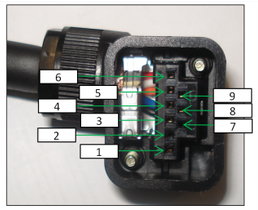

-M1
=AA3/2.1

#<Plug:EP>
u1 v1 w1
motor
M 3~
PE

YASKAWA
SGMJV-08AA61
AC servo motor
0,75kW 3000rpm

Do not connect internal shields at motor

resolver
G

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=HX2/3	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

power component

drawing number		page	1
plant	= HY1	location	+ S1
last page	3	continuation page	2

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

	ready	failure	increment_A	increment /A	increment_B	increment /B	gate	latch	GND	SH	GND
	I8	I9	A	/A	B	/B	C	/C	GND	SH	0V
	X1: 0	X1: 1	X6: 1	X6: 2	X6: 3	X6: 4	X6: 5	X6: 6	X6: 7	X6: 10	X3: 0V.
	=HY1+S1/2.1	=HY1+S1/2.1	=HY1+S1/2.3	=HY1+S1/2.3	=HY1+S1/2.4	=HY1+S1/2.4	=HY1+S1/2.5	=HY1+S1/2.5	=HY1+S1/2.6	=HY1+S1/2.6	=HY1+S1/2.6

SH

=HX2/2.9 / -0VDC

=HX1/2.7 / -CN1:47

=HX2/2.8 / -CN1:29

	YE	PK	BU	RD	BK	VT	YEBN	GN	GY
	0,14	0,14	0,14	0,14	0,14	0,14	0,14	0,14	0,14
							0VDC	24VDC	

-CN1 = Device connection point

-CN1	30	32	33	34	35	36	19	20	47	1	29	31
	S-RDY-	ALM-	increment_A	increment /A	increment_B	increment /B	increment_C	increment /C	0VDC IN	signal common	S-RDY+	ALM+

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	1	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

control component

drawing number		page	2
plant	= HY1	location	+ S1
last page	3	continuation page	3

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

home switch Y

I7
4
=HY1+S1/3.2

=VA0/2.6 / =VA0+S1-X1:14

EM7004
4-axis interface
=CA2+S1-C701
=CA2/4.0

nominal value
+10V
-X6: 8
=HY1+S1/3.3

nominal value GND
-10V
-X6: 9
=HY1+S1/3.3

SH

enable
O8
-X3: 0
=HY1+S1/3.4

reset
O9
-X3: 1
=HY1+S1/3.5

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

+ overtravel Y

I5
3
=HY1+S1/3.7

=HX1/3.7
=VA0-X1 3

=VA0/2.2 / =VA0+S1-X1:10

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

- overtravel Y

I6
7
=HY1+S1/3.8

=HX1/3.7
=VA0-X1 4

=VA0/2.4 / =VA0+S1-X1:12

WH 0,14
BN 0,14
GYPK 0,14
BNGN 0,14
RDBU 0,14
WHGN 0,14

-CN1 5 — V-REF
6 — signal ground
40 — S-DN
44 — ALM-RST
42 — P-OT
43 — N-OT

/1.0
-A1
YASKAWA SERVOPACK
SGDV-5R5A01A

P8 2.2.5

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	2	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

control component

drawing number		page	3
plant	= HY1	location	+ S1
last page	3	continuation page	=IM1+S41/1

Digital input terminal
EL1008
=CA41-C401
=CA41/1.4
arc transfered
I1
1
=IM1+S41/1.1

Digital input terminal
EL1008
=CA41-C401
=CA41/1.4
plasma ready
I2
5
=IM1+S41/1.2

relay outputs
EL2622
=CA41-C402
=CA41/1.7
plasma start
no
without power contacts
N O1 PE L1
3 1 4 2
=IM1+S41/1.2

relay outputs
EL2622
=CA41-C402
=CA41/1.7
plasma hold
no
without power contacts
N O2 PE L2
7 5 8 6
=IM1+S41/1.3

=BA2/1.4
=BA2-X24L 1.3
DC 24 V

-L3
1 2 3 4

BN WH YE GN RD BU GYPK RDBU

+I1-IMA
+I1/1.2


			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=HY1+S1/3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interlock

drawing number		page	1
plant	= IM1	location	+ S41
last page	4	continuation page	2

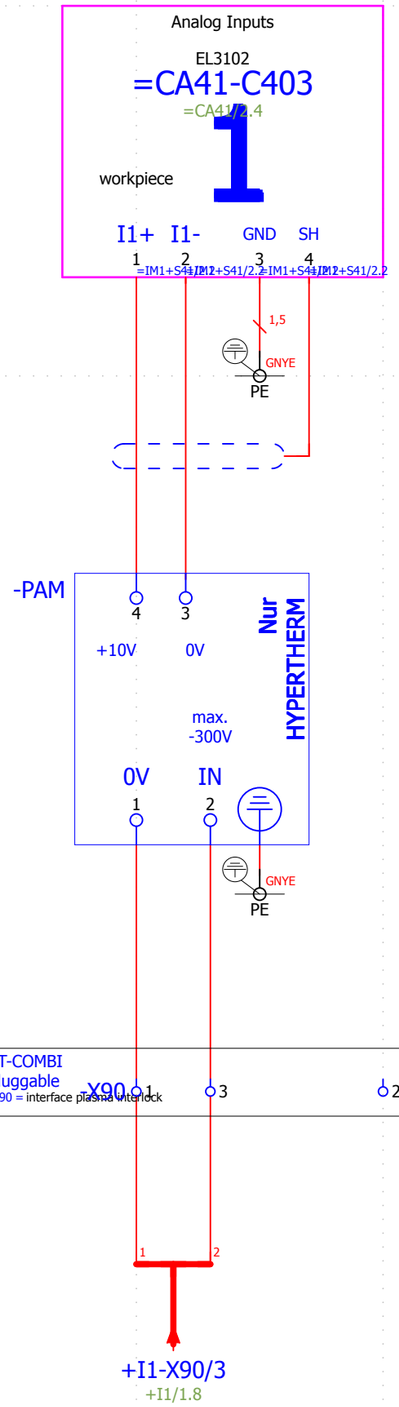

Bauteilbezeichnung
und Kontaktbelegung
gemäß Wagenzuordnung
anpassen!

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	interlock	drawing number	page 2
			editor	INGO.WUNDERLE			plant = IM1	location + S41
001	10.02.2014	Wun	printout	10.02.2014			last page 4	continuation page 3
change	date	name	revisor					
previous page 1		total pages 190	last editor	I.Wund				

MESSER Cutting Systems

relay outputs
EL2612
=CA41-C406
=CA41/4.1

remote ON
without power contacts

O1 O1 O1 PE
3 2 1 4
=IM1+S41/3.1

=BA2/3.2 / =IM1-X44:3

=BA2/3.2 / =IM1-K2:53

relay outputs
EL2612
=CA41-C405
=CA41/3.4

edge
without power contacts

O1 O1 O1 PE
3 2 1 4
=IM1+S41/3.2

relay outputs
EL2612
=CA41-C405
=CA41/3.4

piercing
without power contacts

O2 O2 O2 PE
7 5 6 8
=IM1+S41/3.3

BK VT GY PK

+I1-IMB
+I1/1.4

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	2	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interlock

drawing number		page	3
plant	= IM1	location	+ S41
last page	4	continuation page	4

RS 422 / RS 485

EL6021

=CA41-C416

=CA41/4.7

Serial Interface		GND	shield	Serial Interface		GND	shield
TXD+	RXD+	GND	SH	TXD-	RXD-	GND	SH
1	2	3	4	5	6	7	8

caution

-V1 x1 / x2
-V2 x2 / x1
-V3 x1 / x2
-V4 x2 / x1
-V5 x1 / x2
-V6 x2 / x1
-V7 x1 / x2
-V8 x2 / x1

WXRS
UNITRONIC LiYCY
8x0,25 mm²

WH	GN	GY	BN	YE	SH
0,25	0,25	0,25	0,25	0,25	

=BA2/1.7
=BA2-XL0 2.1
DC 0 V

WH GN GY BN YE

+I1-XRS
+I1/1.5

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	3	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

interlock

drawing number		page	4
plant	= IM1	location	+ S41
last page	4	continuation page	+I1/1

+S41-1X3M
=AB1+S1/7.1
interface module

Phoenix Contact
FLKM-D37 SUB/S
2281115

+S41/1.2
-IMA

+S41/3.2
-IMB

+S41/4.2
-XRS

-WXRS
UNITRONIC LiYCY
8x0,25
=AB1+S1/7.3
GN 0,25 | YE 0,25 | WH 0,25 | BN 0,25 | GY 0,25 | SH

-WX90
UNITRONIC LiYCY
18x0,5
=AB1+S1/7.2
WH 0,5 | BN 0,5 | GN 0,5 | YE 0,5 | BU 0,5 | RD 0,5 | GYPK 0,5 | RDBU 0,5 | GY 0,5 | PK 0,5 | BK 0,5 | VT 0,5 | SH

+S41-1X3
+S41-1X3 = plug connection
4 23 7 26 15 34 14 33 13 32 12 31 21 2 20 1 3

+S41-1X3
+S41-1X3 = plug connection
4 23 7 26 15 34 14 33 13 32 12 31 21 2 20 1 3

-WHPR
US Steuerleitung 22 AWG
37x22 AWG
=AB1+S1/7.2
BK4 22 | YE4 22 | RD7 22 | WH7 22 | GN15 22 | YE15 22 | GN14 22 | BU14 22 | GN13 22 | WH13 22 | RD12 22 | OG12 22 | GN2 22 | BK2 22 | RD1 22 | BK1 22 | BK3 22

-J300
-J300 = plug connection
Sub D 37
23 4 26 7 34 15 33 14 32 13 31 12 2 21 1 20 3

arc transfered
plasma ready
plasma start
plasma hold
pierce complete
edge
TXD-
TXD+
RXD-
RXD+
GND
RS 422

+S41/2.2
-X90/3

-WWST
Ölflex FD Classic 810 CY
3x1,5 mm²
4,5 m
=AB1+S1/7.6
1 | 1,5 | 2 | 1,5 | SH

=BA2+S41/3.2
-IMC

-WREM
Ölflex FD Classic 810 CY
3x1 mm²
4,5 m
=AB1+S1/7.5
1 | 1,0 | 2 | 1,0 | SH

-FKAB
2A
1
2

-TB2:1 2 3 + -
workpiece positive
workpiece negative

with automatic gas control
panel set link from -TB2:1 to
-TB2:2
auto
remote ON

At first setup strictly
remove internal wire from
-TB2:3 to
-TB2:2
manual

=AA3+S1/2.3

HPR 130/260/400 XD

plasma current source
-A1

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	+S41/4	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

HPR 130/260XD

drawing number		page	1
plant	= IM1	location	+ I1
last page	1	continuation page	=JB1+S1/1

relay outputs
EL2622
=CA2-C120
=CA2/10.1



without power contacts


N	O1	PE	L1
3	1	4	2

=JB1+S1/1.1

=VA0/1.8 / =VA0-X1:7

=FK1/3.4 / =FK1-24VAC

Option Körnen

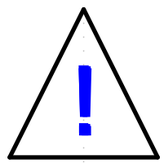

connected via
actor-sensor-box

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	=IM1+I1/1	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

punch marking

drawing number		page	1
plant	= JB1	location	+ S1
last page	1	continuation page	=LD1/1

digital output terminals
EL2008
=CA2-C108
=CA2/11.7

up

O8
8
=LD1+S1/1.1

=BA1/3.1
=BA2-XL0 8.1
DC 0 V

PE
GNYE

Option
customers request
subsequent installation

-T1
+Vin -Vin
input

In 18-75VDC
Out 12VDC

TCL24-112DC 24W
77070093

output
- +

-WX1
Ölflex FD Classic 810 CY
3x0,5 mm²

SH

2 0,5
1 0,5

=AB1/1.6

-X1
plug connection
=AB1/1.5
2 4 SH

-X2
plug connection
=AB1/1.5
2 4 SH

Geflechtschlauch
0546032

BU 0,14
BR 0,14

SH

DC 12 V
77004380
=AB1/1.5

-H1
laserpointer

=LD1+F1

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=JB1/1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

laserpointer

drawing number		page	1
plant	= LD1	location	+ S1
last page	1	continuation page	=MB1/1

Digital input terminal
EL1008
=CA2-C107
=CA2/9.4

push button power on

I8
8
=MB1+S1/1.2

=BA1/3.3
=BA1-XL24 1.2
DC 24 V control voltage

=VA0/2.8 / =VA0+S1-X1:16

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=LD1/1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

exhaust

drawing number		page	1
plant	= MB1	location	+ S1
last page	1	continuation page	=VA0/1

=BA1/3.1
=BA2-XL0 4.3
DC 0 V

=BA1/3.9
=BA1-XP24 5.1
DC 24 V permanent

+M1-WX1
PUR/PVC
16x+5x0,34+0,75 mm²
10 m
=AB1/4.4

BN1 0,75 | BU1 0,75 | GYPK 0,34 | WH 0,34 | WHGN 0,34 | YE 0,34 | WHYE 0,34 | PK 0,34 | WHGY 0,34 | BK 0,34

-X1:9 / =HX1/3.8
-X1:11 / =HX1/3.7
-X1:13 / =HX1/3.2
-X1:15 / =BA1/3.8
-X1:7 / =JB1/1.1

+M1-X1
=AA3/2.0

+1 -1 9 1 11 3 13 5 15 7

DC
notice
jumper

-PE / 2.9

-P1 = port socket
-P1 1 3 5 2 4

-P3 = port socket
-P3 1 3 5 2 4

-P5 = port socket
-P5 1 3 5 2 4

-P7 = port socket
-P7 1 3 5 2 4

=HX1+M1-WB1
PUR/PVC
4x0,34 mm²
1 m
=AB1/4.3
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.2
=HX1+M1-B1
+ overtravel X

=HX1+M1-WB3
PUR/PVC
4x0,34 mm²
1 m
=AB1/4.3
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.2
=HX1+M1-B3
- overtravel X

=HX1+M1-WB5
PUR/PVC
4x0,34 mm²
1 m
=AB1/4.3
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.2
=HX1+M1-B5
home switch X

BU BN
=CA0+P1-VA0-P7
=CA0+P1/2.2
operation desk cooler

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=MB1/1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

actor-sensor-box

drawing number		page	1
plant	= VA0	location	+ S1
last page	2	continuation page	2

=BA1/3.1
=BA2-XL0 3.2
DC 0 V

=BA1/3.9
=BA1-XP24 5.2
DC 24 V permanent

+M1-WX1
PUR/PVC
16x+5x0,34+0,75 mm²
10 m
=AB1/4.4

-X1:10 / =HY1/3.7
-X1:12 / =HY1/3.8
-X1:14 / =HY1/3.2
-X1:16 / =MB1/1.2

PE
GNYE

BN2 0,75 | BU2 0,75 | RDBU 0,34 | GN 0,34 | BNGN 0,34 | GY 0,34 | YEBN 0,34 | RD 0,34 | GYBN 0,34 | VT 0,34 | GNYE 0,75

+M1-X1
=AA3/2.0

+2 -2 10 2 12 4 14 6 16 8 PE

DC
notice
jumper

-PE / 1.9

-P2 = port socket
-P2 1 3 5 2 4

-P4 = port socket
-P4 1 3 5 2 4

-P6 = port socket
-P6 1 3 5 2 4

-P8 = port socket
-P8 1 3 5 2 4

=HY1+O1-WB2
PUR/PVC
5x0,34 mm²
10 m
=AB1/4.7
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.7
=HY1+O1-B2
+ overtravel Y

=HY1+O1-WB4
PUR/PVC LiF9YH11YH
5x0,34 mm²
10 m
=AB1/4.7
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.7
=HY1+O1-B4
- overtravel Y

=HY1+O1-WB6
PUR/PVC LiF9YH11YH
5x0,34 mm²
10 m
=AB1/4.7
BN 0,34 | BU 0,34 | WH 0,34
=AB1/4.7
=HY1+O1-B6
home switch Y

=MB1+A1-XS8
plug connection
=AB1/4.6

=MB1+A1-WS8
Ölflex FD Classic 810 CY
3x1 mm²
1 1,0 | 2 1,0
=AB1/4.7

13 14 PE
13
14
=AA3/2.1
=MB1+A1-S8
exhaust

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

actor-sensor-box

drawing number		page	2
plant	= VA0	location	+ S1
last page	2	continuation page	=VNA0+M2/1

connection to plug =BA4+S1-SNA

=BA4+S1/1.3
=BA4+S1-WSNA

BN WH BU BK

-WSNA
PUR/PVC
4x0,34 mm²
3 m
=AB1+S1/9.4

BN 0,34 | WH 0,34 | BU 0,34 | BK 0,34

-X1
=AB1+S1/9.4
MURR MSDS8R-Art.-No. 2792

-P0 = port socket
-P0 1 2 3 4

B4 / 2.1
B3 / 2.1
B2 / 2.1
B1 / 2.1

1+P 1-0V 9 5 3 1 11 15 7 1324VDC 160VDC

NOT-AUS
emergency stop

-P1 = port socket
-P1 1 2 3 4

-P3 = port socket
-P3 1 2 3 4

-P5 = port socket
-P5 1 2 3 4

-P7 = port socket
-P7 1 2 nc 5 nc 3 nc 4

=VNA0-XP5
=AB1+S1/9.4
jumper plug

BN WH BU BK

Option

=VNA1+M1-WXVNA

=VNA1+M1/1.2 / =VNA1+M1-WXVNA

=BA6-WSRL1
PUR/PVC
4x0,34 mm²
3 m
=AB1+S1/9.3

BN 0,34 | WH 0,34 | BU 0,34 | BK 0,34

11 12 21 22 31 32 43 44

=BA6-SRL1
=AB1+S1/9.1
ZANDER LIFELINE4 901164
72243601
Emergency cord front

foot protection
left

light barriers and bumpers

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	=VA0+S1/2	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

safety loop emergency stop

drawing number		page	1
plant	= VNA0	location	+ M2
last page	2	continuation page	2

-X1
=AB1+S1/9.4
MURR MSDS8R-Art.-No. 2792

1.7 / B4
1.7 / B3
1.7 / B2
1.7 / B1

2+P 2-0V 2 12 2 4 14 6 8 PE

NOT-AUS
emergency stop

-P2 = port socket
-P2 1 2 3 4

-P4 = port socket
-P4 1 2 3 4

-P6 = port socket
-P6 1 2 3 4

-P8 = port socket
-P8 1 2 5 3 4
nc nc nc

=VNA0-XP4
=AB1+S1/9
jumper plug

=VNA0-XP6
=AB1+S1/9.5
jumper plug

BN WH BU BK

Option

=VNA2/1.2 / =VNA2+M2-WXVNA

=BA6-WSRL2
PUR/PVC
4x0,34 mm²
3 m
=AB1+S1/9.6

BN 0,34 WH 0,34 BU 0,34 BK 0,34

11 12 21 22 31 32 43 44

=BA6-SRL2
=AB1+S1/9.7
ZANDER LIFELINE4 901164
72243601
emergency cord rear

foot protection
right

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	1	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

safety loop emergency stop

drawing number		page	2
plant	= VNA0	location	+ M2
last page	2	continuation page	=VNA1+M1/1

über Actor-Sensor-Box
VNA0

=VNA0+M2/1.4
-WXVNA

-WVNA
PUR/PVC
4x0,34 mm²
7,5 m
=AB1+S1/10.4

BN WH BU BK
BN 0,34 WH 0,34 BU 0,34 BK 0,34

-XVNA
=AB1+S1/10.4
MURR SAI-4-M 5P M12 1:1
77004781

-P0 1 2 5 3 4
-P0 = port socket

1 2 5 3 4 6 7 10 8 9 11 12 15 13 14 16 17 20 18 19 21

-P1 = port socket
-P1 1 2 5 3 4

-P2 = port socket
-P2 1 2 5 3 4

-P3 = port socket
-P3 1 2 5 3 4

-P4 = port socket
-P4 1 2 5 3 4

-WS1
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/10.3

-WS2
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/10.6

-WS3
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/10.3

-WS4
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/10.6

BN 0,34 WH 0,34 BU 0,34 BK 0,34

1 2 3 4

21 31
22 32

-S1
=AB1+S1/10.1
foot protection front left
wheel housing left

-S2
=AB1+S1/10.7
foot protection front right
wheel housing left

-S3
=AB1+S1/10.1
foot protection rear left
wheel housing left

-S4
=AB1+S1/10.7
foot protection rear right
wheel housing left

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	foot protection
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	=VNA0+M2/2	total pages	190	last editor I.Wund		

MESSER Cutting Systems

drawing number		page	1
plant	= VNA1	location	+ M1
last page	1	continuation page	=VNA2+M2/1

über Actor-Sensor-Box
VNA0

=VNA0/2.4
-WXVNA

BN WH BU BK

-WVNA
PUR/PVC
4x0,34 mm²
1 m
=AB1+S1/11.4

BN 0,34 WH 0,34 BU 0,34 BK 0,34

-XVNA
=AB1+S1/11.4
MURR SAI-4-M 5P M12 1:1
77004781

-P0 1 2 5 3 4
-P0 = port socket

1 2 5 3 4 6 7 10 8 9 11 12 15 13 14 16 17 20 18 19 21

-P1 = port socket
-P1 1 2 5 3 4

-P2 = port socket
-P2 1 2 5 3 4

-P3 = port socket
-P3 1 2 5 3 4

-P4 = port socket
-P4 1 2 5 3 4

-WS1
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/11.3

BN 0,34 WH 0,34 BU 0,34 BK 0,34

1 2 3 4
21 31
22 32

-S1
=AB1+S1/11.1
foot protection front left
wheel housing right

-WS2
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/11.6

BN 0,34 WH 0,34 BU 0,34 BK 0,34

1 2 3 4
21 31
22 32

-S2
=AB1+S1/11.7
foot protection front right
wheel housing right

-WS3
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/11.3

BN 0,34 WH 0,34 BU 0,34 BK 0,34

1 2 3 4
21 31
22 32

-S3
=AB1+S1/11.1
foot protection rear left
wheel housing right

-WS4
PUR LiF9YH-11YH
4x0,34 mm²
3 m
=AB1+S1/11.6

BN 0,34 WH 0,34 BU 0,34 BK 0,34

1 2 3 4
21 31
22 32

-S4
=AB1+S1/11.7
foot protection rear right
wheel housing right

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	foot protection	drawing number / page 1
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			plant = VNA2 / location + M2
change	date	name	revisor				
previous page =VNA1+M1/1		total pages 190	last editor I.Wund				last page 1 / continuation page =W1+S1/1

MESSER Cutting Systems

cable overview

P8GC_KBUE

cable type	Device tag	Condctrs	cross-section	Length variable	Length ready-made	Messer item No.:	function text	Cable description
ÖLFLEX FD CLASSIC 810	**=BA0-WX00**	3	2,5	25 m		571223		=AB1+S1/1
ÖLFLEX FD CLASSIC 810 CY	**=BA2+S41-WX41**	5	1,5	30 m		0571423		=AB1+S1/7
	=BA2+S41-WX42	5	1,5	30 m		0571423		=AB1+S1/7
Ölflex FD Classic 810 CY	**=BA2+S41-WX422**	5	1,5	30 m		0571423		=AB1+S1/7
PUR/PVC	**=BA4-WKNA**	4	0,34		1 m	77004462		=BA4+S1/1
	=BA6+M2-WSRL1	4	0,34		3 m	77003736		=AB1+S1/9
	=BA6+M2-WSRL2	4	0,34		3 m	77003736		=AB1+S1/9
Datenleitung	**=CA0+P1-WMG2**	4x2	0,14		3 m	77005783	MGuard	=AB1+S1/5
CAT5	**=CA0+P1-WNET**	4x2	0,14		10 m	77005811		=AB1+S1/5
SAIB-M23-19P-(S)-ST	**=CA0+P1-WX40**	16x+3x	0,5+1,0		10 m	77004829		=AB1+S1/5
PUR/PVC	**=CA0+P1-WX40M**	4	0,34		4 m	77070067		=AB1+S1/5
	=EM1+F1-M77070171-WXS3	3	0,25	1 m				=AB1+S1/8
	=EM1+F1-M77070171-WXS4	3	0,25	1 m				=AB1+S1/8
PUR/TPE	**=EM1+F1-WXS1**	5	0,34		10 m	77004910		=AB1+S1/8
ESUY Kupfer-Erdungsseil	**=FK1+F1-WPA**	1	35	6 m		77005938	polarity balance	=AB1+S1/6
Chainflex Hybrid TP	**=FK1+F1-WX1**	12x+4x	0,25+0,5		9 m	72291716		=AB1+S1/6
PUR/PVC	**=FK1+F1-WXS1**	5	0,34		10 m	77004903		=AB1+S1/6
Ölflex FD Classic 810 CY	**=FK1+F1-WXU**	3	1,5		9 m	72291723		=AB1+S1/6
ÖLFLEX FD CLASSIC 810 CY	**=HX1-WV1**	3	2,5					=HX1+S1/1
	=HX1-WV2	3	2,5					=HX1+S1/1
Ölflex FD Classic 810 CY	**=HX1-WXMR1**	3	1,5			0551076		=HX1+S1/1
	=HX1-WXMR2	3	1,5			0551076		=HX1+S1/1
PUR/PVC	**=HX1+M1-WB1**	4	0,34		1 m	77004462		=AB1+S1/4
	=HX1+M1-WB3	4	0,34		1 m	77004462		=AB1+S1/4
	=HX1+M1-WB5	4	0,34		1 m	77004462		=AB1+S1/4
Flexible Type	**=HX1+M1-WCN2**	3x2x	0,34		10 m	77005911		=AB1+S1/2
Yaskawa System	**=HX1+M1-WXM**	4	1,0		10 m	77005913		=AB1+S1/2
Ölflex FD Classic 810 CY	**=HX2-WXMR1**	3	1,5			0551076		=HX2+S1/1

cable overview

P8GC_KBUE

cable type	Device tag	Condctrs	cross-section	Length variable	Length ready-made	Messer item No.:	function text	Cable description
Ölflex FD Classic 810 CY	**=HX2-WXMR2**	3	1,5			0551076		=HX2+S1/1
Flexible Type	**=HX2+M2-WCN2**	3x2x	0,34		10 m	77005911		=AB1+S1/2
Yaskawa System	**=HX2+M2-WXM**	4	1,0		10 m	77005913		=AB1+S1/2
Ölflex FD Classic 810 CY	**=HY1-WXMR1**	3	1,5			0551076		=HY1+S1/1
	=HY1-WXMR2	3	1,5			0551076		=HY1+S1/1
Flexible Type	**=HY1+F1-WCN2**	3x2x	0,34		10 m	77005911		=AB1+S1/3
Yaskawa System	**=HY1+F1-WXM**	4	1,0		10 m	77005913		=AB1+S1/3
PUR/PVC	**=HY1+O1-WB2**	5	0,34		10 m	77004903		=AB1+S1/4
PUR/PVC LiF9YH11YH	**=HY1+O1-WB4**	5	0,34		10 m	77004903		=AB1+S1/4
	=HY1+O1-WB6	5	0,34		10 m	77004903		=AB1+S1/4
SFTP HIROSE/AMP/SUN/	**=IM1+S41-WBUS2**	4x2	0,14		30 m	77004661		=AB1+S1/7
UNITRONIC LiYCY	**=IM1+S41-WXRS**	8	0,25					=IM1+S41/4
	=IM1+S41-1X3M-WX90	18	0,5					=AB1+S1/7
	=IM1+S41-1X3M-WXRS	8	0,25					=AB1+S1/7
US Steuerleitung 22 AWG	**=IM1+I1-WHPR**	37	22		4,5 m	72423104	Plasma	=AB1+S1/7
Ölflex FD Classic 810 CY	**=IM1+I1-WREM**	3	1		4,5 m	72416403	Plasma	=AB1+S1/7
	=IM1+I1-WWST	3	1,5		4,5 m	72416401	Plasma	=AB1+S1/7
	=LD1+F1-WX1	3	0,5	12 m		77070094		=AB1+S1/1
	=MB1+A1-WS8	3	1			0551042		=AB1+S1/4
	=VA0+M1-WX1	16x+5x	0,34+0,75		10 m	77003999		=AB1+S1/4
PUR/PVC	**=VNA0+M2-WSNA**	4	0,34		3 m	77003736		=AB1+S1/9
PUR LiF9YH-11YH	**=VNA1+M1-WS1**	4	0,34		3 m	77005615		=AB1+S1/10
	=VNA1+M1-WS2	4	0,34		3 m	77005615		=AB1+S1/10
	=VNA1+M1-WS3	4	0,34		3 m	77005615		=AB1+S1/10
	=VNA1+M1-WS4	4	0,34		3 m	77005615		=AB1+S1/10
PUR/PVC	**=VNA1+M1-WVNA**	4	0,34		7,5 m	77003737		=AB1+S1/10
PUR LiF9YH-11YH	**=VNA2+M2-WS1**	4	0,34		3 m	77005615		=AB1+S1/11
	=VNA2+M2-WS2	4	0,34		3 m	77005615		=AB1+S1/11

cable overview

P8GC_KBUE

cable type	Device tag	Condctrs	cross-section	Length variable	Length ready-made	Messer item No.:	function text	Cable description
PUR LiF9YH-11YH	**=VNA2+M2-WS3**	4	0,34		3 m	77005615		=AB1+S1/11
	=VNA2+M2-WS4	4	0,34		3 m	77005615		=AB1+S1/11
PUR/PVC	**=VNA2+M2-WVNA**	4	0,34		1 m	77004462		=AB1+S1/11

Cable diagram


NG_KABPL

Messer item No.:

571223

=BA0+S1-WX00

cable type
ÖLFLEX FD CLASSIC 810

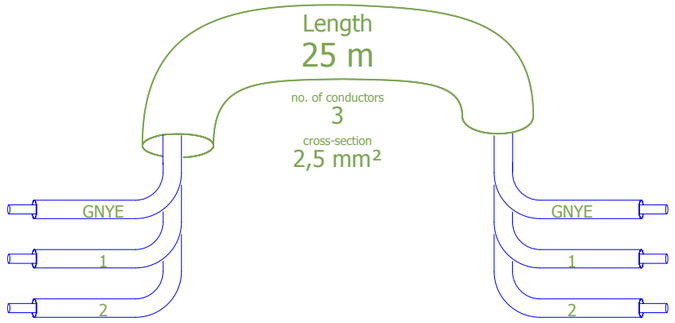

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.3	-X00:PE		+EXT-X:3	/1.3	=BA0+S1/1	
	/1.1	-X00:1		+EXT-X:1	/1.1	=BA0+S1/1	
	/1.2	-X00:4		+EXT-X:2	/1.2	=BA0+S1/1	

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	=W1/3	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =BA0+S1-WX00

drawing number		page	1
Function category	= W2	location	+ S1
last page	59	continuation page	2

Cable diagram


NG_KABPL

Messer item No.:

0571423

=BA2+S41-WX41

cable type
ÖLFLEX FD CLASSIC 810 CY

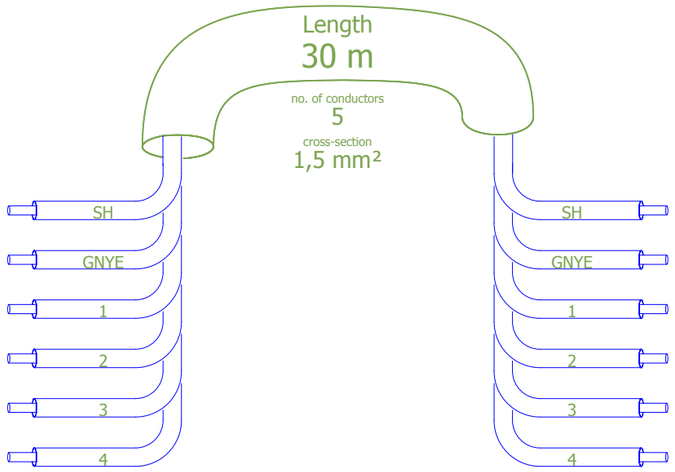

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	+S1/4.2	+S1-X41:PE		-X41:PE	/1.2	=BA2+S41/1	
	+S1/4.1	+S1-X41:1		-X41:1	/1.1	=BA2+S41/1	
	+S1/4.1	+S1-X41:2		-X41:3	/1.1	=BA2+S41/1	
	+S1/4.1	+S1-X41:3		-X41:4	/1.2	=BA2+S41/1	
	+S1/4.2	+S1-X41:4		-X41:2	/1.2	=BA2+S41/1	

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	Cable diagram =BA2+S41-WX41
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 1		total pages 190	last editor	I.Wund		

MESSER Cutting Systems

drawing number		page	2
Function category	= W2	location	+ S1
last page	59	continuation page	3

Cable diagram


NG_KABPL

Messer item No.:

0571423

=BA2+S41-WX42

cable type
ÖLFLEX FD CLASSIC 810 CY

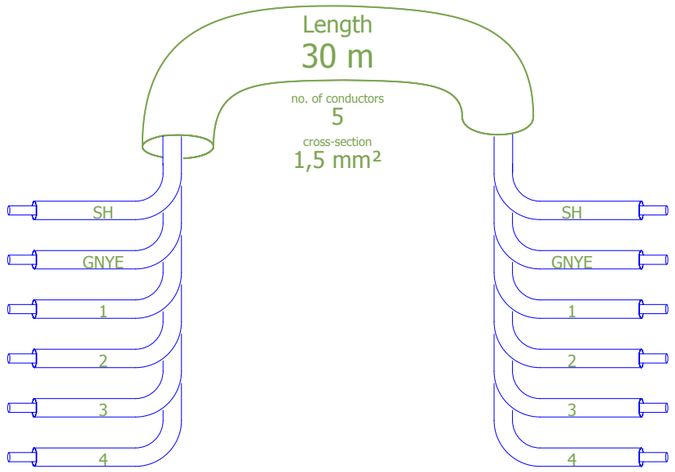

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	+S1/4.5	+S1-X42:PE		-X42:PE	/2.3	=BA2+S41/2	
	+S1/4.4	+S1-X42:1		-X42:1	/2.1	=BA2+S41/2	
	+S1/4.4	+S1-X42:2		-X42:3	/2.2	=BA2+S41/2	
	+S1/4.4	+S1-X42:3		-X42:2	/2.3	=BA2+S41/2	
	+S1/4.4	+S1-X42:4		-X42:4	/2.3	=BA2+S41/2	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	2	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =BA2+S41-WX42

drawing number		page	3
Function category	= W2	location	+ S1
last page	59	continuation page	4

Cable diagram


NG_KABPL

Messer item No.:

0571423

=BA2+S41-WX422

cable type
Ölflex FD Classic 810 CY

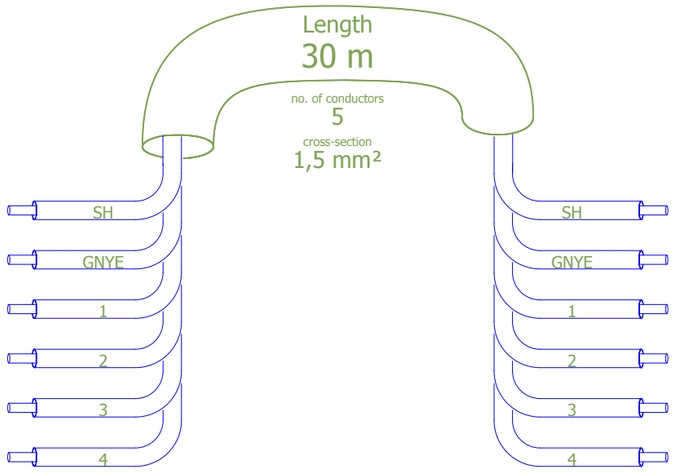

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	+S1/4.8	+S1-X422:PE	-X422:PE	/2.7	=BA2+S41/2	
	+S1/4.6	+S1-X422:1	-X422:1	/2.5	=BA2+S41/2	
	+S1/4.7	+S1-X422:2	-X422:3	/2.6	=BA2+S41/2	
	+S1/4.7	+S1-X422:3	-X422:2	/2.6	=BA2+S41/2	
	+S1/4.7	+S1-X422:4	-X422:4	/2.7	=BA2+S41/2	

P8 2.2.5

Cable diagram


NG_KABPL

Messer item No.:

77004462

=BA4+S1-WKNA

cable type
PUR/PVC

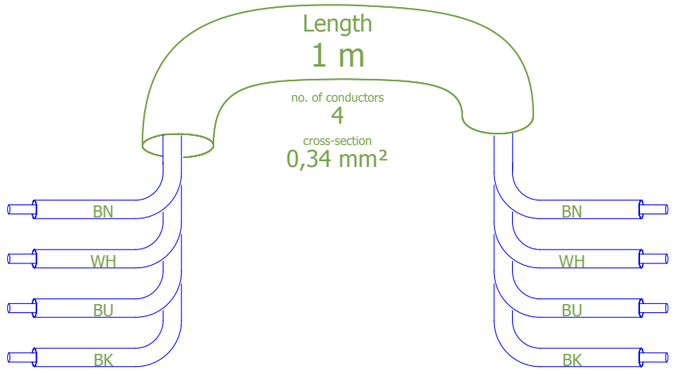

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.3	-SNA:1		-KNA:S11	/1.2	=BA4+S1/1	channel 1
	/1.3	-SNA:2		=BA3-K1:11	/1.2	=BA4+S1/1	watchdog
	/1.4	-SNA:3		-KNA:S21	/1.4	=BA4+S1/1	channel 2
	/1.4	-SNA:4		=BA3-K2:11	/1.4	=BA4+S1/1	watchdog

Cable diagram


NG_KABPL

Messer item No.:

77003736

=BA6+M2-WSRL1

cable type
PUR/PVC

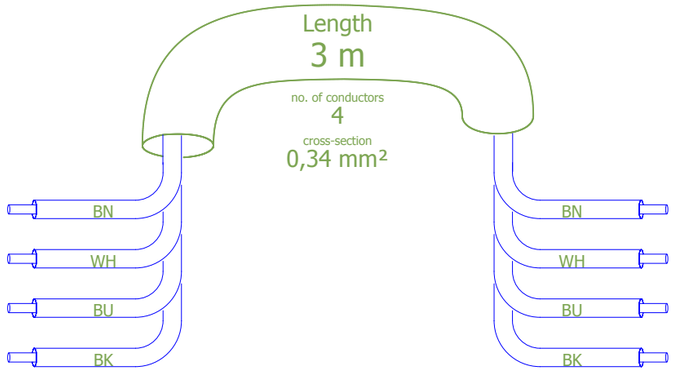

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VNA0/1.2	=VNA0-X1-P1:1	-SRL1:11	=VNA0/1.2	=VNA0+M2/1	
	=VNA0/1.2	=VNA0-X1-P1:2	-SRL1:12	=VNA0/1.2	=VNA0+M2/1	
	=VNA0/1.2	=VNA0-X1-P1:3	-SRL1:21	=VNA0/1.2	=VNA0+M2/1	
	=VNA0/1.2	=VNA0-X1-P1:4	-SRL1:22	=VNA0/1.2	=VNA0+M2/1	

P8 2.2.5

Cable diagram


NG_KABPL

Messer item No.:

77003736

=BA6+M2-WSRL2

cable type
PUR/PVC

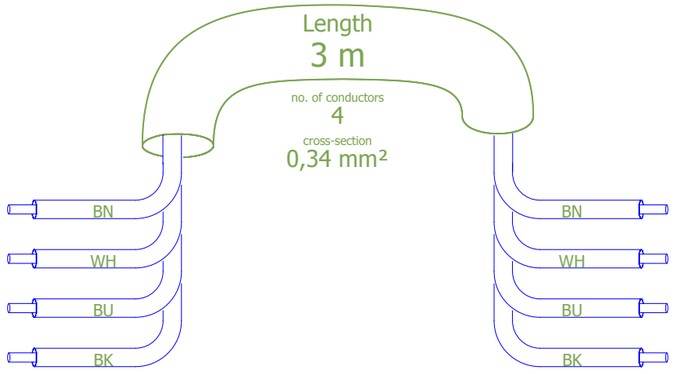

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VNA0/2.2	=VNA0-X1-P2:1	-SRL2:11	=VNA0/2.2	=VNA0+M2/2	
	=VNA0/2.2	=VNA0-X1-P2:2	-SRL2:12	=VNA0/2.2	=VNA0+M2/2	
	=VNA0/2.2	=VNA0-X1-P2:3	-SRL2:21	=VNA0/2.2	=VNA0+M2/2	
	=VNA0/2.2	=VNA0-X1-P2:4	-SRL2:22	=VNA0/2.2	=VNA0+M2/2	

Cable diagram

NG_KABPL

Messer item No.:

77005811

=CA0+P1-WNET

cable type
CAT5

Length
10 m

no. of conductors
4x2

cross-section
0,14 mm²

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref	function text
			SH		
			WH		
			BN		
			GN		
			YE		
			GY		
			PK		
			BU		
			RD		

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 7		total pages 190	last editor I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =CA0+P1-WNET

drawing number | page 8

Function category = W2 | location + S1

last page 59 | continuation page 9

Cable diagram

NG_KABPL

Messer item No.:


77004829

=CA0+P1-WX40

cable type
SAIB-M23-19P-(S)-ST

Length
10 m

no. of conductors
16x+3x
cross-section
0,5+1,0 mm²

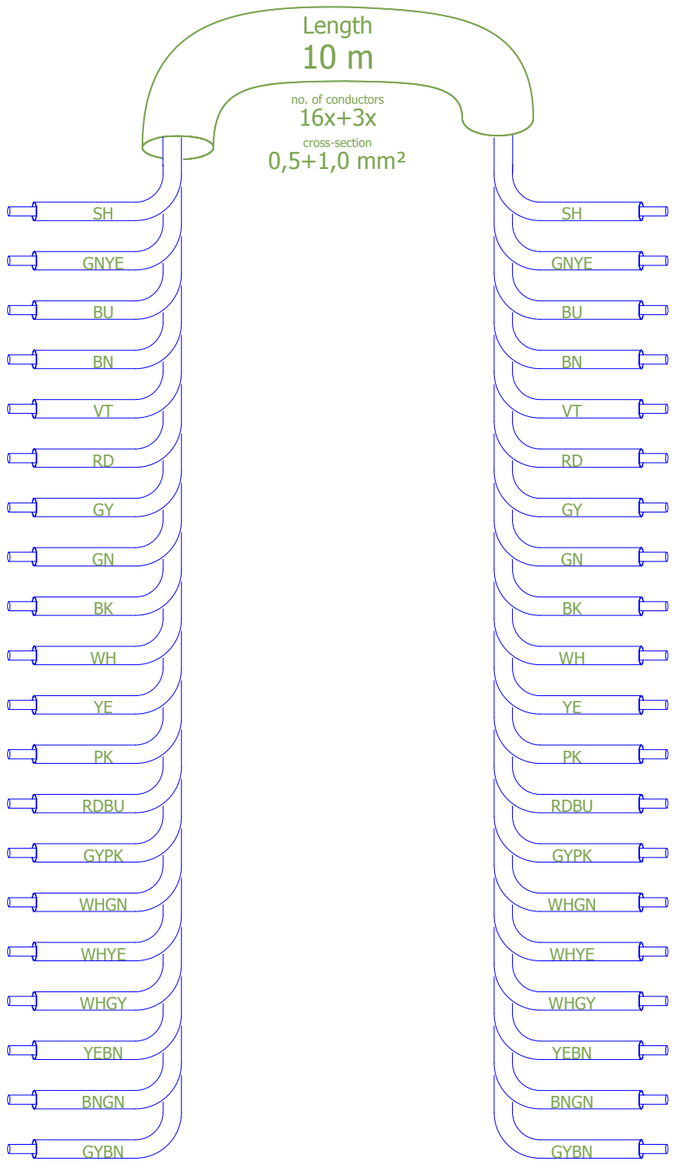

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=BA2+S1/3.9	=BA2+S1-X40:PE	SH	-X40:12	/1.9	=CA0+P1/1	
	=BA2+S1/3.1	=BA2+S1-X40:6	GNYE	-X40:6	/1.2	=CA0+P1/1	
	=BA2+S1/3.1	=BA2+S1-X40:19	BU	-X40:19	/1.2	=CA0+P1/1	
	=BA2+S1/3.1	=BA2+S1-X40:1	BN	-X40:1	/1.3	=CA0+P1/1	
	=BA2+S1/3.2	=BA2+S1-X40:2	VT	-X40:2	/1.3	=CA0+P1/1	
	=BA2+S1/3.1	=BA2+S1-X40:3	RD	-X40:3	/1.3	=CA0+P1/1	
	=BA2+S1/3.0	=BA2+S1-X40:5	GY	-X40:5	/1.7	=CA0+P1/1	
	=BA2+S1/3.2	=BA2+S1-X40:11	GN	-X40:11	/1.2	=CA0+P1/1	
	=BA2+S1/3.0	=BA2+S1-X40:15	BK	-X40:15	/1.7	=CA0+P1/1	
	=BA2+S1/3.8	=BA2+S1-X40:16	WH	-X40:16	/1.8	=CA0+P1/1	
	=BA2+S1/3.7	=BA2+S1-X40:17	YE	-X40:17	/1.5	=CA0+P1/1	
	=BA2+S1/3.1	=BA2+S1-X40:4	PK	-X40:4	/1.3	=CA0+P1/1	
	=BA2+S1/3.4	=BA2+S1-X40:7	RDBU	-X40:7	/1.6	=CA0+P1/1	
	=BA2+S1/3.2	=BA2+S1-X40:8	GYPK	-X40:8	/1.1	=CA0+P1/1	
	=BA2+S1/3.5	=BA2+S1-X40:9	WHGN	-X40:9	/1.5	=CA0+P1/1	
	=BA2+S1/3.6	=BA2+S1-X40:10	WHYE	-X40:10	/1.8	=CA0+P1/1	
	=BA2+S1/3.5	=BA2+S1-X40:13	WHGY	-X40:13	/1.4	=CA0+P1/1	
	=BA2+S1/3.5	=BA2+S1-X40:14	YEBN	-X40:14	/1.4	=CA0+P1/1	
	=BA2+S1/3.4	=BA2+S1-X40:18	BNGN	-X40:18	/1.7	=CA0+P1/1	
			GYBN				

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	8	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =CA0+P1-WX40

drawing number		page	9
Function category	= W2	location	+ S1
last page	59	continuation page	10

Cable diagram


NG_KABPL

Messer item No.:

77070067

=CA0+P1-WX40M

cable type
PUR/PVC

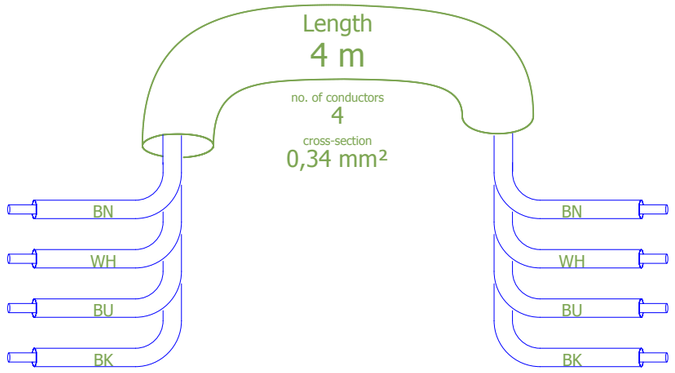

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/2.1	-XM1:1		=VA0+M1-X1-P7:2	=VA0+S1/1.8	=VA0+S1/1	
	/2.2	-XM1:3		=VA0+M1-X1-P7:3	=VA0+S1/1.8	=VA0+S1/1	

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	9	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =CA0+P1-WX40M

drawing number		page	10
Function category	= W2	location	+ S1
last page	59	continuation page	11


Cable diagram

NG_KABPL

Messer item No.:

=EM1+F1-M77070171-WXS3

cable type

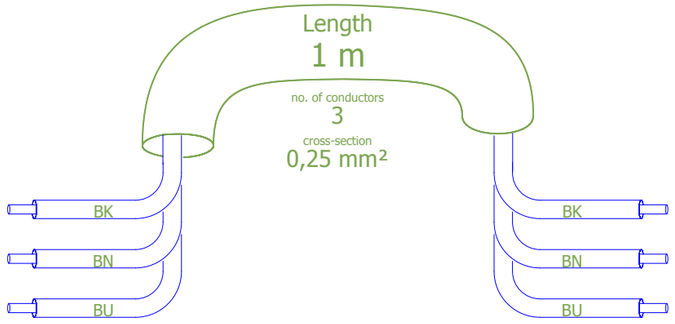

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.4	-M77070171-XS3:4		-M77070171-XS2:4	/1.5	=EM1+F1/1	
	/1.2	-M77070171-XS3:1		-M77070171-XS2:1	/1.4	=EM1+F1/1	
	/1.3	-M77070171-XS3:3		-M77070171-XS2:3	/1.4	=EM1+F1/1	

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	10	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =EM1+F1-M77070171-WXS3

drawing number		page	11
Function category	= W2	location	+ S1
last page	59	continuation page	12


Cable diagram

NG_KABPL

Messer item No.:

=EM1+F1-M77070171-WXS4

cable type

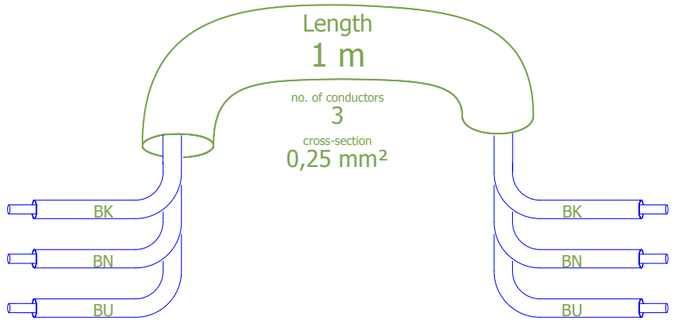

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.5	-M77070171-XS2:2		-M77070171-XS4:4	/1.7	=EM1+F1/1	
	/1.4	-M77070171-XS2:1		-M77070171-XS4:1	/1.5	=EM1+F1/1	
	/1.4	-M77070171-XS2:3		-M77070171-XS4:3	/1.6	=EM1+F1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	11	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =EM1+F1-M77070171-WXS4

drawing number		page	12
Function category	= W2	location	+ S1
last page	59	continuation page	13

Cable diagram


NG_KABPL

Messer item No.:

77004910

=EM1+F1-WXS1

cable type
PUR/TPE

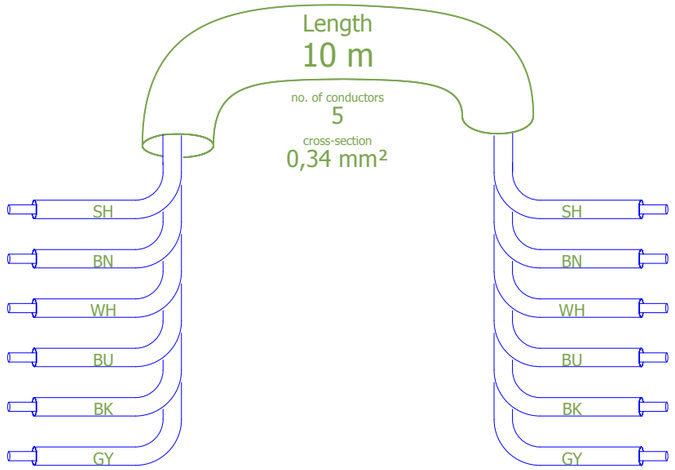

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/8.5	-WXS1		SH	/1.6	=EM1+F1/1	
DC 24 V	/1.3	=BA1+S1-XP24:5.4		-XS1:1	/1.4	=EM1+F1/1	
torch touch enable	/1.6	=CA2+S1-C311:1		-XS1:2	/1.5	=EM1+F1/1	
DC 0 V	/1.4	=BA2+S1-XL0:11.4		-XS1:3	/1.4	=EM1+F1/1	
torch touch	/1.5	=CA2+S1-C302:1		-XS1:4	/1.5	=EM1+F1/1	

Cable diagram

NG_KABPL

Messer item No.:


77005938

polarity balance

=FK1+F1-WPA

cable type

ESUY Kupfer-Erdungsseil

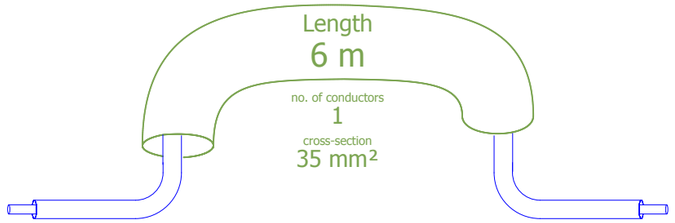

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref	function text

Cable diagram

NG_KABPL

Messer item No.:

72291716


=FK1+F1-WX1

cable type
Chainflex Hybrid TP

Length
9 m

no. of conductors
12x+4x

cross-section
0,25+0,5 mm²

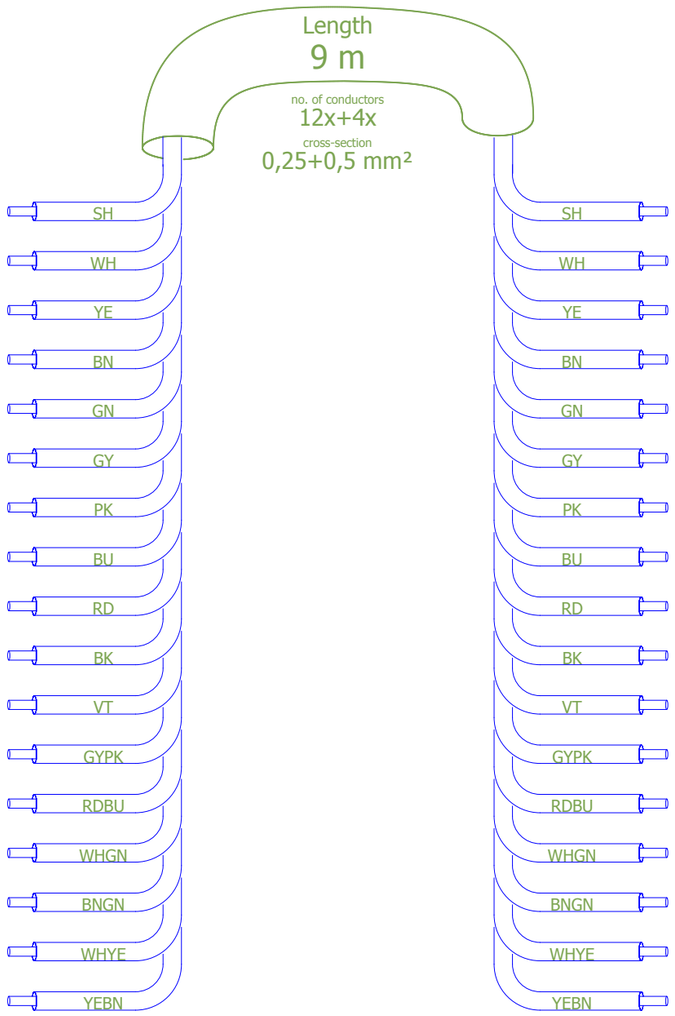

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
DC 0 V	/1.5	-MOT-X1:1	=BA2+S1-XL0:3.3	+S1/4.2	=FK1+S1/4	
N24VAC	/1.6	-MOT-X1:11	=BA2+S1-XL0:4.2	+S1/4.2	=FK1+S1/4	
DC 24 V	/1.5	-MOT-X1:7	=BA2+S1-F5:2	=BA2+S1/1.1	=BA2+S1/1	fuse
ignitor on	/1.6	-MOT-X1:16	=FH1+S1-XZ11:1.1	+S1/3.1	=FK1+S1/3	
nominal value	/1.7	-MOT-X1:3	=CA2+S1-C391:1	+S1/2.1	=FK1+S1/2	analog OUT
analog signal ground	/1.7	-MOT-X1:8	=CA2+S1-C391:2	+S1/2.1	=FK1+S1/2	
ignition valve	/1.6	-MOT-X1:10	=FH1+S1-XZ21:1.1	+S1/3.4	=FK1+S1/3	
auto hight	/1.7	-MOT-X1:4	=CA2+S1-C111:2	+S1/1.5	=FK1+S1/1	auto hight
height found	/1.8	-MOT-X1:6	=CA2+S1-C112:1	+S1/1.1	=FK1+S1/1	height found
down	/1.8	-MOT-X1:5	=CA2+S1-C111:5	+S1/1.4	=FK1+S1/1	down
creep speed	/1.6	-MOT-X1:2	+S1-XVH:1.1	+S1/4.7	=FK1+S1/4	
collision	/1.8	-MOT-X1:12	=CA2+S1-C112:2	+S1/1.3	=FK1+S1/1	collision
set height	/1.8	-MOT-X1:13	=CA2+S1-C111:6	+S1/1.6	=FK1+S1/1	set height
switch over set value	/1.7	-MOT-X1:14	=BA2+S1-F5:2	=BA2+S1/1.1	=BA2+S1/1	fuse
up	/1.9	-MOT-X1:15	=CA2+S1-C111:1	+S1/1.4	=FK1+S1/1	up
upper limit	/1.8	-MOT-X1:9	=CA2+S1-C112:5	+S1/1.2	=FK1+S1/1	upper limit

Cable diagram


NG_KABPL

Messer item No.:

77004903

=FK1+F1-WXS1

cable type
PUR/PVC

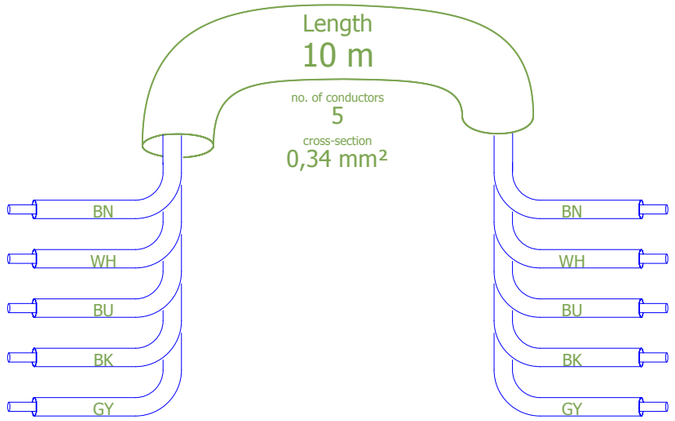

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	+S1/2.2	=BA1+S1-XP24:4.3	-XS1:1	+S1/2.2	=FK1+S1/2	
height found	+S1/2.3	=CA2+S1-C302:5	-XS1:2	+S1/2.3	=FK1+S1/2	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	15	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =FK1+F1-WXS1

drawing number		page	16
Function category	= W2	location	+ S1
last page	59	continuation page	17

Cable diagram


NG_KABPL

Messer item No.:

72291723

=FK1+F1-WXU

cable type
Ölflex FD Classic 810 CY

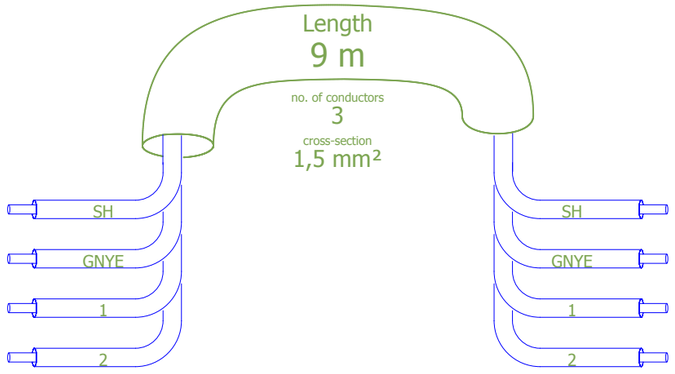

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=BA1+S1/2.3	=BA1+S1-XT:PE		-XU:PE	/2.2	=FK1+F1/2	
	=BA1+S1/2.1	=BA1+S1-XT:1		-XU:1	/2.1	=FK1+F1/2	
	=BA1+S1/2.2	=BA1+S1-XT:2		-XU:3	/2.2	=FK1+F1/2	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	16	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =FK1+F1-WXU

drawing number		page	17
Function category	= W2	location	+ S1
last page	59	continuation page	18


Cable diagram

NG_KABPL

Messer item No.:

=HX1+S1-WV1

cable type
ÖLFLEX FD CLASSIC 810 CY

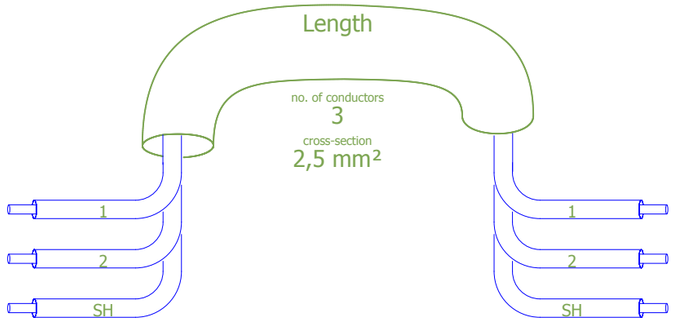

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.2	-XMR:3:1		-V1:I1	/1.2	=HX1+S1/1	
	/1.3	-XMR:4:1		-V1:I2	/1.2	=HX1+S1/1	
	/1.3	-WV1:SH		SH	/1.3	=HX1+S1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	17	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX1+S1-WV1

drawing number		page	18
Function category	= W2	location	+ S1
last page	59	continuation page	19


Cable diagram

NG_KABPL

Messer item No.:

=HX1+S1-WV2

cable type
ÖLFLEX FD CLASSIC 810 CY

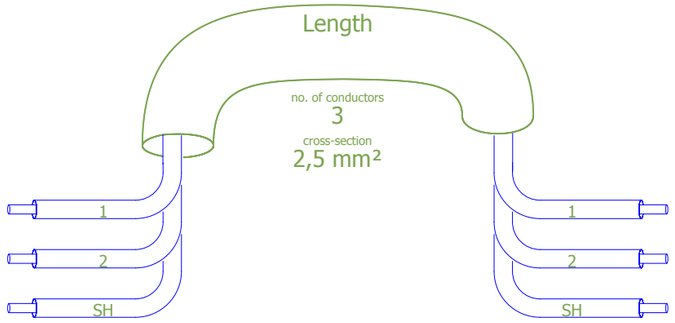

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.6	-XMR:1:1	-V2:I1	/1.6	=HX1+S1/1	
	/1.7	-XMR:2:1	-V2:I2	/1.6	=HX1+S1/1	
	/1.7	-WV2:SH	SH	/1.7	=HX1+S1/1	

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 18		total pages 190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX1+S1-WV2

drawing number		page	19
Function category	= W2	location	+ S1
last page 59		continuation page	20

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HX1+S1-WXMR1

cable type
Ölflex FD Classic 810 CY

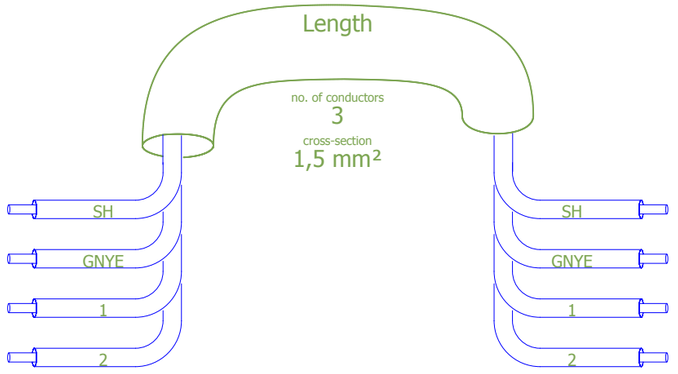

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.3	-A1:SH		-WXMR1:SH	/1.3	=HX1+S1/1	
	/1.3	-A1:L1		-XMR:3:2	/1.2	=HX1+S1/1	
	/1.3	-A1:L2		-XMR:4:2	/1.3	=HX1+S1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	19	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX1+S1-WXMR1

drawing number		page	20
Function category	= W2	location	+ S1
last page	59	continuation page	21

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HX1+S1-WXMR2

cable type
Ölflex FD Classic 810 CY

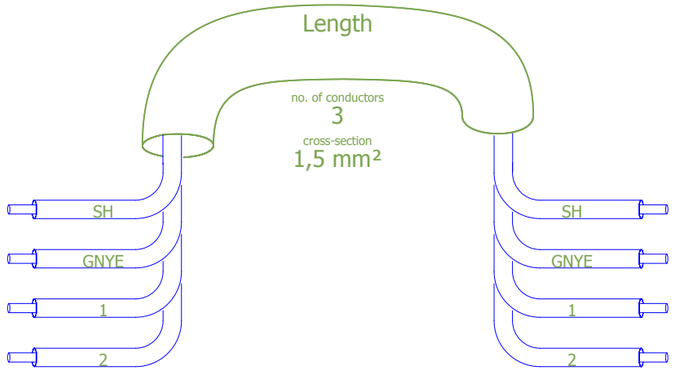

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.7	-A1:SH		-WXMR2:SH	/1.7	=HX1+S1/1	
	/1.6	-A1:L1C		-XMR:1:2	/1.6	=HX1+S1/1	
	/1.7	-A1:L2C		-XMR:2:2	/1.7	=HX1+S1/1	

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	20	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX1+S1-WXMR2

drawing number		page	21
Function category	= W2	location	+ S1
last page	59	continuation page	22

Cable diagram


NG_KABPL

Messer item No.:

77004462

=HX1+M1-WB1

cable type
PUR/PVC

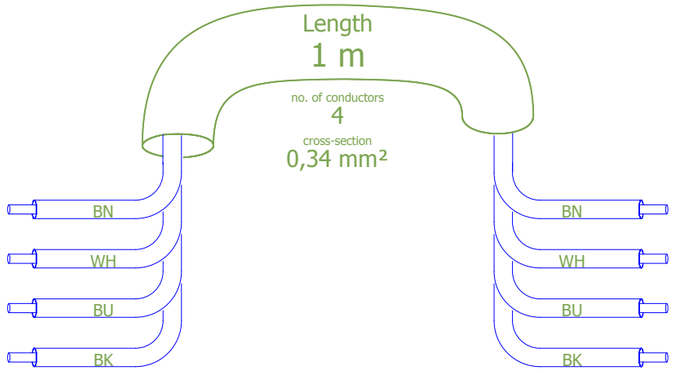

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref	function text
	=VA0+S1/1.2	=VA0-X1-P1:1	-B1	=VA0+S1/1.2 =VA0+S1/1	
	=VA0+S1/1.2	=VA0-X1-P1:2	-B1	=VA0+S1/1.2 =VA0+S1/1	
	=VA0+S1/1.2	=VA0-X1-P1:3	-B1	=VA0+S1/1.2 =VA0+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

77004462

=HX1+M1-WB3

cable type
PUR/PVC

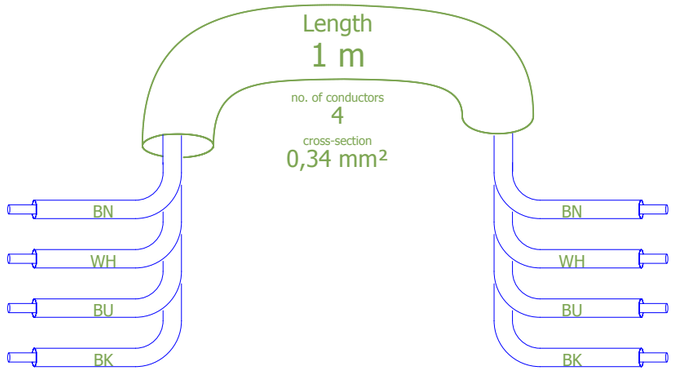

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VA0+S1/1.4	=VA0-X1-P3:1	-B3	=VA0+S1/1.4	=VA0+S1/1	
	=VA0+S1/1.4	=VA0-X1-P3:2	-B3	=VA0+S1/1.4	=VA0+S1/1	
	=VA0+S1/1.4	=VA0-X1-P3:3	-B3	=VA0+S1/1.4	=VA0+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

77004462

=HX1+M1-WB5

cable type
PUR/PVC

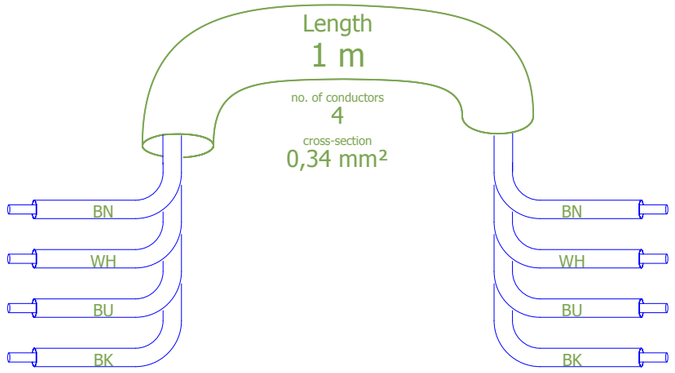

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VA0+S1/1.6	=VA0-X1-P5:1	-B5	=VA0+S1/1.6	=VA0+S1/1	
	=VA0+S1/1.6	=VA0-X1-P5:2	-B5	=VA0+S1/1.6	=VA0+S1/1	
	=VA0+S1/1.6	=VA0-X1-P5:3	-B5	=VA0+S1/1.6	=VA0+S1/1	

Cable diagram

NG_KABPL

Messer item No.:

77005911


=HX1+M1-WCN2

cable type
Flexible Type

Length
10 m

no. of conductors
3x2x

cross-section
0,34 mm²

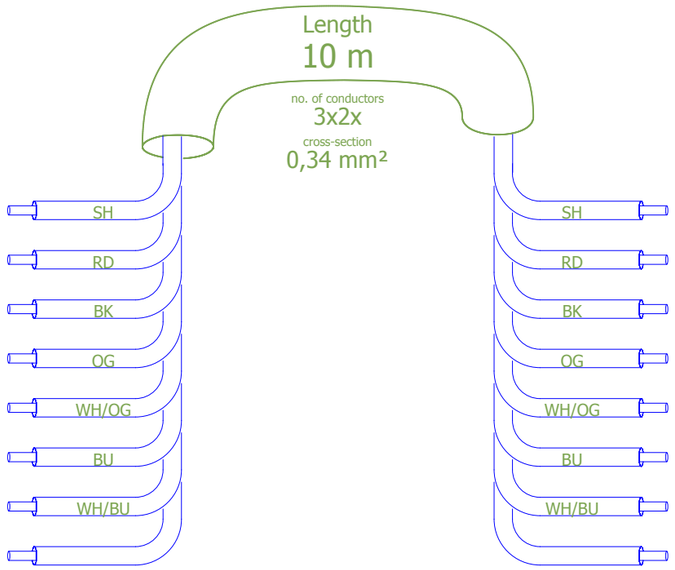

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
5VDC	+S1/1.4	+S1-CN2:1		-CN2:6	+S1/1.4	=HX1+S1/1	5VDC
0VDC	+S1/1.4	+S1-CN2:2		-CN2:3	+S1/1.4	=HX1+S1/1	0VDC
BAT(+)	+S1/1.4	+S1-CN2:3		-CN2:9	+S1/1.4	=HX1+S1/1	
BAT(-)	+S1/1.5	+S1-CN2:4		-CN2:8	+S1/1.5	=HX1+S1/1	
PS	+S1/1.5	+S1-CN2:5		-CN2:4	+S1/1.5	=HX1+S1/1	PS
/PS	+S1/1.5	+S1-CN2:6		-CN2:5	+S1/1.5	=HX1+S1/1	/PS
	=AB1+S1/2.3	-WCN2		SH	+S1/1.5	=HX1+S1/1	

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 24		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX1+M1-WCN2

drawing number		page	25
Function category	= W2	location	+ S1
last page 59		continuation page	26

Cable diagram

NG_KABPL

Messer item No.:

77005913


=HX1+M1-WXM

cable type
Yaskawa System

Length
10 m

no. of conductors
4

cross-section
1,0 mm²

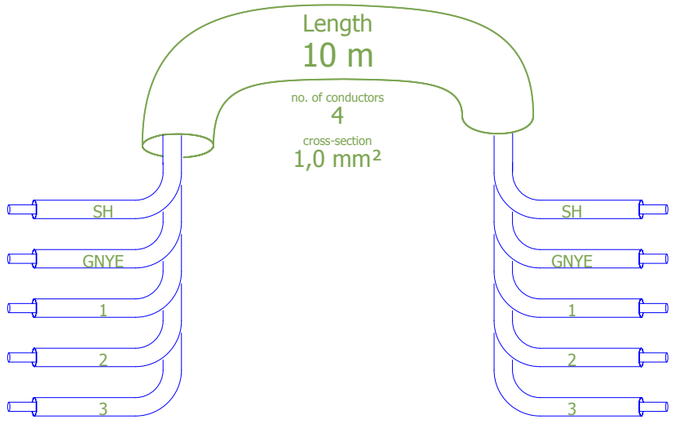

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/2.2	-WXM:SH		SH	+S1/1.2	=HX1+S1/1	
	+S1/1.2	+S1-A1		-XM:1	+S1/1.2	=HX1+S1/1	
	+S1/1.2	+S1-XM:W		-XM:2	+S1/1.2	=HX1+S1/1	
	+S1/1.2	+S1-XM:V		-XM:3	+S1/1.2	=HX1+S1/1	
	+S1/1.1	+S1-XM:U		-XM:4	+S1/1.1	=HX1+S1/1	

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	Cable diagram =HX1+M1-WXM	drawing number
			editor	INGO.WUNDERLE			page 26
001	10.02.2014	Wun	printout	10.02.2014			Function category = W2 location + S1
change	date	name	revisor				last page 59 continuation page 27
previous page 25		total pages 190	last editor	I.Wund			

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HX2+S1-WXMR1

cable type
Ölflex FD Classic 810 CY

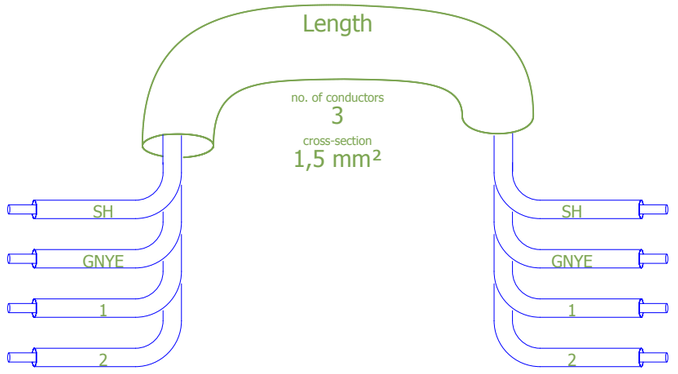

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.3	-WXMR1:SH	-A1:SH	/1.3	=HX2+S1/1	
	=HX1/1.2	=HX1-XMR:3:3	-A1:L1	/1.3	=HX2+S1/1	
	=HX1/1.3	=HX1-XMR:4:3	-A1:L2	/1.3	=HX2+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HX2+S1-WXMR2

cable type
Ölflex FD Classic 810 CY

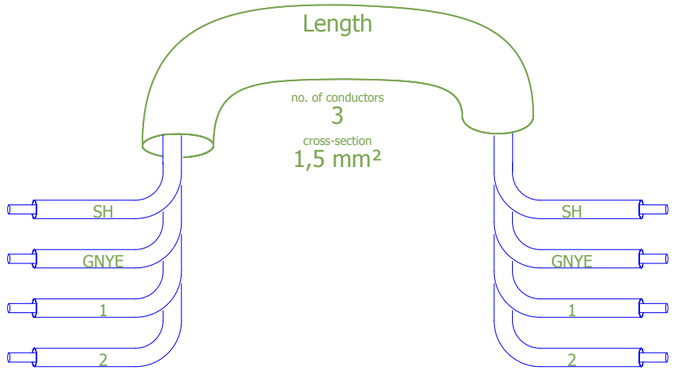

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.7	-WXMR2:SH	-A1:SH	/1.7	=HX2+S1/1	
	=HX1/1.6	=HX1-XMR:1:3	-A1:L1C	/1.6	=HX2+S1/1	
	=HX1/1.7	=HX1-XMR:2:3	-A1:L2C	/1.7	=HX2+S1/1	

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	27	total pages 190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX2+S1-WXMR2

drawing number		page	28
Function category	= W2	location	+ S1
last page	59	continuation page	29

Cable diagram


NG_KABPL

Messer item No.:

77005911

=HX2+M2-WCN2

cable type
Flexible Type

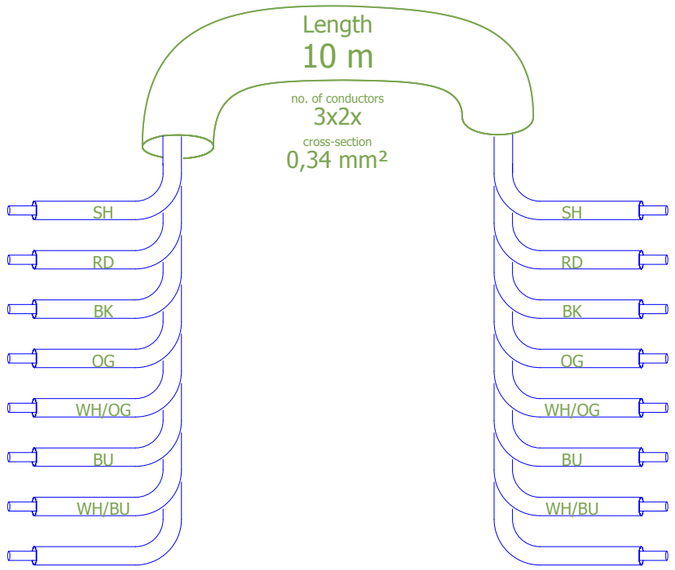

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
5VDC	+S1/1.4	+S1-CN2:1		-CN2:6	+S1/1.4	=HX2+S1/1	5VDC
0VDC	+S1/1.4	+S1-CN2:2		-CN2:3	+S1/1.4	=HX2+S1/1	0VDC
BAT(+)	+S1/1.4	+S1-CN2:3		-CN2:9	+S1/1.4	=HX2+S1/1	
BAT(-)	+S1/1.5	+S1-CN2:4		-CN2:8	+S1/1.5	=HX2+S1/1	
PS	+S1/1.5	+S1-CN2:5		-CN2:4	+S1/1.5	=HX2+S1/1	PS
/PS	+S1/1.5	+S1-CN2:6		-CN2:5	+S1/1.5	=HX2+S1/1	/PS
	=AB1+S1/2.7	-WCN2		SH	+S1/1.5	=HX2+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

77005913

=HX2+M2-WXM

cable type
Yaskawa System

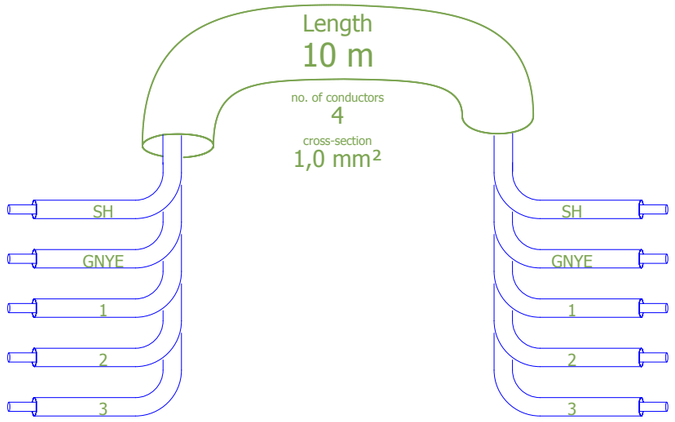

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/2.6	-WXM:SH		SH	+S1/1.2	=HX2+S1/1	
	+S1/1.2	+S1-A1		-XM:1	+S1/1.2	=HX2+S1/1	
	+S1/1.2	+S1-XM:W		-XM:2	+S1/1.2	=HX2+S1/1	
	+S1/1.2	+S1-XM:V		-XM:3	+S1/1.2	=HX2+S1/1	
	+S1/1.1	+S1-XM:U		-XM:4	+S1/1.1	=HX2+S1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	29	total pages 190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HX2+M2-WXM

drawing number		page	30
Function category	= W2	location	+ S1
last page	59	continuation page	31

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HY1+S1-WXMR1

cable type
Ölflex FD Classic 810 CY

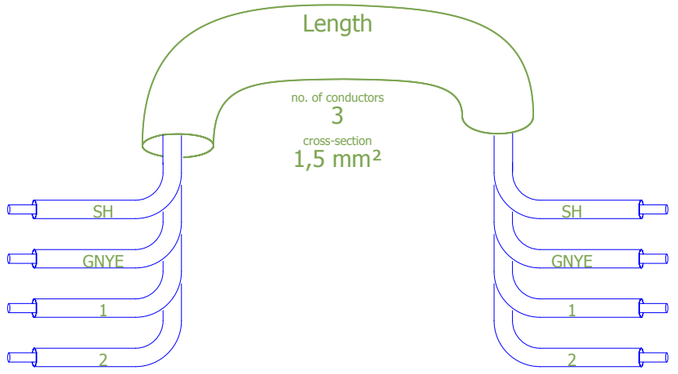

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.3	-WXMR1:SH	-A1:SH	/1.3	=HY1+S1/1	
	=HX1/1.2	=HX1-XMR:3:4	-A1:L1	/1.3	=HY1+S1/1	
	=HX1/1.3	=HX1-XMR:4:4	-A1:L2	/1.3	=HY1+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

0551076

=HY1+S1-WXMR2

cable type
Ölflex FD Classic 810 CY

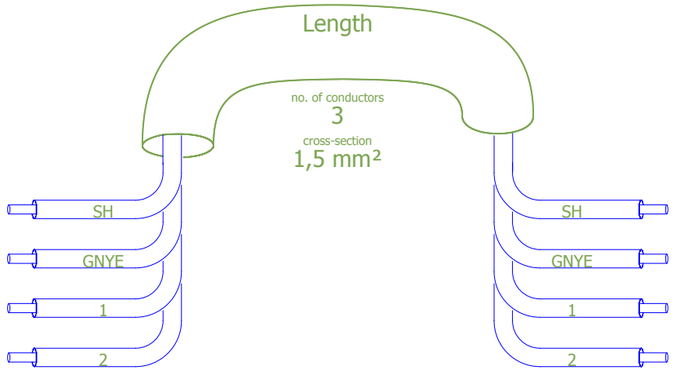

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.7	-WXMR2:SH	-A1:SH	/1.7	=HY1+S1/1	
	=HX1/1.6	=HX1-XMR:1:4	-A1:L1C	/1.6	=HY1+S1/1	
	=HX1/1.7	=HX1-XMR:2:4	-A1:L2C	/1.7	=HY1+S1/1	

Cable diagram

NG_KABPL

Messer item No.:

77005911


=HY1+F1-WCN2

cable type
Flexible Type

Length
10 m

no. of conductors
3x2x

cross-section
0,34 mm²

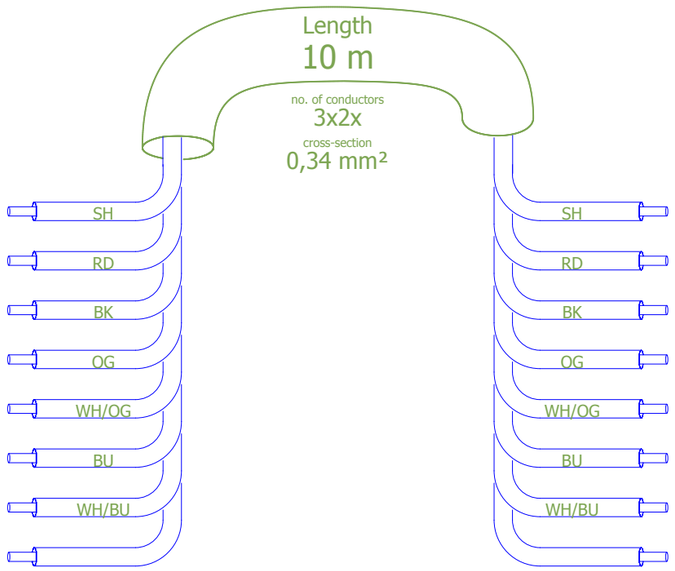

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
5VDC	+S1/1.4	+S1-CN2:1		-CN2:6	+S1/1.4	=HY1+S1/1	5VDC
0VDC	+S1/1.4	+S1-CN2:2		-CN2:3	+S1/1.4	=HY1+S1/1	0VDC
BAT(+)	+S1/1.4	+S1-CN2:3		-CN2:9	+S1/1.4	=HY1+S1/1	
BAT(-)	+S1/1.5	+S1-CN2:4		-CN2:8	+S1/1.5	=HY1+S1/1	
PS	+S1/1.5	+S1-CN2:5		-CN2:4	+S1/1.5	=HY1+S1/1	PS
/PS	+S1/1.5	+S1-CN2:6		-CN2:5	+S1/1.5	=HY1+S1/1	/PS
	=AB1+S1/3.3	-WCN2		SH	+S1/1.5	=HY1+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

77005913

=HY1+F1-WXM

cable type
Yaskawa System

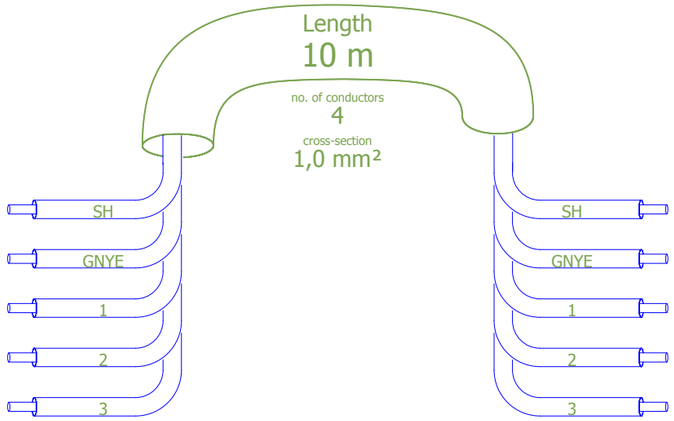

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/3.2	-WXM:SH		SH	+S1/1.2	=HY1+S1/1	
	+S1/1.2	+S1-A1		-XM:1	+S1/1.2	=HY1+S1/1	
	+S1/1.2	+S1-XM:W		-XM:2	+S1/1.2	=HY1+S1/1	
	+S1/1.2	+S1-XM:V		-XM:3	+S1/1.2	=HY1+S1/1	
	+S1/1.1	+S1-XM:U		-XM:4	+S1/1.1	=HY1+S1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	33	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HY1+F1-WXM

drawing number		page	34
Function category	= W2	location	+ S1
last page	59	continuation page	35

Cable diagram


NG_KABPL

Messer item No.:

77004903

=HY1+O1-WB2

cable type
PUR/PVC

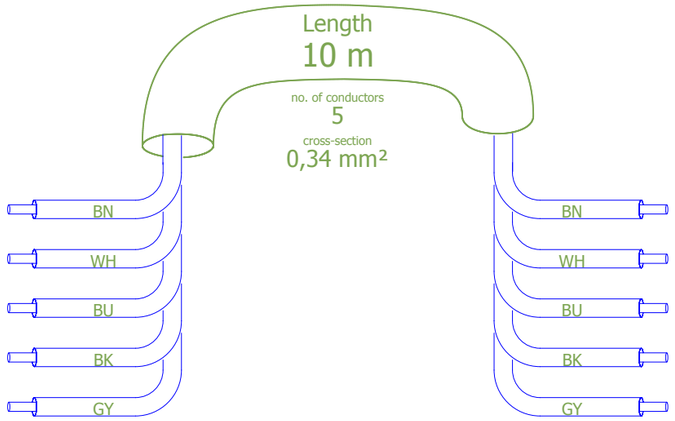

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VA0+S1/2.2	=VA0+M1-X1-P2:1	-B2	=VA0+S1/2.2	=VA0+S1/2	
	=VA0+S1/2.2	=VA0+M1-X1-P2:2	-B2	=VA0+S1/2.2	=VA0+S1/2	
	=VA0+S1/2.2	=VA0+M1-X1-P2:3	-B2	=VA0+S1/2.2	=VA0+S1/2	

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	34	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =HY1+O1-WB2

drawing number		page	35
Function category	= W2	location	+ S1
last page	59	continuation page	36

Cable diagram


NG_KABPL

Messer item No.:

77004903

=HY1+O1-WB4

cable type
PUR/PVC LiF9YH11YH

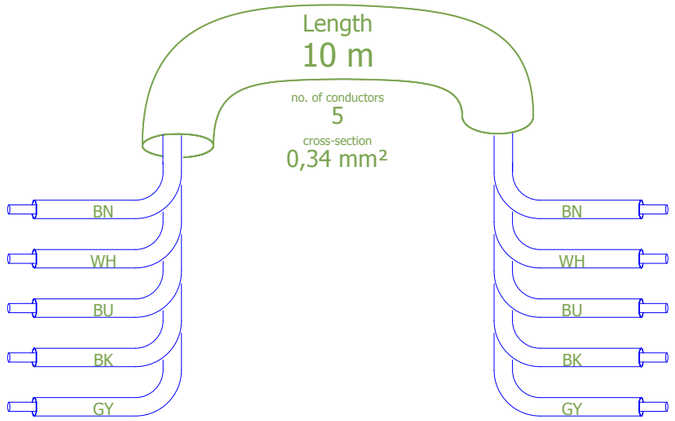

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VA0+S1/2.4	=VA0+M1-X1-P4:1	-B4	=VA0+S1/2.4	=VA0+S1/2	
	=VA0+S1/2.4	=VA0+M1-X1-P4:2	-B4	=VA0+S1/2.4	=VA0+S1/2	
	=VA0+S1/2.4	=VA0+M1-X1-P4:3	-B4	=VA0+S1/2.4	=VA0+S1/2	

Cable diagram

NG_KABPL

Messer item No.:

77004903


=HY1+O1-WB6

cable type
PUR/PVC LiF9YH11YH

Length
10 m

no. of conductors
5

cross-section
0,34 mm²

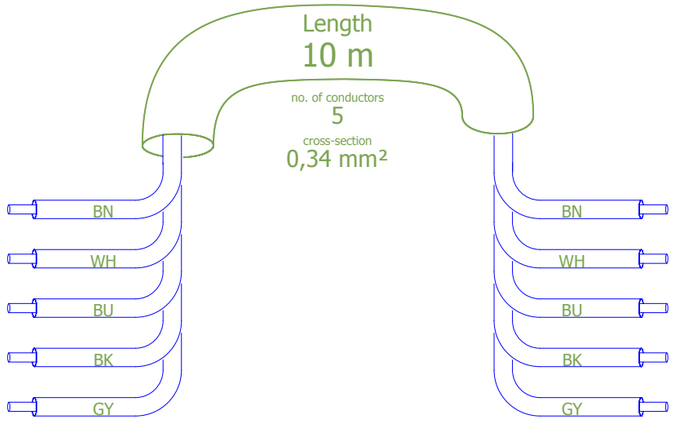

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	=VA0+S1/2.6	=VA0+M1-X1-P6:1	-B6	=VA0+S1/2.6	=VA0+S1/2	
	=VA0+S1/2.6	=VA0+M1-X1-P6:2	-B6	=VA0+S1/2.6	=VA0+S1/2	
	=VA0+S1/2.6	=VA0+M1-X1-P6:3	-B6	=VA0+S1/2.6	=VA0+S1/2	

Cable diagram

NG_KABPL

Messer item No.:

77004661

=IM1+S41-WBUS2


cable type
SFTP HIROSE/AMP/SUN/

Length
30 m

no. of conductors
4x2

cross-section
0,14 mm²

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref	function text
			SH		
			WH		
			BN		
			GN		
			YE		
			GY		
			PK		
			BU		
			RD		

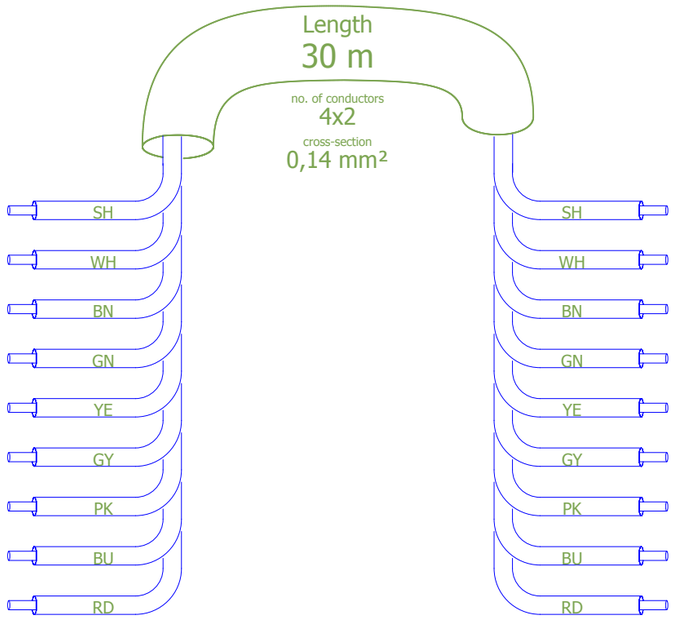

Cable diagram

NG_KABPL

Messer item No.:


=IM1+S41-WXRS

cable type
UNITRONIC LiYCY

Length

no. of conductors
8

cross-section
0,25 mm²

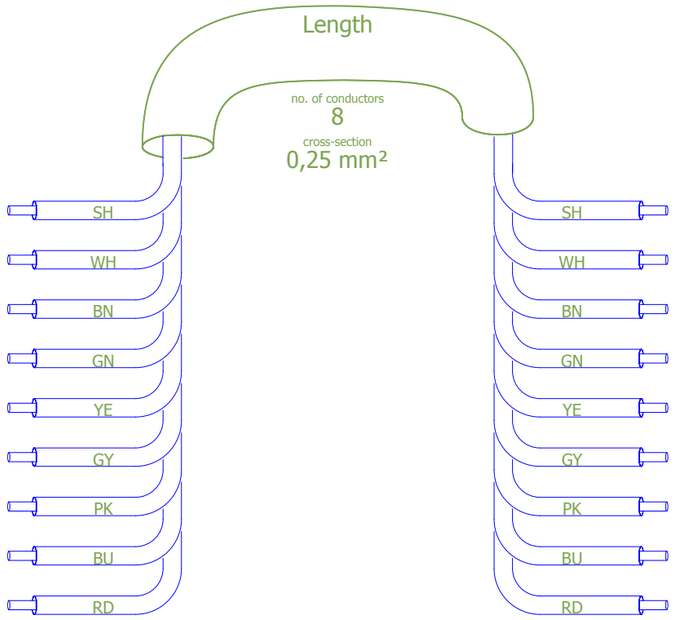

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	+I1/1.5	-1X3:20		=CA41-C416:1	/4.1	=IM1+S41/4	Serial Interface
	+I1/1.5	-1X3:1		=CA41-C416:5	/4.2	=IM1+S41/4	Serial Interface
	+I1/1.5	-1X3:21		=CA41-C416:2	/4.1	=IM1+S41/4	
	+I1/1.5	-1X3:2		=CA41-C416:6	/4.3	=IM1+S41/4	
	+I1/1.6	-1X3:3		=CA41-C416:3	/4.2	=IM1+S41/4	GND

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	38	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =IM1+S41-WXRS

drawing number		page	39
Function category	= W2	location	+ S1
last page	59	continuation page	40

Cable diagram

NG_KABPL

Messer item No.:

=IM1+S41-1X3M-WX90


cable type
UNITRONIC LiYCY

Length

no. of conductors
18

cross-section
0,5 mm²

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/7.2	-1X3M-WX90:SH	SH	SH	+I1/1.5	=IM1+I1/1	
	+I1/1.1	-1X3:4	WH	-L3	/1.1	=IM1+S41/1	
	+I1/1.1	-1X3:23	BN	-L3	/1.0	=IM1+S41/1	
	+I1/1.1	-1X3:7	GN	=CA41-C401:5	/1.2	=IM1+S41/1	plasma ready
	+I1/1.2	-1X3:26	YE	-L3:1	/1.0	=IM1+S41/1	
	+I1/1.3	-1X3:13	GY	=CA41-C405:5	/3.3	=IM1+S41/3	piercing
	+I1/1.4	-1X3:32	PK	=CA41-C405:6	/3.3	=IM1+S41/3	
	+I1/1.2	-1X3:15	BU	=CA41-C402:2	/1.3	=IM1+S41/1	no
	+I1/1.2	-1X3:34	RD	=CA41-C402:1	/1.2	=IM1+S41/1	plasma start
	+I1/1.4	-1X3:12	BK	=CA41-C405:2	/3.2	=IM1+S41/3	edge
	+I1/1.4	-1X3:31	VT	=CA41-C405:1	/3.2	=IM1+S41/3	
	+I1/1.3	-1X3:14	GYPK	=CA41-C402:5	/1.3	=IM1+S41/1	plasma hold
	+I1/1.3	-1X3:33	RDBU	=CA41-C402:6	/1.4	=IM1+S41/1	no

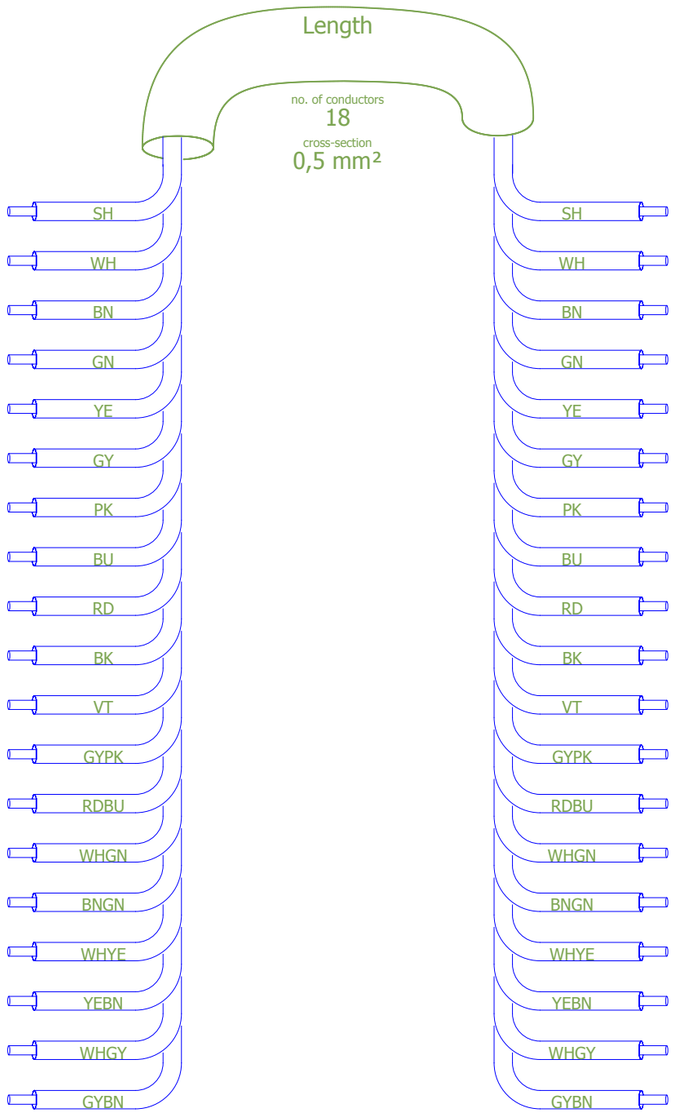

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 39		total pages 190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =IM1+S41-1X3M-WX90

drawing number		page	40
Function category	= W2	location	+ S1
last page 59		continuation page	41

Cable diagram

NG_KABPL

Messer item No.:

=IM1+S41-1X3M-WXRS

cable type
UNITRONIC LiYCY

Length

no. of conductors
8
cross-section
0,25 mm²

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=AB1+S1/7.3	-1X3M-WXRS:SH	SH	SH	+I1/1.6	=IM1+I1/1	
			WH	WH			
			BN	BN			
			GN	GN			
			YE	YE			
			GY	GY			
			PK	PK			
			BU	BU			
			RD	RD			

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	Cable diagram =IM1+S41-1X3M-WXRS
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page 40		total pages 190	last editor	I.Wund		

MESSER Cutting Systems

drawing number		page	41
Function category	= W2	location	+ S1
last page 59		continuation page	42

Cable diagram

NG_KABPL

Messer item No.:

72423104

Plasma


=IM1+I1-WHPR

cable type
US Steuerleitung 22 AWG

Length
4,5 m

no. of conductors
37

cross-section
22 AWG

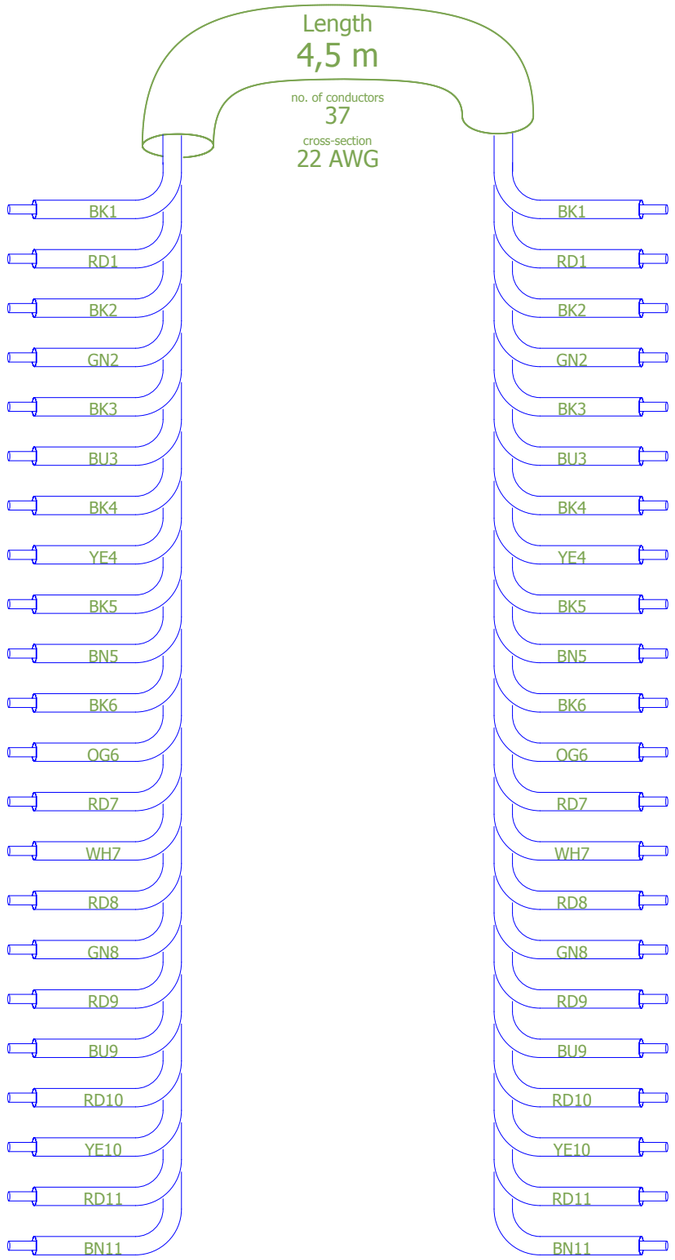

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	/1.5	+S41-1X3:20	-J300:20	/1.5	=IM1+I1/1	
	/1.5	+S41-1X3:1	-J300:1	/1.5	=IM1+I1/1	
	/1.5	+S41-1X3:21	-J300:21	/1.5	=IM1+I1/1	
	/1.5	+S41-1X3:2	-J300:2	/1.5	=IM1+I1/1	
	/1.6	+S41-1X3:3	-J300:3	/1.6	=IM1+I1/1	
	/1.1	+S41-1X3:23	-J300:23	/1.1	=IM1+I1/1	
	/1.1	+S41-1X3:4	-J300:4	/1.1	=IM1+I1/1	
	/1.2	+S41-1X3:26	-J300:26	/1.1	=IM1+I1/1	
	/1.1	+S41-1X3:7	-J300:7	/1.2	=IM1+I1/1	

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	41	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =IM1+I1-WHPR

drawing number		page	42
Function category	= W2	location	+ S1
last page	59	continuation page	43

Cable diagram

NG_KABPL

Messer item No.:

72423104

Plasma


=IM1+I1-WHPR

cable type
US Steuerleitung 22 AWG

Length
4,5 m

no. of conductors
37

cross-section
22 AWG

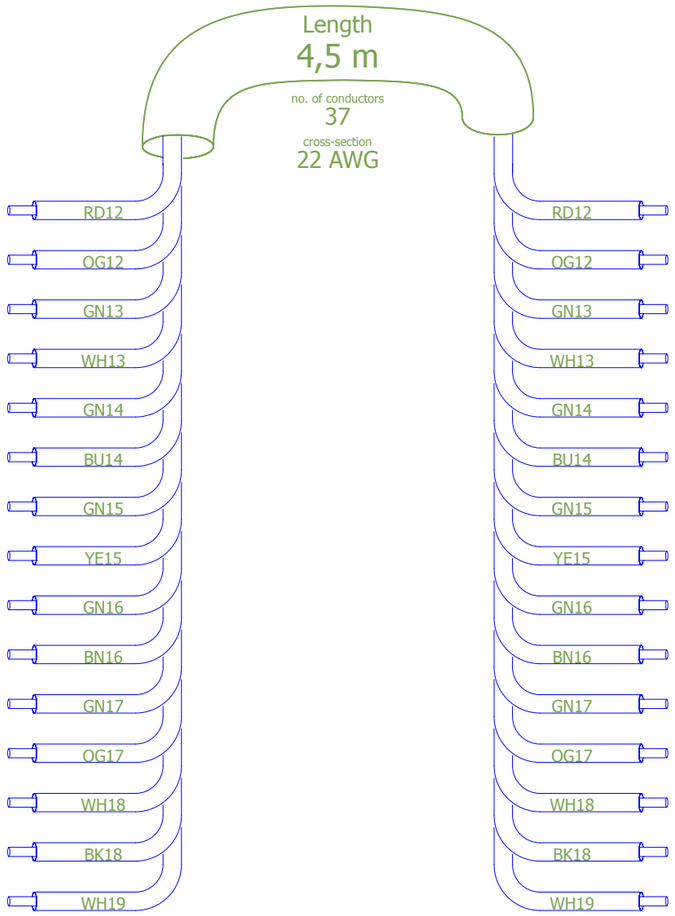

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.4	+S41-1X3:31		-J300:31	/1.4	=IM1+I1/1	
	/1.4	+S41-1X3:12		-J300:12	/1.4	=IM1+I1/1	
	/1.4	+S41-1X3:32		-J300:32	/1.3	=IM1+I1/1	
	/1.3	+S41-1X3:13		-J300:13	/1.4	=IM1+I1/1	
	/1.3	+S41-1X3:33		-J300:33	/1.3	=IM1+I1/1	
	/1.3	+S41-1X3:14		-J300:14	/1.3	=IM1+I1/1	
	/1.2	+S41-1X3:34		-J300:34	/1.2	=IM1+I1/1	
	/1.2	+S41-1X3:15		-J300:15	/1.2	=IM1+I1/1	

Cable diagram

NG_KABPL

Messer item No.:

72416403

Plasma


=IM1+I1-WREM

cable type
Ölflex FD Classic 810 CY

Length
4,5 m

no. of conductors
3

cross-section
1 mm²

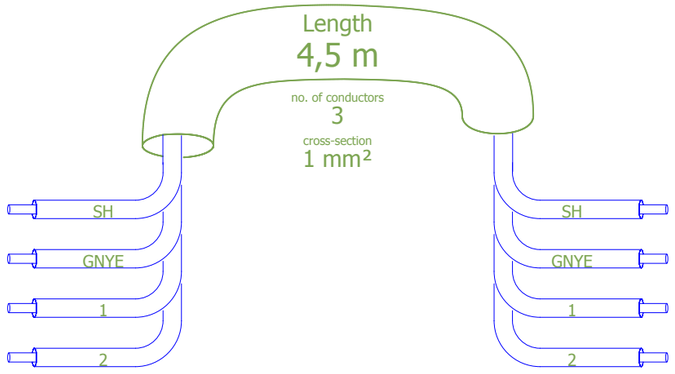

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
Plasma	=AB1+S1/7.5	-WREM:SH	SH	/1.8	=IM1+I1/1	
	=BA2+S41/3.2	=BA2+S41-X43:1	-A1-TB2:2	/1.7	=IM1+I1/1	
	=BA2+S41/3.2	=BA2+S41-X43:3	-A1-TB2:3	/1.8	=IM1+I1/1	

Cable diagram

NG_KABPL


Messer item No.:

72416401

Plasma

=IM1+I1-WWST

cable type
Ölflex FD Classic 810 CY

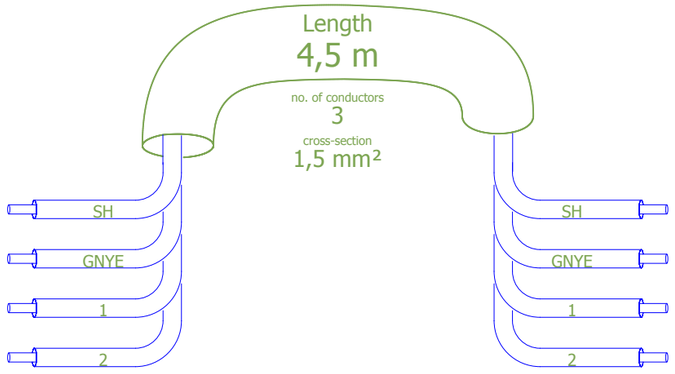

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
Plasma	=AB1+S1/7.6	-WWST:SH	SH	/1.9	=IM1+I1/1	
	+S41/2.2	+S41-X90:1	-A1-TB2:+	/1.8	=IM1+I1/1	
	+S41/2.2	+S41-X90:3	-FKAB:1	/1.9	=IM1+I1/1	

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	44	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =IM1+I1-WWST

drawing number		page	45
Function category	= W2	location	+ S1
last page	59	continuation page	46

Cable diagram


NG_KABPL

Messer item No.:

77070094

=LD1+F1-WX1

cable type
Ölflex FD Classic 810 CY

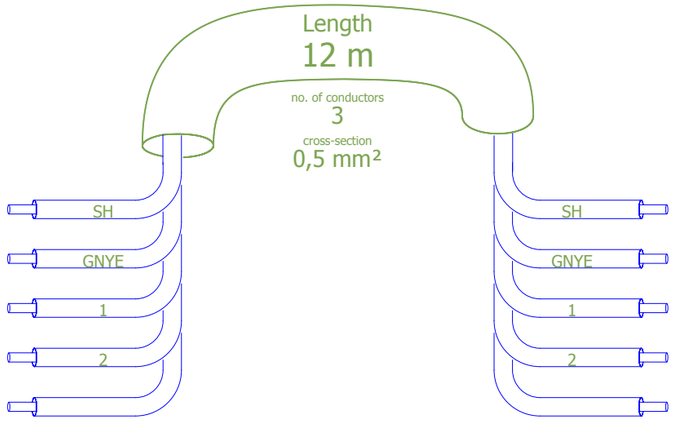

+++///\\\+++	X-Ref	Target designation from	Target designation to	X-Ref		function text
	+S1/1.2	-X1:4	+S1-T1:+	+S1/1.2	=LD1+S1/1	
	+S1/1.2	-X1:2	+S1-T1:-	+S1/1.2	=LD1+S1/1	
SH	+S1/1.2	-X1	SH	+S1/1.2	=LD1+S1/1	

Cable diagram


NG_KABPL

Messer item No.:

0551042

=MB1+A1-WS8

cable type
Ölflex FD Classic 810 CY

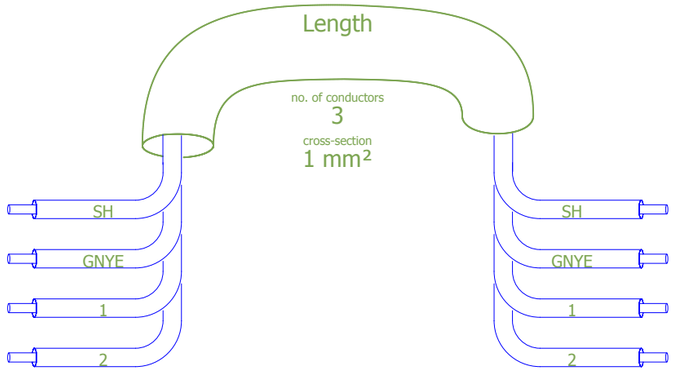

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=VA0+S1/2.8	-XS8		-S8:13	=VA0+S1/2.8	=VA0+S1/2	
	=VA0+S1/2.8	-XS8		-S8:14	=VA0+S1/2.8	=VA0+S1/2	

Cable diagram

NG_KABPL

Messer item No.:

77003999

=VA0+M1-WX1

cable type

Length
10 m

no. of conductors
16x+5x

cross-section
0,34+0,75 mm²

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	+S1/2.9	PE	GNYE	-X1:PE	+S1/2.9	=VA0+S1/2	
DC 0 V	+S1/1.2	=BA2+S1-XL0:4.3	BU1	-X1:-1	+S1/1.2	=VA0+S1/1	
DC 0 V	+S1/2.2	=BA2+S1-XL0:3.2	BU2	-X1:-2	+S1/2.2	=VA0+S1/2	
DC 24 V permanent	+S1/1.2	=BA1+S1-XP24:5.1	BN1	-X1:+1	+S1/1.2	=VA0+S1/1	
DC 24 V permanent	+S1/2.2	=BA1+S1-XP24:5.2	BN2	-X1:+2	+S1/2.2	=VA0+S1/2	
			WH				
			GN				
			YE				
			GY				
			PK				
			RD				
spare	=JB1+S1/1.1	=CA2+S1-C120:1	BK	-X1:7	+S1/1.8	=VA0+S1/1	
			VT				
	=HX1+S1/3.8	+S1-X1:1	GYPK	-X1:9	+S1/1.2	=VA0+S1/1	
	=HY1+S1/3.7	+S1-X1:3	RDBU	-X1:10	+S1/2.2	=VA0+S1/2	
	=HX1+S1/3.7	+S1-X1:2	WHGN	-X1:11	+S1/1.4	=VA0+S1/1	
	=HY1+S1/3.8	+S1-X1:4	BNGN	-X1:12	+S1/2.4	=VA0+S1/2	
home switch X	=HX1+S1/3.2	=CA2+S1-C107:2	WHYE	-X1:13	+S1/1.6	=VA0+S1/1	
home switch Y	=HY1+S1/3.2	=CA2+S1-C107:4	YEBN	-X1:14	+S1/2.6	=VA0+S1/2	
	=BA1+S1/3.7	=BA1+S1-F9:2	WHGY	-X1:15	+S1/1.8	=VA0+S1/1	
push button power on	=MB1+S1/1.2	=CA2+S1-C107:8	GYBN	-X1:16	+S1/2.8	=VA0+S1/2	

			creation date	16.01.2014			
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page	47	total pages	190	last editor	I.Wund		

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =VA0+M1-WX1

drawing number		page	48
Function category	= W2	location	+ S1
last page	59	continuation page	49

Cable diagram


NG_KABPL

Messer item No.:

77003736

=VNA0+M2-WSNA

cable type
PUR/PVC

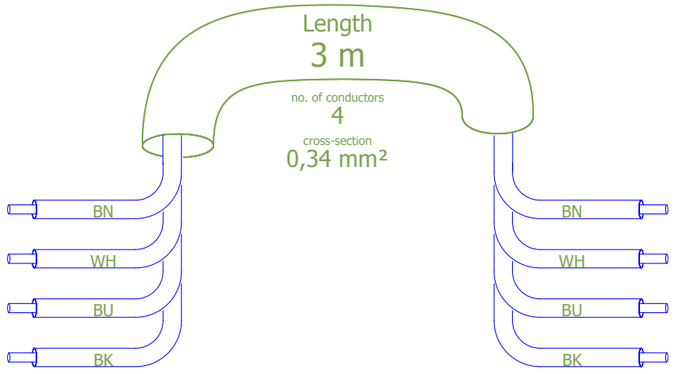

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=BA4+S1/1.3	=BA4+S1-SNA:1	BN	-X1-P0:1	/1.2	=VNA0+M2/1	
	=BA4+S1/1.3	=BA4+S1-SNA:2	WH	-X1-P0:2	/1.2	=VNA0+M2/1	
	=BA4+S1/1.4	=BA4+S1-SNA:3	BU	-X1-P0:3	/1.2	=VNA0+M2/1	
	=BA4+S1/1.4	=BA4+S1-SNA:4	BK	-X1-P0:4	/1.2	=VNA0+M2/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	48	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =VNA0+M2-WSNA

drawing number		page	49
Function category	= W2	location	+ S1
last page	59	continuation page	50

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA1+M1-WS1

cable type
PUR LiF9YH-11YH

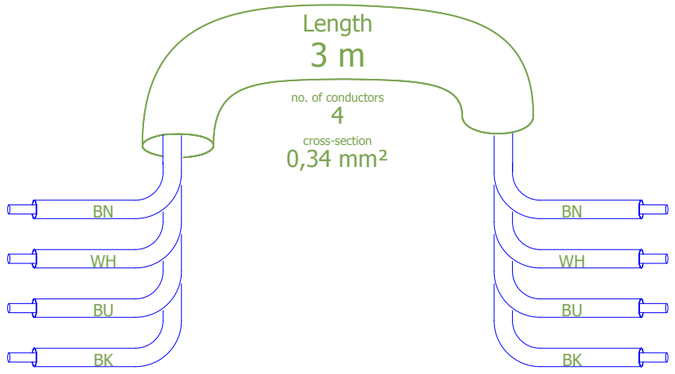

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.2	-S1:1		-XVNA-P1:1	/1.2	=VNA1+M1/1	
	/1.2	-S1:2		-XVNA-P1:2	/1.2	=VNA1+M1/1	
	/1.2	-S1:3		-XVNA-P1:3	/1.2	=VNA1+M1/1	
	/1.2	-S1:4		-XVNA-P1:4	/1.2	=VNA1+M1/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	49	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =VNA1+M1-WS1

drawing number		page	50
Function category	= W2	location	+ S1
last page	59	continuation page	51

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA1+M1-WS2

cable type
PUR LiF9YH-11YH

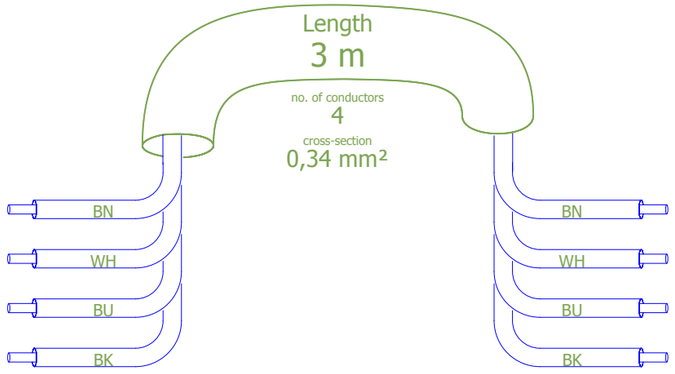

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.4	-S2:1		-XVNA-P2:1	/1.4	=VNA1+M1/1	
	/1.4	-S2:2		-XVNA-P2:2	/1.4	=VNA1+M1/1	
	/1.4	-S2:3		-XVNA-P2:3	/1.4	=VNA1+M1/1	
	/1.4	-S2:4		-XVNA-P2:4	/1.4	=VNA1+M1/1	

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA1+M1-WS3

cable type
PUR LiF9YH-11YH

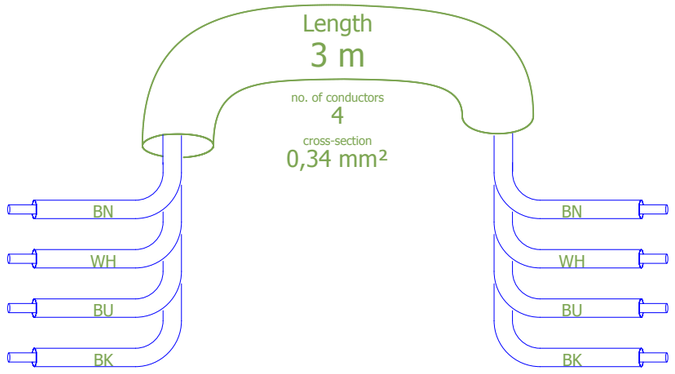

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.6	-S3:1		-XVNA-P3:1	/1.6	=VNA1+M1/1	
	/1.6	-S3:2		-XVNA-P3:2	/1.6	=VNA1+M1/1	
	/1.6	-S3:3		-XVNA-P3:3	/1.6	=VNA1+M1/1	
	/1.6	-S3:4		-XVNA-P3:4	/1.6	=VNA1+M1/1	

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA1+M1-WS4

cable type
PUR LiF9YH-11YH

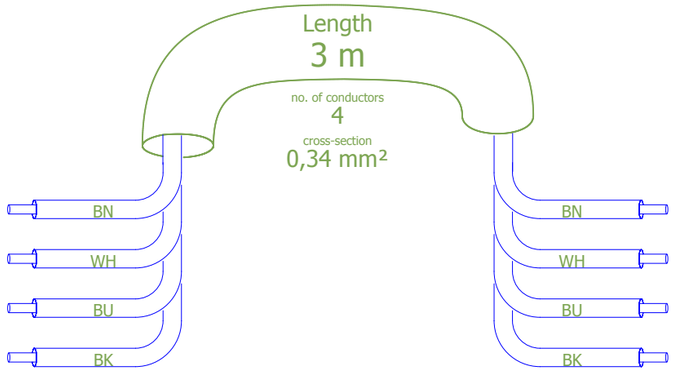

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.8	-S4:1		-XVNA-P4:1	/1.8	=VNA1+M1/1	
	/1.8	-S4:2		-XVNA-P4:2	/1.8	=VNA1+M1/1	
	/1.8	-S4:3		-XVNA-P4:3	/1.8	=VNA1+M1/1	
	/1.8	-S4:4		-XVNA-P4:4	/1.8	=VNA1+M1/1	

Cable diagram


NG_KABPL

Messer item No.:

77003737

=VNA1+M1-WVNA

cable type
PUR/PVC

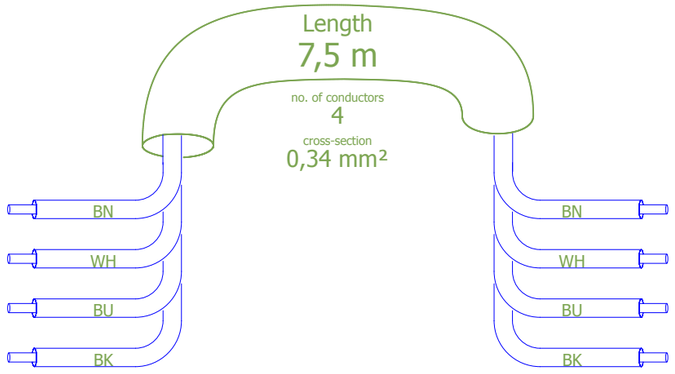

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=VNA0+M2/1.4	=VNA0+M2-X1-P3:1	BN	-XVNA-P0:1	/1.2	=VNA1+M1/1	
	=VNA0+M2/1.4	=VNA0+M2-X1-P3:2	WH	-XVNA-P0:2	/1.2	=VNA1+M1/1	
	=VNA0+M2/1.4	=VNA0+M2-X1-P3:3	BU	-XVNA-P0:3	/1.2	=VNA1+M1/1	
	=VNA0+M2/1.4	=VNA0+M2-X1-P3:4	BK	-XVNA-P0:4	/1.2	=VNA1+M1/1	

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA2+M2-WS1

cable type
PUR LiF9YH-11YH

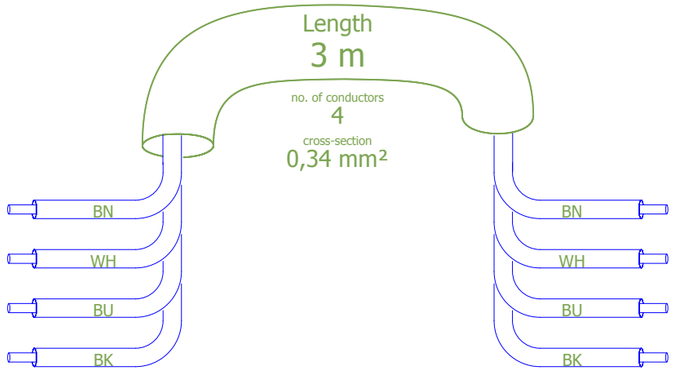

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.2	-S1:1		-XVNA-P1:1	/1.2	=VNA2+M2/1	
	/1.2	-S1:2		-XVNA-P1:2	/1.2	=VNA2+M2/1	
	/1.2	-S1:3		-XVNA-P1:3	/1.2	=VNA2+M2/1	
	/1.2	-S1:4		-XVNA-P1:4	/1.2	=VNA2+M2/1	

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page	54	total pages	190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =VNA2+M2-WS1

drawing number		page	55
Function category	= W2	location	+ S1
last page	59	continuation page	56

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA2+M2-WS2

cable type
PUR LiF9YH-11YH

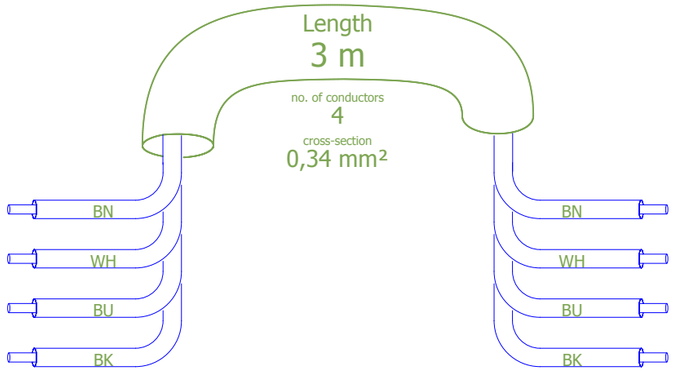

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.4	-S2:1		-XVNA-P2:1	/1.4	=VNA2+M2/1	
	/1.4	-S2:2		-XVNA-P2:2	/1.4	=VNA2+M2/1	
	/1.4	-S2:3		-XVNA-P2:3	/1.4	=VNA2+M2/1	
	/1.4	-S2:4		-XVNA-P2:4	/1.4	=VNA2+M2/1	

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA2+M2-WS3

cable type
PUR LiF9YH-11YH

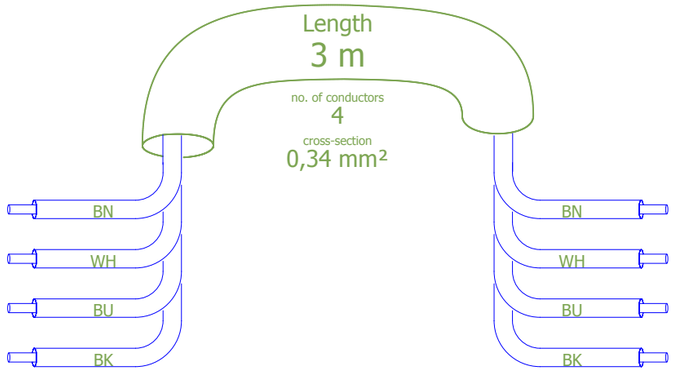

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.6	-S3:1		-XVNA-P3:1	/1.6	=VNA2+M2/1	
	/1.6	-S3:2		-XVNA-P3:2	/1.6	=VNA2+M2/1	
	/1.6	-S3:3		-XVNA-P3:3	/1.6	=VNA2+M2/1	
	/1.6	-S3:4		-XVNA-P3:4	/1.6	=VNA2+M2/1	

P8 2.2.5

			creation date	16.01.2014		
			editor	INGO.WUNDERLE		
001	10.02.2014	Wun	printout	10.02.2014		
change	date	name	revisor			
previous page	56	total pages	190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Cable diagram =VNA2+M2-WS3

drawing number		page	57
Function category	= W2	location	+ S1
last page	59	continuation page	58

Cable diagram


NG_KABPL

Messer item No.:

77005615

=VNA2+M2-WS4

cable type
PUR LiF9YH-11YH

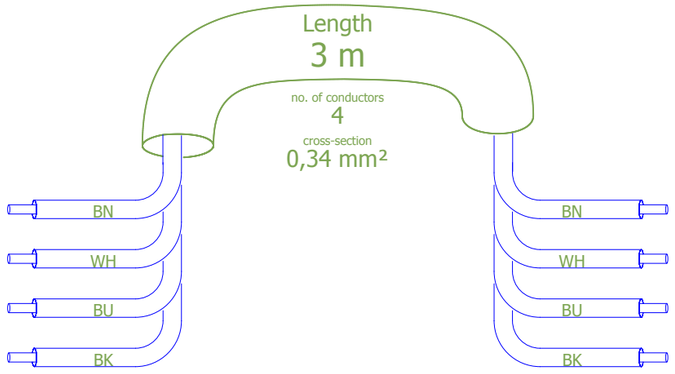

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	/1.8	-S4:1		-XVNA-P4:1	/1.8	=VNA2+M2/1	
	/1.8	-S4:2		-XVNA-P4:2	/1.8	=VNA2+M2/1	
	/1.8	-S4:3		-XVNA-P4:3	/1.8	=VNA2+M2/1	
	/1.8	-S4:4		-XVNA-P4:4	/1.8	=VNA2+M2/1	

Cable diagram


NG_KABPL

Messer item No.:

77004462

=VNA2+M2-WVNA

cable type
PUR/PVC

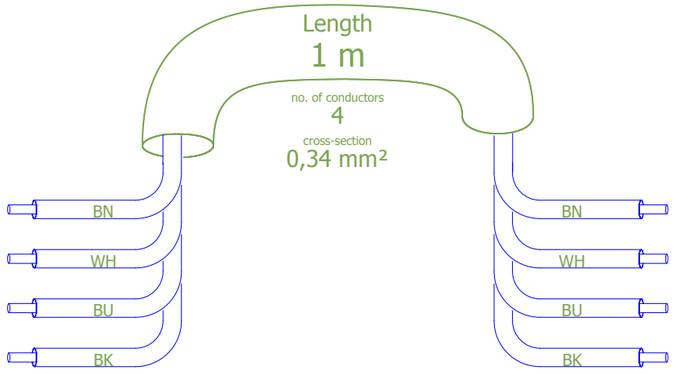

+++///\\\+++	X-Ref	Target designation from		Target designation to	X-Ref		function text
	=VNA0/2.4	=VNA0-X1-P4:1	BN	-XVNA-P0:1	/1.2	=VNA2+M2/1	
	=VNA0/2.4	=VNA0-X1-P4:2	WH	-XVNA-P0:2	/1.2	=VNA2+M2/1	
	=VNA0/2.4	=VNA0-X1-P4:3	BU	-XVNA-P0:3	/1.2	=VNA2+M2/1	
	=VNA0/2.4	=VNA0-X1-P4:4	BK	-XVNA-P0:4	/1.2	=VNA2+M2/1	

Terminal-strip overview

P8GC_KLUE

terminal strip	function text	Terminals					Terminal diagram page
		first	last	Total PE	Total N	Total number	
=BA0-X00	power infeed	1	PE	7	0	12	=X2+S1/1
=BA1-X230L1	distribution AC 230 V	1.1	2.1	0	0	5	=X2+S1/2
=BA1-X230L2	distribution AC 230 V	1.1	3.1	0	0	7	=X2+S1/3
=BA1-XL24	distribution DC 24 V	1.1	2.3	0	0	5	=X2+S1/4
=BA1-XP24	DC 24 V permanent	1.1	5.2	0	0	17	=X2+S1/5
=BA1-XT	distribution terminals	1	PE	0	0	12	=X2+S1/6
=BA2-X40	interface operation panel	1	PE	2	0	22	=X2+S1/7
=BA2-X41	interface interlock	1	PE	1	0	6	=X2+S1/8
=BA2-X42	interface interlock	1	PE	1	0	6	=X2+S1/9
=BA2-X422	interface interlock	1	PE	1	0	6	=X2+S1/10
=BA2-XL0	distribution DC 0 V	PE.1	8.4	0	0	33	=X2+S1/11
=BA2+S41-X24L	distribution DC 24 V	1.1	1.4	0	0	3	=X2+S1/12
=BA2+S41-X41	interface interlock	1	PE	1	0	6	=X2+S1/13
=BA2+S41-X42	interface interlock	1	PE	1	0	6	=X2+S1/14
=BA2+S41-X43	interface interlock	1	PE	0	0	10	=X2+S1/15
=BA2+S41-X422	interface interlock	1	PE	0	0	6	=X2+S1/16
=BA2+S41-XL0	distribution DC 0 V	PE	2.2	1	0	6	=X2+S1/17
=FD-X24	distribution terminals	1.1	2.3	0	0	8	=X2+S1/18
=FD-XGND	distribution terminals	1.1	2.4	0	0	8	=X2+S1/19
=FH1-XZ11	distribution terminals	1.1	2.4	0	0	8	=X2+S1/20
=FH1-XZ21	distribution terminals	1.1	2.4	0	0	8	=X2+S1/21
=FK1-XVH	distribution terminals	1.1	2.4	0	0	8	=X2+S1/22
=HX1-XMR	distribution terminals	1	4	0	0	4	=X2+S1/23
=IM1+S41-X90	interface plasma interlock	1	4	0	0	4	=X2+S1/24
=VA0-X1	distribution terminals	1	4	0	0	4	=X2+S1/25

Terminal diagram

P8GC_KLDD

Strip

=BA0+S1-X00

power infeed

function text	-WX00	Cable name	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	Page / column
	3x2,5 mm² 25 m	cable type								cable type	
	1		+EXT-X	1	1			-F001	1		/1.1
					2						/1.1
					3						/1.2
	2		+EXT-X	2	4			=BA1-Q1	8		/1.2
					5						/1.2
	GNYE		+EXT-X	3	PE			PE			/1.3
					PE						/1.3
					PE						/1.3
					PE						/1.3
					PE						/1.4
					PE						/1.4

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page	=X1/1	total pages	190	last editor I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA0+S1-X00

drawing number		page	1
plant	= X2	location	+ S1
last page	25	continuation page	2

Terminal diagram

P8GC_KLDD

Strip
=BA1+S1-X230L1
distribution AC 230 V

function text	Cable name	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	cable type	Page / column
drives AC 230 V			-X230L1	1.2	1.1		'	-F1	2			/1.8
drives AC 230 V					1.2			-X230L1	1.1			/1.8
			-G1	L	1.3							/3.2
			-K1	A1	1.4							=BA3/1.4
			=HX1-V2	L1	2.1		'					=HX1/1.5

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 1		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA1+S1-X230L1

drawing number		page	2
plant	= X2	location	+ S1
last page	25	continuation page	3

Terminal diagram

P8GC_KLDD

Strip

=BA1+S1-X230L2

distribution AC 230 V

function text	Cable name	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	cable type	Page / column
			-X230L2	1.2	1.1		'	-Q1	7			/1.4
			-T1	N	1.2			-X230L2	1.1			/1.4
			-G1	N	1.4							/3.2
					2.1		'	-K1	A2			=BA3/1.4
					2.2							=BA0/1.4
N			=BA4-K1	5	2.4							/1.5
			=HX1-V2	L2	3.1		'					=HX1/1.6

Terminal diagram

P8GC_KLDD

Strip

=BA1+S1-XL24

distribution DC 24 V

function text	Cable name	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	cable type	Page / column
					1.1		'	-F4	2			/3.4
DC 24 V control voltage					1.2							=MB1/1.1
DC 24 V					2.1		'					/3.4
DC 24 V					2.2							/3.4
DC 24 V					2.3							/3.4

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 3		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA1+S1-XL24

drawing number		page	4
plant	= X2	location	+ S1
last page	25	continuation page	5

Terminal diagram

P8GC_KLDD

function text							=VA0+M1-WX1	=FK1+F1-WXS1	Cable name	Strip =BA1+S1-XP24 DC 24 V permanent					Cable name	=EM1+F1-WXS1				Page / column
							16x+5x0,34+0,75 mm²	5x0,34 mm²	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	cable type	PUR/TPE				
												1.1		'	-K1	11					=BA3/1.3
DC 24 V												5.4		'	=EM1+F1-XS1	1		BN			=EM1+F1/1.3
DC 24 V permanent												1.2			=CA2-C100	1					=CA2/1.1
DC 24 V permanent												1.3			=CA2-C100	2					=CA2/1.2
DC 24 V permanent												2.1		'	=CA2-C701-X0	24V					=HX1/2.8
DC 24 V permanent										=CA2-C115	1	2.2		'							=BA2/6.1
DC 24 V permanent										=HX1-A1-CN1	29	2.3									=HX1/2.8
DC 24 V permanent												2.4			-F10	2					/3.9
DC 24 V permanent										=BA2-X41	4	3.1		'							=BA2/4.2
DC 24 V permanent										=BA2-X41	1	3.2									=BA2/4.1
DC 24 V permanent										=BA4-KNA	23	3.3									=BA2/4.4
DC 24 V permanent												3.4									=BA4/1.7
										=BA2-A1	3+	4.1		'							=BA2/5.5
								BN		=FK1+F1-XS1	1	4.3									=FK1/2.2
												4.4									=BA3/1.6
DC 24 V permanent							BN1			=VA0+M1-X1	+1	5.1		'							=VA0/1.2
DC 24 V permanent							BN2			=VA0+M1-X1	+2	5.2									=VA0/2.2

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 4		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA1+S1-XP24

drawing number		page	5
plant	= X2	location	+ S1
last page	25	continuation page	6

Terminal diagram

P8GC_KLDD

function text								=FK1+F1-WXU	Cable name	Strip =BA1+S1-XT distribution terminals: Target designation	Connection point	terminal	jumper (unten / oben)	Target designation	Connection point	Cable name					Page / column
								3x1,5 mm²	cable type							cable type					
								1		=FK1+F1-XU	1	1		-F21	2						/2.1
												1									/2.1
								2		=FK1+F1-XU	3	2		-T1	N55						/2.2
												2									/2.2
												2									/2.2
												2									/2.2
												3		-F22	2						/2.1
												3									/2.2
												PE									/2.3
												PE									/2.3
								GNYE		=FK1+F1-XU	PE	PE		PE							/2.3
												PE									/2.3

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 5		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA1+S1-XT

drawing number		page	6
plant	= X2	location	+ S1
last page	25	continuation page	7

Terminal diagram

P8GC_KLDD

function text								=CA0+P1-WX40	Cable name	Strip =BA2+S1-X40 interface operation panel						Cable name						Page / column
								16x+3x0,5+1,0 mm²	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	cable type					
								VT		=CA0+P1-X40	1	1	'		-X422	4						/3.1
								RD		=CA0+P1-X40	2	2			=BA4-KNA	S12						/3.2
								GY		=CA0+P1-X40	3	3	'		=BA3-K2	14						/3.1
								RDBU		=CA0+P1-X40	4	4			=BA4-KNA	S22						/3.1
								GN		=CA0+P1-X40	5	5	'		=BA4-KNA	S34						/3.0
								BU		=CA0+P1-X40	6	6			-XL0	1.4						/3.1
								GYPK		=CA0+P1-X40	7	7	'		=CA2-C110	2						/3.4
								WHGN		=CA0+P1-X40	8	8			-G3	1						/3.2
								WHYE		=CA0+P1-X40	9	9	'		=CA2-C110	6						/3.5
								WHGY		=CA0+P1-X40	10	10			=CA2-C110	3						/3.6
								BK		=CA0+P1-X40	11	11	'		-G3	2						/3.2
												12										/3.5
								YEBN		=CA0+P1-X40	13	13	'									/3.5
								BNGN		=CA0+P1-X40	14	14										/3.5
								WH		=CA0+P1-X40	15	15	'		=BA4-KNA	S33						/3.0
								YE		=CA0+P1-X40	16	16			=CA2-C109	3						/3.8
								PK		=CA0+P1-X40	17	17	'		=CA2-C109	6						/3.7
								GYBN		=CA0+P1-X40	18	18			=CA2-C109	7						/3.4
								BN		=CA0+P1-X40	19	19	'		=BA1-F9	2						/3.1
												20										/3.9
								GNYE		=CA0+P1-X40	12	PE			PE							/3.9
												PE										/3.9

Terminal diagram

P8GC_KLDD

function text								+S41-WX41	Cable name	Strip =BA2+S1-X41 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten oben	Target designation	Connection point	cable type					
								1		+S41-X41	1	1		=BA1-XP24	3.2						/4.1
								2		+S41-X41	3	2		-XL0	2.2						/4.1
								3		+S41-X41	4	3		-XL0	2.1						/4.1
								4		+S41-X41	2	4		=BA1-XP24	3.1						/4.2
								GNYE		+S41-X41	PE	PE		PE							/4.2
												PE									/4.2

Terminal diagram

P8GC_KLDD

function text								+S41-WX42	Cable name	Strip =BA2+S1-X42 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten oben	Target designation	Connection point	cable type					
								1		+S41-X42	1	1	'	=BA4-KNA	24						/4.4
								2		+S41-X42	3	2		-XL0	2.3						/4.4
								3		+S41-X42	2	3	'	=BA3-K1	14						/4.4
								4		+S41-X42	4	4		-X422	3						/4.4
								GNYE		+S41-X42	PE	PE		PE							/4.5
												PE									/4.5

Terminal diagram

P8GC_KLDD

function text								+S41-WX422	Cable name	Strip =BA2+S1-X422 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten oben	Target designation	Connection point	cable type					
								1		+S41-X422	1	1	'	=BA4-K1	41						/4.6
								2		+S41-X422	3	2		=BA4-KNA	Y2						/4.7
								3		+S41-X422	2	3	'	-X42	4						/4.7
								4		+S41-X422	4	4		-X40	1						/4.7
								GNYE		+S41-X422	PE	PE		PE							/4.8
												PE									/4.8

Terminal diagram

P8GC_KLDD

function text						=FK1+F1-WX1	=EM1+F1-WXS1	=VA0+M1-WX1	Cable name	Strip =BA2+S1-XL0 distribution DC 0 V						Cable name						Page / column
						12x+4x0,25+0,5 mm²	5x0,34 mm²	16x+5x0,34+0,75 mm²	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	cable type					
DC 0 V										PE		PE.1		'	-XL0	1.1						=BA1/3.1
DC 0 V										-XL0	PE.1	1.1		'	=BA1-G1	-						=BA1/3.1
DC 0 V										=FD-XGND	1.1	1.2			=BA1-T1	N24						=BA1/2.8
DC 0 V												1.3			=BA1-G2	-						=BA1/3.3
DC 0 V										-X40	6	1.4										/3.1
DC 0 V												5.1		'	=FH1-K11	A2						=FK1/3.0
DC 0 V										-X41	3	2.1		'								/4.1
DC 0 V										-X41	2	2.2										/4.1
DC 0 V										-X42	2	2.3										/4.4
DC 0 V												2.4			=CA2-C100	5						=CA2/1.1
DC 0 V												9.2			=CA2-C701-X0	0V.						=HX1/2.6
DC 0 V												3.1		'	=CA2-C100	3						=CA2/1.2
DC 0 V								BU2		=VA0+M1-X1	-2	3.2										=VA0/2.2
DC 0 V							BU			=EM1+F1-XS1	3	11.4										=EM1+F1/1.4
						WH				=FK1+F1-MOT-X1	1	3.3										=FK1/4.2
DC 0 V												3.4										=FK1/4.2
DC 0 V												4.1		'								=BA1/3.5
						YE				=FK1+F1-MOT-X1	11	4.2										=FK1/4.2
DC 0 V								BU1		=VA0+M1-X1	-1	4.3										=VA0/1.2
DC 0 V												4.4			=BA3-K1	A2						=BA3/1.0
												5.2										=FK1/4.3
												5.3										=FK1/4.3
												5.4										=FK1/4.3
												6.1										=FK1/4.4
												6.2										=FK1/4.4
												6.3										=FK1/4.4
												6.4										=FK1/4.5
												7.1		'								=FK1/4.5
												7.2										=FK1/4.5
DC 0 V										-A1	2-	7.3										/5.4
DC 0 V										-A1	4-	7.4										/5.6
DC 0 V										=LD1-T1	-Vin	8.1										=LD1/1.2
DC 0 V												8.4			=CA2-C701-X4	7						=HX1/2.6

Terminal diagram

P8GC_KLDD

Strip

=BA2+S41-X24L

distribution DC 24 V

function text	Cable name	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	cable type	Page / column
DC 24 V					1.1			=CA41-C400	6			/1.4
DC 24 V			=IM1-L3	1	1.3							=IM1/1.0
					1.4			=CA41-C410	6			/1.4

Terminal diagram

P8GC_KLDD

function text								-WX41	Cable name	Strip =BA2+S41-X41 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	cable type					
								1		+S1-X41	1	1	'	-L1							/1.1
								4		+S1-X41	4	2		-L2							/1.2
								2		+S1-X41	2	3	'	-L1							/1.1
								3		+S1-X41	3	4		-L2							/1.2
								GNYE		+S1-X41	PE	PE		PE							/1.2
												PE									/1.3

P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =BA2+S41-X41
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 12		total pages 190	last editor	I.Wund			

drawing number			page	13	
plant	=	X2	location	+	S1
last page	25	continuation page	14		

Terminal diagram

P8GC_KLDD

function text								-WX42	Cable name	Strip =BA2+S41-X42 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	cable type					
								1		+S1-X42	1	1		-K2	A1						/2.1
								3		+S1-X42	3	2		-X43	2						/2.3
								2		+S1-X42	2	3		-K2	A2						/2.2
								4		+S1-X42	4	4		-X43	8						/2.3
								GNYE		+S1-X42	PE	PE		PE							/2.3
												PE									/2.4

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 13		total pages 190		last editor I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA2+S41-X42

drawing number		page	14
plant	= X2	location	+ S1
last page 25		continuation page	15

Terminal diagram

P8GC_KLDD

function text	=IM1+I1-WREM	Cable name	Strip =BA2+S41-X43 interface interlock: Target designation	Connection point	terminal	jumper (unten / oben)	Target designation	Connection point	Cable name	Page / column
	3x1 mm²	cable type							cable type	
	1		=IM1+I1-A1-TB2	2	1		-K2	14		/3.2
					2		-X42	2		/3.3
	2		=IM1+I1-A1-TB2	3	3		=CA41-C406	2		/3.2
					4					/3.3
					5		-K2	44		/3.4
					6					/3.5
					7		-K2	43		/3.5
					8		-X42	4		/3.6
					PE					/3.4
					PE		PE			/3.6

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 14		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA2+S41-X43

drawing number		page	15
plant	= X2	location	+ S1
last page	25	continuation page	16

Terminal diagram

P8GC_KLDD

function text								-WX422	Cable name	Strip =BA2+S41-X422 interface interlock						Cable name					Page / column
								5x1,5 mm² 30 m	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	cable type					
								1		+S1-X422	1	1			-K2	22						/2.5
								3		+S1-X422	3	2										/2.6
								2		+S1-X422	2	3			-K2	21						/2.6
								4		+S1-X422	4	4										/2.7
								GNYE		+S1-X422	PE	PE			PE							/2.7
												PE										/2.7

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 15		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA2+S41-X422

drawing number		page	16
plant	= X2	location	+ S1
last page	25	continuation page	17

Terminal diagram

P8GC_KLDD

Strip

=BA2+S41-XL0

distribution DC 0 V

function text	Cable name	cable type	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	cable type	Page / column
			PE		PE	'		-XL0	1.1			/1.7
DC 0 V			-XL0	PE	1.1	'						/1.7
					1.2			=CA41-C400	7			/1.7
					1.4			=CA41-C410	7			/1.7
DC 0 V					2.1	'		=CA41-C416	7			=IM1/4.4
					2.2							/1.8

P8 2.2.5

			creation date	16.01.2014	
			editor	INGO.WUNDERLE	
001	10.02.2014	Wun	printout	10.02.2014	
change	date	name	revisor		
previous page 16		total pages 190	last editor	I.Wund	

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =BA2+S41-XL0

drawing number		page	17
plant	= X2	location	+ S1
last page	25	continuation page	18

Terminal diagram

P8GC_KLDD

Strip

=FD+S1-X24

distribution terminals

function text									Cable name	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name						Page / column
									cable type								cable type						
AC 24 V												1.1		'	=BA1-F3	2							=BA1/2.7
												1.2											
AC 24 V												1.3											=FK1/4.2
AC 24 V												1.4											=FK1/4.4
												2.1		'									=BA1/2.8
AC 24 V												2.2											=FK1/4.5
AC 24 V												2.3											=FK1/4.6
												2.4											

P8 2.2.5

			creation date	16.01.2014	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =FD+S1-X24	drawing number	page 18
			editor	INGO.WUNDERLE				
001	10.02.2014	Wun	printout	10.02.2014			plant = X2	location + S1
change	date	name	revisor					
previous page 17		total pages 190	last editor	I.Wund			last page 25	continuation page 19

Terminal diagram

P8GC_KLDD

function text									Cable name	Strip =FD+S1-XGND distribution terminals						Cable name					Page / column
									cable type	Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	cable type					
AC GND												1.1	'	=BA2-XL0	1.2						=BA1/2.8
AC GND												1.2									=FK1/4.3
AC GND												1.3									=FK1/4.4
AC GND												1.4									=FK1/4.5
												2.1	'								=BA1/2.9
AC GND												2.2									=FK1/4.6
												2.3									
												2.4									=BA1/2.9

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 18		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =FD+S1-XGND

drawing number		page	19
plant	= X2	location	+ S1
last page 25		continuation page	20

Terminal diagram

P8GC_KLDD

function text								=FK1+F1-WX1	Cable name	Strip =FH1+S1-XZ11 distribution terminals: Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	Cable name					Page / column
								12x+4x0,25+0,5 mm²	cable type							cable type					
								GN		=FK1+F1-MOT-X1	16	1.1		-K11	11						=FK1/3.1
												1.2									=FK1/3.2
												1.3									=FK1/3.2
												1.4									=FK1/3.2
												2.1									=FK1/3.2
												2.2									=FK1/3.2
												2.3									=FK1/3.3
												2.4									=FK1/3.3

P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =FH1+S1-XZ11
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 19		total pages 190	last editor	I.Wund			

drawing number		page	20
plant	= X2	location	+ S1
last page	25	continuation page	21

Terminal diagram

P8GC_KLDD

function text								=FK1+F1-WX1	Cable name	Strip =FH1+S1-XZ21 distribution terminals: Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	Cable name					Page / column
								12x+4x0,25+0,5 mm²	cable type							cable type					
								BU		=FK1+F1-MOT-X1	10	1.1		-K21	11						=FK1/3.4
												1.2									=FK1/3.4
												1.3									=FK1/3.4
												1.4									=FK1/3.5
												2.1									=FK1/3.5
												2.2									=FK1/3.5
												2.3									=FK1/3.5
												2.4									=FK1/3.5

P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =FH1+S1-XZ21
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 20		total pages 190	last editor	I.Wund			

drawing number		page	21
plant	= X2	location	+ S1
last page	25	continuation page	22

Terminal diagram

P8GC_KLDD

function text								+F1-WX1	Cable name	Strip =FK1+S1-XVH distribution terminals						Cable name					Page / column
								12x+4x0,25+0,5 mm²	cable type	Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	cable type					
								GYPK		+F1-MOT-X1	2	1.1		=CA2-C110	8						/4.7
												1.2									/4.8
												1.3									/4.8
												1.4									/4.8
												2.1									/4.8
												2.2									/4.8
												2.3									/4.8
												2.4									/4.9


P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =FK1+S1-XVH
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 21		total pages 190	last editor	I.Wund			

drawing number			page	22	
plant	=	X2	location	+	S1
last page	25	continuation page	23		

Terminal diagram

NG_DYN_KL4pot



wiring diagram
quad potential terminal

Function text

=HY1-WXMR1	=HX2-WXMR1	-WXMR1	-WV1	=HY1-WXMR2	=HX2-WXMR2	-WXMR2	-WV2	Cable name	Strip =HX1+S1-XMR distribution terminals						Cable name	Internal wiring colours or numbers	Page / column
Ölflex FD Classic 810 CY 3x1,5 mm²	Ölflex FD Classic 810 CY 3x1,5 mm²	Ölflex FD Classic 810 CY 3x1,5 mm²	ÖLFLEX FD CLASSIC 810 CY 3x2,5 mm²	Ölflex FD Classic 810 CY 3x1,5 mm²	Ölflex FD Classic 810 CY 3x1,5 mm²	Ölflex FD Classic 810 CY 3x1,5 mm²	ÖLFLEX FD CLASSIC 810 CY 3x2,5 mm²	Cable type	Target designation to	Connection point	Terminal type	Terminal	Jumper	Target designation to	Connection point	Cable type	Cross-section	
							1		-V2	I1	2,5² 4FACH Pot	1 1						/1.6
						1			-A1	L1C		2						
					1				=HX2-A1	L1C		3						
				1					=HY1-A1	L1C		4						
							2		-V2	I2	2,5² 4FACH Pot	1 2						/1.7
						2			-A1	L2C		2						
					2				=HX2-A1	L2C		3						
				2					=HY1-A1	L2C		4						
			1						-V1	I1	2,5² 4FACH Pot	1 3						/1.2
		1							-A1	L1		2						
	1								=HX2-A1	L1		3						
1									=HY1-A1	L1		4						
			2						-V1	I2	2,5² 4FACH Pot	1 4						/1.3
		2							-A1	L2		2						
	2								=HX2-A1	L2		3						
2									=HY1-A1	L2		4						

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 22		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram
=HX1+S1-XMR distribution terminals

drawing number		page	23
Function category	= X2	location	+ S1
last page 25		continuation page	24

Terminal diagram

P8GC_KLDD

function text								+I1-WWST	Cable name	Strip =IM1+S41-X90 interface plasma interlock						Cable name						Page / column
								3x1,5 mm²	cable type	Target designation	Connection point	terminal	jumper unten / oben	Target designation	Connection point	cable type						
								1		+I1-A1-TB2	+	1		-PAM	1							/2.2
												2										/2.3
								2		+I1-FKAB	1	3		-PAM	2							/2.2
												4										/2.3

P8 2.2.5

			creation date	16.01.2014	MESSER Cutting Systems	289.168 GCs_Modular_eco 3600 MBG Poulina	Terminal diagram =IM1+S41-X90
			editor	INGO.WUNDERLE			
001	10.02.2014	Wun	printout	10.02.2014			
change	date	name	revisor				
previous page 23		total pages 190	last editor I.Wund				

drawing number		page	24
plant	= X2	location	+ S1
last page	25	continuation page	25

Terminal diagram

P8GC_KLDD

Strip

=VA0+S1-X1

distribution terminals

function text	+M1-WX1	Cable name	Target designation	Connection point	terminal	jumper unten	jumper oben	Target designation	Connection point	Cable name	Page / column
	16x+5x0,34+0,75 mm²	cable type								cable type	
			=HX1-A1-CN1	42	1		'	=CA2-C107	1		=HX1/3.8
	GYPK		+M1-X1	9							
			=HX1-A1-CN1	43	2		'	=CA2-C107	5		=HX1/3.7
	WHGN		+M1-X1	11							
			=HY1-A1-CN1	42	3		'	=CA2-C107	3		=HY1/3.7
	RDBU		+M1-X1	10							
			=HY1-A1-CN1	43	4		'	=CA2-C107	7		=HY1/3.8
	BNGN		+M1-X1	12							

P8 2.2.5

			creation date	16.01.2014
			editor	INGO.WUNDERLE
001	10.02.2014	Wun	printout	10.02.2014
change	date	name	revisor	
previous page 24		total pages 190	last editor	I.Wund

MESSER Cutting Systems

289.168
GCs_Modular_eco 3600
MBG Poulina

Terminal diagram =VA0+S1-X1

drawing number		page	25
plant	= X2	location	+ S1
last page 25		continuation page	=Z1/1

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=AB1-KLD =AB1/4	1						FERRITRING Ferrite	
=AB1-U1 =AB1/5.2	1				Ferritring 6,5 mm Lochdurchmesser 77004659	DIS	CORER-065B Ferrite	
=BA0-F001 =BA0/1.5	1			+++///\\\+++	Leitungsschutzschalter 3pol B20A 77070076	Siemens Karl Elektronikbapre fuse	5SY6320-6	
=BA0-0F1 =BA0/1.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA0-0F1 =BA0/1.4	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5x20 T10A fuse	
=BA0-0F2 =BA0/1.5	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA0-0F2 =BA0/1.5	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5x20 T10A fuse	
=BA0-WX00 =AB1/1.2	1	25 m		PVC Anschluss- und Steuerleitung	3G2,5 571223	Lapp	0026170	
=BA1-F1 =BA1/1.8	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5	
=BA1-F1 =BA1/1.8	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A	
=BA1-F01 =BA1/1.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F01 =BA1/1.4	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA1-F02 =BA1/1.5	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F02 =BA1/1.5	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5x20 T6,3A fuse	
=BA1-F3 =BA1/2.6	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F3 =BA1/2.6	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA1-F4 =BA1/3.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F4 =BA1/3.4	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A fuse	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=BA1-F5 =BA1/1.7	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5	
=BA1-F5 =BA1/1.7	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A	
=BA1-F9 =BA1/3.7	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5	
=BA1-F9 =BA1/3.7	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A	
=BA1-F10 =BA1/3.9	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F10 =BA1/3.9	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA1-F11 =BA1/3.6	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA1-F11 =BA1/3.6	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA1-F21 =BA1/2.1	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5	
=BA1-F21 =BA1/2.1	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A	
=BA1-F22 =BA1/2.1	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5	
=BA1-F22 =BA1/2.1	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A	
=BA1-G1 =BA1/3.2	1			Netzgerät 230V/24V-20A	Netzteil 230V/24V-20A 77005217	Phoenix Karl Elektronikbau	TRIO-PS/1AC/24DC/20 24VDC 20A	
=BA1-G2 =BA1/3.3	1			Netzgerät 230V/24V-20A	Netzteil 230V/24V-20A 77005217	Phoenix Karl Elektronikbau	TRIO-PS/1AC/24DC/20 24VDC 20A	
=BA1-K1 =BA3/1.4	1						2966294	
=BA1-Q1 =BA1/1.1	1						Q132 32A/3POL main switch	
=BA1-Q1 =BA1/1.1	1						Q132 +N-P1Z main switch	
=BA1-T1 =BA1/2.1	1			Transformator 230VAC/24VAC+55VAC 850VA	Transformator 230VAC/24VAC+55VAC 850VA 77004835	Block Transformatoren	TRAFO 850/2700	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=BA2-A1 =BA2/5.2	1			Cooling unit 24VDC; 3,8A, 75W	PK 75 77011130	RUEB	PK 75 cooling unit	
=BA2-F5 =BA2/1.1	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F5 =BA2/1.1	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F6 =BA2/1.3	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F6 =BA2/1.3	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F7 =BA2/1.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F7 =BA2/1.4	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F8 =BA2/1.6	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F8 =BA2/1.6	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F9 =BA2/2.1	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F9 =BA2/2.1	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F10 =BA2/2.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F10 =BA2/2.4	1			Feinsicherung 5x20 T 6,3A	Glasrohrsicherung 5x20 T 6,3A 65541022	Wickmann Arrow Electronics	5X20 T6,3A fuse	
=BA2-F11 =BA2/2.4	1			+++///\\\+++	Sicherungsklemme 5x20 77070248	Weidmüller Weidmüller	ZSI 2.5 fuse	
=BA2-F11 =BA2/2.4	1			Feinsicherung 5x20 T 10A	Glasrohrsicherung 5x20 T 10A 0583943	Wickmann DIS	5X20 T10A fuse	
=BA2-G3 =BA2/3.2	1			Akkupack 3,4Ah	Akkupack 3,4Ah 77004856	Beckhoff Beckhoff	C9900-U330 Accu-Pack	
=BA2+S41-K2 =BA2+S41/2.2	1			Hilfsschütz 2S+2Ö 24VDC S00	Hilfsschütz 2S+2Ö 24VDC S00 72270472	Siemens Karl Elektronikbau	3RH1122-1BB40	
=BA2+S41-K2 =BA2+S41/2.2	1			Hilfsschalterblock 2S+2Ö S00 für Hilfs- und Motorschütze	Hilfsschalterblock 2S+2Ö S00 für Hilfs- und Motorschütze 77070040	Siemens	3RH1911-1FA22	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=BA2+S41-L1 =BA2+S41/1.0	1						RN202-1/02	
=BA2+S41-L2 =BA2+S41/1.1	1						RN202-1/02	
=BA2+S41-WX41 =AB1/7.4	1	30 m		PVC connection and control cable	5G1,5 CY 0571423	Lapp	0026252	
=BA2+S41-WX42 =AB1/7.6	1	30 m		PVC connection and control cable	5G1,5 CY 0571423	Lapp	0026252	
=BA2+S41-WX422 =AB1/7.7	1	30 m		PVC connection and control cable	5G1,5 CY 0571423	Lapp	0026252	
=BA3-K1 =BA3/1.1	1						2966265	
=BA3-K2 =BA3/1.2	1						2966265	
=BA4-K1 =BA4/1.8	1			Schütz 11KW 24VDC S0	Schütz 11KW 24VDC S0 77003991	Siemens Karl Elektronikbau	3RT1026-1BB40	
=BA4-K1 =BA4/1.8	1			Hilfsschalterblock 3S+1Ö 4polig	Hilfsschalterblock 3S+1Ö 4polig 77070039	Siemens	3RH1921-1FA31	
=BA4-K2 =BA4/1.9	1			Schütz 11KW 24VDC S0	Schütz 11KW 24VDC S0 77003991	Siemens Karl Elektronikbau	3RT1026-1BB40	
=BA4-K2 =BA4/1.9	1			Hilfsschalterblock 3S+1Ö 4polig	Hilfsschalterblock 3S+1Ö 4polig 77070039	Siemens	3RH1921-1FA31	
=BA4-KNA =BA4/1.0	1			Emergency stop monitoring relay	NOT-AUS Überwachungsrelais 77004457	Allen-Bradley Karl Elektronikbau	MSR138DP emergency stop relay	
=BA4-WKNA =BA4/1.3	1		1 m	Connection and control cable	KONF 4Pol M12 fgew mger 1m 77004462	MURR	7000-40121-224-0100	
=BA6+M2-SRL1 =AB1/9.1	1						72243601 Emergency cord front	
=BA6+M2-SRL2 =AB1/9.7	1						72243601 emergency cord rear	
=BA6+M2-WSRL1 =AB1/9.3	1		3 m	Connection and control cable	KONF 4Pol M12 fgew mger 3m 77003736	Turck Turck	8046752	**72883144**
=BA6+M2-WSRL2 =AB1/9.6	1		3 m	Connection and control cable	KONF 4Pol M12 fgew mger 3m 77003736	Turck Turck	8046752	**72883144**
=BA6+M1-XSRL1 =AB1/9.2	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=BA6+M1-XSRL2 =AB1/9.7	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=CA0+P1-M1 =AB1/5.8	1			Lüftereinheit Panel-PC	Lüftereinheit Panel-PC 72291920	MCS MCS	72291920 operation desk cooler	
=CA0+P1-U2 =AB1/5.2	1				Ferritring 6,5 mm Lochdurchmesser 77004659	DIS	CORER-065B Ferrite	
=CA0+P1-U9 =AB1/5.2	1				Ferritring 6,5 mm Lochdurchmesser 77004659	DIS	CORER-065B Ferrite	
=CA0+P1-WMG2 =AB1/5.2	1		3 m	data line	KONF Patchkabel RJ45 3m Push-Pull 77005783 Modulteil	Beckhoff	C9900-K281 MGuard	
=CA0+P1-WNET =AB1/5.3	1		10 m	data line	KONF Patchkabel RJ45 10m Push-Pull 77005811	Beckhoff	C9900-K283	
=CA0+P1-WX40 =AB1/5.6	1		10 m	Anschluss- und Steuerleitung	KONF 19Pol CY M23 fger 10m 77004829	Beckhoff	128661	
=CA0+P1-WX40M =AB1/5.8	1		4 m	Connection and control cable	KONF 4Pol M12 fgew mger 4m 77070067	Weidmüller Weidmüller	SAIL-M12GM12W-4-4.0U	72883144
=CA0+P1-XM1 =AB1/5.8	1						8027469	72881344
=CA0+P1-XMG2 =AB1/5.1	1				Modulteil		RJ45 Verbinder KAT5E	
=CA2-C100 =CA0/1.3	1			Buskoppler EtherCAT	EK1100 77011135	Beckhoff Beckhoff	EK1100	
=CA2-C103 =CA2/8.4	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C107 =CA2/9.4	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C108 =CA2/11.7	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C109 =CA2/8.7	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C110 =CA2/9.1	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C111 =CA2/7.7	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C112 =CA2/8.1	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=CA2-C113 =CA2/7.1	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C114 =CA2/7.4	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C115 =CA2/9.7	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C120 =CA2/10.1	1			2-Kanal-Relais-Ausgangsklemme 230 V AC 2 x Schließer +++///\\\+++	EL2622 77011138	Beckhoff Beckhoff	EL2622	
=CA2-C121 =CA2/10.4	1			2-Kanal-Relais-Ausgangsklemme 230 V AC 2 x Schließer +++///\\\+++	EL2622 77011138	Beckhoff Beckhoff	EL2622	
=CA2-C122 =CA2/10.7	1			2-Kanal-Relais-Ausgangsklemme 125V AC 2 x Wechsler +++///\\\+++	EL2612 77011139	Beckhoff Beckhoff	EL2612	
=CA2-C123 =CA2/11.1	1			2-Kanal-Relais-Ausgangsklemme 230 V AC 2 x Schließer +++///\\\+++	EL2622 77011138	Beckhoff Beckhoff	EL2622	
=CA2-C201 =CA2/11.4	1			Einspeiseklemme +++///\\\+++	EL9100 77011141	Beckhoff Beckhoff	EL9100	
=CA2-C202 =CA2/6.7	1			Einspeiseklemme +++///\\\+++	EL9100 77011141	Beckhoff Beckhoff	EL9100	
=CA2-C301 =CA2/12.1	1			Einspeiseklemme +++///\\\+++	EL9100 77011141	Beckhoff Beckhoff	EL9100	
=CA2-C302 =CA2/12.4	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C303 =CA2/12.7	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	
=CA2-C311 =CA2/13.1	1			Ausgang 8 x positiv 500mA +++///\\\+++	EL2008 77011137	Beckhoff Beckhoff	EL2008	
=CA2-C391 =CA2/13.4	1			4-Kanal-Analog-Ausgangsklemme +/-10V +++///\\\+++	EL4034 77011201	Beckhoff Beckhoff	EL4034	
=CA2-C392 =CA2/13.7	1			4-Kanal-Analog-Ausgangsklemme +/-10V +++///\\\+++	EL4034 77011201	Beckhoff Beckhoff	EL4034	
=CA2-EL1 =CA2/13.9	1			EtherCAT Endkappe	EL9011 77011143	Beckhoff Beckhoff	EL9011	
=CA41+S41-C400 =CA0/1.7	1			Buskoppler EtherCAT	EK1100 77011135	Beckhoff Beckhoff	EK1100	
=CA41+S41-C401 =CA41+S41/1.4	1			Eingang 8 x positiv +++///\\\+++	EL1008 77011136	Beckhoff Beckhoff	EL1008	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=CA41+S41-C402 =CA41+S41/1.7	1			2-Kanal-Relais-Ausgangsklemme 230 V AC 2 x Schließer +++///\\\+++	EL2622 77011138	Beckhoff Beckhoff	EL2622	
=CA41+S41-C403 =CA41+S41/2.4	1			2-Kanal-Analog-Eingang +10...-10V +++///\\\+++	EL3102 77011202	Beckhoff Beckhoff	EL3102	
=CA41+S41-C404 =CA41+S41/2	1			2-Kanal-Analog-Eingang +10...-10V +++///\\\+++	EL3102 77011202	Beckhoff Beckhoff	EL3102	
=CA41+S41-C405 =CA41+S41/3.4	1			2-Kanal-Relais-Ausgangsklemme 125V AC 2 x Wechsler +++///\\\+++	EL2612 77011139	Beckhoff Beckhoff	EL2612	
=CA41+S41-C406 =CA41+S41/4.1	1			2-Kanal-Relais-Ausgangsklemme 125V AC 2 x Wechsler +++///\\\+++	EL2612 77011139	Beckhoff Beckhoff	EL2612	
=CA41+S41-C410 =CA41+S41/4.4	1			Netzteilklemme zur E-Bus-Auffrischung E-bus refresh 2A/5V with diagnostic	EL9410 77011215	Beckhoff Beckhoff	EL9410	
=CA41+S41-C416 =CA41+S41/4.7	1			+++///\\\+++ +++///\\\+++	KL6021 77011031	Beckhoff Beckhoff	KL6021	
=CA41+S41-C424 =CA41+S41/2	1			2-Kanal-Analog-Eingang +10...-10V +++///\\\+++	EL3102 77011202	Beckhoff Beckhoff	EL3102	
=CA41+S41-EL1 =CA41+S41/4.9	1			EtherCAT Endkappe	EL9011 77011143	Beckhoff Beckhoff	EL9011	
=EM1+F1-M77070171 =AB1/8.3	1				Modul		M77070171	**72881344**
=EM1+F1-M77070171-WXS3 =AB1/8.3	1	1 m					3x0,25	
=EM1+F1-M77070171-WXS4 =AB1/8.5	1	1 m					3x0,25	
=EM1+F1-MES =AB1/8.3	1				Mesitt G20000002	MCS MCS	G20000002 G20000002	
=EM1+F1-WXS1 =AB1/8.5	1		10 m	connection and control cable	KONF 5Pol CY M12 fger mger 10m 77004910	Beckhoff	801096	
=FH1-K11 =FK1/3.1	1						2966265	
=FH1-K21 =FK1/3.4	1						2966265	
=FK1+F1-MA1 =AB1/6.7	1		0,3 m		Masseband 2x6mm Bohrung 0,3m 77005034	Karl Elektronikbaground	33230011	
=FK1+F1-MOT =AB1/6.1	1			drive regulator	Sensomat PAN 76801001	MCS Konfektronik	76801001	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=FK1+F1-WPA =AB1/6.2	1	6 m		Potentialausgleich 1x35mm²	1x35 77005938	Lapp Lapp	4571103 polarity balance	**72883144**
=FK1+F1-WX1 =AB1/6.4	1		9 m	Connection and control cable	KONF 16Pol CY M23 fger 9m 72291716	Igus Beckhoff	800029	
=FK1+F1-WXS1 =AB1/6.8	1		10 m	connection and control cable	KONF 5Pol M12 fgew mger 10m 77004903	Weidmüller	9457271000	**72881344**
=FK1+F1-WXU =AB1/6.1	1		9 m	PVC connection and control cable	KONF 4Pol CY fger 9m 72291723	Lapp	72291723	
=FK1+F1-XS1 =FK1/2.2	1				M12 5pol mger 77002800	Binder	99 0437 12 05 port socket	
=HX1-A1 =HX1/1.0	1				Verstärker Sigma 5 Yaskawa 77005909	Yaskawa Yaskawa	SGDV-5R5A01A	
=HX1-F1 =HX1/1.1	1			Leitungsschutzschalter 1pol C10A	Leitungsschutzschalter 1pol C10A 77003797	Siemens Karl Elektronikbau	5SX2110-7	
=HX1-F2 =HX1/1.1	1			Leitungsschutzschalter 1pol C10A	Leitungsschutzschalter 1pol C10A 77003797	Siemens Karl Elektronikbau	5SX2110-7	
=HX1-V1 =HX1/1.2	1			Funk-Entstörfilter	Funk-Entstörfilter 250VAC 16A 77070154	Schurter	FMBB-0131-1610	
=HX1-V2 =HX1/1.6	1			Funk-Entstörfilter	Funk-Entstörfilter 250VAC 8A 77070131	Schurter	FMBB-0116-0810	
=HX1-WXMR1 =HX1/1.3	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HX1-WXMR2 =HX1/1.7	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HX1+M1-WB1 =AB1/4.3	1		1 m	Connection and control cable	KONF 4Pol M12 fgew mger 1m 77004462	MURR	7000-40121-224-0100	**72883144**
=HX1+M1-WB3 =AB1/4.3	1		1 m	Connection and control cable	KONF 4Pol M12 fgew mger 1m 77004462	MURR	7000-40121-224-0100	**72883144**
=HX1+M1-WB5 =AB1/4.3	1		1 m	Connection and control cable	KONF 4Pol M12 fgew mger 1m 77004462	MURR	7000-40121-224-0100	**72883144**
=HX1+M1-WCN2 =AB1/2.3	1		10 m	Encoder connection cable	KONF Encoder Yaskawa 10m 77005911	Yaskawa Yaskawa	JZSP-CSP21-10-E-G2	
=HX1+M1-WXM =AB1/2.2	1		10 m	Motor connection cable	KONF Motorleitung Yaskawa 10m 77005913	Yaskawa Yaskawa	JZSP-CSM23-10-E-G2	
=HX2-A1 =HX2/1.0	1				Verstärker Sigma 5 Yaskawa 77005909	Yaskawa Yaskawa	SGDV-5R5A01A	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=HX2-WXMR1 =HX2/1.3	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HX2-WXMR2 =HX2/1.7	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HX2+M2-WCN2 =AB1/2.7	1		10 m	Encoder connection cable	KONF Encoder Yaskawa 10m 77005911	Yaskawa Yaskawa	JZSP-CSP21-10-E-G2	
=HX2+M2-WXM =AB1/2.6	1		10 m	Motor connection cable	KONF Motorleitung Yaskawa 10m 77005913	Yaskawa Yaskawa	JZSP-CSM23-10-E-G2	
=HY1-A1 =HY1/1.0	1				Verstärker Sigma 5 Yaskawa 77005909	Yaskawa Yaskawa	SGDV-5R5A01A	
=HY1-WXMR1 =HY1/1.3	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HY1-WXMR2 =HY1/1.7	1			PVC Anschluss- und Steuerleitung	3G1,5 CY 0551076	Lapp	0026250	
=HY1+F1-WCN2 =AB1/3.3	1		10 m	Encoder connection cable	KONF Encoder Yaskawa 10m 77005911	Yaskawa Yaskawa	JZSP-CSP21-10-E-G2	
=HY1+F1-WXM =AB1/3.2	1		10 m	Motor connection cable	KONF Motorleitung Yaskawa 10m 77005913	Yaskawa Yaskawa	JZSP-CSM23-10-E-G2	
=HY1+O1-WB2 =AB1/4.7	1		10 m	connection and control cable	KONF 5Pol M12 fgew mger 10m 77004903	Weidmüller	9457271000	**72883144**
=HY1+O1-WB4 =AB1/4.7	1		10 m	connection and control cable	KONF 5Pol M12 fgew mger 10m 77004903	Weidmüller	9457271000	**72883144**
=HY1+O1-WB6 =AB1/4.7	1		10 m	connection and control cable	KONF 5Pol M12 fgew mger 10m 77004903	Weidmüller	9457271000	**72883144**
=IM1+S41-L3 =IM1+S41/1.0	1			Interference suppression filter	Entstörfilter im Gehäuse 72291948	MCS Karl Elektronikbau	72291948	
=IM1+S41-PAM =IM1+S41/2.1	1			Passiv-Analog-Modul	PAM 76801015	MCS KARL	Passiv-Analog-Modul	
=IM1+S41-V1 =IM1+S41/4.1	1						Diode ZPD15	
=IM1+S41-V2 =IM1+S41/4.1	1						Diode ZPD15	
=IM1+S41-V3 =IM1+S41/4.1	1						Diode ZPD15	
=IM1+S41-V4 =IM1+S41/4.1	1						Diode ZPD15	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=IM1+S41-V5 =IM1+S41/4.3	1						Diode ZPD15	
=IM1+S41-V6 =IM1+S41/4.3	1						Diode ZPD15	
=IM1+S41-V7 =IM1+S41/4.3	1						Diode ZPD15	
=IM1+S41-V8 =IM1+S41/4.3	1						Diode ZPD15	
=IM1+S41-WBUS2 =AB1/7.1	1		30 m	data line	KONF Patchkabel RJ45 30m 77004661	Groh	CAT5 SFTP HIROSE/AMP/SUN/ 30m	
=IM1+S41-WXRS =IM1+S41/4.3	1			data line	8x0,25 CY	Lapp Karl Elektronikbau	0034408	
=IM1+S41-1X3M =AB1/7.1	1		0,5 m	D-Sub 37 plug adaptor	KONF Plasmaschnittstelle HPR, HSD 77005668	MCS Karl Elektronikbau	Global 2 Stecker Neu interface module	
=IM1+S41-1X3M-WX90 =AB1/7.2	1			PVC Anschluss- und Steuerleitung	18x0,5 CY	Lapp Lapp	0034618	
=IM1+S41-1X3M-WXRS =AB1/7.3	1			data line	8x0,25 CY	Lapp Karl Elektronikbau	0034408	
=IM1+I1-WHPR =AB1/7.2	1		4,5 m	+++///\\\+++	KONF 37x22AWG 4,5m 72423104	Hypertherm	123211 Plasma	72881403
=IM1+I1-WREM =AB1/7.5	1		4,5 m	connection and control cable	Konf HPR130-400 Remote 72416403	MCS	72416403 Plasma	
=IM1+I1-WWST =AB1/7.6	1		4,5 m	connection and control cable	Konf HPR130-400 Brennspannung GC 4,5m 72416401	MCS MCS	72416401 Plasma	
=LD1-T1 =LD1/1.2	1				DC/DC Konverter 18-75VDC 12VDC 2A 77070093	Traco Power Traco Power	TCL 024-112 DC	
=LD1+F1-KLD =AB1/1.5	1				Ferritring 6,5 mm Lochdurchmesser 77004659	DIS	CORER-065B Ferrite	
=LD1+F1-WX1 =AB1/1.6	1	12 m		Anschluss- und Steuerleitung	3G0,5 CY 77070094	Lapp Lapp	0026201	
=LD1+F1-X1 =AB1/1.5	1				M12 5pol fgew schirmbar 77005997	Binder Binder	99 1436 822 05 plug connection	
=LD1+F1-X2 =AB1/1.5	1				M12 5pol mger schirmbar 77070092	Binder Binder	99 1439 814 05 plug connection	
=MB1+A1-WS8 =AB1/4.7	1			PVC Anschluss- und Steuerleitung	3G1 CY 0551042	Lapp	0026231	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=MB1+A1-XS8 =AB1/4.6	1				M12 5pol mger 77002800	Binder	99 0437 12 05 plug connection	
=VA0+M1-WX1 =AB1/4.4	1		10 m	actor-sensor-box	KONF Sensor/Aktor-BOX-8fach 10m 77003999	MURR	27083	
=VNA0+M2-WSNA =AB1/9.4	1		3 m	Connection and control cable	KONF 4Pol M12 fgew mger 3m 77003736	Turck Turck	8046752	
=VNA0+M2-X1 =AB1/9.4	1			M12 Not-Halt-Box-8fach mit Anschlussstecker	M12 Not-Halt-Box-8fach mit Anschlussstecker 72291950	MURR MCS	72291950 emergency stop periphery	
=VNA0+M2-XP3 =AB1/9	1				M12 Not-Halt Kodierstecker 4Pol 77005150	MURR MURR	332779 jumper plug	
=VNA0+M2-XP4 =AB1/9	1				M12 Not-Halt Kodierstecker 4Pol 77005150	MURR MURR	332779 jumper plug	
=VNA0+M2-XP5 =AB1/9.4	1				M12 Not-Halt Kodierstecker 4Pol 77005150	MURR MURR	332779 jumper plug	
=VNA0+M2-XP6 =AB1/9.5	1				M12 Not-Halt Kodierstecker 4Pol 77005150	MURR MURR	332779 jumper plug	
=VNA1+M1-S1 =AB1/10.1	1						77005253 foot protection front left	
=VNA1+M1-S2 =AB1/10.7	1						77005253 foot protection front right	
=VNA1+M1-S3 =AB1/10.1	1						77005253 foot protection rear left	
=VNA1+M1-S4 =AB1/10.7	1						77005253 foot protection rear right	
=VNA1+M1-WS1 =AB1/10.3	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA1+M1-WS2 =AB1/10.6	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA1+M1-WS3 =AB1/10.3	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA1+M1-WS4 =AB1/10.6	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA1+M1-WVNA =AB1/10.4	1		7,5 m	Connection and control cable	KONF 4Pol M12 fgew mger 7,5m 77003737	Weidmüller	9457310750	
=VNA1+M1-XS1 =AB1/10.2	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	

Device tag list

P8GC_ARTLIST

Device tag Placement	Quantity	variable length	ready-made length	Designation of devices	Typenumber / Specification Messer item No.:	manufacturer supplier	part number function text	part list index
=VNA1+M1-XS2 =AB1/10.7	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA1+M1-XS3 =AB1/10.2	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA1+M1-XS4 =AB1/10.7	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA1+M1-XVNA =AB1/10.4	1			Sensor/Aktor-Passiv-Verteiler 4-fach M12 mit Flanschstecker M12 4pol M20	Sensor/Aktor-Passiv-Verteiler 4-fach M12 mit Flanschstecker M12 4pol M20 72291951	MCS MCS	M72291951 foot protection	
=VNA2+M2-S1 =AB1/11.1	1						77005253 foot protection front left	
=VNA2+M2-S2 =AB1/11.7	1						77005253 foot protection front right	
=VNA2+M2-S3 =AB1/11.1	1						77005253 foot protection rear left	
=VNA2+M2-S4 =AB1/11.7	1						77005253 foot protection rear right	
=VNA2+M2-WS1 =AB1/11.3	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA2+M2-WS2 =AB1/11.6	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA2+M2-WS3 =AB1/11.3	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA2+M2-WS4 =AB1/11.6	1		3 m	Connection and control cable	KONF 4Pol M12 fger mger 3m 77005615	ESCHA	AL-WAK4-3-WAS4/S370	
=VNA2+M2-WVNA =AB1/11.4	1		1 m	Connection and control cable	KONF 4Pol M12 fgew mger 1m 77004462	MURR	7000-40121-224-0100	
=VNA2+M2-XS1 =AB1/11.2	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA2+M2-XS2 =AB1/11.7	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA2+M2-XS3 =AB1/11.2	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA2+M2-XS4 =AB1/11.7	1		0,5 m	M12 Flanschstecker 4pol	M12 4pol Flanschstecker 77005407	ESCHA ESCHA	8027481 plug connection	
=VNA2+M2-XVNA =AB1/11.4	1			Sensor/Aktor-Passiv-Verteiler 4-fach M12 mit Flanschstecker M12 4pol M20	Sensor/Aktor-Passiv-Verteiler 4-fach M12 mit Flanschstecker M12 4pol M20 72291951	MCS MCS	M72291951 foot protection	