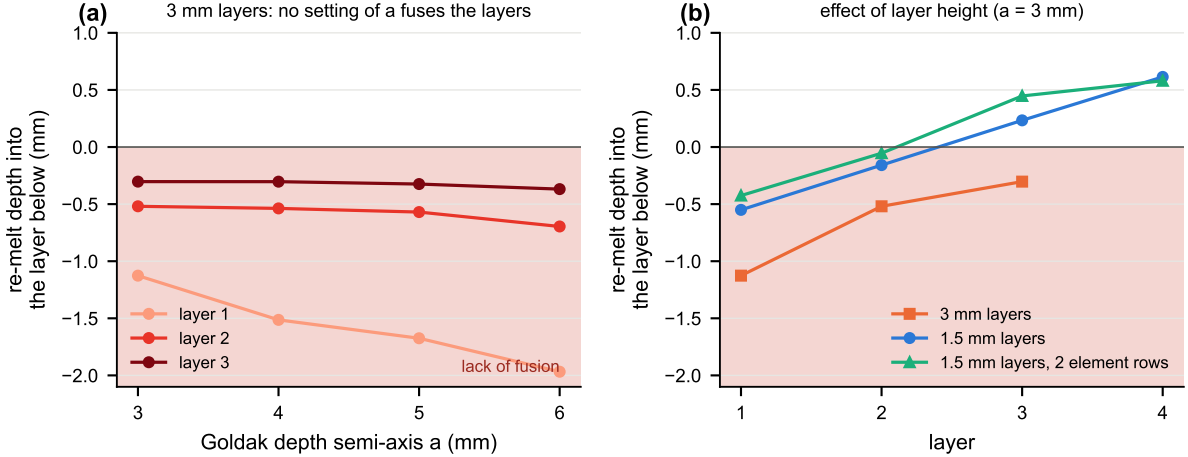
(a)
3 mm layers: no setting of a fuses the layers
re-melt depth into the layer below (mm)
1.0
0.5
0.0
−0.5
−1.0
−1.5
−2.0
layer 1
layer 2
layer 3
lack of fusion
3
4
5
6
Goldak depth semi-axis a (mm)
(b)
effect of layer height (a = 3 mm)
re-melt depth into the layer below (mm)
3 mm layers
1.5 mm layers
1.5 mm layers, 2 element rows
1
2
3
4
layer