REMOTE SOURCE

888-769-8806

inquiries@remotesource.net

www.remotesource.net

Sample specifications

The following information shall be filled in by the sample production unit:

Supplier: Shenzhen Chuangrongfa Electronics Co., Ltd.

Supplier material/model: A121RF616B0001

Item Name: Bluetooth Air Mouse Remote Control Kit

Customer Part Number: 101B ONEVIEW

Sample delivery approved	Inspection and verification	Approval confirmation

Sample submission content:

Stamped with official seal:

O Sample ( )

O Drawings, specifications

O Main inspection items and implementation standards for materials

O Reliability test report

O RoHS Compliance Test Report

Note: Suppliers should submit their applications in the order listed above; failure to do so will result in disqualification.

The following content is filled in by the customer:

Confirmor	judgement	Remark

SPECIFICATION FOR APPROVAL

SUPPLIER:	
MANUFACTURER:	
PART LOGO:	101B ONEVIEW
PART NAME:	Bluetooth air mouse remote control
SPEC. TYPE:	A121RF616B0001
MONOMER NET WEIGHT:	93g (±3g)
DATE:	2026.2.7
QUALITY GRADE:	
CHIP PROGRAM	HB9261
FIRMWARE VERSIONS:	1.0.6

MANUFACTURER		
DRAFTER	CHECK	APPROVER

Release Notes	Change content	Modifier	Change time
V1	first output	B24100002	2026.2.7
V2	Add packaging information	B24100002	2026. 4. 22
V3	Jpdated ID image (added laser engraving B24100002 to the bottom shell)		2026. 4. 27
V4	Add Dongle diagram	B24100002	2026. 5. 22
V5	Update packaging image	B24100002	2026. 6. 1
V6	Test dynamic current of B24100002 with backlight off;		2026.6.4
V7	update packaging image. Update quiescent current range	B24100002	2026. 6. 11

Remote control specification sheet	
Product name	Bluetooth air mouse remote control
Product model:	RF616B
Sample quantity:	5pcs
Sample reference:	Customer samples
Whether it complies with ROHS:	yes
Battery type:	AAA alkaline battery (size 5), shipped without battery.
Does it come with an instruction manual? (External instruction manual and back label instruction manual)	No
Button color type, button	silk screen
Conductive material (full-bottle/partial-bottle/non-bottle)	Quanguozi
Surface treatment	Material, mold texturing treatment
Does it come with a nameplate (silk screen/sticker)?	No.

:

Customer Name/Customer: RemoteSource Company Number/CO. P/N: A0341

Date: 2026-02-07 Date: 2026-02-07

Remote control manufacturer's signature:

INSPECTED BY VERIFIED BY APPROVED BY

examine: Review: approval:

Remarks:

Table of contents:

1. Specification book cover

2. Table of Contents

3. Raw material requirements

4. Inspection Content and Requirements

5. Remote control appearance diagram and code value

6. List of raw materials for the remote control

7. Remote Control Schematic Diagram

8. Remote control structural dimension drawing

9. Remote control packaging image

3. Raw material requirements:

NO	project	Testing Requirements
3.2	PCB board thickness requirements	The PCB is made of double-sided FR4 material, with a thickness of 1.2mm ± 0.1mm and a copper foil thickness greater than 25um. It uses OSP and carbon ink.
3.3	PCB copper foil thickness requirements	PCB copper foil thickness: greater than 25um.
3.4	Transmitter wafer size	The size of the transmitter chip is not less than 12 mil.
3.5	Conductive rubber button feel coefficient	k > 20% Except for dome remote controls; in special cases, the actual sealed sample shall prevail.).
3.6	Carbon resistance value	Using a 0.5 deg * 0 linewidth grid test board, under a 500g positive pressure, the carbon particle resistance should be less than 100 ohms and the carbon oil resistance should be less than 200 ohms.
3.7	Shell raw materials	ABS + ≤10% sprue
3.8	Product size	190mm*46mm*25.5mm(±2mm)

4. Inspection Content and Requirements

4.1 Electrical performance requirements

NO	Project	Testing Requirements
4.1.1	Peak infrared irradiance of the remote control	Under ambient illuminance of 200±50 lx under natural light or fluorescent lamps, and with the remote control powered at its rated operating voltage, measurements were taken using an infrared peak radiometer. At a distance of 0.5 m between the remote control's transmitting point and the peak radiometer's receiving point along their horizontal and vertical axes, each button on the remote control was pressed to emit infrared light signals. The linear IR power was 240 uW/cm², and the horizontal IR power at a 30° angle was 220 uW/cm².
4.1.2	Infrared remote control distance	Remote control distance: 210 meters in a straight line; 25 meters in a horizontal direction (30°); 25 meters in a vertical direction (45°).
4.1.3	RF remote control distance	1. Bluetooth: In open and unobstructed areas, the button distance is ≥10m (Bluetooth reception is normal in 360° direction).

inquiries@remotesource.net 888-769-8806 remotesource.net

4.1.4	dynamic current	After turning off the backlight, test the operating current with an ammeter. Bluetooth ≤ 30mA, infrared ≤ 45mA.
4.1.5	Quiescent current	0-7uA
4.1.6	High and low working voltage test	It must function normally within a voltage range of 2.4V-3.6V (including normal learning and remote control capabilities).
4.1.7	Remote control button battery life experiment	The remote control was placed on a button life tester with batteries inserted, and tested 500,000 times with 100 presses per minute and 300g pressure. It should work normally after being removed (using alkaline batteries).
11.8	Discharge test	Air voltage = ±8KV, contact discharge = ±6KV, capacitance: 150pF, resistance: 3300hm. Functions and components are undamaged.
4.1.9	Battery radiation anti-interference and battery radiation EM	According to EN 55013, EN61000.-4-2, EN61000-4-3.
4.1.10	Infrared carrier frequency	Using a PC tester, the carrier frequency is: 38kHz ± 500Hz. 36kHz ± 500Hz
4.1.11	Reverse battery connection	After reversing the battery for 1 minute, remove the battery, reinstall it correctly, and test the remote control's operation. The remote control works normally, and the reversed test shows no continuity.
4.1.12	Carbon particle/carbon oil resistance test	Using a 0.5*0.5mm linewidth grid test board, under a 500g positive pressure, the carbon particle resistance should be less than 100 ohms and the carbon oil resistance should be less than 200 ohms.

4.2 Hardware Test Indicators

Test content	test items	Test method	Judgment criteria	Actual measurement result	Test instrument
	Crystal oscillator frequency deration	Use a probe to test the trace between the crystal and the chip (do not touch the pins; solder mask can be used for contact).	<10PPM	4.8PPM	spectrum analyzer
	2. Antenna transmit power/-carrier frequency offset	Using an adjustable power supply, adjust the voltage to 3VDC to power the PCBA. Send a test command from the host computer to put the PC BA into RF fixed-frequency transmission mode.	Transmitting power:/	Center frequency: 2.440GHz +30kHz	Spectrum analyzer

inquiries@remotesource.net 888-769-8806 remotesource.net

		With the PCBA antenna end of the controller close to the spectrum analyzer coupling plate, test the RF signal transmit power and frequency offset:			
	3. Power supply ripple (NA)	Press and hold the voice button to test the ripple of each power supply pin.	VPP must be less than 150mV (Bluetooth only)		
	4. Battery working life	Based on 8 hours of daily use, 16 hours of standby time, 300 button presses per day, 10 minutes of voice prompts per day, and 2 AAA 700mAh batteries, the lifespan of the remote control is calculated as follows:	Requirements>7 months	A. 16-hour standby power consumption: 16^ * 0.0018 = 0.0288mAh B. Button power consumption: 300*1.139 * 0.3s / 3600s = 0.0285mah C. 10min-Word Power consumption: 12.23 * 10min / 60 * min = 1.8 * 85 mAh D. 7.8 hours of operation Static power consumption: 7.8 * 0.07-0.546 mAh Total power consumption: + 0.0285 + 1.885 + 0.5462.488 mAh Total: 700/2.488/30~9.38 mAh 41.86	Oscillo-scope/Set-top Box
	5. Dynamic power consumption	Infrared button current: In infrared mode, press any button on the remote control to read the maximum operating current of the infrared button (tested with the OK button); Bluetooth button operating current: With Bluetooth connected and in Bluetooth mode, briefly press any button to read the maximum current value (tested with the OK button).	Bluetooth ≤30mA, Infrared ≤45mA	mA; 28.26 mA	
	6. Quiescent current	Current without connection	0-70A	4.4 UA	

4.3 Mechanical Performance Requirements

serial number	Category	Specification	Require
4.3.1	Appearance	All exterior parts should be visually inspected at a distance of 30 cm from the front line of sight.	According to our company's remote control quality specifications,
4.3.2	Alcohol test (for ordinary paint and screen-printed products)	A 500g load-bearing test rod (with a lint-free cloth wrapped around the bottom) was soaked in 95% alcohol and pressed onto the sample. The rod was then rubbed back and forth at a speed of 40 times/min, with a test distance of approximately 20mm. No color fading, peeling, or exposure of the substrate was observed after the test. Spray painting/screen printing: 50 coats; UV/PU paint: 100 coats.	after alcohol resistance testing, the spray-painted parts showed no color fading, peeling, or exposure to the substrate; the screen-printed parts showed no broken lines or scratches, and were clearly visible to be considered(qualified).
4.3.3	Hardness Test (for ordinary paint products)	Mount the pencil on a dedicated pencil hardness tester (750g load, 45" angle between the pencil and the horizontal plane), push the pencil 5mm to make 5 marks (at different locations), then erase the pencil marks with an eraser. No coating damage is acceptable; minor indentations at the starting point are permissible. Ordinary paint has a hardness of HB; UV paint has a hardness of 2H.	The coating must not be worn through, the primer must not be exposed, and the substrate must not be exposed. The screen printing must be free of defects such as broken strokes, scratches, and fading. (Refer to our company's remote control quality specifications.)
4.3.4	abrasion resistance test (for ordinary paint and screen-print-ed products)	A FABER-CASTELL 7017R eraser was attached to the bottom of a 500g test rod, and the surface was rubbed back and forth at a speed of 40 times/min, with a test distance of about 20mm. There was no obvious fading or showing through to the substrate. 30 rounds of screen printing; 100 rounds of UWPU paint:	No peeling or exposed substrate, silkscreened parts should have no broken lines or scratches, and should be clearly visible to be considered (qualified). (Refer to our company's remote control quality specifications).
4.3.5	3M adhesive tape test (for screen printing)	Completely adhere the screen-printed area with 3M 600 tape, then peel off the tape at a 45° angle within 1 second. Repeat this process 3 times, using fresh tape each	For the first and second applications, the silkscreen paint should not peel off. For the third application, the area of paint peeling off should be s5% (refer to our company's remote control quality specifications)
4.3.6	Cosmetic resistance test (screen printing)	Apply Nivea cream to the printed pattern, covering the printed pattem to be tested by 15 * 15mm After standing for 24 hours, wipe it clean and perform a visual inspection.	The wiping cloth must be free of printing ink; the printed pattern should be clear and legible, without peeling or broken lines. (Refer to our company's remote control quality specifications.)
4.3.7	Sweat Resistance Test (Silkscreen Printing)	Test conditions: a) The test solution consists of: 400ml purified water, 8g sodium chloride, 7g ammonium chloride, 2g urea, 1ml acetic acid, 6ml lactic acid, and a small amount of sodium hydroxide, pH = 4.7 b) Filter paper soaked in the solution is attached to the surface and back of the sample, the product is sealed in the filter paper, and then placed in a constant temperature water bath at 40±2°C for 48 hours.	Judgment criteria: The filter paper must not be stained, and the outer surface must not show signs of corrosion or delamination to be considered (qualified). (Refer to our company's remote control quality specifications)
4.3.8	Hundred grid test (Surface spray painting)	Using a cross-cut scribing tool, make 11 horizontal and 11 vertical cuts, spaced approximately 1mm apart, to create 100 small squares. Use a brush or remove any paint dust from the cut areas. Completely adhere the cross-cut area with 3M 600 tape, then peel it off at a 45° angle within one second. Repeat this process three times, using fresh tape each time.	The edges of the 100-square grid test lines should be smooth, and the area of detachment should be s 5% (if the test area is less than 100 squares, the detachment area should be judged proportionally) (refer to our company's remote control quality specifications).
4.3.9	Key operating force	The operating force is tested by pressing the button vertically downwards at its center using a 4mm diameter test head.	All buttons: 240±100g
4.3.10	Button rebound	Press any button at any position	The buttons should not be stuck on the top cover.

4.3.11	Button life	Place a remote control with standard batteries on the button life testing machine and test the OK button and any other button in sequential mode. After testing, the remote control should still be able to transmit codes normally; the buttons should feel normal and without any abnormalities. (Refer to the grade standard)	There must be no mechanical, electrical, or functional failures.
4.3.12	Battery cover opening and closing life	Continuous opening and closing of the battery cover 100 times	The opening and closing force of the battery should not change significantly, and there should be no abnormalities.
1.3.13	Battery cover opening and closing	The battery cover can be opened and closed with normal force.	It should be able to open smoothly without any tools.
4.3.14	Battery contact elasticity	The spring rebound force is tested when the negative electrode spring is compressed to the height that the smallest battery can be compressed to.	The rebound force should not be less than 3N.
4.3.15	Battery installation	Try installing the largest and smallest remote controls according to the diagram below. 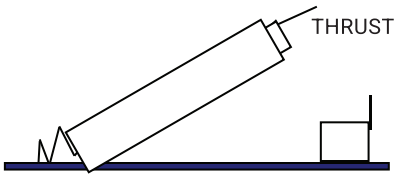	The battery should install smoothly
4.3. 16	Drop test	The battery-operated remote control was dropped from a height of 80cm onto a wooden floor at least 3cm thick, with all six sides and four corners landing on it.	If the latch falls off but can be reinstalled and the remote control worksnormally, it is considered(qualified). The appearance and function should be checked and found to be normal
4.3.17	Packaging Vibration Test	The intact box of remote controls was placed on a vibration test bench and subjected to vibration at a frequency of 10Hz-30Hz-10Hz and an amplitude of 1.5mm. The vibration direction was vertical, and the test lasted for 2 hours.	The tested remote control must not have any functional failures.
4.3.18	Packaging drop test:	The intact box of remote controls was placed on a drop test platform and dropped from a height of 60cm onto the platform. Three sides, one side, and one corner need to be tested. Test order: X, Y, Z, sides, corners 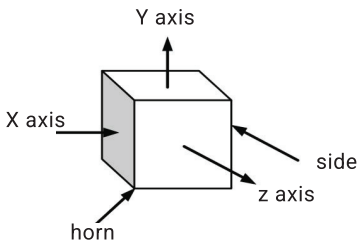	The tested remote control must not have any functional failures.

4.4 Environmental Testing Requirements

serial number	Category	Test conditions	Specification requirements
4.4.1	High temperature storage test	Temperature: 60°C Humidity:NA Storage time: 48 hours Number of samples: 5 PCs After being left at room temperature for one hour, no functional or appearance problems were observed.	After testing under the following conditions, check that the electronic and mechanical functions meet the requirements of this specification.
4.4.2	Low-temperature storage test	Temperature: -25°C Humidity:NA Storage time: 48 hours Number of samples: 5 PCs After being left at room temperature for one hour, no functional or appearance problems were observed.	After testing under the following conditions, check that the electronic and mechanical functions meet the requirements of this specification.
4.4.3	Constant moisture and heat storage	Temperature: 55°C Humidity: 93±3% Storage time: 96 hours Number of samples: 5 PCs After being left at room temperature for one hour, no functional or appearance problems were observed.	After testing under the following conditions, check that the electronic and mechanical functions meet the requirements of this specification.
4.4.4	Temperature shock storage test	High temperature 60°C (2 hours), Low temperature -30°C (2 hours), Switch time (3 minutes), 5 cycles 1. Test after leaving at room temperature for one hour; no functional defects are allowed. 2. The coating has no abnormalities in appearance, such as peeling, cracks, or discoloration.	After testing under the following conditions, check that the electronic and mechanical functions meet the requirements of this specification.
4.4.5	High temperature aging	The remote control was fitted with batteries and placed in a high-temperature aging est chamber at 45°C for 96 hours. All functions of the remote control were tested mside the chamber; no abnormalities were observed. The remote control was checked every 24 hours.	It meets the electrical performance parameters of the remote control, there are no mechanical or appearance abnormalities such as deformation or discoloration.
4.4.6	Salt spray test	Temperature: 35 deg C plus/minus 2 deg C Humidity: 85% RH Density: 1.030 and 1.040 Volume collected at horizontal level: (2 plus/minus 1 ml / h) / 80 c m ^ 2 NaCl concentration: 5% Ph =6.5 ~7.2 Duration: 48 hours Drying time: 48 hours	All metal parts were free of rust, but rust may be present at the cut edges.
4.4.7	Packaging and Transportation Tests: Drop Test	The entire box of products was dropped from a height of 60cm to the ground, and tests were conducted on three axes, one side, and one corner. As shown below:	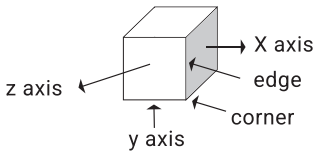
4.4.8	Packaging requirements	The PE bags for remote controls must meet environmental protection requirements, have a silkscreened recycling label, and be subject to standardized barcode management.	
4.4.9	ROHS	RoHS testing should comply with environmental protection requirements. (Routine testing)	

5. Remote control appearance diagram and code value

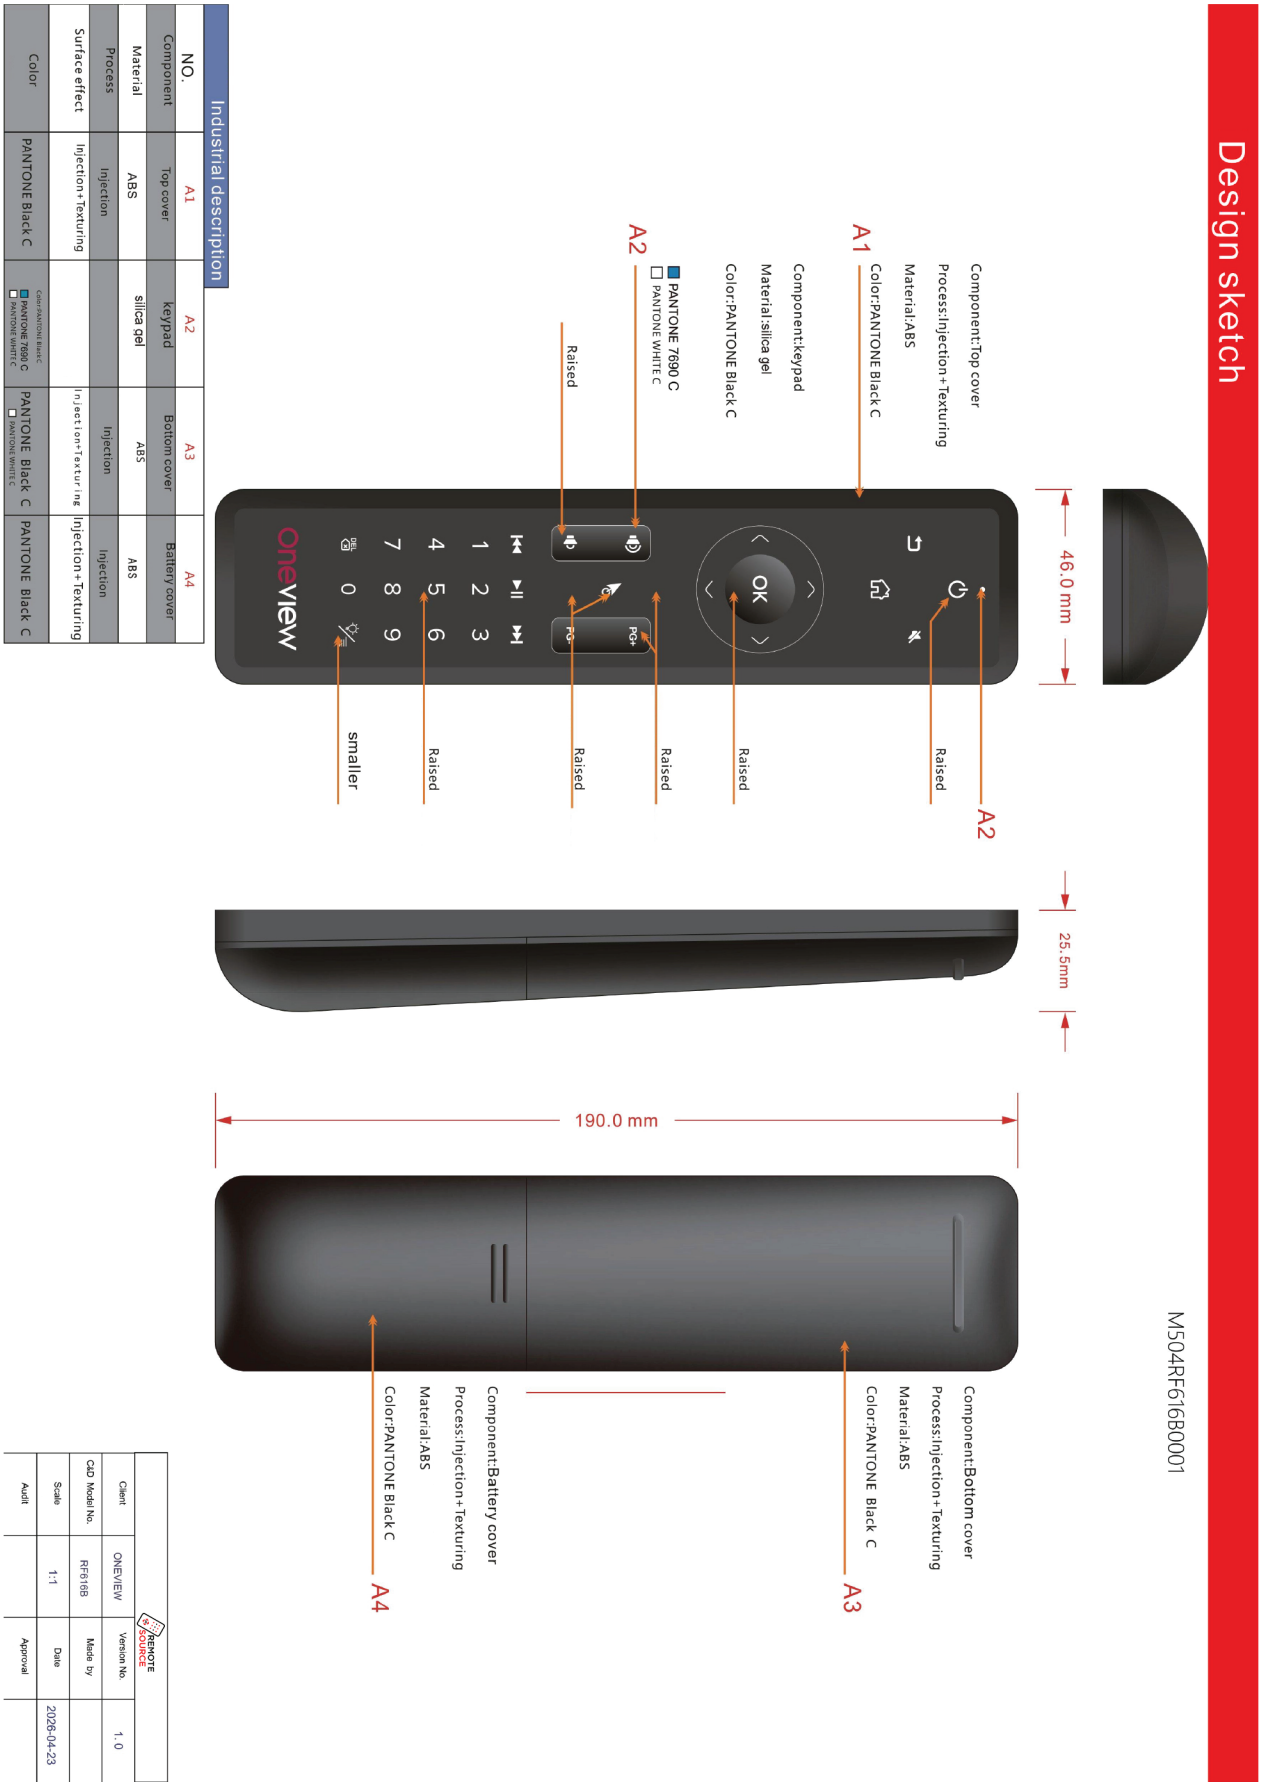

Screen printing file

PVC Color:PANTONE Black C

Silicone Buttons: M504RF616B0001

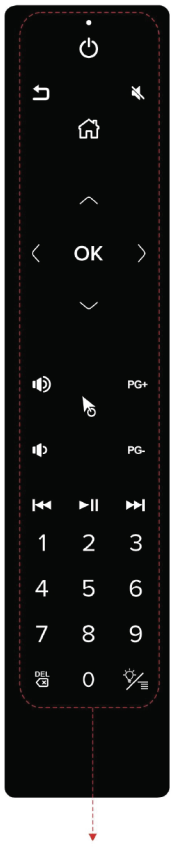

This part of the characters needs to be transparent

The standard offset for the silkscreen printing on raised buttons is +0.1mm.

Character screen printing color

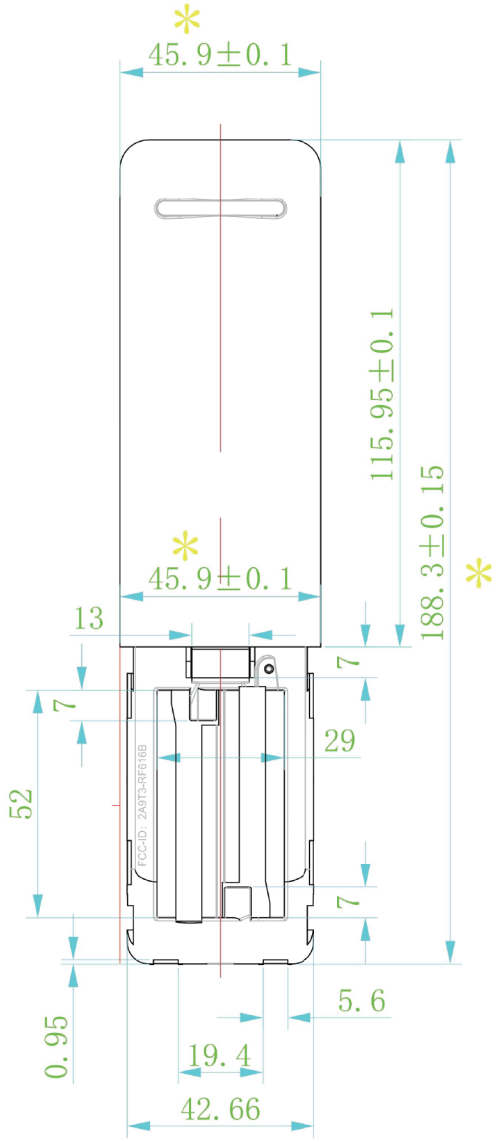

Laser-engraved back cover: S4042RC0388001

Client	ONEVIEW	Version No.	1. 0
C&D Model No.	RF616B	Made by	
Scale	1:1	Date 日期	2026-04- 23
Audit		Approval	

remotesource.net
888-769-8806
inquiries@remotesource.net

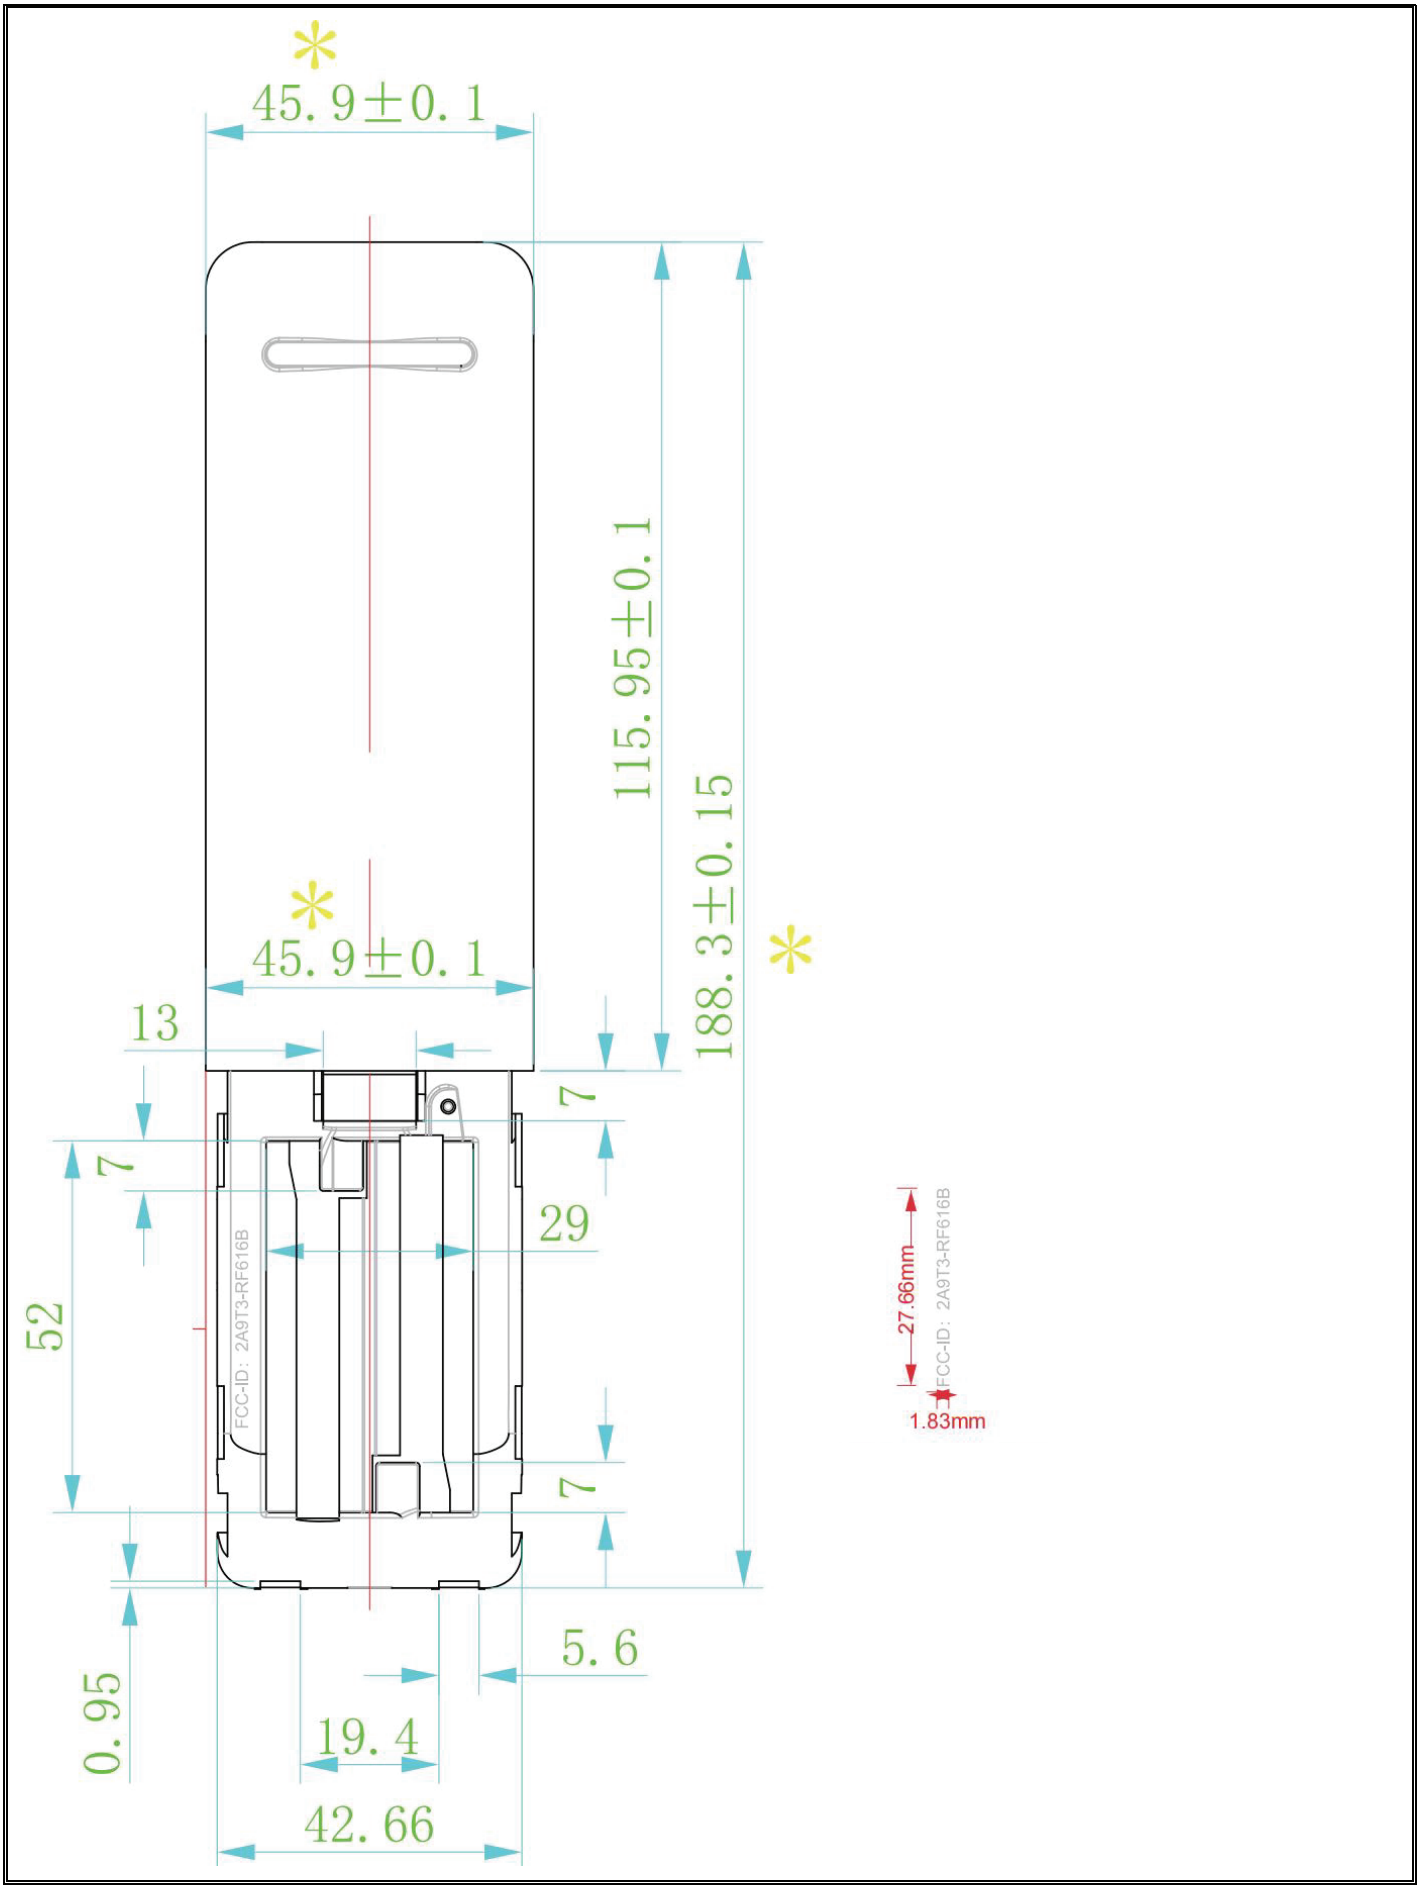
45.9±0.1
115.95±0.1
188.3±0.15
45.9±0.1
13
7
7
29
52
7
0.95
5.6
19.4
42.66
FCC-ID: 2A9T3-RF616B
27.66mm
1.83mm
FCC-ID: 2A9T3-RF616B

Dongle:

Code value and function description:

RF616B Bluetooth Air Mouse Remote Control Specifications

2.4G & BT5.0 Dual Mode Wireless Air Mouse

2.4G & Bluetooth 5.0 Dual-Mode Wireless Air Mouse Remote Control

How to use the IR Programming

The operation steps of infrared programming are as follows:
(take learning the power button on the infrared remote control as an example)

1. Press and hold the power button of this product for 3 seconds. When the indicator light flashes slowly, prompt to enter the IR programming mode.

2. Position this product and your TV remote head-to-head on a flat surface with 1 inch apart, press the power button of your IR remote control, then The indicator light will go out after flashing, indicating that the infrared programming is completed.

3. There are two buttons (power button and (Mute Button can be used infrared programed for this product, and the programming operation can refer to steps 1-2.

Press and hold the Power + Del buttons for 5 seconds, The indicator light flashes to prompt restore to the factory settings.

How to Change the Cursor Speed

Please hold OK button and then click Volume - You will get a slower speed successfully when the LED light changes from blink to solid.

Please hold OK button and then click Volume+ You will get a faster speed successfully when the LED light changes from blink to solid.

inquiries@remotesource.net 888-769-8806 remotesource.net

Backlight function:

After the battery is installed, the backlight function is automatically turned on. Long press the Menu button ☰ to turn off/on the backlight.

The duration of backlight after activation is 5s, and it needs to be activated again after 5s. Press any key can activation the backlight.

Low battery reminder:

The red light flashes slowly when the AAA battery power of the product is lower than 2V. It means that the battery need to be replaced at this time.

Sensor Calibration:

Automatic calibration: when the device works, the cursor may drift due to changes in voltage and temperature. Please place the device on flat desktop and keep it still. After the device turns into quiescent mode, wake up again to complete calibration.

Manual calibration: press and hold the OK button OK and install the battery at the same time. After the red LED light turns from flashing to normally on, place the product flat on the desktop and wait for the indicator to turn to flashing, then complete the manual calibration.

How to Use

For initial use, plug a USB receiver into the USB port of device and wait for 20-60 seconds to install driver of USB receiver. Move the mouse, the mouse cursor can move on the screen means that pairing is successful.

If it is unsuccessful, press and hold OK OK and Back buttons ↩ , LED light begin to flash. Pairing is successful when LED light stop flashing.

inquiries@remotesource.net 888-769-8806 remotesource.net

Note:

1). Air mouse functions:

Some multi-media device maybe is not available for air mouse, so if the key OK OK doesn't work during device working, please end close air mouse pointer and try again.

2). Infrared transmission program:

2 keys of infrared program can be available for many popular television, voice devices and A/V receiver, but it is not suitable for all kinds of brands and items. As some remote control cannot be infrared programmed due to Bluetooth or wireless radio frequency technology. Or as the infrared remote control may use an unusual/unique infrared code number, in this case, we cannot program successfully.

3). Battery power:

Please make sure that the battery is sufficiently charged. When the battery is low, the brightness of the backlit and the stability of the air mouse cursor will be affected.

4). Space under work

The actual space of this device will be affected by the electronic magnetic field. Please make sure that there is no electromagnetic interference in the working space.

Description of BT pairing and deleting pairing information.

1. Before using this device, first you must turn on the BT function of the main device.

2. Then long press"OK"+"Return" keys, when the LED turns to flash quickly, the product enters the pre pairing.

3. Click "add search new devices" on the main device to find this air remote's name (Example: G20S PRO), Click the name can to connecting.

4. After the product is successfully connected, the direction of the mouse pointer can be controlled by waving in the air.

5. If the connection is not successful, please perform the operation steps of item 2-4 again.

6. Reconnent efficiency description: The normal reconnent time of this product is 3-5 seconds after it is normally paired with the main equipment.

7. This product can only remember the pairing information of one main device. when the product is connected to a new device, the connection of historical devices is not supported after.

8. in this case, you need to delete the historical connection information of this peripheral can be successfully matched for new search.

inquiries@remotesource.net 888-769-8806 remotesource.net

Ir Protocol: Nec		Custom Code: 0x01fe	Ble
Number	Icon	Ir Code	Usage Id
1		01 FE 40 BF	07 94
2		01 FE 41 BE	0C E2
3	PG+	01 FE F1 0E	07 4B
4		01 FE 00 FF	
5	Pg-	01 FE F2 0D	07 4E
6		01 FE 16 E9	07 52
7		01 FE 51 AE	07 50
8	OK	01 FE 13 EC	0C 41
9		01 FE 50 AF	07 4F
10		01 FE 1A E5	07 51
11		01 FE 19 E6	0C 224
12		01 FE 11 EE	0C 223
13		01 FE 10 EF	0C EA
14		01 FE 43 BC	
15		01 FE 18 E7	0C E9
16		01 FE 4B B4	0C B6
17		01 FE 5A A5	0C CD
18		01 FE 4F B0	0C B5
19	1	01 FE 4E B1	07 1E
20	2	01 FE 0D F2	07 1F
21	3	01 FE 0C F3	07 20
22	4	01 FE 4A B5	07 21
23	5	01 FE 09 F6	07 22
24	6	01 FE 08 F7	07 23
25	7	01 FE 46 B9	07 24
26	8	01 FE 05 FA	07 25
27	9	01 FE 04 FB	07 26
28	DEL	01 FE 42 BD	07 2A
29	0	01 FE 01 FE	07 27
30		01 FE 4C B3	07 65

inquiries@remotesource.net 888-769-8806 remotesource.net

6. Remote control raw material list

Remote control:

Name	Specification	Bit Number	Quantity	Unit	Cardinality
PCB	V1.1/FR-4/2-layer/OSP+carbon oil /295*155mm/1.6mm/35um/White/Green		1	Pcs	1
Programming IC	HB9261/QFN-32//SMT Pre-programming/Supplier Programming	U1	1	Pcs	1
IC	ME2135A33M6G/SOT23-6/1.8V-5.5V/DC-DC	U2	1	Pcs	1
IC	ICM-42670-P/LGA14/TDK	U4	1	Pcs	1
crystal oscillator	24MHz/9PF/±10PPM/SMD3225	Y1	1	Pcs	1
capacitance	2. 2UF/6.3V/X5R/±10% 0402	C7, C8	2	Pcs	1
capacitance	0.1uF/25V/X5R/±10% 0402	C4, C14, C23	3	Pcs	1
capacitance	3P/50V/NP0/±0.25P/0402	C9, L2	2	Pcs	1
capacitance	10uF/16V/X5R/±10% 0603	C10, C11, C12	3	Pcs	1
capacitance	Multilayer capacitor/General purpose/22uF/16V/±20%/0805/X5R	C13	1	Pcs	1
capacitance	10NF/25V/X7R/±10% 0402	C15	1	Pcs	1
capacitance	4.7uF/25V/X5R/±10% 0603	C22	1	Pcs	1
capacitance	100nF/16V/X7R/±10%	C24	1	Pcs	1
capacitance	22PF/50V/NP0/±5%/0402	C28, C29, C30, C31, C32	5	Pcs	1
resistance	SMD/Standard/10KΩ/±5%/0402/1/16W	R1, R9	5	Pcs	1
resistance	SMD/Standard/1KΩ/±5%/0402/1/16W	R2, R3, R5, R6, R7, R8, R10, R23, R26, R27, R28, R29, R30, R31, R32, R33, R16, R34	18	Pcs	1
resistance	Patch/Standard/12/±5%/0805/	R4	1	Pcs	1
resistance	20KΩ ±5% 0402	R11	1	Pcs	1
resistance	Patch/Standard/100Ω/±5%/0402/1/16W	R12	1	Pcs	1
resistance	2.2Ω±5% 0805	R15	1	Pcs	1
resistance	470Ω±5% 0402	R17	1	Pcs	1
resistance	4.7KΩ ±5% 0402	R19, R20	2	Pcs	1
diode	Surface Mount/Rectifier/RB551V-30/Vrm: 30V, -40°C~125°C/SOD323	D33, D34	2	Pcs	1
light emitting diode	SMD/Positive Emitting/White/0603/1.8*0.8mm/SMD1808 BIN: 2#	D2, D3, D4, D5, D6, D7, D8, D10, D11, D12, D15, D16, D17, D18, D19, D20	16	Pcs	1
light emitting diode	Patch/Positive Emitting/Red/0603/Red/0603/19-213/R6C-AP1Q2B/5T	D21	1	Pcs	1

diode	Surface Mount TVS/ESD5451N/Bidirectional, Vrwm: 5V, 55°C~125°C5/DFN1006-2L	D9	1	Pcs	1
triode	Surface Mount/Small Signal/PNP/SS8550 Y * 2 / I * C = 1.5A / H =200 sim350/SOT-23/ (For Vietnam Use Only)	Q1	1	Pcs	1
triode	SS8050 Changdian Y1 SOT23	Q2, Q3	2	Pcs	1
inductance	1.5nH/0402//SDCL1005C1N5BTDFM01	L1	1	Pcs	1
PCB slices	144.32*35/Φ5/29/180	C3 D1	1	Pcs	1
capacitance	47UF/10V±20% 4*7 DIP		1	Pcs	1
Infrared emission tube	Plug-in /LIRK201413Z-3.5-3.6/940nm/42mW/sr/36de g/3mm		1	Pcs	1
spring	Positive electrode spring wire diameter? 0.6MM, no plating required.		1	Pcs	1
spring	Negative electrode spring wire diameter? 0.6MM, no plating required.		1	Pcs	1
spring	Connecting spring wire diameter? 0.6MM, no plating required.		1	Pcs	1
Beer plastic noodle shell	0001 Injection Molded ABS Black with Textured Finish		1	Pcs	1
Laser engraving bottom case	Injection molding ABS758 + black pigment with infrared light transmission + etching		1	Pcs	1
Beer plastic battery cover	Injection Molded ABS Black + Textured		1	Pcs	1
Beer plastic button bracket	0001 Injection Molded ABS Black		1	Pcs	1
Beer plastic sunshade	0001 Injection Molded ABS Black		1	Pcs	1
silicone button	15.2g/1/2/1 color printing/1 coat printing/4/White spray + black spray + laser engraving + LOGO ONEVIEW/14		1	Pcs	1
Self-tapping screws	KA1.7*6.0MM Black Zinc Plated		1	Pcs	1
PE bag	260*80*0.05mm PE material		1	Pcs	1

Receiver:

name	Specification	bit number	quantity	unit	Cardinality
PCB	V1.0/FR-4/2-layer/Immersion Gold/23.8*11.9mm/0.8-0.7mm/35um/White/Green		1	Pcs	1
Programming IC	HB9266B/sop8//SMT pre-programming/supplier programming	U1	1	Pcs	1
resistance	Surface Mount/General Purpose Resistor/12/±5%/0201/50mW	R1	1	Pcs	1
capacitance	Multilayer capacitor / General / 10pF/25V/5%/0201/	C4	1	Pcs	1
capacitance	luF/6.3V/X5R/±20%/0201	C2, C3	2	Pcs	1
TVS tube	Patch TVS/SMF6.0A/Unidirectional/Vrmw: 6.0V, Ipp: 19. 4A/SOD-123FL/Mark: AG	VZ1	1	Pcs	1
crystal oscillator	Patch/24MHz/10PPM/12PF/10PPM/-40°~85°/Y1 ±1ppm/2520		1	Pcs	1
Beer plastic noodle shell	RF091K front cover ABS		1	Pcs	1
Beer plastic bottom case	RF091K bottom shell ABS		1	Pcs	1
USB hardware	USB hardware accessories 12mm*12mm*4.5mm		1	Pcs	1
packaging bag	Self-sealing zipper bag PE /// 40*60MM //		1	Pcs	1

inquiries@remotesource.net 888-769-8806 remotesource.net

Package:

name	Specification	bit number	quantity	unit	Cardinality
sticker	TZ-RC38B-01 Outer Carton Sticker 100*75mm Coated Paper Printed by Our Factory		1	Pcs	88
flat card	370*220 mm Material: A3B		6	Pcs	88
Packing box	Dimensions: 400 x 240 x 243 mm (Length Width Height) K=K Blank Box		1	Pcs	88
Pallet	1000*1000*120MM Timber Export Sterilization Pallet		1	Pcs	3, 520
comer protector	L-shaped corner protectors (width) 950*50*50mm, thickness 5mm, high-density paper plate		2	Pcs	3, 520
comer protector	L-shaped corner protectors, 1200*50*50mm, 5mm thick, high-density cardboard.		4	Pcs	3, 520
comer protector	L-shaped corner protectors (length) 790*50*50mm, 5mm thick, high-density paper. plate		2	Pcs	3, 520

inquiries@remotesource.net 888-769-8806 remotesource.net

7. Remote control schematic diagram

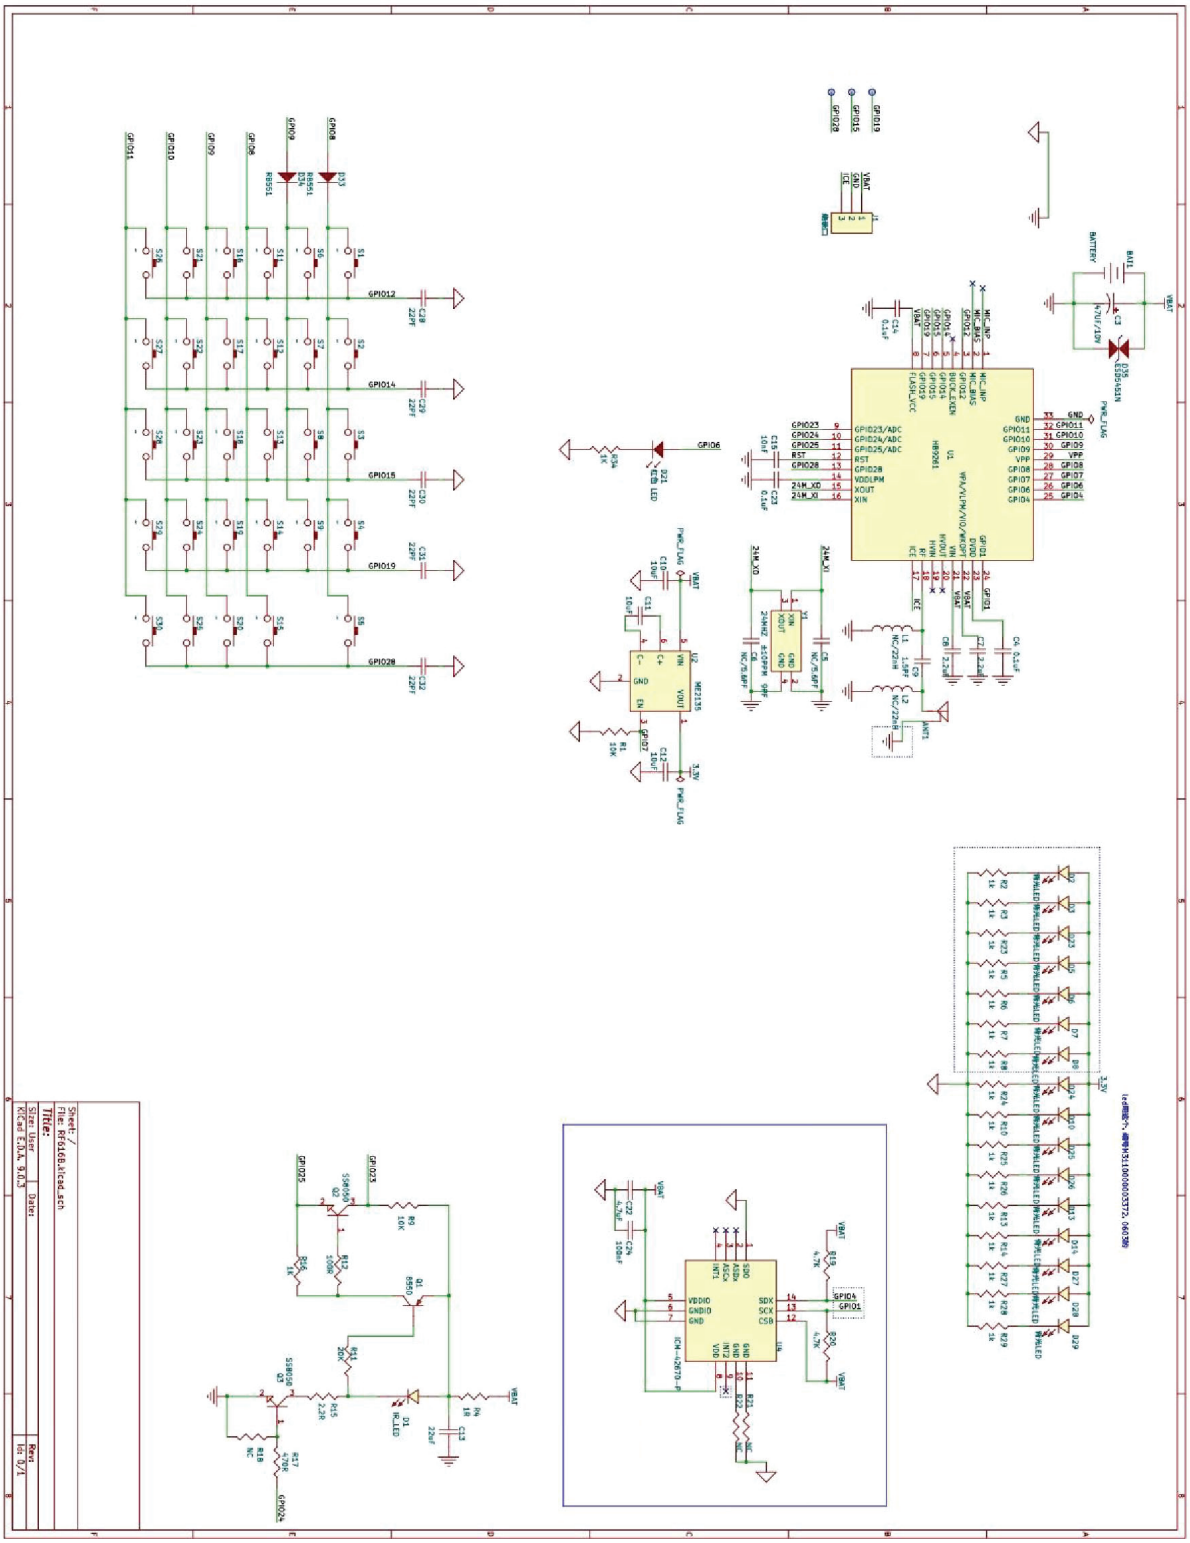

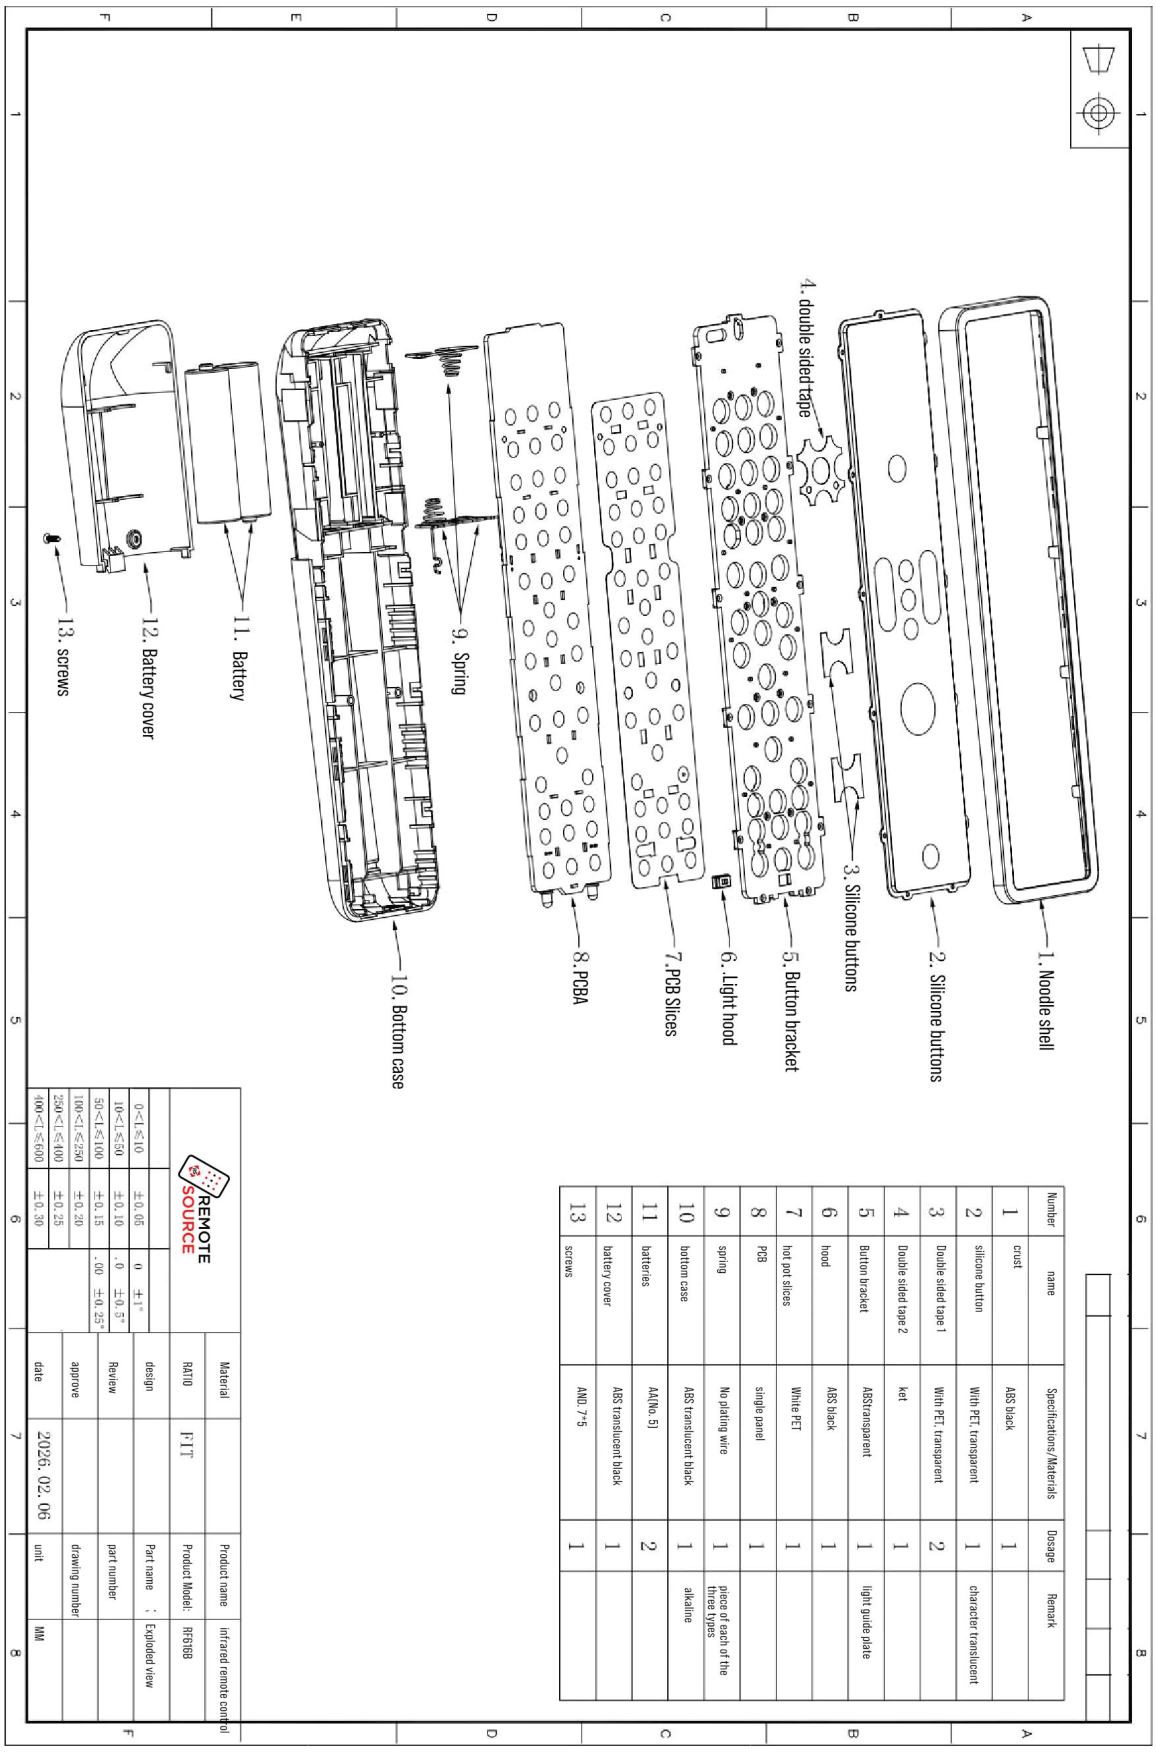

Number	name	Specifications/Materials	Dosage	Remark
1	crust	ABS black	1	
2	silicone button	With PET. transparent	1	character translucent
3	Double sided tape 1	With PET. transparent	2	
4	Double sided tape 2	ket	1	
5	Button bracket	ABStransparent	1	light guide plate
6	hood	ABS black	1	
7	hot pot slices	White PET	1	
8	PCB	single panel	1	
9	spring	No plating wire	1	piece of each of the three types
10	bottom case	ABS translucent black	1	alkaline
11	batteries	AA(No. 5)	2	
12	battery cover	ABS translucent black	1	
13	screws	AND 7*5	1	

REMOTE SOURCE			Material		Product name: infrared remote control
RATIO	FIT			Product Model:	RF616B
design				Part name	Exploded view
Review				part number	
approve				drawing number	
date	2026. 02. 06			unit	MM

0<L≤10	±0.05	0 ±1°
10<L≤50	±0.10	.0 ±0.5°
50<L≤100	±0.15	.00 ±0.25°
100<L≤250	±0.20	
250<L≤400	±0.25	
400<L≤600	±0.30	

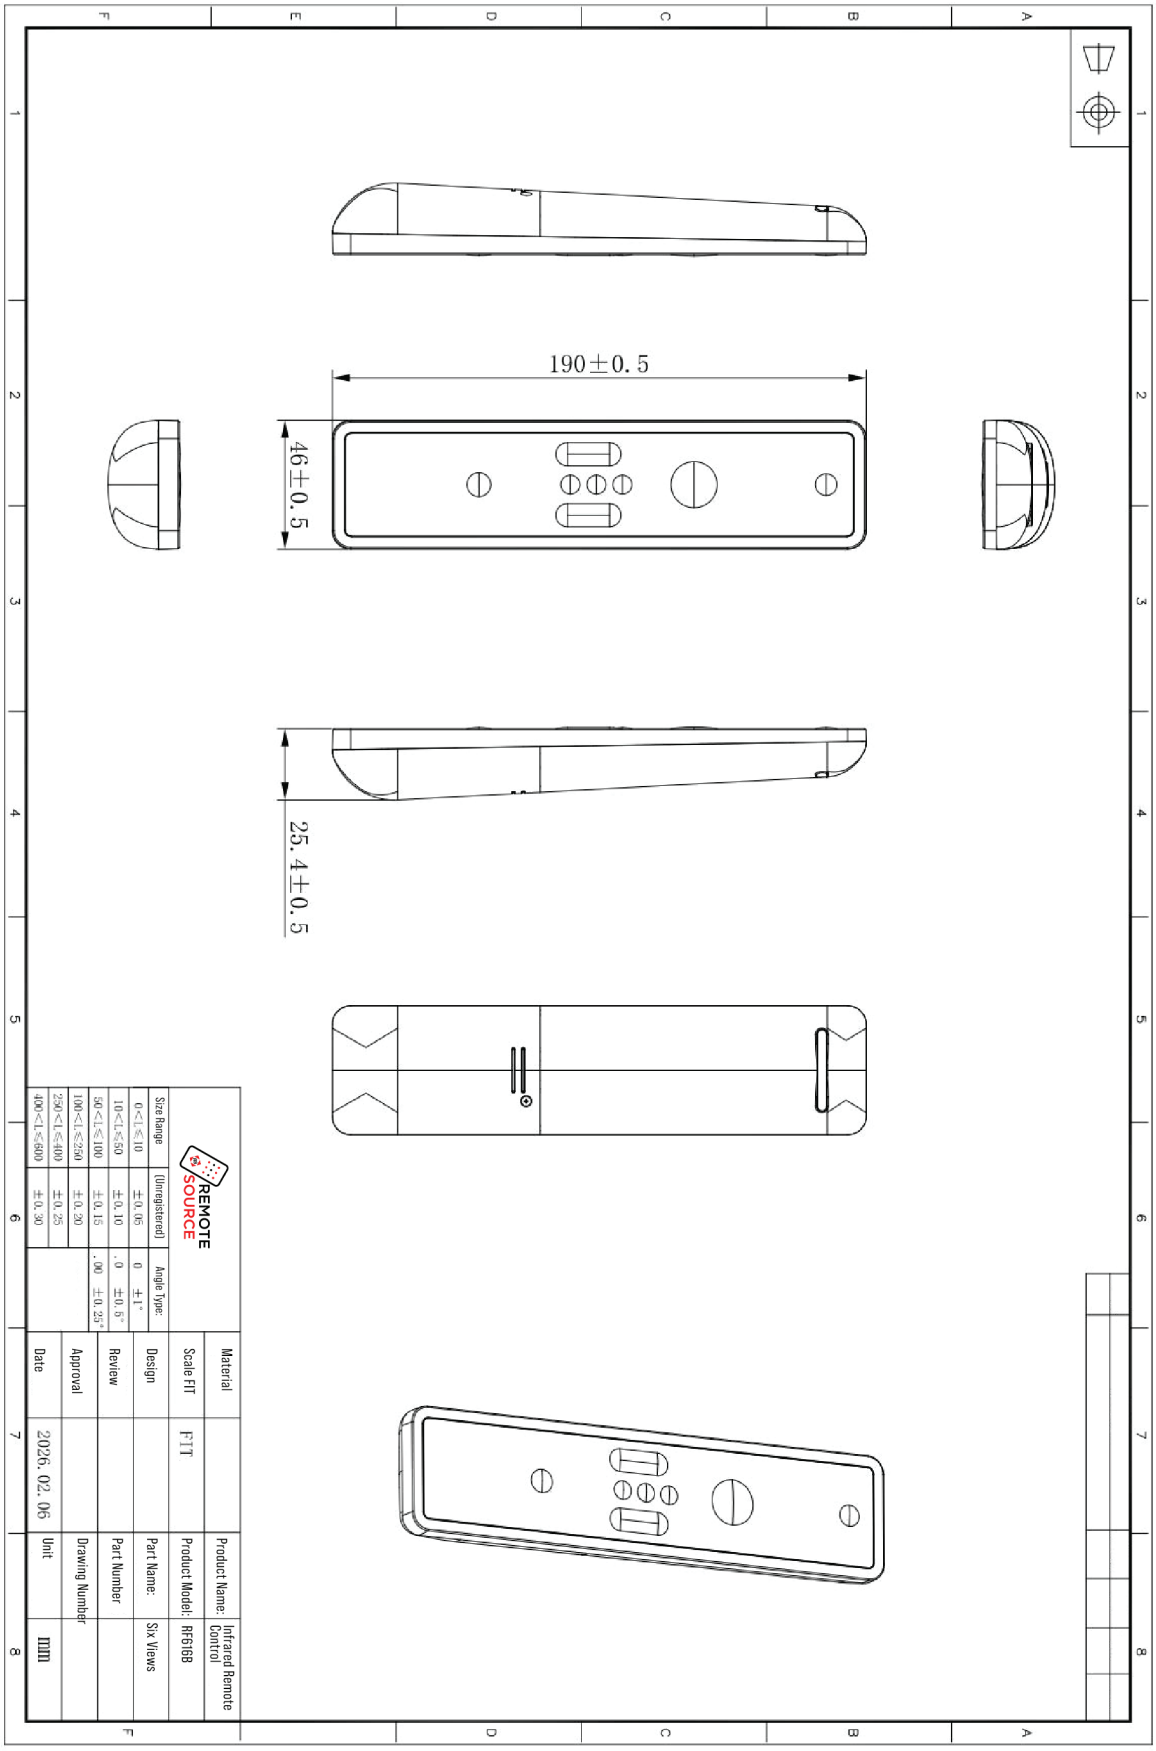
190±0.5
46±0.5
25.4±0.5
REMOTE SOURCE
Material
Scale FIT
Design
Review
Approval
Date
2026.02.06
Unit
mm
Product Name: Infrared Remote Control
Product Model: RF616B
Part Name: Six Views
Part Number
Drawing Number
Size Range
(Unregistered)
Angle Type:
0<L≤10
10<L≤50
50<L≤100
100<L≤250
250<L≤400
400<L≤600

9. Universal packaging diagram for remote controls

REMOTE SOURCE

Number

Date

Package material size photos:

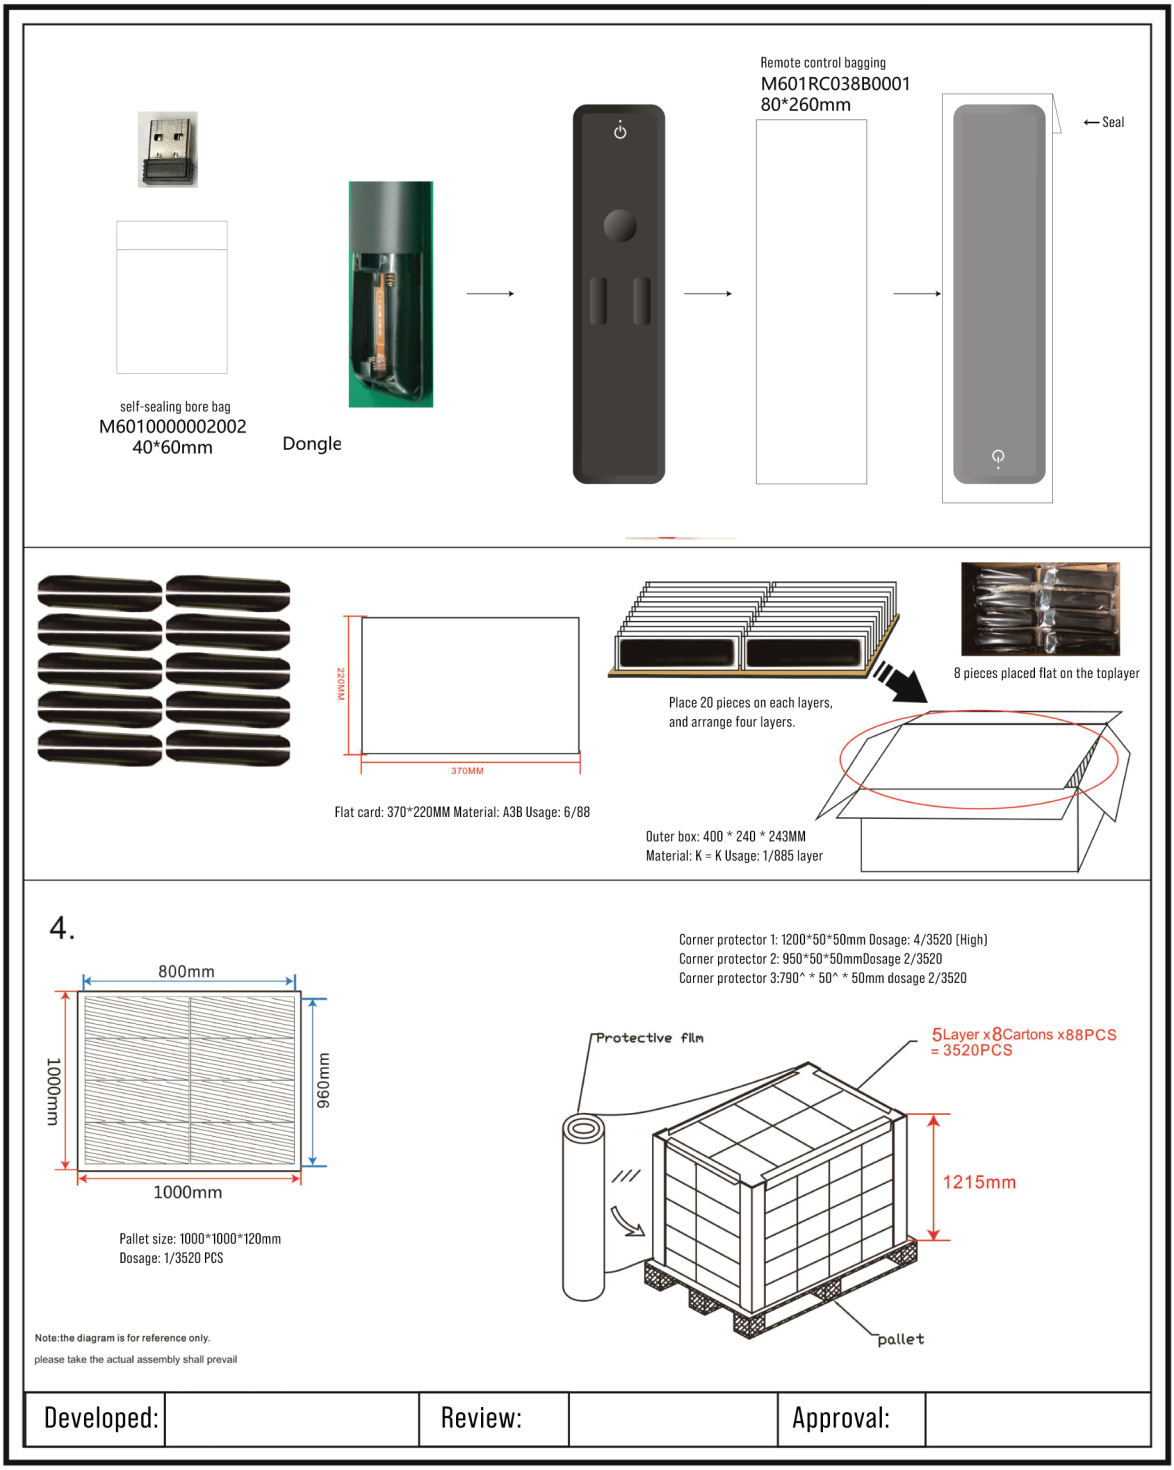

Developed:		Review:		Approval:	

REMOTE SOURCE

888-769-8806
inquiries@remotesource.net
www.remotesource.net