
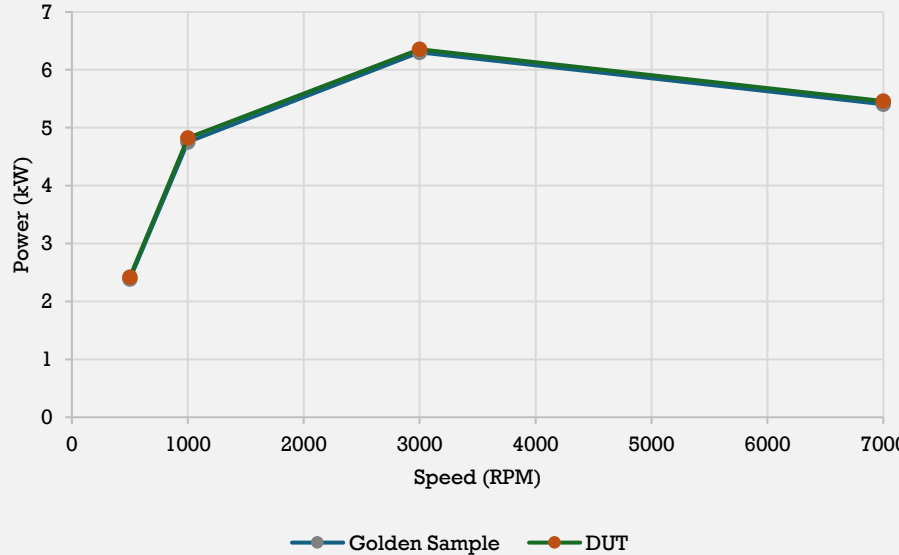


End of Line Report				Confidentiality Note: This report contains proprietary and confidential information intended solely for the use of authorized personnel. Any unauthorized disclosure, distribution, or reproduction of this document or its contents is strictly prohibited.								ABHINAVA RIZEL							
Program Name:		Firefly Motor														Motor Code:		ML2A05-C01	
Motor Model:		ML2A														Serial no:		A260523A000057	
Datasheet				Back-EMF				Validation Checklist											
Parameter	Golden Sample	DUT	Deviation	Speed	Golden Sample	DUT	Deviation	Parameter	Compliance										
Model	ML2A05A-51V_P05	A260523A000057	-	500	4.80	4.81	0.12%	Back EMF	OK										
Nominal DC Voltage	51	51	-	1000	9.50	9.49	-0.14%	Peak Power	OK										
Peak Power	6.58	6.35	-	1500	14.26	14.21	-0.30%	Peak Torque	OK										
Peak Torque	45.60	46.26	-	2000	18.99	18.92	-0.37%	Characterstics Curves	OK										
Peak Current - AC	240	240	-	3000	28.50	28.42	-0.28%	Average Efficiency	OK										
Motor Max Speed	7200	7200	-	4000	38.02	37.91	-0.28%												
Document Ref.	AR_Golden Sample Report			5000	47.55	47.40	-0.31%												
				5500	52.32	52.14	-0.34%												
Comparison - Torque Specs			Comparison - Power Specs				Comparison - Group Efficiency Specs												
Speed	Golden Sample	DUT	Deviation	Speed	Golden Sample	DUT	Deviation	Speed	Golden Sample	DUT	Difference								
500	45.57	46.26	1.51%	500	2.39	2.42	1.51%	500	51.50	52.35	1.66%								
1000	45.37	46.06	1.52%	1000	4.75	4.82	1.52%	1000	65.87	67.10	1.88%								
3000	20.06	20.23	0.83%	3000	6.30	6.35	0.83%	3000	86.51	88.32	2.09%								
7000	7.37	7.45	1.06%	7000	5.40	5.46	1.06%	7000	85.67	88.97	3.85%								
Peak Torque (Golden sample & DUT) 				Peak Power (Golden sample & DUT) 				Group Efficiency (Golden sample & DUT) 											
Integration Details		sin min	1190	cos min	1182	sin max	2853	cos max	2831	sinP-P	1663	cosP-P	1649	Offset	766.00				
Electrical PDI		Leakage current(mA)		1.09		Insulation Resistance(MOhms)		9999		RESISTANCE(mOhms)		18.42							
END OF LINE RESULT				PASS		Comment		Tested by		Approval									
						Motor tested at 35°C; winding resistance was higher and found acceptable within limits.		GMN - 23 May 2026		This is a system-approved document; signatures are not required.									

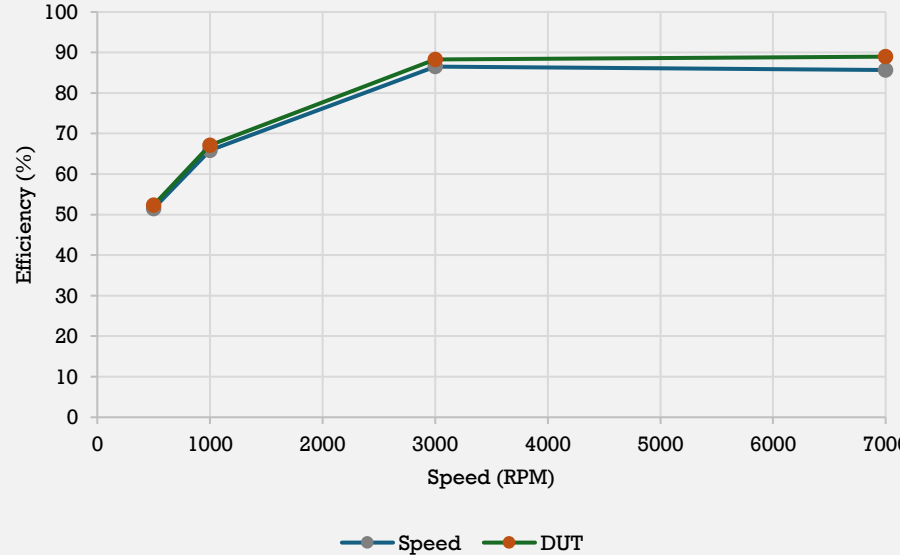