

The Robert Sorby Ring tool is for use in **end-grain**, working out from the centre in order to cut with the grain. They are ideal for the insides of goblets and large end-grain holloware of all kinds.

The following instructions will enable you to achieve good, safe results when using the Ring tool.

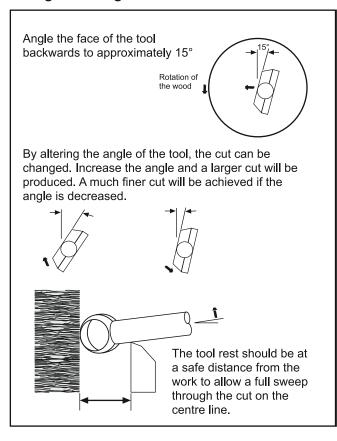

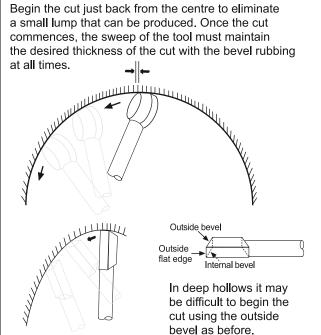

In this situation, begin the cut using the ouside flat edge


on the wood with the internal bevel controlling the cut.

Then when there is more room for handle movement,

complete the cut using the outside bevel again.

Sharpening and tool care

It is recommended that a fine slip stone or diamond file is used to sharpen the cutting edgeof the Ring tool.




The Robert Sorby Ring tool can be used on lathes that have outboard facility that run in reverse as well as normal lathes. Due to the way th tool is used there are two different areas that require sharpening, depending on the direction of the lathe rotation.

These areas are shown here as either side of 9 o'clock.

A. Area in use when cutting with the lathe rotating clockwise.

B. Area in use when cutting with the lathe rotating anti-clockwise.



Sharpen the edges with the slip stone or diamond file as shown here. Ensure that the shape of the ring is maintained throughout this process.

If accidental damaged should occur, such as a chip in the cutting edge, it is possible to remove the damaged area by using a fine cone shaped grinding stone. Place the stone inside the ring and gently remove the required amount to re-new the cutting edge.



Robert Sorby

Athol Road Sheffield England S8 0PA

Tel: +44 (0) 1142250700 Fax:+44 (0) 1142250710 sales@robert-sorby.co.uk www.robert-sorby.co.uk