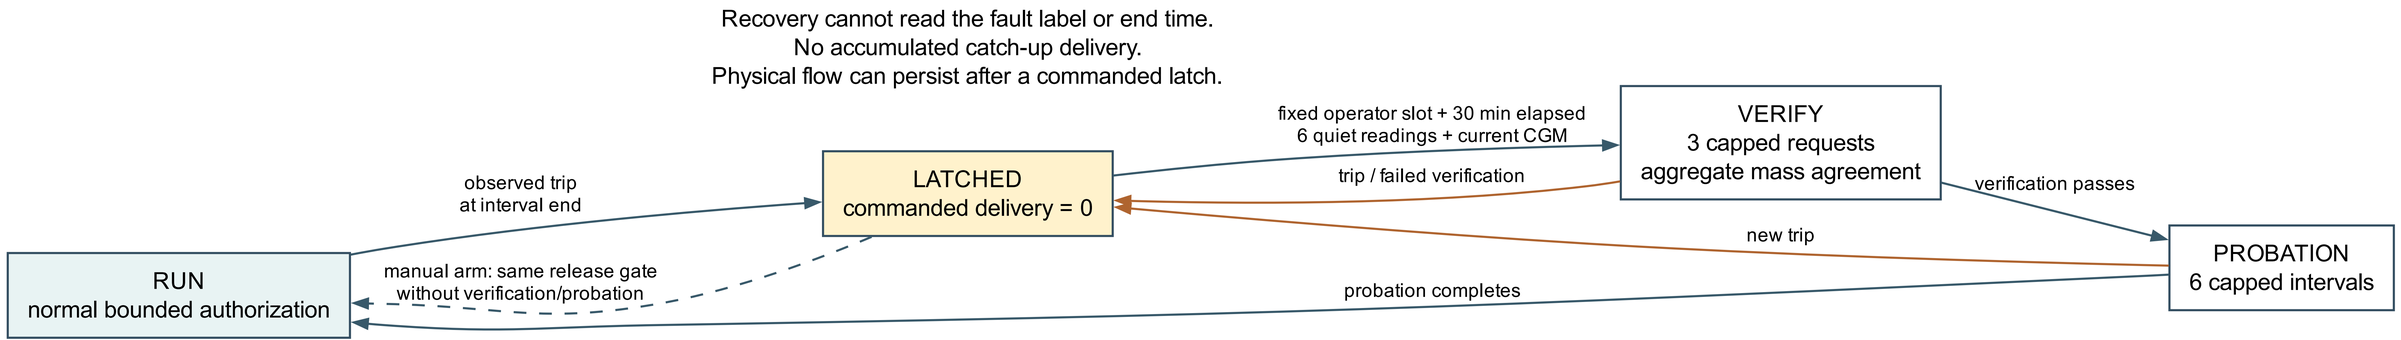
Recovery cannot read the fault label or end time.
No accumulated catch-up delivery.
Physical flow can persist after a commanded latch.
RUN
normal bounded authorization
observed trip
at interval end
LATCHED
commanded delivery = 0
fixed operator slot + 30 min elapsed
6 quiet readings + current CGM
VERIFY
3 capped requests
aggregate mass agreement
trip / failed verification
verification passes
PROBATION
6 capped intervals
new trip
manual arm: same release gate
without verification/probation
probation completes