


भारत सरकार
Government of India
रेल मंत्रालय
MINISTRY OF RAILWAYS

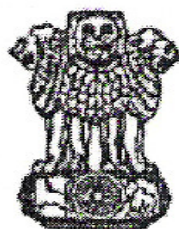

सत्यमेव जयते

रेलों के फ़्लैश बट वेल्डिंग हेतु नियमावली
Manual for Flash Butt Welding of Rails

(पुनर्मुद्रण अप्रैल - 2022)
(Reprint- April 2022)

(Incorporated up to ACS No. 5)

अनुसंधान, अभिकल्प एवं मानक संगठन, लखनऊ -11

Research, Design and Standards Organisation, Lucknow-11



CONTENTS

PARA NO.	SUBJECT	PAGE NO.
1	Scope	2
2	Selection of Rail to be welded	2
3	Suitability of rails for welding	3
4	Preparation of rails to be welded	5
5	Procedure of welding of rails	6
6	Record of welds	13
7	Post-weld straightening	13
8	Finishing	13
9	Marking of joints	14
10	Testing of weld	15
11	Handling of high strength rails (90 UTS, HH & 110UTS)	19
12	Check list for flash butt welding plants	19
13	Welding team for mobile flash butt welding plant	20
14	Upkeep and maintenance of mobile flash butt welding plants	21
15	Periodic Quality Audit	27

ANNEXURES

Annexure No.	Description	Page No.
I	DELETED VIDE CS-4	23
II	Post weld Air quenching treatment for Flash butt welding of 60 Kg Head hardened rails	24
III	Record of welds	25
IV A & B	Finishing tolerances for welds	26-27
V	Precautions to avoid defects in Flash butt welded rail joints	28
VI A	Dimensional check of welded joints (After finishing)	30
VI B	Ultrasonic testing of welded joints	31
VI C	Hardness test of welded joints	32
VI D	Transverse testing of welded joints	33
VI E & F	Macro examination of welded joints	34
VII	Handling instructions for 90UTS and Head Hardened rails	35
VIII	Check list for Flash butt welding plants	39
IX	List of minimum Equipments & machines required for Flash butt welding plants	42
X	Procedure to be followed for approval of quality assurance program (QAP) For Mobile Flash Butt Welding Plants.	43
XI	Information to be provided in quality assurance program for Mobile Flash Butt Welding Plants.	45
XII	Competency Certificate	49

FIGURES

Figure No.	Description	Page No.
Figure 3.2	Sorting of rails to be welded	50
Figure 3.4(a)	Tolerance on the end bends in the vertical plane	51
Figure 3.4(b)	Tolerance on the end bends in the horizontal plane	51
Figure 3.4(c)		
Figure 3.4(d)	Deviation of the rail end from the square	52
Figure 4.2(a)	Head width checking gauge for 60Kg (UIC) rails	53
Figure 4.2(b)	Head width checking gauge for 52Kg rails	54
Figure 4.2(c)	Head width checking gauge for 90R rails	55
Figure 5.4(a)	Details of A.C. pipe arrangement for controlled cooling	56
Figure 5.4(b)	Air quenching gadget for enhanced cooling of HH rail joints	57
Figure 8(a)	Tolerance for vertical misalignment of welded joint with new rails	58
Figure 8(b)	Tolerance for lateral misalignment of welded joint with new rails	58
Figure 8(c)	Tolerance for finishing on sides of head of welded joint with new rails	59
Figure 8(d)	Tolerance for finishing top table surface of welded joint with new rails	59
Figure 8(e)	Tolerance for vertical misalignment of high welded joint with old rails	60
Figure 8(f)	Tolerance for vertical misalignment of low welded joint with old rails	60
Figure 8(g)	Tolerance for lateral misalignment of welded joint with old rails	60
Figure 8(h)	Tolerance for finishing on sides of head of welded joint with old rails	61
Figure 8(i)	Tolerance for finishing top table surface of welded joint with old rails (High joint)	61
Figure 8(j)	Tolerance for finishing top table surface of welded joint with old rails (Low joint)	61
Figure 9	Location of marking of weld	62
Drg. RDSO/T-6219	Arrangement for stacking of free rails and welded panels	63

CORRECTION SLIPS

S.No.	Correction Slip No.	Date of Issue	Subject	Para No(s) affected	Remarks

MANUAL FOR FLASH BUTT WELDING OF RAILS

FOREWORD

On Indian Railways, Alumino Thermic (A.T.) Welding, Flash Butt (Electric Resistance) Welding and Gas Pressure Welding processes are presently in use for welding of rail joints.

Flash Butt Welding is being done on Zonal Railways departmentally, using Stationary Flash Butt Welding Plants of different makes. Mobile Flash Butt Welding Plants, capable of in situ Flash Butt Welding of rail joints, are also in operation on some of the Zonal Railways.

The Code of Practice for Flash Butt Welding of Rails (tentative) was issued in January, 1972. Revision of this Code was made in 1996 to cover procedures for Flash Butt Welding of heavier and higher strength rails, used on Indian Railways and to incorporate the latest practices. This Code of Practice was renamed as "Manual for Flash Butt Welding of Rails". Further revision is being made to cover procedures for flash butt welding with mobile plant and latest international specifications to improve quality of flash butt welds.

The Flash Butt Welding Plants have to be maintained in good health to produce good quality welds in accordance with this manual and to have least number of thermit welds and maximum number of flash butt welds on Indian Railways.

MANUAL FOR FLASH BUTT WELDING OF RAILS

1. SCOPE

1.1 The manual gives details of the types and suitability of rails to be welded by stationary Flash Butt Welding Plant, Mobile Flash Butt Welding Plant, pre-welding inspection, preparation of rail ends before welding, the general procedure of execution of welding and finishing of welded joints. It also defines geometrical tolerances for the finished joints and acceptance tests to ensure quality control. It also defines process for procedure approval of welding plants, procedure approval for other rail sections and grades and additional transverse tests required to be performed on rectification of a welding machine malfunction, machine overhaul or work other than normal maintenance and change to another approved procedure.

1.2 Weld parameters for different rail sections/chemistry have been prescribed by manufacturers and are unique to the particular welding plants. These shall be approved by RDSO in accordance with para 5.6 of this manual. Should any change in these parameters be considered necessary, the same shall be got approved by RDSO.

1.3 All welding shall be carried out on a flash butt welding plant using automatic, programmed welding sequence.

2. SELECTION OF RAILS TO BE WELDED

2.1 **SECTION OF RAILS:** Capacity of the individual plant will determine the heaviest section and type of rail that can be welded. New as well as released but serviceable rails of same type (section and metallurgy) shall only be welded together. Welding of rails of different sections metallurgy shall not be attempted. It is preferable that rails rolled by the same manufacturers are welded together. Minimum length of old but serviceable rails for welding shall be 6 metres.

2.2 **WELDING OF OLD RAILS:** While welding old rails, it shall be ensured that only serviceable rails are welded. Old rails to be welded shall preferably be match marked before releasing from track to achieve maximum uniformity of profiles in weld zone.

2.3 **FISHBOLT HOLES:** Welded panels (10/20 rails) for laying long welded rails shall, as far as possible, be without fishbolt holes. If drilling of fishbolt hole is necessitated for the purpose

of handling during end unloading; only the second fishbolt hole (one away from the rail end) need be drilled. In case, welding of new rails with fishbolt holes cannot be avoided, it shall be ensured that the outer edge of the hole nearest to the rail end is at least 40mm away from the end to be welded to avoid the heat affected zone of the weld extending up to the edge of the hole. All fishbolt holes shall be chamfered before welding.

2.3.1 Ends of old rails with fishbolt holes/bond wire holes shall be cropped by a minimum length of 450mm before welding.

2.4 **ULTRASONIC TESTING OF RAILS TO BE WELDED:** New and old but serviceable rails shall be free from internal defects. In the case of new rails, the ultrasonic testing is required to be done at the rail manufacturer's premises. Old but serviceable rails shall invariably be tested ultrasonically before they are taken to Flash Butt Welding Plants.

3. SUITABILITY OF RAILS FOR WELDING

3.1 OLD RAILS

3.1.1 **Defective rails:** Rails having cracks or other defects such as heavy corrosion pits or which are worn by more than 2mm depth at rail seat shall not be welded.

3.1.2 **Permissible vertical wear of rails to be welded:** The vertical wear in old rails to be welded (measured as per Para 702 (1)(b)(iii) of Indian Railways Permanent Way Manual) shall be within the limits specified below:- (CS-4)

Rail Section	Standard height of the new rail	Minimum height of worn rail
60kg (UIC)/60E1	172.00 mm	164.00 mm
IRS-52kg	156.00 mm	150.00 mm

3.1.3 **Permissible lateral wear of rails to be welded:** Old rails to be welded shall preferably show similar pattern of side wear and the minimum width of rail head shall be as specified below:- (CS-4)

Rail Section	Standard width of the head of new rail	Minimum width of the head of old rail
60kg (UIC)/60E1	72.00 mm	66.00 mm
IRS-52kg	67.00 mm	61.00 mm

3.1.4 Rails with cyclic wear shall not be welded.

3.2 DIFFERENCE IN HEIGHT OF RAIL ENDS TO BE WELDED:
The individual rail ends for new rails may have a maximum difference in height of 1.2mm at the welded joints. This is illustrated in Fig.3.2. The difference in height shall be transposed to the foot of the rail. (CS-4)

3.3.1 The difference in the width of rail heads of two rails to be welded shall not exceed 1.0mm for new and 2.0mm for old rails. For new rails, it is preferable to restrict the difference in width of rail heads to 0.5mm by adopting procedure laid-down in Para 4.2. (CS-4)

3.3.2 Any difference in the widths of rail heads at the welded ends, in case of both new and old rails, as a result of rolling tolerances in case of new rail and wear in case of old rails, the rail ends shall be aligned in accordance with 3.3.3 and 3.3.4 below.

3.3.3 In case of welding in depot, where it is not possible to determine the gauge face side exactly when laid in track, during setting up of rails, any difference in the width of rail heads at welded ends shall be transposed to one side of the head keeping the other side perfectly aligned. The aligned side of such welded panels shall be distinctly marked with green paint on the web at both ends of the panel. To facilitate pairing of panels, aligning on operator side as well as non-operator side may be resorted to.

Resulting step on non gauge face side after welding shall be ground out to slope not steeper than 1:500.

3.3.4 In case of in-situ welding and in case where it is possible to exactly determine gauge face when laid in track, the rail ends shall be perfectly aligned to gauge face. Any step as a result of unequal head width due to rolling tolerances shall be ground out to slope not steeper than 1:500.

3.4 RAIL END GEOMETRY: Rail ends to be welded shall meet following geometrical standards: -

- (a) End-bends in the vertical plane not greater than 0.7mm on a 1.5metre straight edge [Fig. 3.4 (a)]. Sagging ends not permitted.
- (b) End-bends in the horizontal plane not greater than ± 0.7 mm on a 1.5 metre straight edge [Figs. 3.4 (b) and (c)].
- (c) Deviation of the end from the square not greater than ± 0.6 mm [Fig. 3.4 (d)].

3.5 A thorough inspection shall be carried out at the plants with a view to avoid welding of rails with visible surface defects such as rolling/guide marks, wheel burns etc.

3.5.1 Rail should also be inspected to ensure that there is no chisel mark or dent of any type on bottom flange of the rail as this constitutes the tension zone.

3.6 The rails rejected due to non-compliance of the requirements of paras 3.1 to 3.5 shall not be welded. Such rails shall be marked and stacked separately for other uses.

4. PREPARATION OF RAILS TO BE WELDED

4.1 PRE-STRAIGHTENING OF RAILS: Rails not meeting the geometrical standards stipulated in clause 3.4 are to be rectified before welding using a pre-straightening machine so as to conform to the standards.

4.2 In order to minimise the difference in head width of rail ends to be welded, actual head width of rails shall be checked using template shown in Fig. 4.2 (a), (b) & (c). The deviations shall be marked on the rail head so that rails with same or minimum relative deviations are selected for welding.

4.3 END-CLEANING: Before welding, end faces of the rails to be welded and electrode contact locations shall be thoroughly cleaned of loose scales, rust, paint etc. by brushing and shot blasting/grinding to bare metal finish for good electrical contact to avoid arcing at the contact points on the rail and to eliminate the possibility of rail failure near joint due to Copper penetration and formation of brittle martensite structure. Cleaning of rail bottom shall be ensured by placing a mirror and watching the cleaned surface. The electrode contact locations should be marked with chalk on each rail end to be welded to serve as guidance for cleaning. Oil and grease, if present, shall be removed by Carbon Tetrachloride or Benzene. If any internal defect such as piping is noticed during end cleaning, the rail shall not be welded.

5. PROCEDURE OF WELDING OF RAILS

5.1 ELECTRICAL CONTACT: The electrical contacts, i.e. Copper/Melloroy electrode in the welding machine must be cleaned by compressed air pistol to ensure freedom from loose oxides and other foreign matter so that no arcing takes place at the contact points on the rail and to eliminate the possibility of rail failure near joint due to Copper penetration and formation of brittle martensite structure. The electrodes must be replaced and machined whenever surface depressions exceeding 1mm in depth are formed due to wear. For this purpose, adequate spare electrodes should be kept in the plant.

5.2 RAIL ALIGNMENT:

5.2.1 The running surfaces of rails at interface shall be aligned carefully to avoid any 'step' defect generally keeping gauge face corner as reference line except as provided in 3.3.2, 3.3.3 and 3.3.4.

5.2.2 For the reason of asymmetry, rails should preferably be welded with brand marks on same side.

5.3 WELDING SEQUENCE: The Stationary Flash-butt Welding Plants adopt following welding sequence :-

- Aligning (along with de-twisting, if possible).
- Initial burn off.
- Preheating.
- Flashing.
- Forging (upsetting).
- Stripping.

The mobile flash butt welders, however, give continuous flashing instead of initial burn off, preheating and flashing cycles separately.

Air pressure and voltage/current recommended by the manufacturer must be ensured throughout the welding cycle.

5.3.1 Initial burn-off: Relevant to the specifications of rail and welding machine, controls shall be adjusted so that at the end of this phase weld interface has good overall contact.

5.3.2 Preheating: The rail ends are brought into contact to allow a low voltage high amperage current flow which preheats the rail ends. Lower voltages are preferred to minimise crater damage on the rail ends. The movable rail is alternatively moved backward and forward producing a series of electrical contacts with the fixed rail end. The objective is to heat the rail faces uniformly by flashes upto the red hot stage. The rail ends are brought in and out of contact for certain duration a number of times depending on the specifications of the welding plant, the section and the metallurgy of the rail. This pre-heating cycle is executed in a fully controlled automatic mode once the parameters are selected.

5.3.3 Flashing: Flashing consists of moving the rail in continuous manner initially at a fixed speed but during the last few seconds, at an accelerated rate. The flashing speed is so arranged that the rail ends burn-off without short circuiting or giving rise to an open circuit condition.

5.3.4 Forging (upsetting) : Immediately following flashing, the pattern movement is accelerated so that the rail ends are butted together to a stage of fusion under a heavy butting force whose magnitude depends on the make of the welding plant. The welding current automatically gets cut off during the later part of the forging operation. The joint should be left undisturbed in clamped position for ten seconds after the welding cycle.

5.3.4.1 The recommended butting pressure for different types of rails is indicated below:-

- 72 UTS rails – 5kg/mm² on cross sectional area.
- 90 UTS rails & Head Hardened rails – 6 kg/m² on cross sectional areas.
- 110 UTS and R350HT Grade rails- 7 Kg/mm² on cross sectional area. (CS-4)

The heaviest rail section which can be welded on plant should be decided on this basis.

Welding of higher UTS and higher section rails on low butting load plant by increasing the number of pre-heats causes very pronounced heat affected zone (HAZ) and is detrimental to the service life of the joints.

5.3.5 **Stripping**

(i) Automatic stripper : A stripper, which may be integral with the welding plant or installed either just adjacent to welding machine or at 13/26 m distance from it, shall strip the hot upset metal all round the rail section in such a way that minimum grinding is required to achieve final finished profile at weld.

(ii) Manual removal of upset metal: Wherever automatic stripper is not installed, manual chipping using pneumatic chisel may be adopted. Recommended width of flat chisel is 50mm for removal of upset metal from junction of head & web and web & foot of the rail, half round chisel should be used. Care should be taken to ensure that chipping does not create any notches or under cutting. However, hot upset metal all round the rail shall be stripped.

(iii) Maximum thickness of trimmed upset shall be in accordance with item (v) of Annexure IV Part A for welds of new rails and item (v) of Annexure IV Part B for welds of old rails.

5.4 POST WELD HEAT TREATMENT: 72 UTS and 90 UTS rails do not require any special post weld heat treatment. Head hardened and heat treated rails need post weld heat treatment to ensure the variation in hardness within acceptable limits in heat affected zone. Typical post weld heat treatments for head hardened/heat treated rails are given in Annexure II. However, any other suitable advance technique for post weld heat treatment may be adopted and shall be mentioned in the QAP of flash butt welding plant. **(CS-4)**

5.5 **WELD PARAMETERS:**

Welding parameters will depend on section and metallurgy of rail to be welded. These are normally specified by the manufacturer of the welding plant. Before adoption, the welding parameters shall be got approved from RDSO by following procedure approval in accordance with para 5.6.

5.5.1 Changing weld parameters arbitrarily like changing platten travel, increasing duration and/or number of preheat cycles so as to increase interface temperature to achieve fusion with lower butting pressure (wherever butting capacity of the plant is low) or to retain heat in weld for easy upset metal removal when stripping is done away from welding machine, shall strictly be prohibited.

5.6 Procedure for Standardization of Welding Parameters (CS-3)

5.6.1 Standardization of welding parameters shall be carried out by RDSO for each individual Flash Butt Welding Machine (no type approval) by testing weld samples produced in accordance with procedure enumerated below:

5.6.2 Approval of QAP:

The Quality Assurance Plan (QAP) of each individual Flash Butt Welding Plant shall be got approved by RDSO.

- a) For Stationary Welding Plant associated with Zonal Railways, the Quality Assurance Plan (QAP) shall be submitted to RDSO through concerned Railway administration, who shall scrutinize and approve by ensuring compliance to this manual.
- b) For Stationary Flash Butt Welding Plant used in rail Manufacturing unit, the Quality Assurance Plan (QAP) shall be submitted to RDSO against contract of Railway Board/directive of Railway Board.
- c) For Mobile Flash Butt welding Plants, the procedure given in Annexure-X of this Manual shall be followed.

The Quality Assurance Plan (QAP) shall contain the information given in Annexure-XI.

5.6.3 Sample Preparation:

The samples shall be prepared from rail pieces having ends conforming to tolerances mentioned in 3.4 above. Before welding, end faces to be welded and electrode contact area shall be thoroughly cleaned of loose scale, rust, paint etc. by brushing and shot blasting or grinding to bright metal and brand mark removed by grinding to give consistent and good electrical contact at interface. The rails shall not be damaged by cleaning operation or through poor electrical contact. The rails shall be positioned in the welding machine such that the welding interface is central to the contact electrodes as assessed by visual or mechanical means.

Ten weld samples on the basis of welding parameters recommended by the firm shall be prepared in presence of RDSO representative.

5.6.4 Approval Tests:

5.6.4.1 Visual Inspection:

All welds and rails shall be inspected visually for welding, trimming, clamping or profile finish imperfections, such as tears, cavities, cracks, damage and thermal damage, in particular, in the electrical contact areas.

5.6.4.2 Weld trimming and upset examination:

There shall be no sign of tearing, chisel mark or cavity in weld metal due to trimming, and upset shall not be raised more than 3mm and there shall be no depression in accordance with item (v) of Annexure IV-A & B as applicable.

5.6.4.3 Step across the weld:

All the welds shall be measured in as welded condition to determine step across the weld. No step shall be permitted except as provided in 3.3.3 and 3.3.4 above.

5.6.4.4 Dimensional check:


All Finished weld samples shall be checked for weld geometry and shall conform to tolerance laid down in Annexure-IV of this manual.

5.6.4.5 Ultrasonic test:

All weld samples shall be subjected to ultrasonic testing for detecting presence of internal defects in the weld in accordance with Para 10.1.3.

5.6.4.6 Hardness Testing:

Brinell hardness test shall be conducted on the test weld samples before conducting transverse load test. The individual hardness value in HAZ shall not vary from the hardness of the parent rail by more than ± 20 HB. The location of hardness test shall be as under:

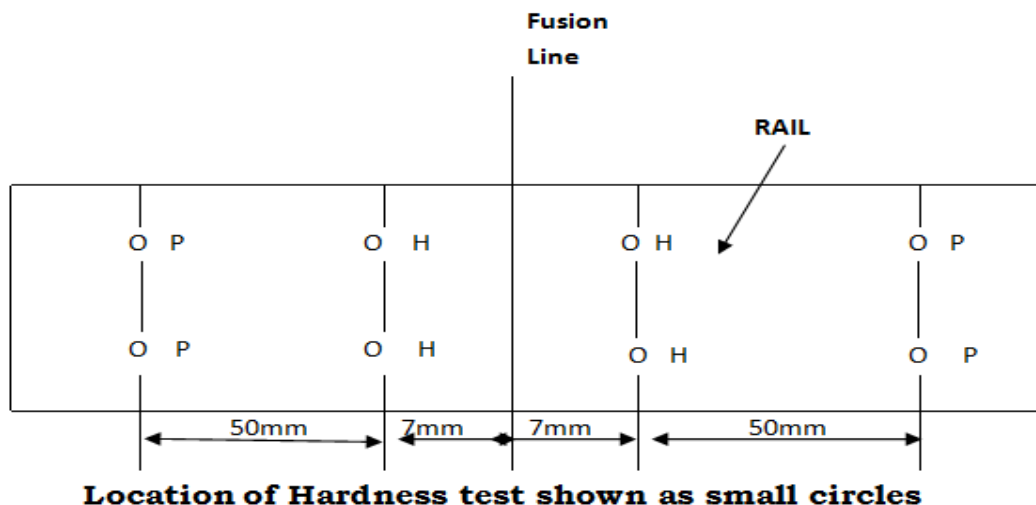

5.6.4.7 Transverse Testing:

Out of ten, five alternate welds in as finished condition having met the requirement of 5.6.4.1 to 5.6.4.6 shall be subjected to transverse test in accordance with procedure laid down in 10.2.2.1 with following additional provisions.

Each transverse test shall be continued until fracture occurs or be terminated when force limit of the press is reached, provided that the bend test values have reached the values given in 10.2.2.1.

For the latter case, the weld shall be notched to ensure that fracture occurs in welding zone and the test weld shall be fractured. If the fracture occurs about the weld line, the fracture surfaces shall be inspected. The details of any weld imperfection shall be recorded. Lack of bond shall not be permitted. Flat spots shall not be considered to be lack of bond.

If fracture occurs remote from weld, the fracture surfaces shall be checked for the presence of die burn, which if detected shall cause the process to fail approval.

If fracture occurs within rail for reasons other than die burn then another test weld specimen shall be substituted for testing.

Five tested welds shall meet the requirement of given rail profile and grade specified in table 1.

5.6.4.8 Macro examination:

Balance Five welds in finished condition shall be sectioned for macro examination. For macro examinations a longitudinal vertical section shall be taken centrally down the vertical axis of full rail and extend 50mm each side of fusion line. Similar section shall be taken from both sides of the foot, 10mm in board of the foot tip. The sections shall be polished to a suitable finish using a minimum 220 grit paper. One full depth rail sample and associated rail foot samples from each of the two welds shall be etched to show the weld boundary lines.

The etching agent shall be 5-10% Nitric Acid. Etching at room temperature shall be done for sufficient time, 20 minutes maximum, in order to show boundary lines clearly when examined. These welds shall conform to following requirements.

- a) The visible heat affected zone shall be of a nominally symmetrical shape about weld line and fall within the width of 40mm maximum and 20mm minimum. The permissible deviation between the maximum and minimum dimension of visible affected zone on any weld shall not exceed 5 mm (10mm in case of 1175HT rails). This requirement shall apply equally to

vertical axis cut through full rail depth and those taken from each rail foot.

- b) There shall be no evidence of lack of bond, inclusion, cracks or shrinkage. Imperfections that cannot be positively identified by macro examination shall be inspected by micro examination.
- c) In case that flat spots are found, they shall be checked by micro examination at 100 X magnification. If any cracks are found, the process is rejected.

5.6.4.9 Micro examination:

Following completion of macro examination, a micro examination shall be carried out on one of the five welds taken for macro examination having maximum HAZ. The micro sample 15mm high and 25mm wide (it includes 2mm on one side of fusion line and 23 mm on other side of fusion line) shall be drawn from the foot 3mm above rail foot bottom surface. The microstructure shall be free from martensite and bainite and grain size shall not be coarser than ASTM-4 at 100X magnification.

5.6.5 Approval of other rail profiles or grades.

5.6.5.1 Following the initial approval with particular rail profile and grade, other rail profiles and other rail grades as contained in IRS T-12 shall be undertaken for approval as and when required.

5.6.5.2 Approval tests:

For approval of each rail profile and grade, samples shall be tested in accordance with 5.6.4 above.

5.7 Field approval of welding procedure –

For mobile flash butt welding plant having obtained procedure approval in accordance with para 5.6 above, approval for field welding shall be granted after execution of 30 welds on track (carried out in two shifts), if they satisfy the weld acceptance criteria defined in 5.6.4.1, 5.6.4.4, 5.6.4.5, 5.6.4.7 above (visual, dimension, ultrasonic, transverse testing). This shall be carried out in presence of Engineer in-charge and the approval shall be granted by Chief Track Engineer/ Chief Engineer (construction).

6. RECORD OF WELDS: Record of all the joints shall be maintained in a register as per proforma as Annexure III. The register shall be signed daily by the welder at the end of the shift and shall be verified and countersigned by the supervisor in-charge. For those welding plants which are equipped with Automatic weld recorder, the chart of the weld recorder shall be analysed every day with respect to voltage, current, upsetting force and platten travel for each weld. Any parameter not conforming with the standard parameter should be set right. The chart shall also be preserved in addition to the register to facilitate investigations in case of defective joint and joints failing in service.

7. POST WELD STRAIGHTENING: A post straightening machine shall be installed at suitable distance from the welding machine for straightening the joint if required to achieve required geometrical tolerances in vertical/lateral alignment.

7.1 WATER COOLING: It is desirable to do post weld straightening after the weld has cooled down to ambient temperature. Water spray cooling shall be done at such suitable distance from the welding plant where the temperature of the weld is not more than 350 degree Celsius which normally is achieved in 7-8 rail length.

8. FINISHING :

8.1 The top, side and bottom surfaces of the rail head shall be ground smooth so that the weld surface is absolutely flush with the parent rail surfaces. Particular care is necessary to ensure that finish grinding does not burn or notch the rail surfaces. After grinding, the top table and the sides of the rail head shall comply with the geometrical standards given in Annexure IV. Grinding shall be done preferably using a profile grinding trolley, in the absence of which manual grinding can be done using a cup

grinder. Depending upon whether it is done mechanically or manually, grinding may be done in stages.

8.2 Areas to be ground smooth:

Upper sides, under surfaces and edges of rail foot shall be ground smooth. The edges of foot should be rounded and bottom of rail foot ground smooth without any minus tolerances to avoid damage to elastic rail pads and eliminate stress riser.

8.3 In case of in-situ welding with mobile flash butt welding plant, profile grinding can be done in stages i.e. initial grinding and final grinding. Final grinding can be performed in track with rails fastened in position over a minimum length of three sleepers on either side of weld. Profile finishing of rail head shall be carried out and contained in shortest possible length but not greater than 400 mm on either side of weld. Profile finishing should not cause any thermal or mechanical damage to rail.

9. MARKING OF JOINTS: Every joint shall have distinctive mark indicating the weld number, month and year of welding and the code of the plant as shown below. The marking should be embossed on the gauge and non gauge face sides of the head of the rail and diagonally opposite to each other across the joint at 300 mm away from the centre line of weld by punching after finishing of the weld without causing any damage to rail, in letters/digits of 6mm height, located as indicated in figure 9.0.

(A) For Stationary Plant:-

XXXX MM YY AAA

The first four digits indicate the weld number starting from 0001 for first weld of every month, the next two digits month of welding followed by last two digits of the year of welding. The end letters shall be code of the Welding Plant. For example, 32810891 MGS indicates that the particular weld is 3281st weld of August 1991 of Mughalsarai Flash Butt Welding Plant.

(B) For Mobile Plant:-

XXXX MM YY OO PP EE

The first four digits indicate the weld number starting from 0001 for first weld of every month, the next two digits month of welding followed by next two digits of the year of welding. The letters OO denotes the code for owner of the plant, PP denotes the code for

the plant of that particular owner and EE stands for the code of agency executed the welding work.

10. TESTING OF WELD: It shall be the responsibility of the Plant in-charge and the quality control supervisors to device adequate stage inspections before final acceptance tests are conducted. Causes for failure either of weld or in heat affected zone at any stage in production shall be investigated and corrective action taken before regular welding is continued. Some common causes for failure and the precautions to be taken are listed in Annexure-V for guidance. Acceptance test comprises of all the weld being checked by visual inspection, dimensional tolerances and ultrasonic test. Sample welds should be subjected to transverse bending test and detailed metallurgical tests in a laboratory as a quality assurance measure. Results of all the tests shall be maintained in register by the plant in-charge assisted by quality control supervisor. Details and method of conducting the tests are as follows:-

10.1 TESTS FOR EVERY JOINT

10.1.1 Visual inspection: After finish grinding, all welds shall be visually inspected for possible cracks, lack of fusion and other surface defects like notching, damage in heat affected zone etc. Welds with visible defects shall be rejected.

10.1.2 Dimensional check:(CS-5) All welds shall be inspected using standard 1m and 10cm straight edges and feeler gauges, as shown in figure 8 (a) to 8 (j) for compliance of geometrical standards as given in Annexure-IV. In addition to these gauges dimensional checks shall be inspected using 'Rail tread measuring instrument' to provide precise deviation readings and storing measurement data. Welds not meeting these standards, if rectifiable by grinding, can be re-ground, failing which they shall be rejected. Results shall be maintained as per proforma given in Annexure-VI 'A'.

10.1.3 Magnetic Particle Testing (MPT) of Flash Butt Welds: (CS-5) All the welds executed at Stationary Flash Butt Welding Plants shall be tested by magnetic particle testing method in accordance with IS 3703:2004 for detection of surface and near-surface discontinuities. MPT shall be carried out after completion of finish grinding and prior to Ultrasonic Testing. The profile finished area and the area of the electrode contacts shall be checked. The tested area shall be free of harmful cracks. If any crack is detected the welding process shall be deemed unsuitable.


The MPT Operator should have Level-II Certificate from Indian Society for Non-Destructive Testing (ISNT), Chennai or American Society for Non-Destructive Testing (ASNT), Chennai. Results shall be maintained as per proforma given in Annexure-VI 'G'.

10.1.4 Ultrasonic Test (USFD) : All welds shall be subjected to ultrasonic testing for detecting presence of internal defects in the weld. This test can be done by installing an on-line USFD equipment or as an interim measure manually with portable USFD machine. Entire cross section of the rail i .e. head, web and foot shall be tested by trained personnel as per the procedure laid down for Ultrasonic testing of Flash butt welds in 'Manual for Ultrasonic testing of rails & welds' and its correction slips, issued by RDSO, Lucknow to detect internal f laws. Welds having defects shall be rejected. Results shall be maintained as per proforma given in Annexure-VI 'B' . Defective joint shall be distinctly marked and panels with defective joints shall be separately stacked. The defective joint shall be cut and removed before the panel is dispatched from the Flash Butt Welding Plant. Another panel of matching length should be welded and the short panels (minimum 3 rail lengths) dispatched in pairs.

10.2 TEST ON SAMPLE JOINT: Sample test joints shall be made on pieces of rails of similar section and conforming to the same specifications as the rails being welded. The length of each piece shall not be less than 750mm. Following tests shall be carried out on sample test joint. Frequency of test is indicated in table 1. These test shall also be carried out whenever there is a change in type of rail being welded. In case a sample joint does not comply with the requirements of the test, two more sample joints will be made and tested. If both the sample joints meet the requirements of the tests, welding may continue. In case of failure of any of the retest joints, RDSO should be consulted for investigation and fixing revised welding parameters.

10.2.1 Hardness Test: Brinell hardness test shall be conducted on the test weld sample before conducting transverse load test.

The hardness value in HAZ shall not vary from the hardness of the parent rail by more than +20 HB. Results shall be maintained as per proforma given in Annexure – VI 'C'. Location of hardness test shall be as under:

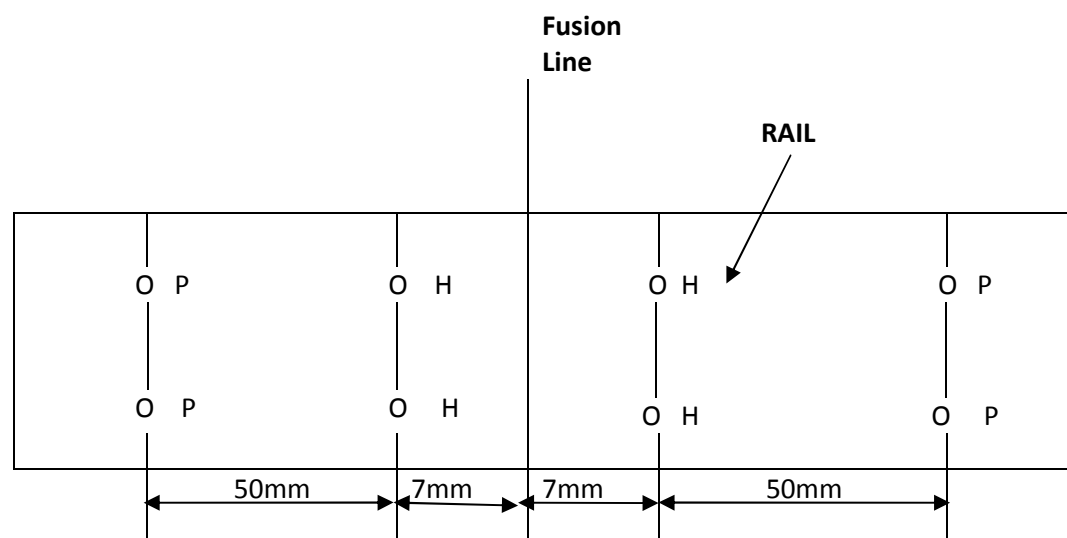

Location of Hardness test shown as small circles

10.2.2 Transverse Test: The finished test weld samples, not less than 1.5 metre long with the weld at the centre shall be subjected to transverse load test in a transverse testing machine in the following manner:-

10.2.2.1 The test joint shall be supported on cylindrical or semi-cylindrical supports having a diameter of 30 to 50mm and distance of one metre between them. In case of 60kg 110 UTS/head hardened rail joints the test span shall be 1.25 metre. The mandrel diameter shall be between 30 to 50mm. The mandrel axis should be perpendicular to the horizontal axis of the rail section and it should be positioned at the centre of the weld. The weld shall be in the centre of the span and loaded in such a manner that the foot of the rail is in tension. The load shall be uniformly and gradually increased. The rate of application of the load should not exceed 2.5 tons/sec. The test joints shall withstand the minimum load and shall show minimum deflection as given in Table 1 without showing any signs of cracking or failure. (CS 1) Results shall be maintained as per proforma given in Annexure-VI 'D'.

"10.2.2.1(a) The test load shall withstand minimum transverse breaking load as indicates in column 4 of table 1. The deflection at centre at the actual transverse breaking load shall not be less than that specified in column 5 of table 1"(CS1)

Table 1 (CS-4)

VALUES OF MINIMUM BREAKING LOAD AND DEFLECTION IN TRANSVERSE LOAD TEST

S N	Rail Section & Grade	Span (in meter)	Min. breaking load (in Ton)	Minimum deflection at the center at the actual transverse breaking load (in mm)	Frequency of testing	
					Stationary FBW Plant	Mobile FBW Plant (working as mobile or in stationary mode)
1	60E1 Grade- R350HT	1.00	163 (1600KN)	20	1 in 100*	1 in 100*
2	60E1 Grade- R260	1.00	150	20	1 in 100**	1 in 100*

3	60 kg (UIC)/ 60E1, Grade- 1080HH	1.25	115	30	1 in 500	1 in 100*
4	60 kg (UIC)/60E1 90 UTS Grade-880/ R260NC	1.00	150	20	1 in 1000	1 in 100*
5	IRS-52 kg 90UTS	1.00	115	20	1 in 1000	1 in 100*
6	60 kg UIC MM (72 UTS)	1.00	135	30	-do-	1 in 100*
7	52 kg MM (72 UTS)	1.00	100	30	-do-	1 in 100*

* Sample joints for first 1,000 joints will be tested at frequency of 1 in 100 joints and subsequently at a frequency of 1 in 500 joints.

** Sample joints for first 1,000 joints will be tested at frequency of 1 in 100 joints and subsequently at a frequency of 1 in 1000 joints.

10.2.2.2 Additional Requirement for Bend Tests:

In addition to above requirement for bend test, the following occurrences will require a mandatory bend test:

- (a) Immediately following rectification of a welding machine malfunction;
- (b) Immediately following machine overhaul or work other than normal maintenance;
- (c) Any change to another approved welding procedure, if the procedure has not been used in previous 4 weeks.

10.2.3 Macro examination: (CS-3)

One test joint for every 5000 joints welded in case of stationary Flash Butt welding Plant and one test joint for every 1,000 joints welded in case of Mobile Flash Butt Welding Plant shall be subjected to macro examination as per Cl 5.6.4.8 and micro examination as per Cl 5.6.4.9. 100mm length of rail with weld at centre shall be cut and the sample shall be sectioned in vertical longitudinal direction through the weld. One of the sections shall be etched with 5-10% Nitric acid and for confirming any defect found in Macro Examination, Magna flux test should also be carried out. Extent of heat affected zone shall be measured for head, foot and web of the rail. The visible heat affected zone shall be of a normally symmetrical shape about the weld line and fall within the width of 40 mm maximum and 20 mm minimum. The permissible deviation between the maximum and minimum dimension on any weld shall not exceed 5 mm in general (10mm in case of 1175HT rails). However the limit shall be guided by the value standardized during the procedure for standardization of welding parameters. This requirement shall apply equally to the vertical axis cut through the rail depth and each rail foot tip.

There shall be no evidence of lack of bond, inclusion, cracks or shrinkage. Imperfections that cannot be positively identified by macro examination shall be inspected by micro examination.

In case that flat spots are found, they shall be checked by micro examination at 100 X magnification. If any cracks are found, the process is rejected.

Results shall be maintained as per proforma at Annexure – VI ‘E’.

11. HANDLING OF HIGH STRENGTH RAILS (90 UTS, HH AND 110 UTS)

11.1 The 90 UTS head hardened and 110 UTS rails are comparatively brittle having less fracture toughness as compared to 72 UTS (MM) rails. Therefore, such rails require special care in handling. Provisional guidelines for handling and maintenance of such rails are given in Annexure-VII. Flash Butt Welding Plants shall create adequate handling facilities to follow these guidelines.

12. CHECK LIST FOR FLASH BUTT WELDING PLANTS

A check list containing items to be checked daily and weekly is placed at Annexure-VIII. This check list should be followed meticulously as a quality assurance measure.

In order to ensure proper quality of Flash Butt Welds, a list of minimum equipment and machines to be provided in each Flash Butt Welding Plant is placed at Annexure-IX.

13. Welding Team for Mobile/STATIONARY Flash Butt Welding Plant (CS-4)

13.1 Welding team may consist of minimum one supervisor and two welders. The educational qualification of supervisor should be min. Diploma in Mechanical/ Electrical Engineering or BSc and that of welder should be minimum class X or equivalent, passed. Welders and supervisor already working in Mobile/Stationary FBW Plant may continue if Chief Track Engineer/Chief Engineer (construction) is satisfied about the quality of welds by these operators. Zonal Railways shall also ensure periodical training of welders and Supervisors of Mobile/Stationary Flash Butt Welding Plants.

13.2 Test for competency certificate of supervisor/welders of Mobile/ Stationary Flash Butt Welding Plant will be conducted by concerned Zonal Railway/PSU/Metro Railway as per this Manual and after satisfactory result; the competency certificate will be issued in the proforma given in Annexure-XII by the authority as detailed in (i) & (ii) below.

(i) Competency certificate to welding team (supervisor & welders) of Stationary Flash Butt Welding Plants (Departmental / Rail manufacturing Agencies) shall be issued by CTE of concerned Zonal Railway.

(ii) Competency certificate to welding team (supervisor & welders) of Mobile Flash Butt Welding Plants shall be issued by CTE/Chief Engineer (construction) of concerned Zonal Railway /General Manager (equivalent to SA grade officer and above) of concerned PSU/Metro Railway.

For guidance, test scheme as well as syllabus for written test and interview is given as under:

13.2.1 Part-I (Written Test and Interview)

13.2.1.1 Written Test

- (i) Welding parameters and its influence on quality of welding and heat affected zone.
- (ii) Suitability of rail for welding.
- (iii) Preparation of rails to be welded including pre-straightening of rails.
- (iv) Procedure of welding of rails.
- (v) Record of welds.
- (vi) Post weld straightening of joints.
- (vii) Finishing of joints.
- (viii) Marking of joints.
- (ix) Testing of welds.
- (x) Precautions to avoid defects in Flash Butt Welding rail joints.

13.2.1.2 Interview

A personal interview of these candidates shall be taken by competent authority as per syllabus. The candidate must be conversant with details of Flash Butt Welding of rails and the machine, welding defects, their causes and remedies. The candidate found suitable in interview shall be allowed for further tests.

13.2.2 Part-II (Practical Test)

Six number of test welds shall be made by welder in presence of competent authority. The length of rail piece shall be minimum 0.75 meters of 90 UTS or higher grade rails. Any rail section/sections may be used free from any external and internal defects. Examination of welded rail joints shall be done as per clause 10.1.1, 10.1.2, 10.1.3, 10.2.1, 10.2.2 and 10.2.3 of this Manual.

On the basis of test conducted as mentioned above, competency certificate shall be issued for rail sections/grades as under:

Sl. No.	Practical test conducted on rail section/grade	Competency will be valid for FB welding of rail section/grade
1	90 UTS	90UTS (60 Kg, 52 Kg, R260, R260NC) & 72UTS rails
2	1080HH/R350HT	1080HH, R350HT, 90UTS (60 Kg, 52 Kg, R260, R260NC) & 72UTS rails

13.3 Validity of competency certificate: Validity of competency certificate of supervisor/welders of Mobile/Stationary Flash Butt Welding Plants shall be as under:

- (a) Supervisor/Welders of Mobile Flash Butt Welding Plant- One year from the date of issue
- (b) Supervisor/Welders of Stationary Flash Butt Welding Plants-Two years from the date of issue

14. Upkeep and Maintenance of Mobile Flash Butt Welding Plants

Quality and quantity of output of Mobile Flash butt Welding Plant depends on health of machine, therefore their proper upkeep and maintenance is utmost importance. Periodical maintenance of Mobile Flash Butt Welding Plants shall be done as per procedure and frequency laid down by OEM (Original equipment Manufacturer) with genuine spare part either supplied by OEM or procured from sources recommended by OEM.

14.1 Periodical Inspection of Mobile Flash Butt Welding Plant

Mobile Flash Butt Welding Plant shall be inspected by OEM or his authorized representative at an interval of two years or execution of 20,000 joints whichever is earlier to conduct technical audit of its health. Maintenance shall be carryout in accordance with his advice.

14.2 Availability of Sufficient Stock of Genuine Spares

Mobile Flash Butt Welding Plant shall have sufficient stock of genuine spare parts and consumables to ensure its minimum down time.

15 Periodic Quality Audit: (New Para added -CS 4)

Periodic quality audit of Flash Butt Welding Plants shall be conducted as per schedule given below:

15.1 Periodic Audit of Stationary FBWP:- RDSO to conduct periodic audit once in three years.

15.2 Periodic Audit of Mobile FBWPs:- RDSO has to conduct periodic audit once every year for the plants working on IR. **(CS-5)**

15.3 It will be responsibility of the Railway/agency to approach RDSO for quality audit of their Stationary/Mobile Flash Butt Welding Plant at least three months in advance from the due date of quality audit. **(CS-5)**

15.4 In case the firm has not offered their plant for periodic quality audit by RDSO, concerned QAP will become invalid automatically after completion of one year from the date of its approval/ previous quality audit and the same will be deleted from TMS. If periodic quality audit of the plant is delayed on the account of RDSO, the QAP shall remain valid till such time quality audit is performed by RDSO. **(CS-5)**

**POST WELD CONTROLLED COOLING TREATMENT FOR 110
UTS ALLOY STEEL RAILS**

(DELETED VIDE CS-4)

POST WELD AIR QUENCHING TREATMENT FOR FLASH BUTT WELDING OF 60 KG HEAD HARDENED/HEAT TREATED RAILS (CS-4)

During welding of head hardened/ heat treated rails using the normal welding procedure, the average hardness of the HAZ of the rail becomes considerably less than the parent rail hardness. This lower hardness is due to transformation of rail steel occurring at a cooling rate much lower than that achieved during the original head hardening operation. Such a hardness difference can lead to differential plastic deformation during the wheel-rail contact which may cause localised cupping on the running surface at the welds.

Head hardened/ heat treated rails, therefore, must be subjected to controlled cooling treatment (slack quench) to improve the sagging heat affected zone hardness.

A fabricated air quenching gadget as shown in Figure 5.4(b) shall be used for enhanced cooling of the rail joints made with head hardened/ heat treated rails. The length of this gadget is approx. 250mm and width 190mm. There are series of drilled holes of 3mm diameter in the gadget and their position is shown in figure. The gap maintained between the inner faces of the gadget is approx. 120mm which will enable gap of approx. 25mm between the railhead side surfaces and the gadget. This will result in efficient application of air quenching jet. Within one minute of welding, air quenching should be carried out while the rail surface temperature is in the region 900-950°C. The air pressure should be approximately 2kg/cm² and duration of application should be about 1 minute.

RECORD OF WELDS

MACHINE

1. Date of welding
2. Shift (day/night)
3. Joint No.
4. Length of rail
5. Section of rail
6. Welding current (primary, amps)
7. Primary voltage (volts)
8. Clamping pressure Kg/cm²
9. Butting pressure Kg/cm²
10. No. of pre-heats
11. Pre-heating time On.....Off.....
12. Burn off time (sec.)
13. Flashing time (sec.)
14. Post welding heat treatment if any
15. Whether automatic weld record chart available
16. Remarks (Any change of voltage during welding etc.)
17. Signature of welder
18. Signature of Foreman

FINISHING TOLERANCES FOR WELDS

A. Welds with new rails

- (i) Vertical misalignment : $\begin{matrix} +0.3\text{mm} \\ - 0.0 \text{ mm} \end{matrix} \}$ at the centre of a 1 m straight edge.
- (ii) Lateral misalignment : $\pm 0.3\text{mm}$ at the centre of a 1 m straight edge.
- (iii) Head finishing (in width): Side of rail head should be finished to :-
 $\pm 0.25 \text{ mm}$ on gauge side at the centre of 10 cm straight edge.
- (iv) Finishing of top table surface: $\begin{matrix} + 0.2\text{mm} \\ - 0.0\text{mm} \end{matrix} \}$ at the centre of 10cm straight edge
- (v) Web zone (under side of head, web, top of base, both fillet each side): $\begin{matrix} + 3.0 \text{ mm} \\ - 0.0 \text{ mm} \end{matrix} \}$ of the parent contour
- (vi) Upper sides, under surfaces and edges of rail foot shall be ground smooth. The edges of foot should be rounded and bottom of rail foot ground smooth without any minus tolerances to ensure proper seating on sleepers, unhindered movement of welded panels on end unloading rakes, avoid damage to elastic rail pads and eliminate stress riser.

NOTE: Tolerances for BSP rail rolled as per Explanatory Note to IRST-12/2009 shall be as under:- (Deleted under CS-4)

- (a) Vertical misalignment- $\begin{matrix} + 0.4 \text{ mm} \\ - 0.0 \text{ mm} \end{matrix} \}$ at the centre of 1m straight edge.
- (b) Lateral misalignment - $\pm 0.4\text{mm}$ -do-

B. Welds with old rails

- (i) Vertical misalignment: $\pm 0.5\text{mm}$ at the centre of a 1m straight edge.
- (ii) Lateral misalignment: $\pm 0.5\text{ mm}$ at the centre of a 1m straight edge.
- (iii) Head finishing (on sides): $\pm 0.3\text{ mm}$ on the gauge side at the centre of a 10 cm straight edge.
- (iv) Head finishing (on top table surface) : $+ 0.2\text{ mm}$ at the centre of a 10cm straight edge (CS-4).
- (v) Web zone (under side of head, web, top of base and both fillets on each side):
 $\left. \begin{array}{l} + 3.0\text{ mm} \\ - 0.0\text{ mm} \end{array} \right\} \text{ of parent contour}$
- (vi) Upper sides, under surfaces and edges of rail foot shall be ground smooth. The edges of foot should be rounded and bottom of rail foot ground smooth without any minus tolerances to ensure proper seating on sleepers, unhindered movement of welded panels on end unloading rakes, avoid damage to elastic rail pads and eliminate stress riser.
- (vii) The above tolerances are finished tolerances of welds inclusive of tolerances of rail.

**PRECAUTIONS TO AVOID DEFECTS IN FLASH BUTT WELDED
RAIL JOINTS**

Following precautions shall be taken to avoid various defects in the welded joints:-

1. Oxide inclusion : The rail end faces and the adjoining surface of the rail profile to a width of about 25mm all round shall be cleaned properly by portable grinders or brushing machine or shot blasting to remove loose scale, rust, scabs, dust, paint etc. Oil and grease, if present shall be removed by Carbon Tetrachloride or Benzene.
2. Lack of fusion – Preheating cycle and time, flashing and butting stroke as standardised shall be strictly maintained during welding to avoid this defect.
3. Poor joints due to defect in rails – Rail ends having cracks and other visible rolling defects should be cropped before welding.
4. Notches and chisel marks adjacent to the weld joints. During stripping by chiseling and finishing by grinding, care should be taken that notches, dents or chisel marks are not formed on the rail surface as such flaws may act as stress raisers in service leading to premature failure.
5. Copper penetration/arching on rail foot bottom surface. During flash butt welding, the two copper blocks (electrodes) below the rails get worn out and grooved/dented due to rail movement. Besides this, after the flashing/burning off operations, lot of loose oxides of metal are deposited on the copper blocks. Due to the above reasons, current flow between the rail foot surfaces and the copper block is not continuous resulting in arcing and formation of local melting/denting and even copper penetration at the rail foot surface. Such affected area results in premature fracture. Therefore, after each operation loose oxide/metal shall be cleaned by brushing the copper block surfaces and the copper blocks shall be periodically reconditioned or replaced with new ones.

6. Use of treated water for cooling system – The pipes/tubes for circulation of water for cooling purpose are, generally, of small diameter. Due to presence of impurities in water, scaling on the inner side of the pipe takes place resulting in less circulation of cooling water and consequent problems. Therefore, suitably treated water should be used for cooling system. The welding plant should not be operated if the cooling system is non-functional.
7. End squareness of rail end faces must be ensured. Better weld strength with minimum value and nearly parallel shape of HAZ can be achieved using perfect matching of rail ends.
8. Secondary output of current should be sufficient enough to achieve complete fusion of butting faces of rails.
9. Butting stroke should be sufficient for complete coalescence (Not less than 12 mm).
10. Throughout uniform and smooth auto trimming of the squeezed out metal and complete grinding using profile grinder around the butt joint is essential.
11. Minimum and nearly parallel Heat affected Zone of the joint should be achieved by setting the weld parameters.
12. Facilities for auto recording of weld parameters including final butting pressure shall be available.
13. When welding is carried out in-situ, minimum 20 minutes time after trimming is required to pass train through the weld with proper packing and support below the joint.

DIMENSIONAL CHECK OF WELDED JOINTS
(AFTER FINISHING)

1. Date, month and year
2. Joint No.
3. Rail section
4. 1m straight edge Top/ LH/ RH
5. 10 cm straight edge Top /LH/ RH
6. Remarks
7. Signature
8. Summary – (at the end of the month)

No. of joints welded during the month (Rail section-wise)

No. of joints checked (Rail section-wise)

No. of joints rejected (Rail section-wise)

ULTRASONIC TESTING OF WELDED JOINTS

Date/Month/year/Name of Operator Welding Machine USFD

1. Joint No.
2. Rail section & chemistry
3. Day Night shift
4. Result of testing
5. If defective, details of flaw Defective zone Flaw peak pattern
Head/Web/Foot Probe Trace
6. Remarks
7. Signature

Summary (at the end of the month)

No. of joints welded during the month (Rail section-wise)

No. of joints tested (Rail section-wise)

No. of joints found defective (Rail section-wise)

HARDNESS TEST OF WELDED JOINTS

1. Date, month and year
2. Joint No.
3. Rail section & UTS
4. Hardness (BHN)
Parent rail
Heat affected zone
5. Remarks
6. Operator's Signature

Summary (at the end of the month)

No. of joints welded during the month (Rail section-wise)

No. of joints tested (Rail section-wise)

No. of joints found defective (Rail section-wise)

TRANSVERSE TESTING OF WELDED JOINTS

1. Date, month and year
2. Joint no.
3. Rail section & UTS
4. Machine on which welded
5. Load applied (tonne)
6. Deflection (mm)
7. Span (m)
8. Broken or not
9. Remarks
10. Signature
11. Summary – (at the end of the month)

No. of joints welded during the month (Rail section & UTS-wise)

No. of joints tested (Rail section & UTS-wise)

No. of joints failed (Rail section & UTS-wise)

ANNEXURE-VIE
(Para 10.2.3)

MACRO EXAMINATION OF WELDED JOINTS

1. Date, month and year
2. Joint No.
3. Rail section
4. Machine on which welded
5. Extent of head affected zone (mm)

Head
Web
Foot

6. Result of visual examination
7. Remarks
8. Signature

Annexure-VI F
(Para-5.6.4.10)

Micro Examination of Welded Joints

1. Date, month and year
2. Joint No.
3. Rail section
4. Date of Testing
5. Remarks on Microstructure at 100X magnification with grain size
6. Signature
7. Summary – (at the end of the month)

No. of joints welded during the month (Rail section-wise)

No. of joints checked (Rail section-wise)

No. of joints rejected (Rail section-wise)

(CS 2)

Magnetic Particle Testing (MPT) of Flash Butt Welds

- 1) Name of the company carrying out the test
- 2) The object tested (FB Joint No.)
- 3) Date of testing:
- 4) Parent and weld materials (Rail Grade/Section):
- 5) Any post weld heat treatment
- 6) Thickness of upset metal (Head, Web & Foot):
- 7) Temperature of the test object and the detection media (when using media in circulation) throughout testing duration:
- 8) Identity of the test procedure and description of the parameters used, including the following:
 - a) type of magnetization
 - b) type of current
 - c) detection media
 - d) viewing conditions
- 9) Details and results of the overall performance test, where applicable
- 10) Acceptance levels: Crack of any size is not acceptable
- 11) Description and location of all recordable indications:
- 12) Test results: Pass/Fail
- 13) Names, relevant qualification, and signatures of personnel who carried out the test

HANDLING INSTRUCTIONS FOR 90 UTS AND HEAD HARDENED RAILS

1. Protection of straightness: Barely visible straightness variations for example, a deflection of 0.75 mm over 1.5 metres span, renders a rail unacceptable and required careful handling and stacking. Therefore,

AVOID

- Heavy static loading
- Sudden impact
- Localised point or line contact loading in stacking.
- Excessive end drop and flange overlaps while lifting/moving.
- Criss-cross stacking of rails of alternative layers as at right angles as far as possible.

DO

- Keep rails horizontal and straight while lifting/moving
- Stack rails of same length on firm level base of well-drained platform, preferably of concrete, as per drg. No.RDSO/T-6219.
- Stack subsequent layers on uniformly placed spacers in vertical alignment with base supports.
- Keep rail ends in vertical alignment.
- Place rail of shorter length in upper layers.

2. Protection of rail surface: Surface notches of even less than 0.75 mm in depth are liable to cause rail fracture in service. Therefore,

AVOID

- Impact abrasion of rails against separators in wagons.
- Round link chain slings for securing the rails.

DO

- Use conventional slings for lifting rails made of flat link chains.
- Lifting of rails preferably with Magnet lifting device

3. **Prevention of metallurgical damage:** These rails are thermally very sensitive and are likely to develop metallurgical defects, if exposed to localised heating, which produces very hard, brittle and cracked metallurgical structures which may lead to sudden failures. Therefore,

AVOID

- Heating, flame cutting, on or adjacent to rails.
- Contact with electric arcs and molten metal splashes, i.e. from loose cables or adjacent welding operations.

DO

- Flame cutting when found essential, after preheating minimum of 10cm of rail length on either side of the cut to about 250-350 degree C by uniform movement of heating torch.

4. **Protection from contact with injurious substances:** These rails can withstand normal degree of rusting but localised corrosion pitting may cause subsequent rail fractures. Therefore,

AVOID

- Contact with injurious substances which produce high corrosion of steel, i.e. acids, alkalis, salts, etc.

DO

- Stack rails on well drained platform preferably of concrete as per drg. No.RDSO/T-6219.

5. **Slinging principles:** The single point slinging increases risk of excessive bending and surface damage to the rails. The overhang beyond the outer lifting point should not be greater than one-half the distance between lifting points. Therefore,

AVOID

- Single point slinging.

DO

- Use two point slinging for rail length up to 13m.
- Recommended locations of lifting points for various rail lengths are tabulated below:

Rail length metres	No. of lifting points	Distance between lifting points (m)	Max. rail end overhang (m)
12-13	2	6-6.5	3-3.25
26	4	6.5	3.25
39	6	6.5	3.25
130	20	6.5	3.25
260	40	6.5	3.25

- Use of lifting beams fitted with slings is desirable.

6. **Safety of Personnel**

AVOID

- Standing under suspended loads.

DO

- Use protective gloves and clothing to minimise the risk of skin abrasion.
- Wear distinctive coloured helmet and clothing for easy identification by crane and machinery drivers to avoid accidents.

ANNEXURE-VIII
(Para 12)

CHECK LIST FOR FLASH BUTT WELDING PLANTS

	Yes	No	Not Appli cable
1. ITEMS TO BE CHECKED DAILY			
1.1 UNLOADING OF LOOSE RAILS			
1.1.1 Rails of same section and UTS are stacked together			
1.1.2 Spacers are provided between successive layers of rails.			
1.1.3 Rail are stacked in head up position			
1.1.4 Numbers of layers in each stack is not exceeding 15.			
1.2 FEEDING OF RAILS			
1.2.1 Rails ends have been checked for – (a) Straightness (b) Squareness (c) Width of head and height			
1.2.2 Fish bolt holes/any other drilled are chamfered.			
1.2.3 Rail ends are cleaned of rust, scales, paint etc.			
1.2.4 Top of rail head and bottom of rail foot are clear at electrode position.			
1.2.5 Grease/oil at rail ends, if present has been removed with carbon tetrachloride/ Benzene.			
1.3 WELDING			
1.3.1 Alignment of rail ends is proper and checked with 1m straight edge.			
1.3.2 Electrodes surfaces are clean (cleaning after every welding operation)			
1.3.3 Stipulated oil and air pressure is available in the welding machine.			
1.3.4 Record of each weld is kept in prescribed proforma.			
1.4 FINISHING OF JOINT			
1.4.1 Stripping/trimming of entire weld cross section has been done.			
1.4.2 Notches/undercuts are avoided while stripping with pneumatic chisel			

- | | | | | |
|-------|--|--|--|--|
| 1.4.3 | Post weld controlled cooling is done for Cr-Mn/head hardened rails. | | | |
| 1.4.4 | Joint has been checked for –
(a) Straightness on
(i) 10 cm st. edge
(ii) 1 m st. edge
(b) Dimensional tolerances | | | |
| 1.4.5 | Joint is numbered | | | |
| 1.5 | TESTING OF JOINT | | | |
| 1.5.1 | Joint is ultrasonically tested using normal, D.C. 70° and 45° probes. | | | |
| 1.5.2 | Ultrasonically defective joint is prominently marked | | | |
| 1.5.3 | Joint is dimensionally correct (checking with 10 cm & 1 m straight edge) . | | | |
| 1.5.4 | Records of each test are maintained in prescribed proforma. | | | |
| 1.6 | DESPATCH OF PANELS | | | |
| 1.6.1 | Panels of same rail section and UTS are stacked together | | | |
| 1.6.2 | Spacers are provided between successive layers of panels | | | |
| 1.6.3 | Panels are stacked in head up position | | | |
| 1.6.4 | Number of layers of panels is not exceeding 15. | | | |
| 1.6.5 | Rails are placed on rollers without impact. | | | |
| 1.6.6 | Loading of welded panels in EUR is being done in pairs of equal length | | | |

Signature of Shop Supdt./Supervisor

- | | | | | |
|-----|---|--|--|--|
| 2 | ITEMS TO BE CHECKED WEEKLY | | | |
| 2.1 | Electrodes have been machined before formation of 1mm deep groove. | | | |
| 2.2 | Standard welding parameters are correctly set for the type and section of rails being welded. | | | |
| 2.3 | Panels with defective joints are separately stacked. | | | |
| 2.4 | Movement of hoists in lateral and vertical direction is well synchronized. | | | |
| 2.5 | Work spot is clean and tidy. | | | |

- | | | | | | |
|------|---|--|--|--|--|
| 2.6 | While unloading, the rails are held at two points 6-6.5m apart and overhang of ends does not exceed 3-3.5m. | | | | |
| 2.7 | Rails/panels are stacked on leveled and well drained platform and they have no contact with soil. | | | | |
| 2.8 | Transverse testing & macro examinations of test welds is done at prescribed frequency and records are maintained. | | | | |
| 2.9 | Transverse testing machine is calibrated. | | | | |
| 2.10 | Workmen are provided with required protective clothing. | | | | |

Signature of XEN/Dy.CE

**LIST OF MINIMUM EQUIPMENTS & MACHINES REQUIRED
FOR FLASH BUTT WELDING PLANTS**

- I. TESTING FACILITIES
 - 1. Transverse Load Testing Machine of 200t capacity.
 - 2. Hardness testing machine.
 - 3. USFD testing machine (preferably on line tester).
 - 4. Equipment for Macro and Magna flux examination.
- II. PREWELDING EQUIPMENTS
 - 1. Pre-straightening machine.
 - 2. Portable grinders.
 - 3. Shot blasting machines.
 - 4. Mechanical rolling system for feeding of single rails for welding.
 - 5. Abrasive rail cutting machines.
- III. POST WELDING MACHINE
 - 1. Weld stripping machine.
 - 2. Profile grinders.
 - 3. Post straightening machine.
 - 4. Equipments and fixture for post weld controlled cooling.
 - 5. Equipments and fixture for post weld air quenching.
 - 6. Automatic weld recorders.
 - 7. Arrangements for availability of treated water for cooling system.
- IV. HANDLING/TRANSPORTATION AND OTHER EQUIPMENTS
 - 1. Electric Hoists/Gantries in adequate numbers for unloading of single rail from wagons.
 - 2. Electric Hoists/Gantries in adequate numbers with centralised control panel capable of loading/handling of rails up to 20 rail panels.
 - 3. Motorized conveyor line for feeding and welding of rails.
 - 4. Arrangement of stacking of single rails and 20 rail welded panels with capability of mechanical handling (capacity to handle to match with plant production).
 - 5. Generating Diesel sets of adequate capacity for standing arrangements.
 - 6. Independent water supply and water cooling system.
 - 7. Provision of chilling plant for cooling of oil to maintain hydraulic pressure specially for summers.
 - 8. Adequate number of End Unloading Rakes.
 - 9. Adequate line capacity for receiving rails and for dispatch of welded rail panels.
 - 10. Other minor tools and plants required for day to day repair and **maintenance.**

ANNEXURE-X
(Para-5.6.2)

**Procedure to be followed for approval of Quality Assurance
Program (QAP) for Mobile Flash Butt Welding Plants (CS-4)**

1.0 The mobile flash butt welding plants used on Railways are mostly outsourced. In order to expedite the approval of QAP and minimize the time gap between award of contract and start of work, the following procedure shall be followed.

2.0 Submission of General Quality Assurance Programme:

2.1 The general QAP, containing the information as per Annexure-XI of Manual shall be submitted in soft copy in pdf format of size <20MB to RDSO by the agency/ Plant owner separately for each Mobile Flash Butt welding Plant proposed to be deployed. Availability of Railways' order (Letter of acceptance) will not be required at this stage.

2.2 The complete QAP (excluding details of welding team, and standardized welding parameters) so submitted by the firm will be scrutinized and approved by RDSO after ensuring compliance of relevant provisions of this manual.

2.3 Approved soft copy of General Quality Assurance Programme will be issued to the concerned agency, which has approached for approval.

3.0 Approval of Welding Team:

3.1 Once the contract is awarded, the firm will approach concerned Zonal Railway/PSU/Metro Railway for approval of welding team as per Para 13 of Manual.

3.2 The competency certificate to welding operators and supervisors will be issued by Chief Track Engineer/Chief Engineer (Construction) of Zonal Railway/GM (equivalent to SA grade officer and above) of PSU/Metro Railway after conducting necessary test as per Manual and other instructions on the subject.

4.0 Submission of Final Quality Assurance Programme:

4.1 After the agency has got the welding team approved by concerned Zonal Railway/PSU/Metro Railway, the firm will undertake internal test to provisionally fix the welding parameters for rails of different sections/metallurgy as required to be welded.

4.2 After completing above exercise, the agency will submit the final Quality Assurance Programme (Duly updating the earlier approved General QAP with details of welding team approved by Zonal Railway/PSU/Metro Railway with competency certificates and welding parameters as decided by the firm during internal test) to RDSO through concerned Railway/PSU/Metro Railway Administration for standardization of welding parameters and-approval of final QAP.

5.0 Standardization of Welding Parameters and approval of QAP:

5.1 After the final QAP submitted is found satisfactory during scrutiny, the standardization of welding parameter for concerned Rail section/ UTS as requested by agency/ Zonal Railway/PSU/ Metro Railway will be undertaken by RDSO as per Para 5.6 of Manual.

5.2 The standardized welding parameters and marking code allotted by RDSO will be attached with the final QAP submitted by the agency/ Zonal Railway/PSU/Metro Railway. The final QAP duly containing the standardized welding parameters shall be approved by RDSO and issued to the concerned Zonal Railway/PSU/Metro Railway and the firm for undertaking the Flash Butt welding work as per provisions of this Manual.

5.3 The adherence to provisions of Manual and QAP will be ensured by the concerned Zonal Railway/PSU/Metro Railway.

6.0 Validity of QAP:

6.1 The Final Quality Assurance Programme (QAP) of a particular Mobile Flash Butt Welding Plant need not be re-approved by RDSO unless the firm has failed to get the quality audit conducted by RDSO within stipulated time as mentioned in Para 15 or there is major change in Quality Control setup or new type of rail to be welded or there is a revision/amendment to FBW Manual to provisions related to quality assessment of FB welds/procedure of welding/ methodology of standardization of welding parameters. The final decision whether there is major change in Quality Control setup or not will rest with the Chief Track Engineer/ Chief Engineer of Zonal Railway and GM (equivalent to SA grade officer and above) of PSU/Metro Railway, where plant is being deployed.

6.2 In case of change of operator/ supervisor or expiry of their competency certificates, concerned Zonal Railway/PSU/Metro Railway shall take action for approval of welding team. Approved competency certificates shall be attached with the RDSO approved QAP.

**Information to be provided in Quality Assurance Programme for
Mobile/Stationary Flash Butt Welding Plants**

1. Cover page of the QAP

This shall indicate the Name and relevant details of the Agency; Details of Flash Butt Welding machine (Make, Model & Serial no. etc. and carrier vehicle registration no. in case of Rail-cum-Road Vehicle type Mobile Plant).

2. Index.

3. Brief description about the firm/ company and General information about the addresses and contact numbers of office and work stations, branches and sister concerns and the details of ISO certification, if firm is already a ISO certified company having Operation and maintenance of Mobile/ Stationary Flash Butt Welding Plant in scope. If firm is not already ISO certified, ISO certification including Operation and maintenance of Mobile/ Stationary Flash Butt Welding Plant in scope shall be ensured before submission of Final QAP.

4. If firm is ISO certified,

(a) Quality policy of the company as per ISO certification.

(b) Certificate to this effect that the approved QAP is a controlled document and a quality record of ISO quality control system of the vendor.

5. Organization chart emphasizing quality control set-up.

6. Qualification and experience of key personnel and officials deployed for operation and in quality control cell including supervisor and welders of the machine.

Details of competency certificate of the welders and supervisor issued by Zonal Railway/PSU/Metro Railway as per clause 13.2 of Manual shall be specifically indicated.

7. Brief description on the Mobile/Stationary Flash Butt Welding Machine and other machinery & plant deployed. (Serial no., model no., make, date of manufacturing, AMC details and brief working procedure of the machine).

(Mobile/Stationary Flash Butt Welding machine must have facility for display and storage of all the welding parameters in re-producible electronic forms at the time of F.B. welding of rail joints. A certificate in this regard along with brief on the facility for display/ storage capacity of the machine must be specifically mentioned in the QAP).

8. Recommended Welding parameters for various rail sections and rail metallurgies as per operating manual of FBW machine specified by Manufacturer.
9. Process flow chart for complete process (from receipt of rail to dispatch of welded panels).
10. Procedure for Standardization of welding parameters as per clause 5.6 of the manual.
11. Procedure of the field approval of welding procedure as per clause 5.7 of Manual in case of MFBWP.
12. Quality Assurance System covering the following:
 - (a) Scope
 - (b) List of standards, codes and reference documents.
 - (c) Inspection & Testing process of incoming rails as per clause 2 to 4 of Manual.
 - (d) Detailed description of procedure of regular welding of rails.
 - (i) Welding Process and In process check:
 - Inspection of Copper/ Melloroy electrodes for electrical contact.
 - Rail alignment.
 - Welding sequence including stripping.
 - (ii) Weld Record for each joint duly indicating actual weld parameters vis-à-vis parameters standardized by RDSO.
 - (iii) Post weld heat treatment for 110 UTS, HH & R350HT rails, if applicable.
 - (iv) Post weld straightening.
 - (v) Finishing of joints to achieve geometrical standards given in Annexure IV of Manual.
 - (vi) Marking of joints for Mobile/Stationary FBW plants. (Marking code shall be assigned by RDSO at the time of approval of final QAP).
The formats duly indicating the frequency of in process check shall be part of QAP.
 - (e) Product Control:
 - (i) Tests for every flash butt welded joint.
 - Visual inspection.
 - Dimensional check.
 - Ultrasonic test.

(ii) Additional Tests on sample flash butt welded joint.

- Hardness test.
- Transverse Load test.
- Macro examination.
- Micro examination.

Formats as per Manual for each of the above mentioned tests shall form part of QAP.

(f) System Control as per clause 11 to 14 of Manual as under:

- (i) Handling of high strength rails, if applicable.
- (ii) Periodical maintenance of mobile/stationary flash butt welding machine as per procedure and frequency laid down by OEM (Original Equipment Manufacturer).
- (iii) Periodical inspection of mobile/stationary flash butt welding machine by OEM or his authorized representative at an interval of two years or execution of 20,000 joints whichever is earlier to conduct technical audit of its health, as per clause 14.1 of Manual.
- (iv) Availability of sufficient stock of genuine spares.

(g) List of various gauges/ templates e.g. feeler gauge, straight edge etc. along with their calibration status and plan.

13. Quality Assurance System- Inspection & Testing covering the following:-

S. No.	Process	Sample size and frequency of inspection/testing wherever applicable	Parameters for inspection /tests	Method/measuring/ equipments	Accuracy	Acceptance limit/ specified value	Reference documents	Standard format no. for maintaining results	Rejection details (reprocessed/ scrapped)

14. List of tools & plants and testing equipments available with FBW machine for execution of rail welding along with calibration status and plan.

15. List of Registers maintained and their standard formats with unique number.

Following registers/records are mandatory:

1. Record of Weld Register (Proforma as per Annexure –III of Manual),
 2. Dimensional Check Register (Proforma as per Annexure–VIA of Manual),
 3. USFD Test Register (Proforma as per Annexure – VIB of Manual),
 4. Hardness Test Register (Proforma as per Annexure – VIC of Manual),
 5. Transverse Load Test Register (Proforma as per Annexure– VID of Manual),
 6. Macro Examination Register (Proforma as per Annexure– VIE of Manual),
 7. Micro Examination Register (Proforma as per Annexure– VIF of Manual),
 8. Daily Progress Register (Proforma as per Annexure–‘A’ attached),
 9. Joint Rejection Register (Proforma as per Annexure –‘B’ attached),
 10. Customer Complaint Register (Proforma as per Annexure– ‘C’ attached).
16. A blank format as given below shall be part of the final QAP of mobile flash butt welding plant for entering the details regarding movement of the machine and work executed. This format shall be placed after Index page of QAP. While submitting initial QAP for approval, Column no. 1, 2, 3 & 6 shall be filled by the firm. During movement of the machine from one work site to another work site against a contract agreement/ different contract agreement details shall be filled and signed by firm and Railway/PSU officials in the proforma.

Movement details of Mobile Flash Butt Welding Plant

Sl. No.	Railway	Division/ Section	Period		CA/WO No. of FB welds ordered	Name of welder	FB Welds executed	Cumulative FB welds executed	Signature	
			From	To					Firm's official (Plant in-charge)	Railway officials with designation
1	2	3	4	5	6	7	8	9	10	11

17. The QAP covering all the information must be given in the form of single document indicating name of the firm, effective from, document no., revision number and page no. 'x' of 'y' on each page. QAP shall be digitally signed by (with name and designation) 'Prepared by', 'Checked by' (QC in-charge) and 'Approved by' by competent authority. All certificates/supporting documents shall be attached as Annexure to the QAP. In case of General QAP, details of welding team, and standardized welding parameters need not to be included.

COMPETENCY CERTIFICATE**Welder's/Supervisor's official ID No.:** _____,**Adhar No.:** _____

Photo	duly
attested	by
issuing	authority

(Signature of Welder/Supervisor)

Shri _____ FB welder/supervisor son of Shri _____
 sponsored by M/s _____ has been examined as per
 procedure and syllabus mentioned in Para 13 of the Manual for Flash Butt
 Welding of Rails-Revised 2012 (Reprint April 2022) with latest amendment. He
 has been found competent to execute flash butt welds with mobile/stationary
 flash butt welding plant model: _____, Make: _____.

This competency certificate is valid upto _____ for FB welding of -----
 ----{rail section(s)/grade(s)}

Date: _____**(Signature)****Chief Track Engineer/Chief Engineer (Construction)**_____
Railway,**or****(in case of PSUs/Metro Railway)****Name:****Designation with Grade:****Name of Organization****Seal:**


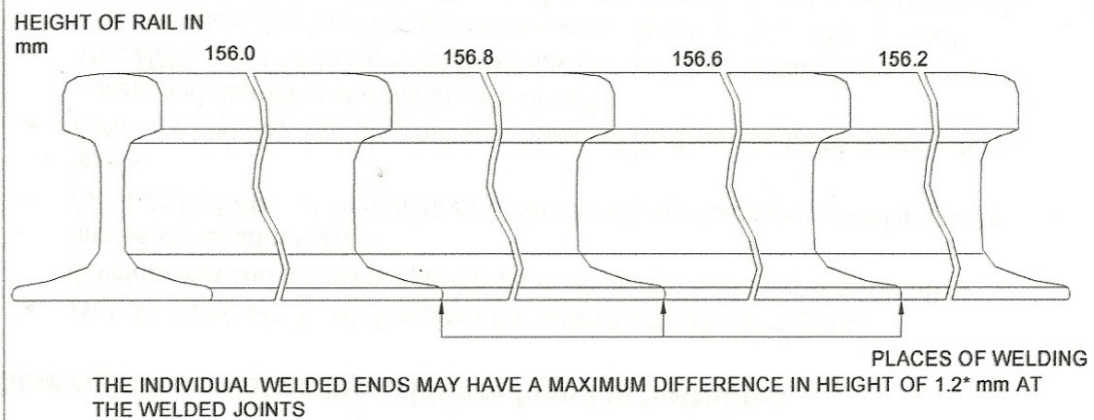



FIG : 3.2 SORTING OF RAILS TO BE WELDED

* FOR RAILS MANUFACTURED BY SAIL WITH DISPENSATIONS, THIS VALUE MAY BE 1.5 mm

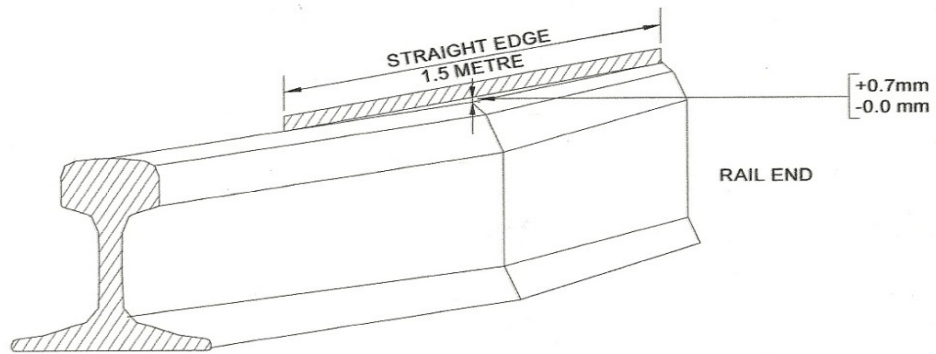



ELEVATION

FIG :3.4(a) TOLERANCE ON THE END BENDS IN THE VERTICAL PLANE

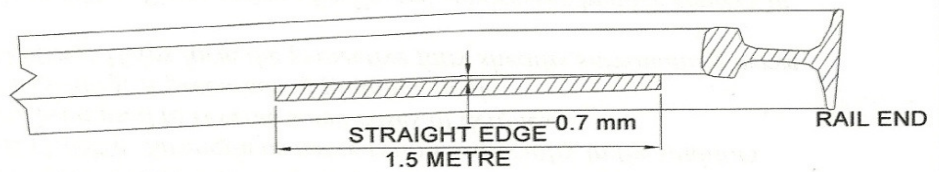


PLAN

FIG :3.4(b)

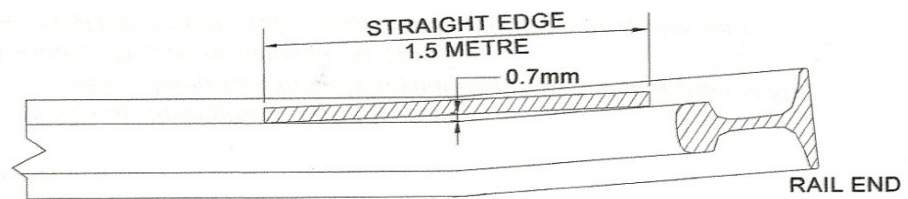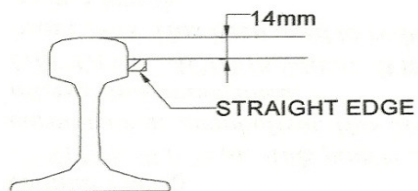


PLAN


FIG : 3.4(c) TOLERANCE ON THE END BENDS IN THE HORIZONTAL PLANE

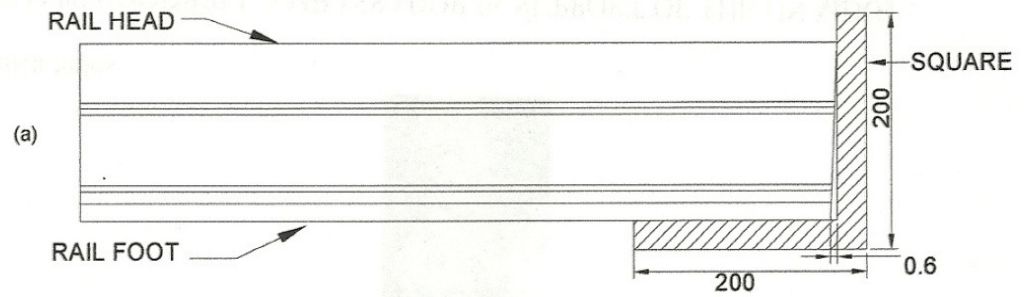


ELEVATION

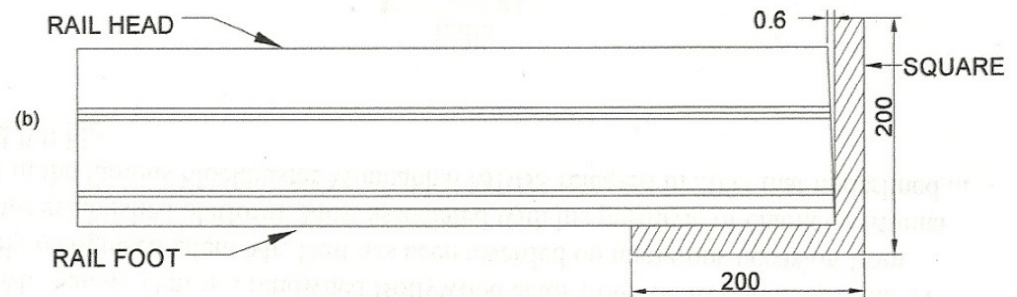

ELEVATION

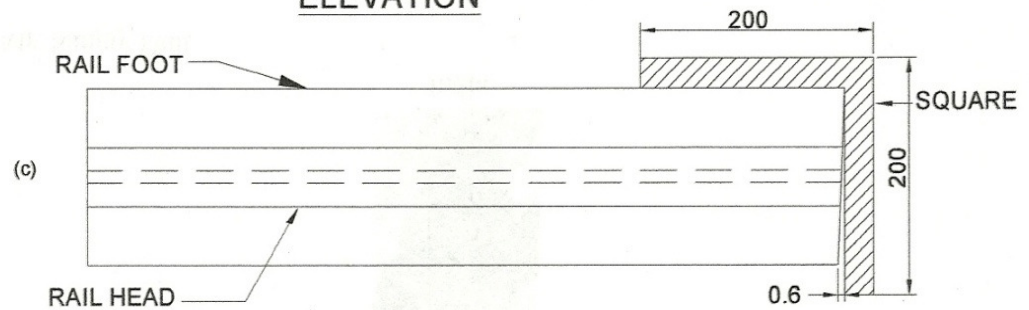

PLAN

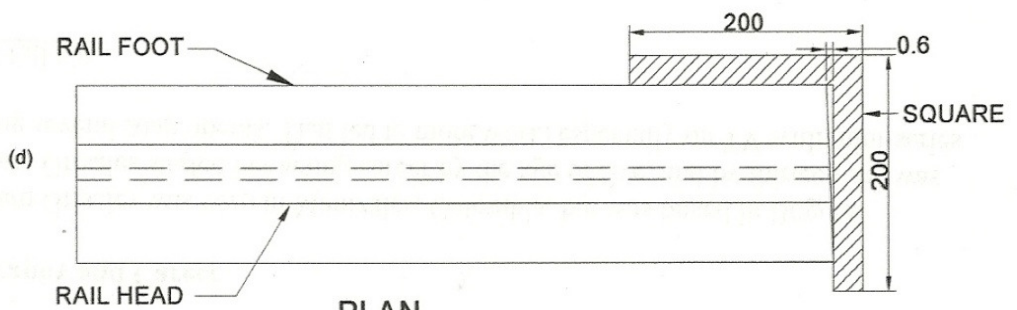

PLAN

FIG : 3.4 (d) DEVIATION OF THE RAIL END FROM THE SQUARE

ALL DIMENSIONS ARE IN MILLIMETRES

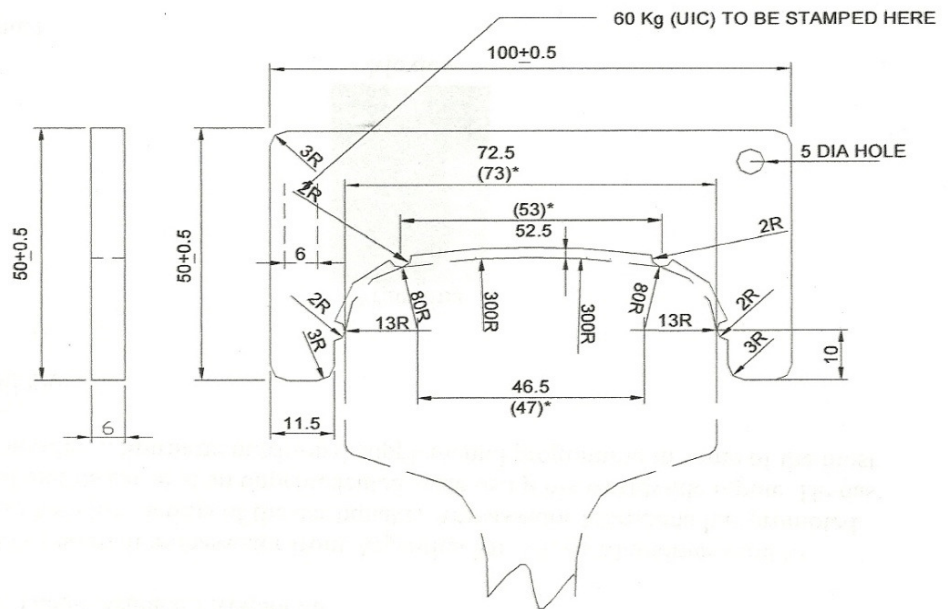


FIG : 4.2(a) HEAD WIDTH CHECKING GAUGE FOR 60 Kg (UIC) RAILS

* DIMENSIONS SHOWN IN BRACKETS ARE FOR RAILS MANUFACTURED BY SAIL WITH DISPENSIONS.
ALL DIMENSIONS ARE IN MILLIMETRES

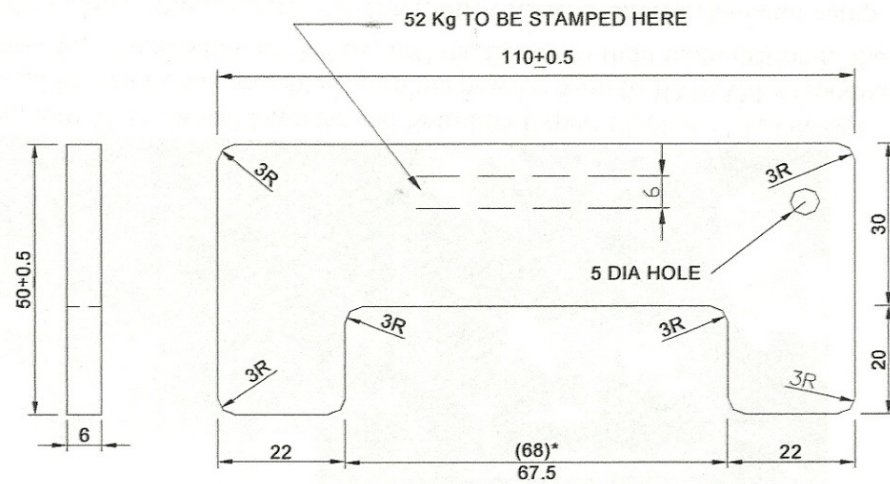


FIG : 4.2 (b) HEAD WIDTH CHECKING GAUGE FOR 52 Kg RAILS

* DIMENSIONS SHOWN IN BRACKETS ARE FOR RAILS MANUFACTURED BY SAIL WITH DISPENSATIONS.
ALL DIMENSIONS ARE IN MILLIMETRES.



55



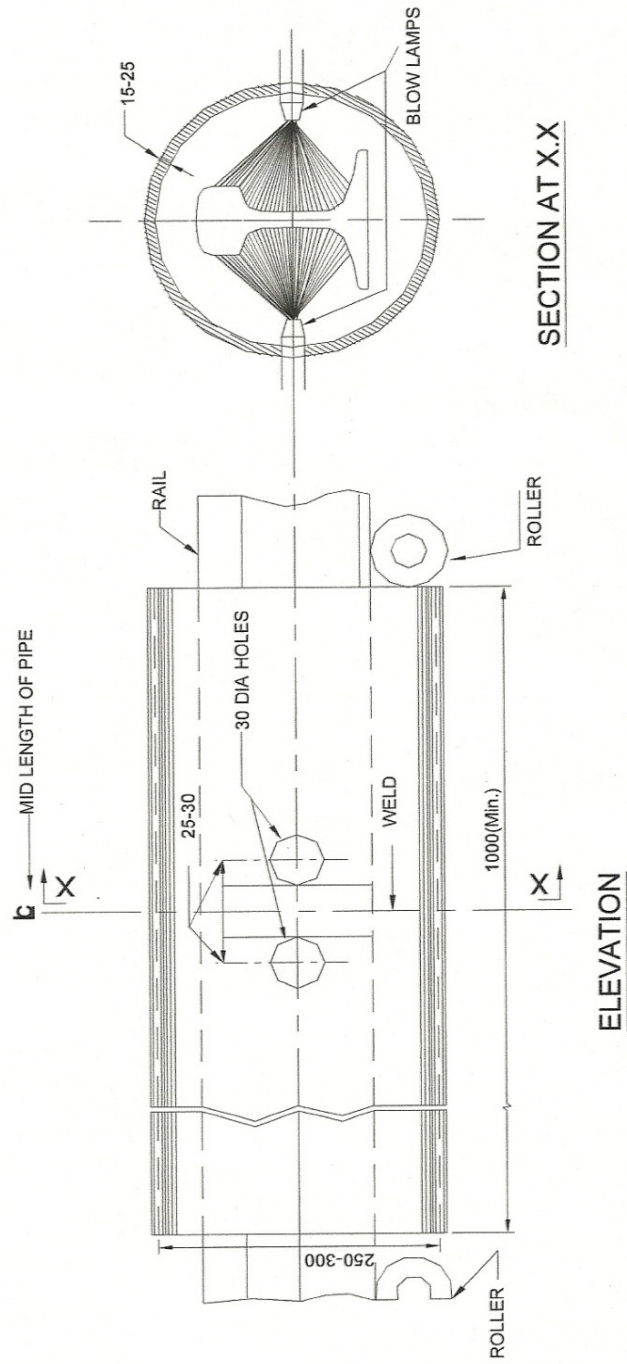


FIG :5.4(a) DETAILS OF A.C. PIPE ARRANGEMENT FOR CONTROLLED COOLING


ALL DIMENSIONS ARE IN MILLIMETRES

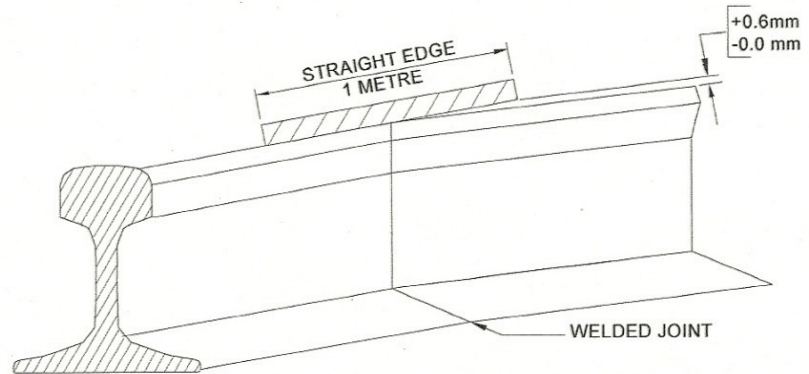


**FIG :8(a) TOLERANCE FOR VERTICAL MISALIGNMENT
OF WELDED JOINT WITH NEW RAILS**

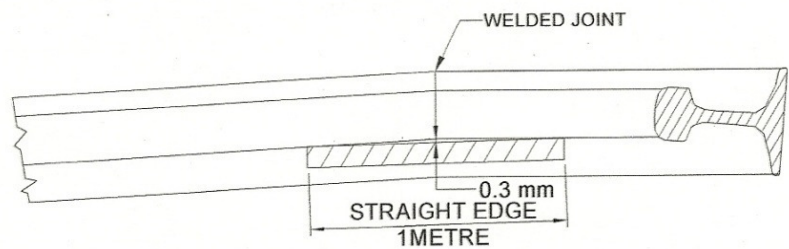

**FIG :8(b) TOLERANCE FOR LATERAL MISALIGNMENT
OF WELDED JOINT WITH NEW RAILS**

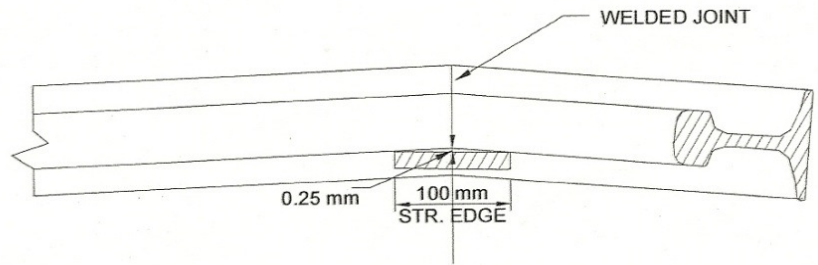

**FIG :8(c) TOLERANCE FOR FINISHING ON SIDES OF
HEAD OF WELDED JOINT WITH NEW RAILS**

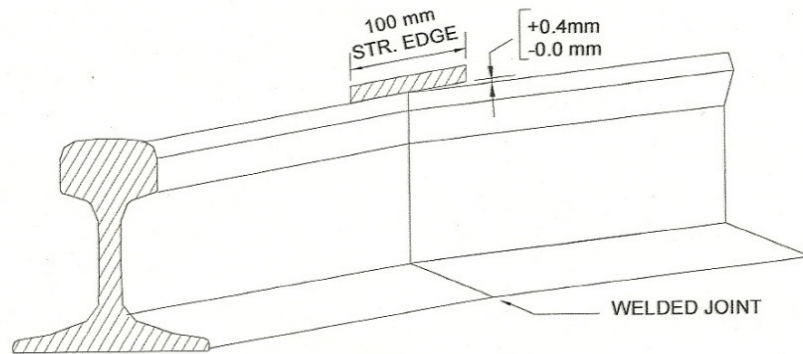

**FIG :8(d) TOLERANCE FOR FINISHING TOP TABLE
SURFACE OF WELDED JOINT WITH NEW RAILS**

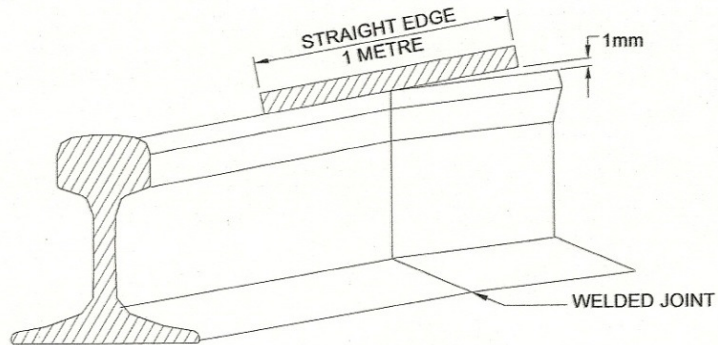


FIG :8(e) TOLERANCE FOR VERTICAL MISALIGNMENT OF HIGH WELDED JOINT WITH OLD RAILS

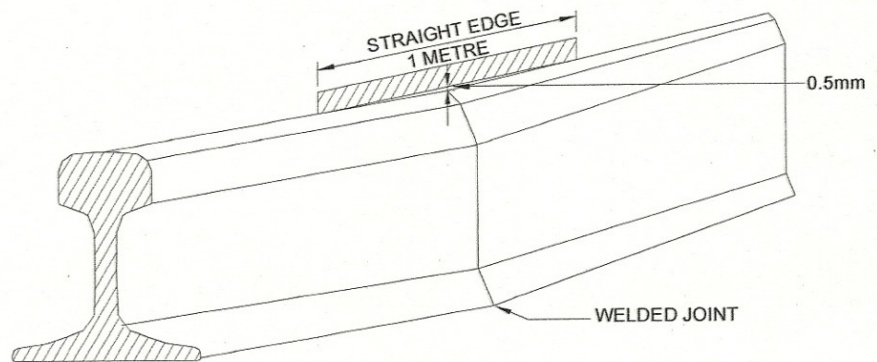


FIG :8(f) TOLERANCE FOR VERTICAL MISALIGNMENT OF LOW WELDED JOINT WITH OLD RAILS

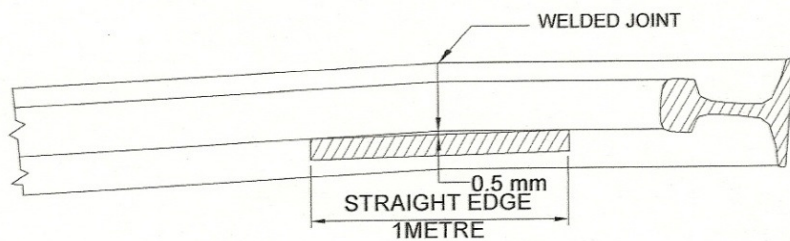


FIG :8(g) TOLERANCE FOR LATERAL MISALIGNMENT OF WELDED JOINT WITH OLD RAILS

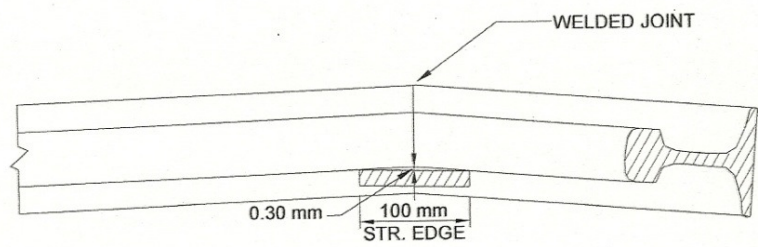


FIG :8(h) TOLERANCE FOR FINISHING ON SIDES OF HEAD OF WELDED JOINT WITH OLD RAILS

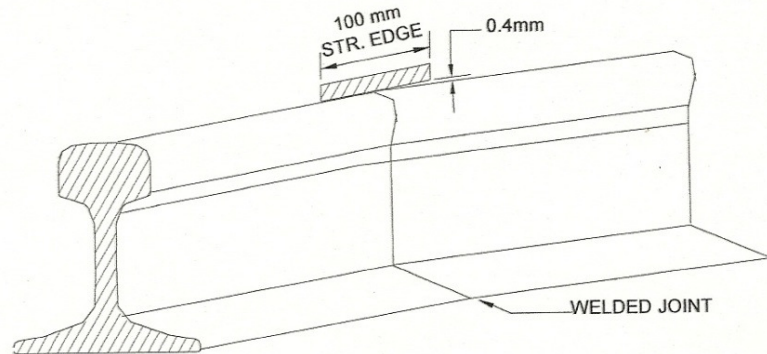


FIG :8(i) TOLERANCE FOR FINISHING TOP TABLE SURFACE OF WELDED JOINT WITH OLD RAILS (HIGH JOINT)

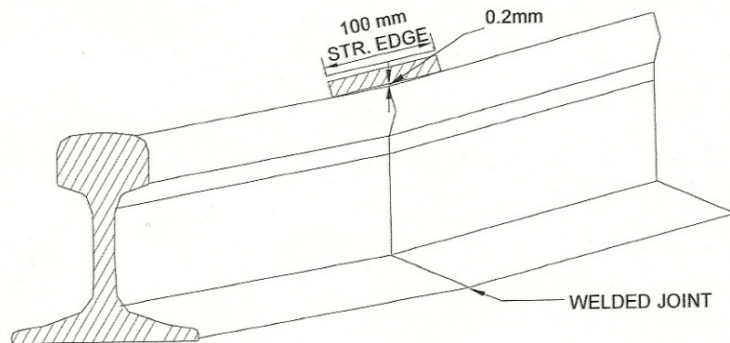


FIG :8(j) TOLERANCE FOR FINISHING TOP TABLE SURFACE OF WELDED JOINT WITH OLD RAILS (LOW JOINT)


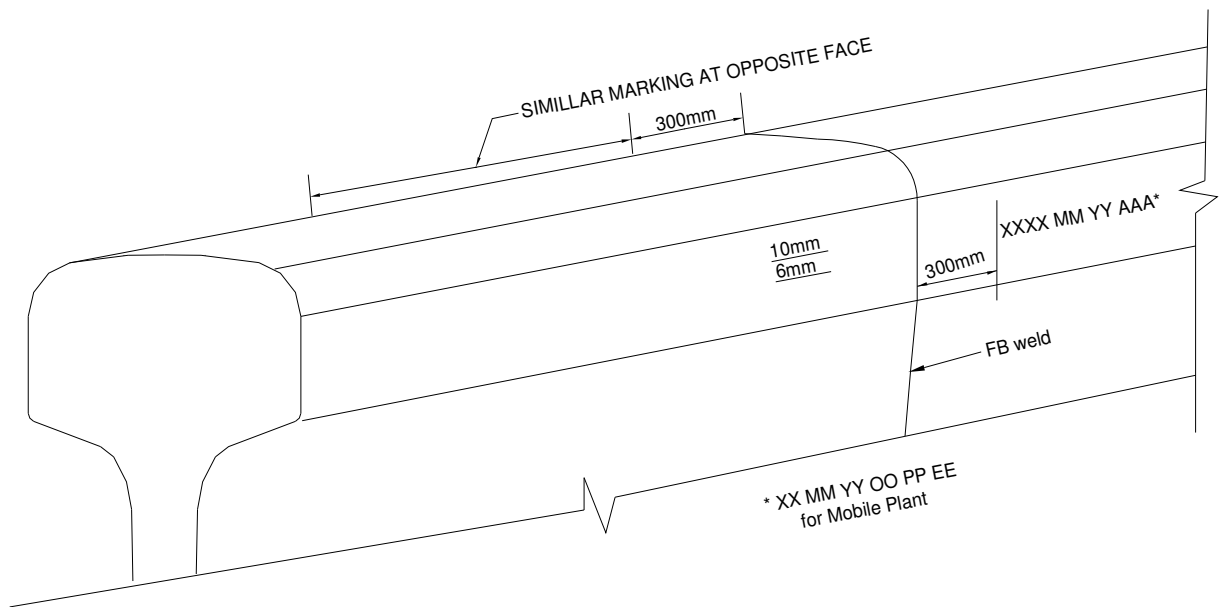


FIG: 9.0 LOCATION OF MARKING OF WELD

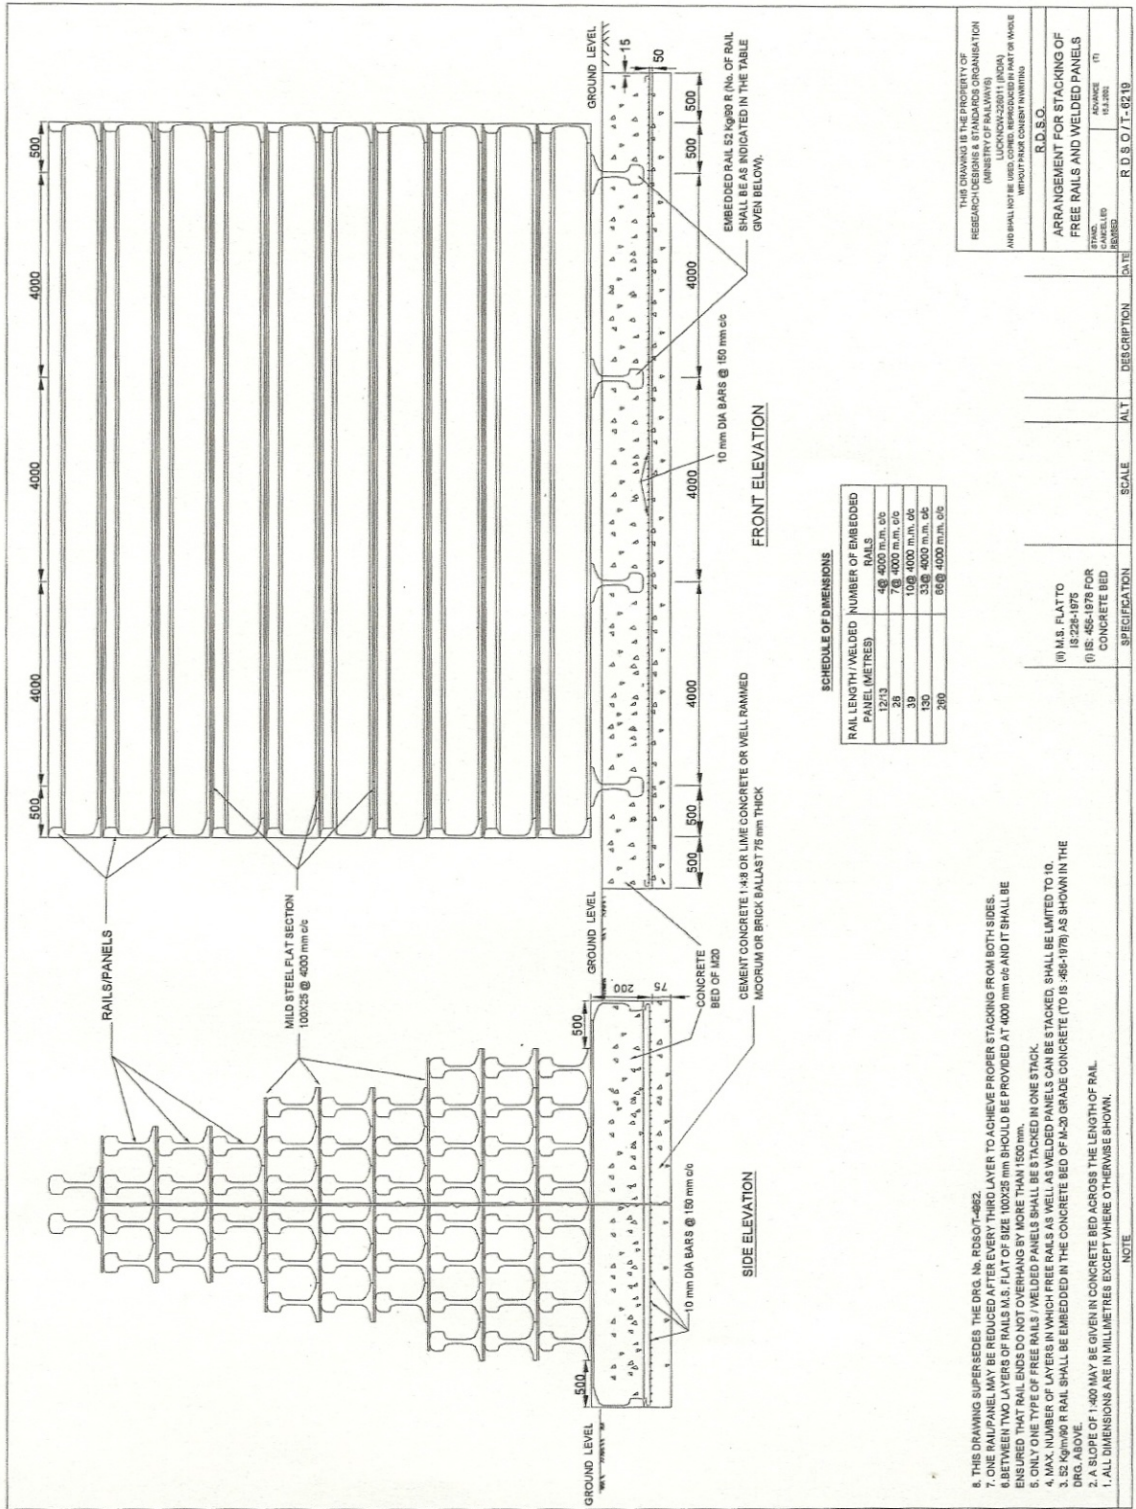

SCHEDULE OF DIMENSIONS

RAIL LENGTH / WELDED PANEL (METRES)	NUMBER OF EMBEDDED RAILS
12/13	4 @ 4000 m.m. c/c
26	7 @ 4000 m.m. c/c
39	10 @ 4000 m.m. c/c
130	33 @ 4000 m.m. c/c
200	66 @ 4000 m.m. c/c

8. THIS DRAWING SUPERSEDES THE DRG. No. ROSOT-462.

7. ONE RAIL/PANEL MAY BE REDUCED AFTER EVERY THIRD LAYER TO ACHIEVE PROPER STACKING FROM BOTH SIDES.

6. BETWEEN TWO LAYERS OF RAILS M.S. PLAT OF SIZE 100x25 mm SHOULD BE PROVIDED AT 4000 mm c/c AND IT SHALL BE EMBEDDED IN THE CONCRETE BED.

5. ONLY THE TYPE OF RAILS DO NOT PERMISSIBLE FOR THIS DRAWING.

4. MAX. NUMBER OF LAYERS IN WHICH FREE RAILS AS WELL AS WELDED PANELS CAN BE STACKED, SHALL BE LIMITED TO 10.

3. S2 K990 R RAIL SHALL BE EMBEDDED IN THE CONCRETE BED OF M-20 GRADE CONCRETE (TO IS : 456-1978) AS SHOWN IN THE DRG. ABOVE.

2. A SLOPE OF 1:400 MAY BE GIVEN IN CONCRETE BED ACROSS THE LENGTH OF RAIL.

1. ALL DIMENSIONS ARE IN MILLIMETRES EXCEPT WHERE OTHERWISE SHOWN.

THIS DRAWING IS THE PROPERTY OF
RESEARCH DESIGNS & STANDARDS ORGANISATION
(UNITED STATES OF AMERICA)
AND SHALL NOT BE USED, COPIED, REPRODUCED IN PART OR WHOLE
WITHOUT PRIOR CONSENT WRITING

R.D.S.O.

ARRANGEMENT FOR STACKING OF
FREE RAILS AND WELDED PANELS

STAGE
CANCELED
REVISE
ADVANCE
13.3.2021
(7)

R D S O / T - 0219

NOTE

SCALE

ALT

DESCRIPTION

DATE

SPECIFICATION

(1) M.S. PLAT TO
IS 225-1975
(2) IS 456-1978 FOR
CONCRETE BED