

High-fidelity frames, 1440 × 900

Rendered on the tokens approved in Pass B — three surfaces, four priority ramps, Public Sans and IBM Plex Mono, a 3px radius ceiling. Nothing in this document introduces a new colour. One incident — a wrong-way driver on camera CAM-014 — runs through frames 1 to 3 so you can see it detected, reviewed, and later dispatched.

FRAMES	CANVAS
5, plus the arrival choreography and a state matrix	1440 × 900, printed one frame per sheet
COPY RULES	
Sentence case · active voice · a control's verb becomes its confirmation	

Priority key  CRITICAL  HIGH  MEDIUM  LOW

CONTENTS	TWO CLOCKS THIS DESIGN ANSWERS TO
01 Default monitoring state	Time to awareness ≤ 2s · time to decision ≤ 15s for a critical.
02 Critical event arrival	
03 Incident under review	
04 Component state matrix	
05 Degradation and edge states	

18 / 18 feeds live

▲ 1 ◆ 2 ● 5 ■ 4

02:19:44 LOCAL01:19:44 UTC

Mute

QUEUE · 12 OPEN

Newest first

▲	CAM-014 · Wrong-way driver	05:37
◆	CAM-108 · Stopped vehicle, live lane	● 00:52
◆	CAM-231 · Debris, live lane	03:18
●	CAM-062 · Stopped vehicle, hard shoulder	06:41
●	CAM-019 · Congestion building	● 01:05
●	CAM-145 · Debris, hard shoulder	11:22
●	CAM-077 · Smoke, verge	18:09
●	CAM-203 · Congestion, lanes 1–2	22:47
■	CAM-091 · Low-confidence detection	09:14
■	CAM-156 · Routine congestion	44:52
■	CAM-038 · Resolved, logging	52:30
■	CAM-152 · Resolved, logging	58:03

● MEDIUM

Stopped vehicle, hard shoulder

CAM-062 · M6 northbound

CAM-062 · 02:19:41

Drop a snapshot — CAM-062, hard shoulder

or [browse files](#)

LOCATION

M6 northbound · Jct 10a

MILE MARKER

MM 34.7

DETECTION LATENCY

0.8s

CONFIDENCE

92%

DESCRIPTION

Vehicle stationary on the hard shoulder for over 6 minutes. Hazard lights not detected.

Dispatch

Acknowledge only

Dismiss, not real ▾

02:19:44 — a routine shift. CAM-014's wrong-way driver from earlier this hour is already dispatched and calm in row one; the operator's attention is on a hard-shoulder stop instead. Twelve rows, no scrolling.

● 18 / 18 feeds live

02:14:07 LOCAL

Mute

▲ Wrong-way driver — CAM-014, M6 northbound, Jct 8–9

Live lane 2 of 3 · detected 0.6s ago

Acknowledge

View

QUEUE · 12 OPEN

Newest first

▲ CAM-014 · Wrong-way driver, live lane 2 of 3	● 00:00
M6 N · Jct 8–9	
◆ CAM-108 · Stopped vehicle, live lane	● 00:52
M42 S · Jct 3a–4	
◆ CAM-231 · Debris, live lane	03:18
M6 Toll · Jct T1–T2	
● CAM-062 · Stopped vehicle, hard shoulder	06:41
M6 N · Jct 10a	
● CAM-019 · Congestion building	● 01:05
M25 clockwise · J6–7	
● CAM-145 · Debris, hard shoulder	11:22
M6 S · Jct 15	
● CAM-077 · Smoke, verge	18:09
M42 N · Jct 8	
● CAM-203 · Congestion, lanes 1–2	22:47
M6 N · Jct 11a–12	
■ CAM-091 · Low-confidence detection	09:14
M25 anti-clockwise · J9	
■ CAM-156 · Routine congestion	44:52
M6 S · Jct 4	
■ CAM-038 · Resolved, logging	52:30
M42 S · Jct 1	
■ CAM-152 · Resolved, logging	58:03
M6 N · Jct 9–10	


▲ HIGH Debris, live lane

CAM-231 · M6 Toll

SELECTION PRESERVED — THE ARRIVAL DID NOT MOVE OR REPLACE WHAT WAS ALREADY OPEN

The banner takes space at the top; it never overlays the detail pane. The row the operator already had open — an unrelated debris call — keeps its scroll position and selection.

T + 0.0S — DETECTION LANDS

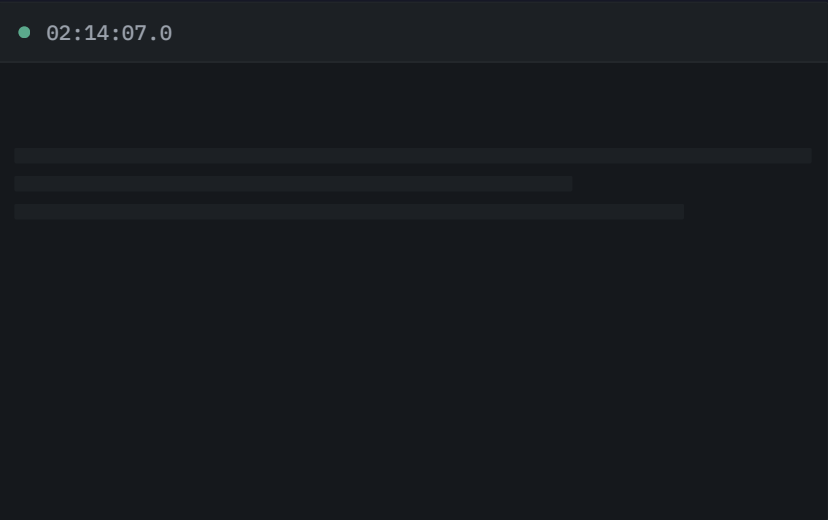

Nothing on screen yet — the detector has fired but the UI hasn’t painted it.

T + 0.3S — BANNER AND ROW SETTLE



Banner has expanded from 0; the row has inserted into the pinned band. Both finish inside 220ms.

T + 8S — STILL WAITING



Banner has not auto-dismissed — nothing does. Row is still unread; the age counter is the only thing moving.

TAB TITLE, BEFORE AND AFTER

- Incident Monitor — Sector 4
- (1) CRITICAL · Incident Monitor

Banner entry at 220ms cubic-bezier(.16,.8,.24,1), row insertion at 180ms cubic-bezier(.2,.7,.3,1) — the same tokens from Pass B, not new ones. The tab title flips the instant the banner does, so the alert survives the operator being on another monitor. Nothing here auto-dismisses: the banner retires on acknowledge, never on a timer.

▲ CAM-014 · Wrong-way driver

◆ CAM-108 · Stopped vehicle, live lane

◆ CAM-231 · Debris, live lane

● CAM-062 · Stopped vehicle, hard shoulder

● CAM-019 · Congestion building

● CAM-145 · Debris, hard shoulder

● CAM-077 · Smoke, verge

● CAM-203 · Congestion, lanes 1–2

● CAM-091 · Low-confidence detection

● CAM-156 · Routine congestion

● CAM-038 · Resolved, logging

● CAM-152 · Resolved, logging


▲ **CRITICAL** Wrong-way driver

CAM-014 · M6 northbound, Jct 8–9

“Critical — live lane 2 of 3, junction approach”

Detector description: vehicle travelling against traffic flow in live lane 2 of 3, approaching Jct 9.

CAM-014 · 02:14:07

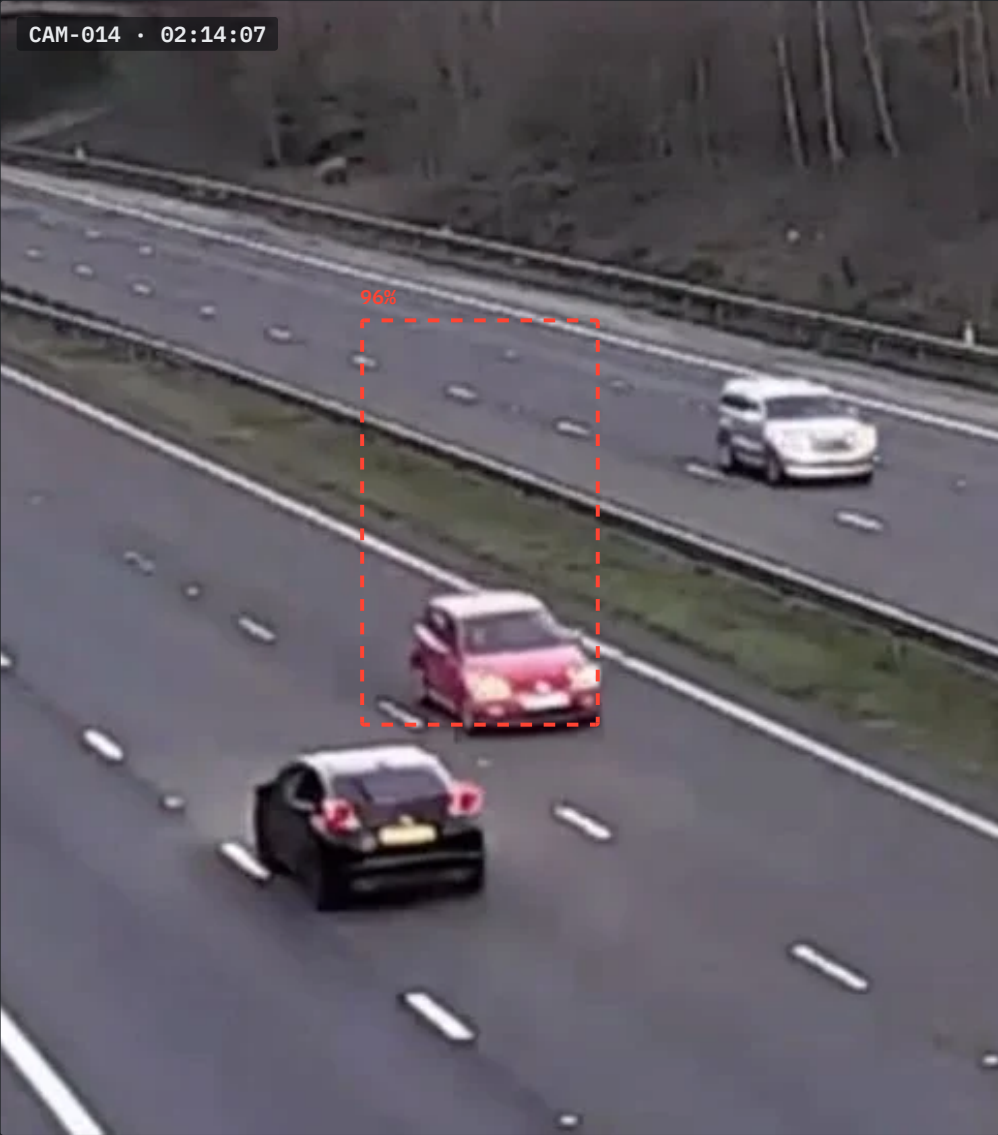

LOCATIONM6 northbound · Jct 8–9

MILE MARKERM42.3

DETECTION LATENCY0.6s

CONFIDENCE96%

NEARBY CAMERAS

●CAM-011 · MM 41.0

●CAM-014 · MM 42.3 — this incident

●CAM-017 · MM 43.6

AUDIT TRAIL

02:14:07Detected · confidence 96% (system)

02:14:07Priority set Critical (system)

02:14:19Unacknowledged 20s — banner re-fired, pushed to supervisor (system)

02:14:41Acknowledged (J. Kavanagh)

Dispatch

✓ Acknowledged · J. Kavanagh

Dismiss, not real ▾

The reason sits directly under the title in the priority's own colour — the only saturated text on the frame. Acknowledge already happened at 34s (past the 20s auto-escalation, visible in the audit trail); Dispatch is still the one live decision.

Default	CAM-077 · Debris, hard shoulder M42 N · Jct 8 18:09	Baseline row — no special state.
Hovered	CAM-077 · Debris, hard shoulder M42 N · Jct 8 18:09	Pointer over the row — background lifts one step, no colour added.
Keyboard-focused	CAM-077 · Debris, hard shoulder M42 N · Jct 8 18:09	↑↓ focus ring — 2px inset, neutral, never the priority colour.
Selected	CAM-062 · Stopped vehicle, hard shoulder M6 N · Jct 10a 06:41	Persistent highlight — stays while the detail pane shows it.
New & unread	CAM-108 · Stopped vehicle, live lane M42 S · Jct 3a–4 • 00:52	Unread dot, bolder text. Clears the moment it’s opened.
Ageing past SLA	CAM-019 · Congestion building M25 clockwise · J6–7 SLA 07:42	Age gains weight and an outline tag — contrast, not a new hue.
Acknowledged	CAM-014 · Wrong-way driver M6 N · Jct 8–9 JK 00:41	Owner’s initials replace the unread dot. Clock keeps running.
Dispatched	CAM-014 · M6 N · Jct 8–9 Unit 12 · ETA 4 min 04:12	Calm treatment — unit and ETA replace the raw description.
Dismissed	CAM-091 · Dismissed — shadow Undo	Collapses to a 20px strip with its reason and an undo, holds 8s, then leaves.

Connection indicator

- LIVE
- Feed connected, processing normally. Steady, no motion.
- RECONNECTING
- Dropped and retrying — the only status dot allowed to move.
- OFFLINE
- Feed down. Static, paired with a frozen “data as of” timestamp.

Buffered new-events bar

▲ +3 new events

Press Home, or click to jump to newest

▲ +4 new · 1 critical

Escalates even while the operator has scrolled away

CONNECTION LOST

●

OFFLINE

Feed connection lost. Showing data as of 02:19:44. Reconnecting automatically.

EMPTY QUEUE

✓

Queue clear

All 18 feeds live. New detections appear here automatically.

SNAPSHOT FAILED TO LOAD

Snapshot unavailable

The camera feed may be delayed. Retry, or continue from the description below.

Retry

LOW-CONFIDENCE, NEEDS VERIFICATION

NEEDS VERIFICATION

41% confidence

CAM-091 · M25 anti-clockwise, J9

Possible debris in lane 1. Low-confidence detection — image contrast was poor.

Confirm as Medium

Dismiss, not real