


HDC wiring v1

From


Duet Connections

10 pin socket


- 1 Live bed heater
- 2 Neutral bed heater
- 3 Earth bed heater
- 4
- 5
- 6 Temp Bed a
- 7 Temp Bed b
- 8
- 9 Anvil Nozzle Probe signal
- 10 Anvil Nozzle Probe gnd

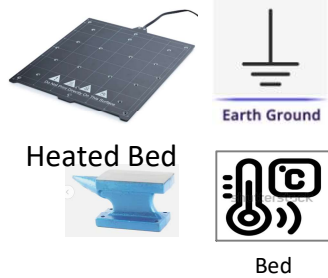

HDC Connector Assembly

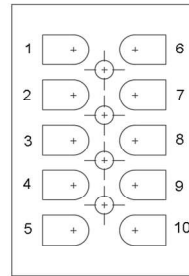

Socket view of screw terminals

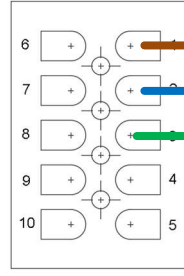

Plug view of screw terminals

See Drawing Mains connections




10 pin Plug


- 1 N/C
- 2 N/C
- 3 N/C
- 4 N/C
- 5 N/C
- 6 TEMP 0_VSSA
- 7 TEMP 0_temp0
- 8 N/C
- 9 IO_5_in
- 10 IO_5_gnd

6 pin Socket

- 1 Temp Chamber a
- 2 Temp Chamber b
- 3 Chamber Lighting +24
- 4 Chamber Lighting gnd
- 5
- 6

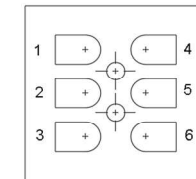

Socket view of screw terminals

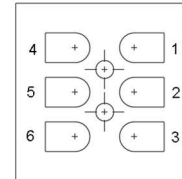

Plug view of screw terminals

See Drawing Mains connections




6 pin Plug


- 1 TEMP 2_VSSA
- 2 TEMP 2_temp2
- 3 POWER IN_Vin
- 4 POWER IN_gnd
- 5
- 6

6 pin Plug

- 1 Live Chamber heater
- 2 Neutral Chamber heater
- 3 Earth chamber heater
- 4
- 5 Fan Chamber +24
- 6 Fan Chamber gnd

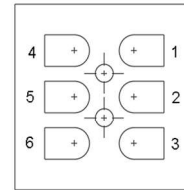

Plug view of screw terminals

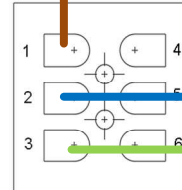

Socket view of screw terminals

6 pin Socket

- 1 N/C
- 2 N/C
- 3 N/C
- 4 N/C
- 5 OUT8_V_OUTLC2
- 6 OUT8_out8

Place a blob of RTV over the L and N connections , safety precaution in case the screws come loose!