


Tool head Wiring v1


GX20 10 FM

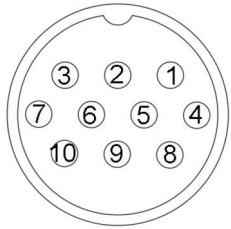

Socket viewed
from solder side

1	Fan Extruder +	Red/26/0.15	900mm
2	Fan Extruder -	Black/26/0.15	900mm
3	Pt1000 Temperature sensor	white/26/0.15	1M
4	PT1000 Temperature sensor	white/26/0.15	1M
5	thermistor extruder	blue/26/0.15	920mm
6	thermistor extruder	blue//26/0.15	920mm
7	Part cooling Fan +	Red/26/0.15	900mm
8	Part cooling Fan -	Black/26/0.15	900mm
9	Z Probe	green/26/0.15	1M
10	Z Probe	green/26/0.15	1M

GX20 6 FM

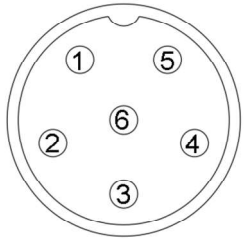

Socket viewed from
solder side

1	Heater Cartridge +	white/20/0.5	1M
2	Heater Cartridge -	white/20/0.5	1M
3	Stepper motor A2	Black/ 28awg/ 0.1	840mm
4	Stepper motor A1	Green/28awg/ 0.1	840mm
5	Stepper motor B1	Blue/28awg/ 0.1	840mm
6	Stepper motor B2	Red/28awg/ 0.1	840mm