


GX20 Tool Head Connections


GX20 10 FM

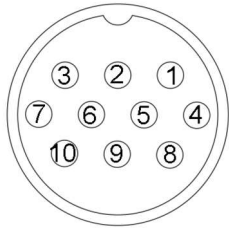

Socket viewed
from solder side

From Pin Num	Device	Wire Col/Size	Length mm
1	N/C		
2	N/C		
3	Pt1000 Temperature sensor	Red/22	1000
4	PT1000 Temperature sensor	Red/22	1000
5	Thermistor extruder	Blue/22	920
6	Thermistor extruder	Blue/22	920
7	N/C		
8	N/C		
9	Z Probe	White/22	1000
10	Z Probe	White/22	1000

GX20 6 FM

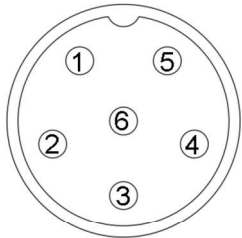

Socket viewed from
solder side

From Pin Num	Device	Wire Col/Size	Length mm
1	Heater Cartridge +	Used supplied	1000
2	Heater Cartridge -	Used supplied	1000
3	Stepper motor A2	Black used supplied	940
4	Stepper motor A1	Green used supplied	940
5	Stepper motor B2	Blue used supplied	940
6	Stepper motor B1	Red used supplied	940

Max wire size

6 Pin 16 AWG

10 Pin 20 AWG