
Modifications to BW16 rtlduino v1.0 to be able to download from Arduino using on board USB

Add jumper from CH340 pin 3 to PA7 (LOG_TX)

Add Jumper from CH340 pin 2 to PA8 (LOG_RX)

Cut traces to Pins 2 and 3 of CH340

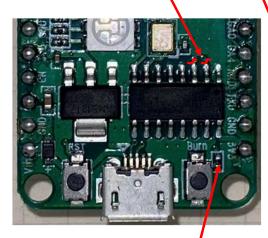

Change resistor from 0 ohms to 1.8K to meet RTL872X requirements for the minimum resistance to ground

