
BSPD 2027 — ENGINEERING REVIEW / CALIBRATION REQUIRED


Same Molex connector and pinout. Hardware only. External normally-open high-side shutdown relay required.


All trimmers removed: thresholds are selected by soldered precision resistors. Do not order for vehicle use before release checks.

1. CONNECTOR




2. PROTECTED SUPPLY / REFERENCE

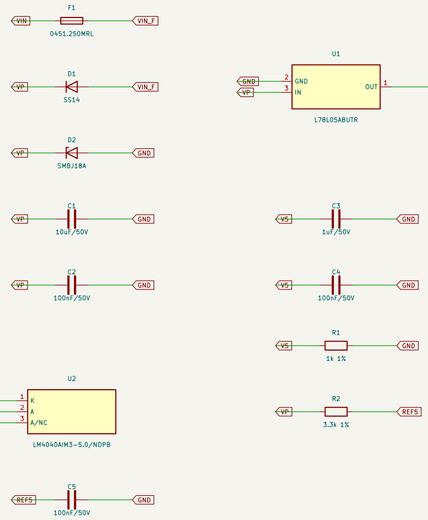


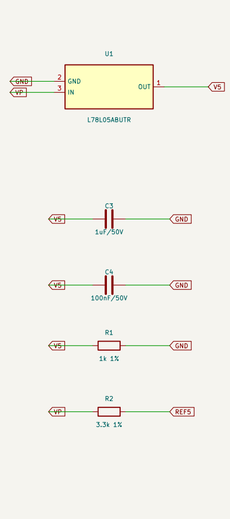





3. CURRENT / SENSOR FAULTS / UV

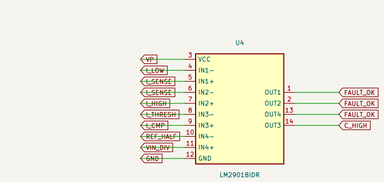

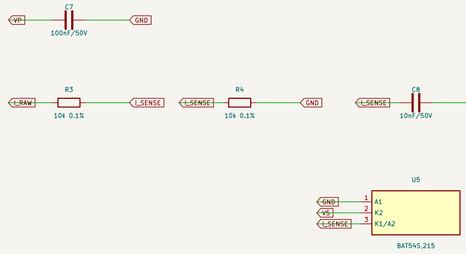



4. BRAKE / SENSOR FAULTS

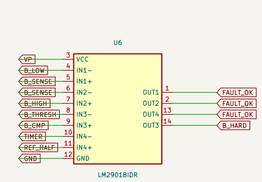

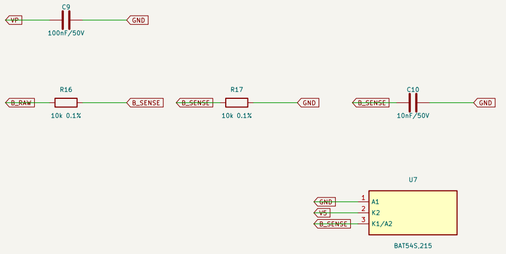


5. COINCIDENCE + TRIP LATCH

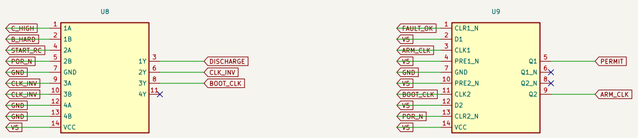


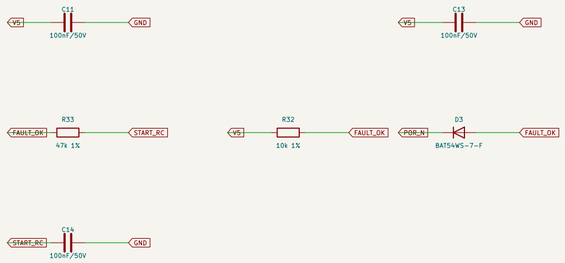

6. CONTINUOUS TIMING

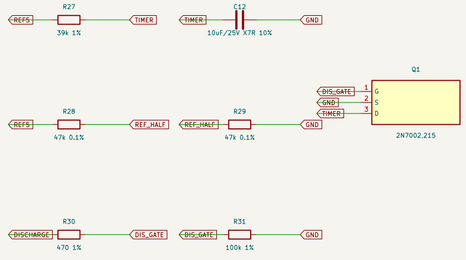

7. ACTIVE-HIGH OUTPUT

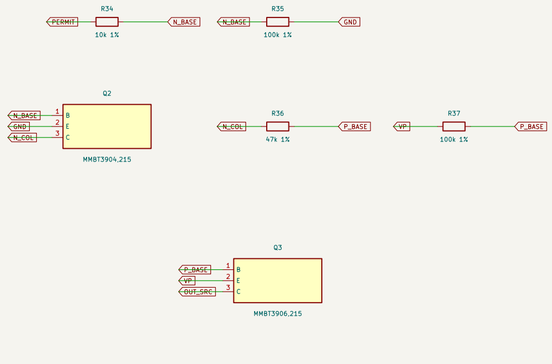

FAULT_OK is wired-AND: sensor opens/shorts and undervoltage clear the hardware latch immediately; only brake+current coincidence is delayed.

Q2 arms once on the first valid sensor state per GLV cycle. Later fault recovery cannot clear a trip. GLV must stay powered when SDC opens.

DHAB S/134 channel 2: ideal 5kW @360V =13.8889A: nominal Vout=2.63889V @5.000V. Confirm direction and supply accuracy.

AIM X05SNP13520: 0-135 bar / 1-5 V. Hard-brake pressure remains unconfirmed. Resistor population requires vehicle calibration.

Sheet: /	
File: BSPD_2027.kicad_sch	
Title: BSPD 2027 engineering review	
Size: A2	Date: 2026-10-05
KiCad E.D.A. 10.0.6	**Rev: R1 — calibration pending**
	Id: 1/1