
BSPD 2027 — ENGINEERING REVIEW / CALIBRATION REQUIRED

Same Molex connector and pinout. Hardware only. External normally-open high-side shutdown relay required.

All trimmers removed: thresholds are selected by soldered precision resistors. Do not order for vehicle use before release checks.

1. CONNECTOR



2. PROTECTED SUPPLY / REFERENCE





















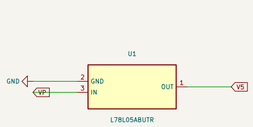













3. CURRENT / SENSOR FAULTS / UV

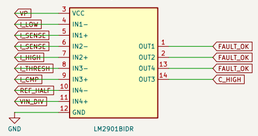






































4. BRAKE / SENSOR FAULTS

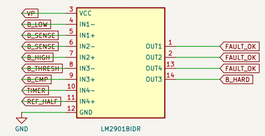

































5. COINCIDENCE + TRIP LATCH

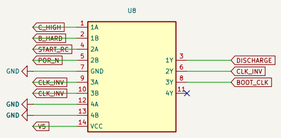

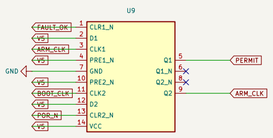












6. CONTINUOUS TIMING

















7. ACTIVE-HIGH OUTPUT




















FAULT_OK is wired-AND: sensor opens/shorts and undervoltage clear the hardware latch immediately; only brake+current coincidence is delayed.

Q2 arms once on the first valid sensor state per GLV cycle. Later fault recovery cannot clear a trip. GLV must stay powered when SDC opens.

DHAB S/134 channel 2: ideal 5kW @360V =13.8889A: nominal Vout=2.63889V @5.000V. Confirm direction and supply accuracy.

AIM X05SNP13520: 0-135 bar / 1-5 V. Hard-brake pressure remains unconfirmed. Resistor population requires vehicle calibration.

Sheet: /
File: BSPD_2027.kicad_sch

Title: BSPD 2027 engineering review

Size: A2 | Date: 2026-10-05 | **Rev: R1 — calibration pending**

KiCad E.D.A. 10.0.6 | Id: 1/1