
BSPD 2027 — ENGINEERING REVIEW / CALIBRATION REQUIRED

Same Molex connector and pinout. Hardware only. External normally-open high-side shutdown relay required.

All trimmers removed: thresholds are selected by soldered precision resistors. Do not order for vehicle use before release checks.

1. CONNECTOR







2. PROTECTED SUPPLY / REFERENCE






























3. CURRENT / SENSOR FAULTS / UV

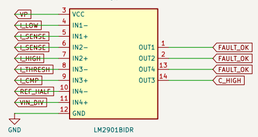

















4. BRAKE / SENSOR FAULTS

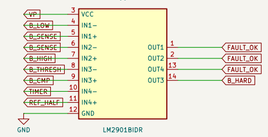















5. COINCIDENCE + NON-LATCHING PERMIT

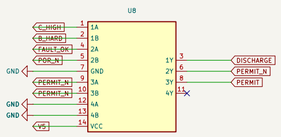






6. CONTINUOUS TIMING









7. ACTIVE-HIGH OUTPUT











FAULT_OK is wired-AND: sensor faults and undervoltage directly remove permit; only brake+current coincidence is delayed.

PERMIT = FAULT_OK AND POR_N. The signal recovers when faults clear. Fault retention and manual reset belong to the external relayboard.

DHAB S/134 channel 2: ideal 5kW @360V =13.8889A; nominal Vout=2.63889V @5.000V. Confirm direction and supply accuracy.

AIM X05SNP13520: 0-135 bar / 1-5 V. Hard-brake pressure remains unconfirmed. Resistor population requires vehicle calibration.

Sheet: /	
File: BSPD_2027.kicad_sch	
Title: BSPD 2027 engineering review	
Size: A2	Date: 2026-10-30
KiCad E.D.A. 10.0.6	**Rev: R2 — external relay latc**
	Id: 1/1