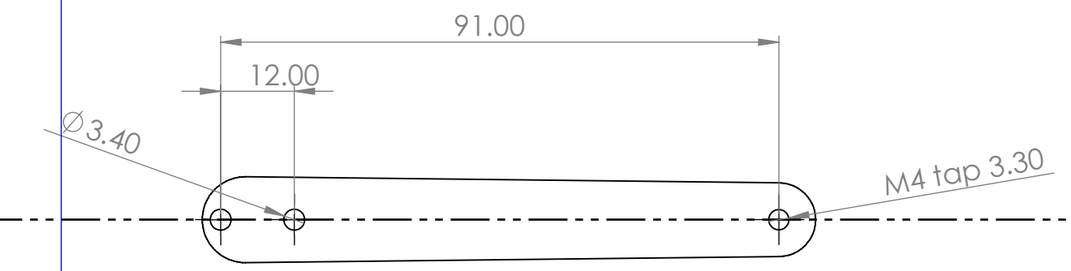

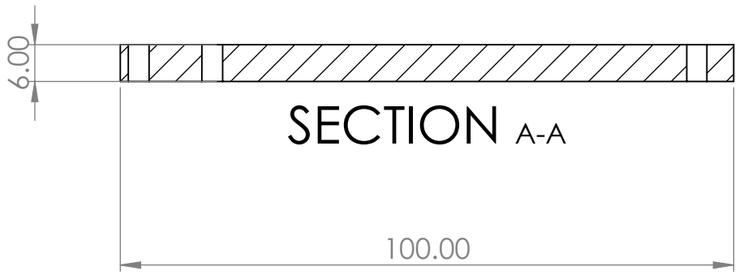

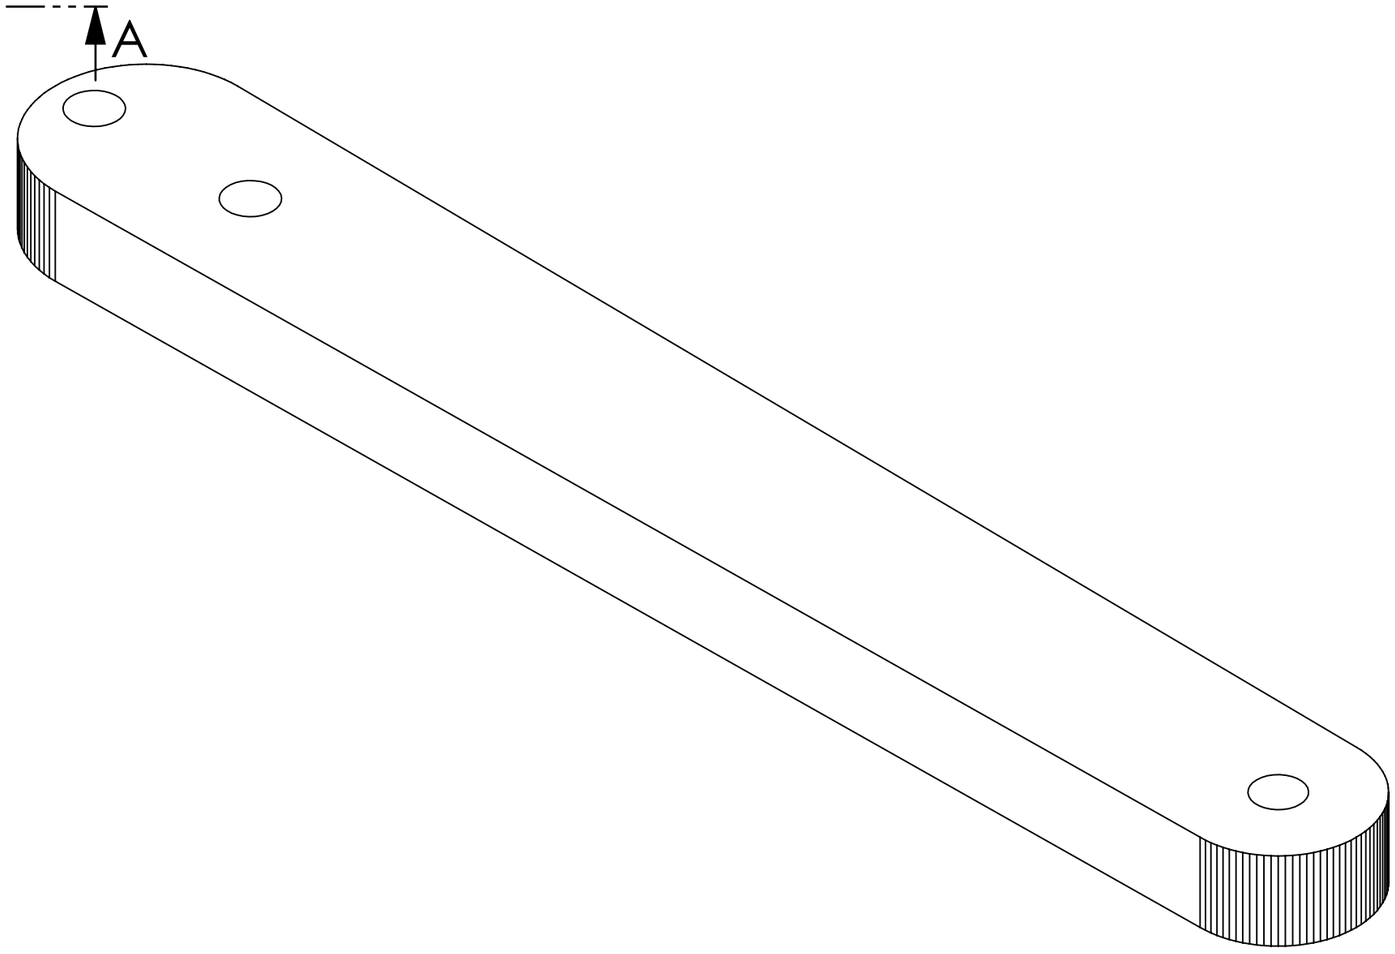

6061-T6 plate 6.0, waterjet or milled, clear anodise. Flat 0.05. Width 14 at the hub end tapering to 12 at the knob end; ends full radius R7 (centre 3 mm beyond the hub axis) and R4 (on the knob hole).
Hub axis midway between the two M3 clearance holes (dia 3.4); knob hole 85.0 from the hub axis (crank radius).
Knob hole M4x0.7 tapped through for the ISO 7379 shoulder screw.
General tolerance ISO 2768-mK, linear +-0.1, angles +-0.5 deg; all edges 0.3x45; Ra 1.6 on fits, 3.2 elsewhere.

grindmn crank arm (part 5) - machining

grindmn_crank_arm | requirements.md 5.6, end +2 mm
Scale 1:1 (iso 3:1) mm 3rd angle

2026-11-06

SOLIDWORKS Educational Product. For Instructional Use Only.