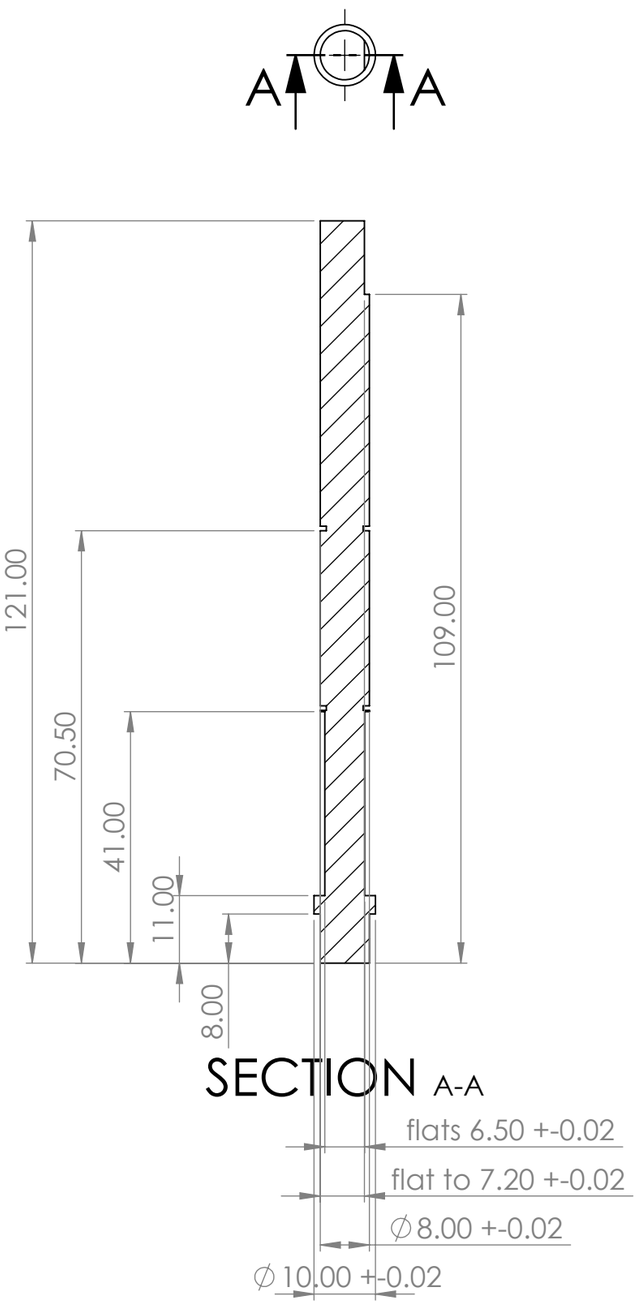

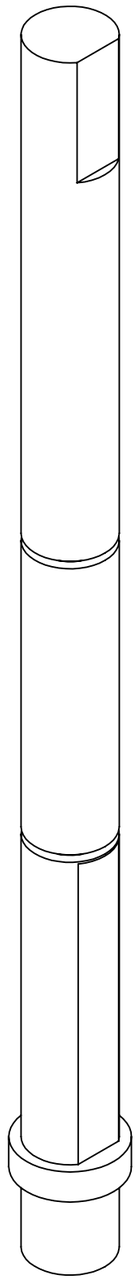

416 stainless (magnetic). Turn between centres; grind both bearing seats in one setup between centres.
Bearing seats dia 8 h5 (0/-0.006), Ra 0.4: z 0..8 and z 89..100. Runout seats to each other 0.005; burr drive 0.01 to seats; straightness 0.01.
E-clip grooves DIN 6799 size 6: dia 6.0 x 0.74 wide at z 41.2 and z 70.5. Collar faces perpendicular 0.01.
Burr drive z 11..41: two flats 6.50 across, symmetric 0.02 (ASSUMED, cut to the inner burr bore). Crank flat z 109..121, one side.
Top end: 0.3 chamfer, face flat (magnet seats on it).
General tolerance ISO 2768-mK, linear +-0.1, angles +-0.5 deg; all edges 0.3x45; Ra 1.6 on fits, 3.2 elsewhere.

grindmn shaft (part 4) - machining

grindmn_shaft | projects/grindmn/requirements.md section 5.3
Scale 1:1 (iso 2:1) mm 3rd angle

2026-11-06

SOLIDWORKS Educational Product. For Instructional Use Only.