8D-Report

WÜRTH ELEKTRONIK MORE THAN YOU EXPECT

Claim no.	C_11787	**Version no.**	01
Date entered	13.08.2024	**Interim report**	13082024
Part No.	B130	**Customer claim**	yes
Date completed	open	**Final Decision for claim**	open

Business partner			
From	WE iBE GmbH	**To**	AVO Carbon DE

Symptom
Kohlen zu kurz

Quantity			
Total	Batch 269407 (90.000 St.) LS 547170/A1	**Complained**	**12.000 St.**
Returned	**12.000 St.**	**Accepted**	
Rejected			

D1 Problem solution team

Role	Name	Department	Phone	Email
Teamleader	Joachim Gehl	QM	01723889953	joachim.gehl@avocarbon.com
Team Member	Baniel Beil	QM		
Team Member	Gunther Luschtinetz	QM		
Team Member	Martin Röhr	Endbearbeitung		
Team Member				
Team Member				
Team Member				
Team Member				
Team Member				
Team Member				

D2 Problem description

Position: 1			
Entered	13.08.2024	**Part no.**	B130, WE iBE batch 2347D1
Problem description	WE iBE Kunde hat Fertigteile reklamiert, bei welchen die Kohlen zu kurz sind Spezifikation: 10 +/-0,3 mm (**SPC Maß !**) NOK Teile: 9,21 - 9,22 mm Anteil: 78.000/15 = 0,019%		

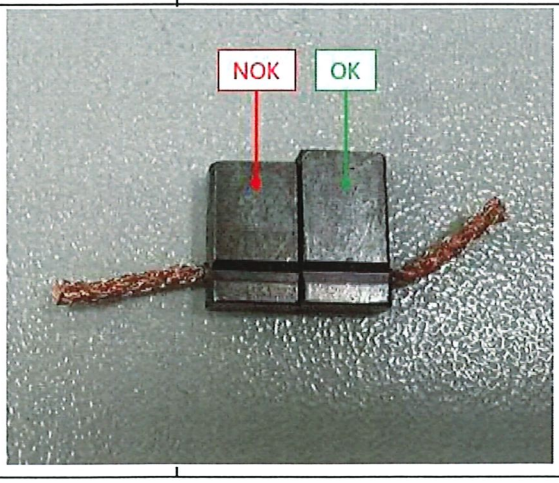

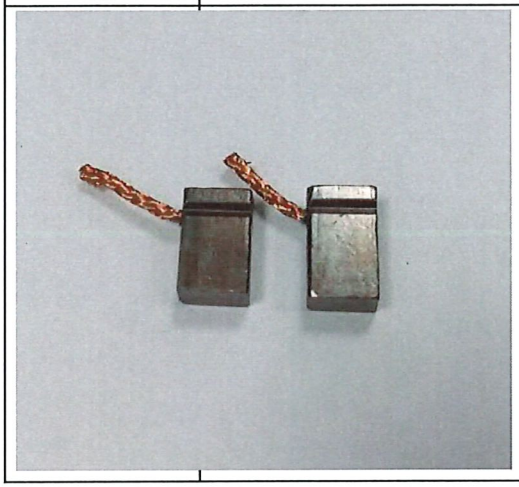

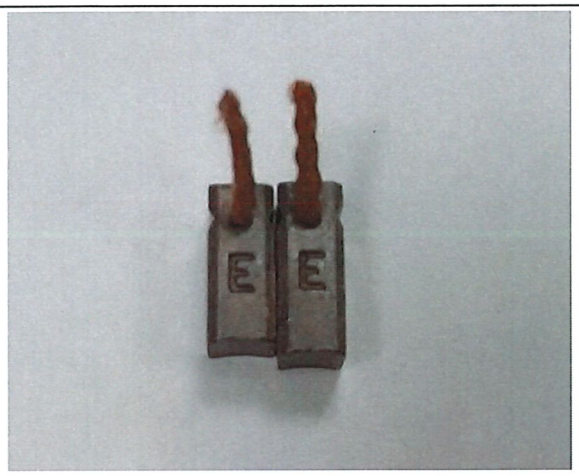

Analysis action @ supplier

Action title	Responsible employee	Planned end date
Check production data check Quality data check maintenance data inform production department organize return shipment clarify sorting and prepare sorting instruction	AVO Carbon	15.08.2024

D3 Immediate actions

Action title		Responsible employee	Start date
Inspection of stock @ WE iBE (components)		Hauser	12.08.2024
Control / check	noch 12.000 St. von Batch 269407 bei WE iBE lagernd		
Result	Kohlen gesperrt -> Rücklieferung an AVO Carbon		
Replacement Delivery		Baykov	13.08.2024
Control / check	Ersatzlieferung von WE iBE an Kunde bis 15.08.24, wegen drohendem Bandstillstand		
Result	-> Kostenbelastung für Sondertransport an AVO Carbon		
Inspection of stock @ WE iBE customer		Baykov	13.08.2024
Control / check	noch 7.168 St. Fertigteile bei WE iBE Kunde lagernd, wurden gesperrt		
Result	Teile sortieren bei Kunde, um Bandstillstand zu vermeiden. Sortierung von WE iBE freigegeben -> Kostenbelastung für entstandene Reklamation und Sortierkosten an AVO Carbon		
Inspection of parts in transit AVO Carbon -> WE iBE		AVO Carbon	asap
Control / check	**no parts in transit;**		
Result	---		
Inspection of internal stock @ AVO Carbon		AVO Carbon	asap
Control / check	**129405 Teile mit Bügelmessschraube prüfen**		
Result	753 NIO-Teile (Teile zu kurz)		
Information to all responsible departments / employees			
Result	all departments are informed in daily QRQC Meeting		
Risk assessment		AVO Carbon	asap
Control / check	**WE iBE hat noch folgende Menge lagernd:** **110.00 St., LS 551631/A1** **16.000 St., LS 547170/A1** **Inwieweit besteht das Risiko, dass auch diese Lose zu kurze Kohlen enthalten ?**		
Result	all parts are checked		
Other actions			
Control / check	**see analysis actions**		
Result	all actions done		

D4 Cause analysis

Cause theory				
No.	Title	Confirmed on	Category	Excluded
1	wrong adjustment during setup	only 753 pcs found	man	excluded
2	wrong adjustment after wheel change	only 753 pcs found	man	excluded
3	support for grinding wheel movement was not tight	single parts where found in different card boxes	machine	

Compliance test / Verification			
No.	Action title	Responsible employee	Planned end date
1	---	---	---
2	---	---	---
3	untighten the screw from the support and produce parts	Martin Röhr	15.09.2024

Cause Effect Diagram

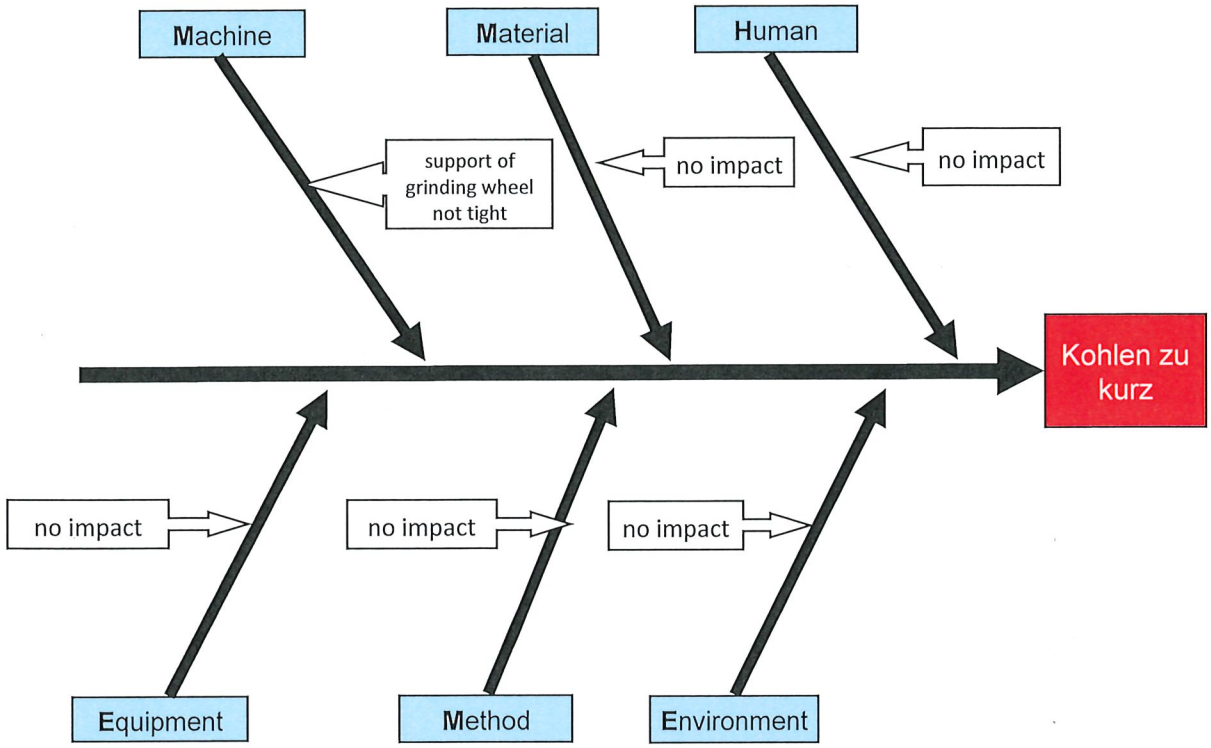

Questions on the root cause theory

Questions on the theory 1:	
Why happened?	
1	because screw of support was not tightened
2	because it was missed by technician
3	because technician was unattentive
4	because he was disturbed by operator
5	
Why not discovered?	
1	because the defect does not occur permanently
2	because the support is partially locked in his position
3	because during serial inspection the defect part was not detected
4	
5	

Questions on the theory 2:	
Why happened?	
1	---
2	
3	
4	
5	
Why not discovered?	
1	---
2	
3	
4	
5	

Questions on the theory 3:
Why happened?

1	---
2	
3	
4	
5	
Why not discovered?	
1	---
2	
3	
4	
5	

D5 Planned remedial actions

Cause No.	Action title	Responsible employee	Planned start date
1	sorting of all batches probably involved	Joachim Gehl	01.09.2024
Effectiveness / End date	02.10.2024		
2			
Effectiveness / End date			
3			
Effectiveness / End date			

D6 Current remedial actions

Cause No.	Action title	Responsible employee	Start date	Planned end date
1	support - bearing was defect - grinding was not continuously	Maintenance / MR	18.09.2024	19.09.2024
Comment	support is working properly now			
2	check conditions of preventive maintenance	Gabriel Dohr	18.09.2024	18.09.2024
Comment	preventive maintenance was checked and added to the plan			
3				
Comment				

D7 Prevention of repeated error

Cause No.	Action title	Responsible employee	Planned start date	Planned end date
1	check conditions of preventive maintenance	Gabriel Dohr	18.09.2024	18.09.2024
Comment	preventive maintenance was checked and added to the plan			
2	check during work place audits	QM	18.09.2024	ongoing
Comment				
3				
Comment				

Information passed to relevant persons / departments	Responsible Person
information during QRQC	Joachim Gehl

D8 Sign off, appreciation of team effort

Date	10.10.2024	Appreciation of the team / responsible	Joachim Gehl

Sign off confirmed by			
Name	Joachim Gehl	Date 06 01 25	
Signature	Joachim Gehl		

Attachments