Supplier 8D report
供应商8D报告

Customer plant 客户工厂	Kelier	**Supplier** 供应商	AVO Anhui/Tianjin	**Date of claim** 投诉日期	2025/9/28
Customer contact 客户联系人	Tony	**SAP no.** SAP编号		**Date of QR** QR日期	2025/9/28
Claim reference 客诉编号	20250929	**Author** 审核者	Tim	**Update of QR** QR更新日期	2025/10/11

QUICK RESPONSE 快速响应

This QR form must be replied to within 24 hours after the complaint notification is given to the supplier

-该QR表单必须在投诉通知给供应商之后的24小时内回复

D 1. Description of the problem 问题描述

1.a What is the problem ? Use 5W+2H to describe what is the current situation. 问题是什么？使用5W2H描述当前状态。

Problem description 问题描述	碳刷铜线尺寸短 Short size of carbon brush copper wire	What happened? 发生了什么	Standard:: 25±1 Actual size:: 18.74
Incident level事故等级	C2 : Production claim	Why is it a problem? 为什么这是一个问题？	影响使用，碳刷无法正常工作 Affects usage, carbon brushes cannot function properly
Part number料号	UP28	When did it happen? 何时发生的？	2025/9/28
Part description名称	Brush	Who detected it? 何人发现的？	OAperator
Traceability of nok parts 不合格品追溯	20250822	Where was it detected? 在哪里被发现的？	Assembly line
Recurrence 事故再发？	no reccurent defect	How was it detected? 如何发现的？	visual inspection
Defect S/R 不良类型	no	How many parts ? 发现多少不良？	1/4000

nok part picture / sketch 不良品照片/草图

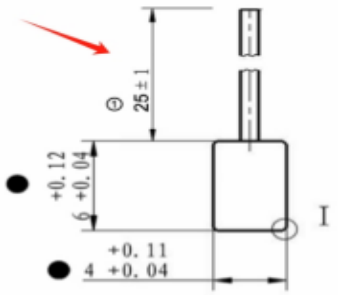

1.b Supplier problem solving team 供应商问题解决团队

Name 姓名	Position 职位	Location 地址	Telephone 电话	Email 邮箱
Weijing Peng	QM	AVO	158-2206-9076	weijiang.peng@avocarbon.com
Zhenqing Yao	PE	AVO	138-0216-0261	yongchun.zhang@avocarbon.com
Wenyuan He	PM	AVO	189-2011-0788	wenyuan.he@avocarbon.com
Bingren Yuan	QC Team Leader	AVO	158-2299-0120	bingren.yuan@avocarbon.com
Qingjun Meng	QE	AVO	189-0215-3332	OQC@avocarbon.com

1.c Tool to use (defined by Nidec) 使用工具

[ ] Ishikawa [x] FTA [x] 5why's [x] LLC [ ] Audit [ ] Other

1.d Problem description from supplier / first analyse of problem / potential root causes

供应商对问题的描述/ 问题初步分析 /潜在根本原因

目前从图片上不能确认失效的原因，需要进行制造过程及生产记录排查分析

At present, the cause of the failure cannot be determined from the pictures. Further investigation and analysis of the manufacturing process and production records are required.

Samples of nok parts required at supplier location 供应商处对不良样品的需要与否？ yes

Express shipping supplier account 供应商快递账号

D 2. Risk on similar products and processes 类似产品和制程上的风险

Can this defect happen on similar parts ?

该不良会发生在类似产品上吗？

		Comments (compulsory if yes)
Other family product 其他家族产品	no	
Other machine 其他设备	no	
Other tooling 其他工具工装	no	

Supplier 8D report
供应商8D报告

Customer plant 客户工厂	Kelier	**Supplier** 供应商	AVO Anhui/Tianjin	**Date of claim** 投诉日期	2025/9/28
Customer contact 客户联系人	Tony	**SAP no.** SAP编号		**Date of QR** QR日期	2025/9/28
Claim reference 客诉编号	20250929	**Author** 审核者	Tim	**Update of QR** QR更新日期	2025/10/11

QUICK RESPONSE 快速响应

This QR form must be replied to within 24 hours after the complaint notification is given to the supplier

-该QR表单必须在投诉通知给供应商之后的24小时内回复

Other 其他 如有则必须填写	no	

Supplier 8D report
供应商8D报告

Customer plant 客户工厂	Kelier	**Supplier** 供应商	AVO Anhui/Tianjin	**Date of claim** 投诉日期	2025/9/28
Customer contact 客户联系人	Tony	**SAP no.** SAP编号		**Date of QR** QR日期	2025/9/28
Claim reference 客诉编号	20250929	**Author** 审核者	Tim	**Update of QR** QR更新日期	2025/10/11

QUICK RESPONSE 快速响应

This QR form must be replied to within 24 hours after the complaint notification is given to the supplier

-该QR表单必须在投诉通知给供应商之后的24小时内回复

D 3. Containment 遏制措施

see sorting approval 点击查看分拣许可

What are the actions to detect all non-conforming parts in the process flow ? 过程中检测所有不良品的行动是怎样的?

Location in the process flow 过程地点	Nb to be sorted 待检数量	Nb parts sorted	Nb nok parts 不良品数量	ppm 不良率	Date 日期	Resp. 责任者
Parts at plant 在工厂内的产品	**5,100**	5,100	0	0	2025/9/28	Qinhe
Parts at logistics platform 在物流站台的产品	**0**	0	0	#DIV/0!	NA	NA
Parts at customer (C1 claim) 在客户处的产品（C1投诉）	**21480**	21480	0	0	2025/9/28	Tim
Parts in transport 在途品	**0**	0	0	#DIV/0!	NA	NA
Parts at supplier / supplier platform 在供应商/供应商站台的产品	**21,000**	21000	0	0	2025/9/28	Bingren Yuan
Parts at sub-supplier 在下级供应商处的产品	**0**	0	0	#DIV/0!	NA	NA

How are the ok parts identified ? 良品如何标识?	标签上增加“返检品” Add "return inspection product" to the label
How are the ok paletts identified ? 不良品如何标识?	不良品将在标签上张贴不合格标识 Defective products will be labeled with a non conformance labe
First contained shipment information 第一批遏制出货信息	Lot No:20250930

What are the immediate actions to prevent production/delivery of nok parts ? 采取何种紧急行动防止不良品的生产/出货?

Actions 行动	decision决策	Resp.责任者	Date plan.计划日	Date clos.完成日
suspect stocks to be sent to supplier 客户处的疑虑库存退回给供应商		Tim	20250930	20250930
Express delivery to to avoid production stop 快递良品至客户防止产线停线		Tim	20250930	20250930
ex: Quality alert at working area 例如：在操作区进行质量警示				
ex: Information to all related employees 例如：向所有相关员工进行通报				