1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **4/18/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☑
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

Trimmed Sheet Not Punched

Who detected it?

11TA Assembly Line Operator

Where was it detected?

11TA Assembly Line

How was it detected?

Visually

Why is it a problem?

Fuse Choke Losses its Functionallity

When did it happen?

3/13/2024 11:00:00 PM (your local time)

How many parts ?

4.00

2. What is the cause?

standard is not enough :
the frequency of cleaning the debreding station is not well defined , that's mean cleaning each shift is not enought to eliminate the burr and the risk of punshed point not done

3. Description of the applied modification

BEFORE

frequency of cleaning of debriding station , one time each shift
visual control 1 part each 5parts

AFTER

frequency of cleaning of debriding station , each 30 min of production
100 % taking1 parts each 5 parts of production with gauge

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence :
*/frequency of cleaning of debriding station , each 30 min of production
*/training opertor regarding the updated
For non detection
*/100 % taking1 parts each 5 parts of production with gauge

CHECKING

What is the method (who, what, how) for the countermeasures?

Who: Supplier
What :
*/For occurrence: checking the operation of cleaning done perfectly or not and checking the method of cleaning
*/For non-detection verification, the standard of control with gauge is applied.

SIGNALING

What is the countermeasure supposed to conformity ?

In case of detection NOK parts with Trimm
Punched parts in the production line : aler
stock for the sorting
+ ALert and block the parts in the transit

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☑	g. Visual aids are posted:	☑
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other functions are trained:	☑
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (records,5 ' meeting):	☑
d. Control Plan and PFMEA:	☑	j. Operators can correctly describe what they must do:	☑
e. Maintenance instructions:	☑	k. Other:	☐

f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☐

work_instruction_new (1).pdf

An evidance of modification: debreding_station_audit.pdf

FP- Ph 10 deshuntage B8 - updated one.pdf

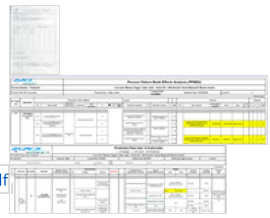

6. Potential applicability

LLC Applicability Product: **(A18116507G)**

LLC Applicability Line / process: **11TA/B8**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Lledo Alfons**

Position: **Supplier Quality Assurance**

Phone: **+34 93 5447067**

Fax:

Email: **Alfons.Lledo@nidec-ma.com**

CLAIM RECEIVER

Name: **NEILI Amen Allah**

Position: **Quality Engineer**

Phone: **+216 58 58 88 41**

Fax:

Email: **amenallah.neili@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Trimmed Sheet Not Punched

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**

Parts at Nidec logistics platfrom: **0.00**

Parts at Nidec's customer (C1): **0.00**

Parts in transport: **0.00**

Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**

Suspected delivery notes and batches#:

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone: