Claim Management Panel

Supplier: **AVO Carbon France (NMAS609128)**

Type: **C2 : Production claim**

Problem description: **Lack Of Capacitor**

Claim reference: **NMAS/609128/8/2024/1822**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**8/12/2024**	1:16:36 PM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**8/9/2024**	3:44:08 PM (your local time)	(QR) D2-
D4 Default Due Date :	**8/14/2024**	1:16:36 PM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**10/16/2024**	11:30:17 AM (your local time)	I
D5-D6 Default Due Date:	**8/23/2024**	1:16:36 PM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**10/18/2024**	10:02:39 AM (your local time)	D5-
D7-D8 Default Due Date:	**8/23/2024**	1:16:36 PM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**11/14/2024**	10:00:42 AM (your local time)	D7-I

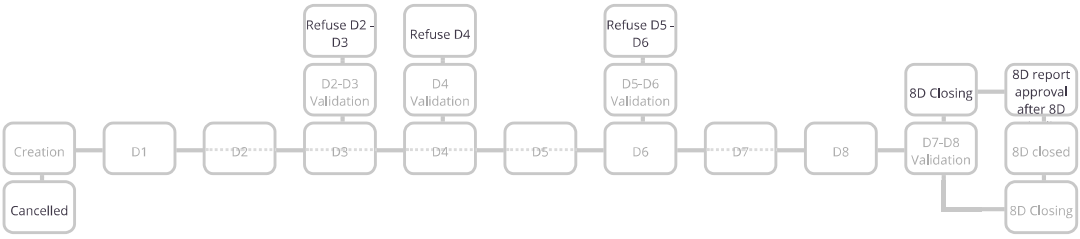

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	11/14/2024	Marwen Haggui
D1	8/9/2024	Alfons Lledo
D4 Validation	10/16/2024	Alfons Lledo
D2	10/16/2024	Anis Othmani
D2	10/16/2024	Marwen Haggui
D2-D3 Validation	8/9/2024	Alfons Lledo
D3	10/16/2024	Marwen Haggui
D4	10/16/2024	Marwen Haggui
D5	10/18/2024	Marwen Haggui
D5-D6 Validation	10/22/2024	Alfons Lledo
D6	10/18/2024	Marwen Haggui
D7	11/14/2024	Marwen Haggui
D7-D8 Validation	11/14/2024	Alfons Lledo
8D closed	11/14/2024	Alfons Lledo
8D Closing	11/14/2024	Alfons Lledo

« ‹ 1 2 › 16 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D4 Validation	10/16/2024	Alfons Lledo	Update
D7-D8 Validation	11/12/2024	Alfons Lledo	Update acc mail sent 12-11-2024

2 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Date of Claim: **8/9/2024**
Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **8/12/2024**
Claim reference: **NMAS/609128/8/2024/1822**
Author: **LLEDO Alfons**
Update of QR:
Status: **Closed**
Type: **C2 : Production claim**
CLAIM PPM: 0.00
D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **Lack Of Capacitor**
What happened?: **NOK Motors due to lack of capacitor**
Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**
Why is it a problem?: **Motor malfunction**
Traceability of nok parts: **2402191-01**
When did it happen? : **8/7/2024** 11:00:00 PM (your local time)
Recurrence: **No reccurent defect**
Who detected it?: **11TA Assembly Operator**
Defect S/R: **Yes (S/security)**
Where was it detected? : **Assembly Line Electrical Test**
How was it detected?: **Electrical Test Stops**
How many parts ?: **7.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add an existing contact:

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Profile	Status
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Supplier	Active
Othmani Anis		• anis.othmani@avocarbon.com	anis.othmani@avocarbon.com	216	+21658588818		Quality Manager	Supplier	Active

NidecTeam

Contact	Email	Profile

LLEDO Alfons	Alfons.Lledo@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)
MACÍAS Juan Antonio	juan-antonio.macias@nidec-ma.com	{profile} Contributor (Claim)
MOYA FRANCISCO	francisco.moya@nidec-ma.com	{profile} Contributor (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☑ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **Lack Of Capacitor**

Samples of nok parts required at supplier location: ☐ Express shipping supplier account: **regular truck**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **A18116507G**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	0.00	0.00	7.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	0.00	0.00	0.00			
Parts at supplier / supplier platform	0.00	0.00	0.00			
Parts at sub-supplier	252.00	252.00	0.00	8/9/2024		will be deleved week 33
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured regarding lack of capacitor**

First contained shipment information: **first delevered secured will be delevered Week 33**

How are the ok paletts identified?: **Orange NIDEC identification**

How are the ok parts identified? ::

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop	Not required	Nidec	8/9/2024	
Nidec suspect stocks to be sent to supplier	Not required	Nidec	8/9/2024	

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
display quality alert	Not required	Supplier	8/9/2024	8/9/2024
QRQC meeting with all team	Not required	Supplier	8/9/2024	8/9/2024
reproduction of the defect and passed in AVO electrical test	Not required	Supplier	8/9/2024	8/9/2024

3 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (SPAIN) S.A.U
Supplier: **AVO Carbon France (NMAS609128)**
Creation Date: **8/9/2024**
Customer Contact: **Lledo Alfons**
SAP Vendor Code: **609128**
Date of QR: **8/12/2024**
Claim reference: **NMAS/609128/8/2024/1822**
Created by: **LLEDO Alfons**
Update of QR:
Status: **Closed**
Type: **C2 : Production claim**
Date of D4-D8: **8/9/2024**
CLAIM PPM: 0.00
D4-D8 evaluation score: 75
Update of D4-D8:

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

Insufficient standard:

There is no pressure stability inside the welding machine

HOW WAS THE DEFECT REPRODUCED ?

Parts was welded with pressure (= 6.4 Bar) over than the maximum (= 5.5 Bar)
Parts were With strong welding

Attachment:

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

insuffisant standard :

in the current standart there is no indication to avoid the manipulation of components.

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment field

1. implementation of pressure control in capacitor welding machine	hajer	10/16/2024	10/16/2024	

1 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
3. update the final control instruction IC700 with NO manipulation of components	Hamza	10/17/2024	10/17/2024	IC_700_507G Updated customer request.pdf

1 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit 11TA-B8 production line ; claim 1822	haggui marwan	10/18/2024	10/18/2024	Process audit 11TA-B8 production line ; claim 18
updated the PMFEA	haggui marwan	10/18/2024	10/18/2024	
Updated the control plan according the last corrective action	haggui marwan	10/18/2024	10/18/2024	
updated SOP check liste to check the activation of pressostat to control the pressure	haggui marwan	10/18/2024	10/18/2024	
adding a green dot in 100% in OVP to check the presence of capacitor during the 3 month	hamza	10/24/2024	10/24/2024	Copie de Mesure conservatoire condo découplag
Traceability of the first batch produced with green dot N° pallet is 871 N° batch 2411071	Marwan haggui	10/24/2024	10/24/2024	

6 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit 11TA-B8 production line ; claim 1822	haggui marwan	10/18/2024	10/18/2024	Process audit 11TA-B8 production line ; claim 1822.pdf
training session for the opeartor	training departement	11/5/2024	11/5/2024	training session.pdf

2 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA	haggui marwan	10/18/2024	10/18/2024	
Control Plan	haggui marwan	10/18/2024	10/18/2024	

Work instruction				
Control instruction	haggui marwan	10/17/2024	10/17/2024	IC_700_507G_Updated_customer_request (1).pdf
Procedure	haggui marwan	10/18/2024	10/18/2024	
Control gage				
Maintenance instruction				
Lesson Learned Card				
Other	hajer	10/16/2024	10/16/2024	
Other	marwan haggui	10/18/2024	10/18/2024	Process audit 11TA-B8 production line ; claim 1822.pdf
Other	training departement	11/5/2024	11/5/2024	training session.pdf

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **10/18/2024**

Supplier Audit Results: **results of Audit : OK 100%**

Supplier Audit Comment:

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **Quality customer**

Date of validation of 8D closure from supplier management: **10/18/2024**

Closure of 8D from Nidec

Chargeback: **Done**

Efficiency of 8D proven: **Done**

Nok stocks at zero: **Done**

8D eval value (%): **100.00**

Date of closure: **11/14/2024**

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements fulfill
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all functions of t functional team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments (e.g. possible root cause provide
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk at c numbers/family provided
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment effec documentation available

D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to reprod (e.g. pictures, records from p provided
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to reprod (e.g. pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for c respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines for cl respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions succe after introduction of perma action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions succe after introduction of perma action
D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalization c countermeasures to similar performed
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked and ap champion/management
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations and term definition used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **10/9/2024** Update of Ishikawa:

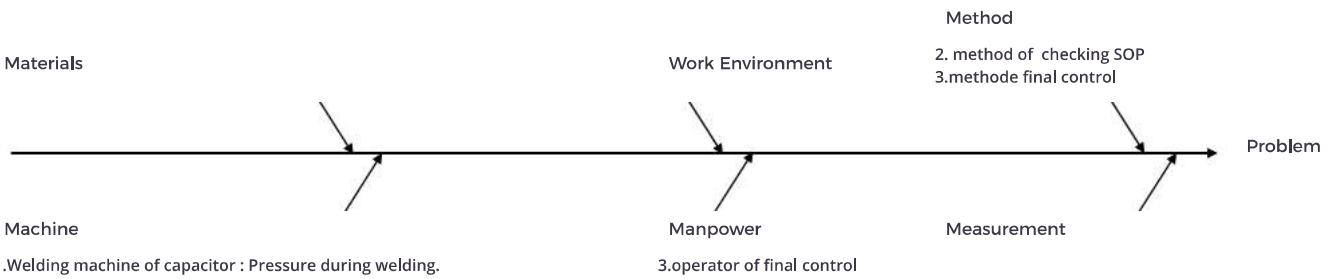

Nidec Comments

Factor Tree Analysis

Date of FTA: **10/9/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **Lack Of Capacitor**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	Def.
1.Welding machine of capacitor : Pressure during welding.	During SOP the quality Agent control the value of Pressure	according to the work instruction */ min 3.5 bar */ Max 5.5 bar	the OK parts produced with pressure = 4 bar	the NOK parts produced with Pressure heigher than the standard = 6.4 bar	No	Yes	make the welding with pressure 6.4 bar (out of tolerance max)	9/17/2024	Yes	

1 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	Def.
2. method of checking SOP	Start of production with parameters control record	according to the work instruction */ min 3.5 bar */ Max 5.5 bar	Ok parts with SOP validated by Quality agent	the NOK parts with SOP validated by Quality agent , later there is variation in the pressure of the machine	Yes	Yes	no action to reproduce the defect	9/17/2024	No	
3.methode final control	Visual control of welding aspect of capacitor	visual control according to control Intruction IC700	Ok parts with presence and Good welding of capacitor	NOK parts with moving the capacitor to ckeck the aspect	No	No	moving the capacitor with strong welding	9/17/2024	Yes	

2 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **10/9/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **Lack Of Capacitor**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th Check
1.Welding machine of capacitor : Pressure during welding.	bad welding of capacitor	>	the pressure increase from 4 to 6.4 bar without stop machine	>	there is no pressure controlled equiped in welding machine	X		

1 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th Check
3.methode final control	the final control operator manipulate the legs of capacitor	>	>	the opeartor has a doubt to check the welding aspect	insuffisant standard didn't avoid the manipulation of components	X		

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **10/16/2024**

Logistics:	☐	Management:	☐
Product:	☐	Detection:	☑
Occurence:	☑	Process:	☐

1. What was the problem?

What happened?

NOK Motors due to lack of capacitor

Who detected it?

11TA Assembly Operator

Where was it detected?

Assembly Line Electrical Test

How was it detected?

Electrical Test Stops

Why is it a problem?

Motor malfunction

When did it happen?

8/7/2024 11:00:00 PM (your local time)

How many parts ?

7.00

2. What is the cause?

There is no pressure stability inside the welding machine

3. Description of the applied modification

BEFORE

For occurence
*/No pressure control in welding machine
For Non detection
*/In control instruction there is no Indication to avoid any manipulation of composants

AFTER

For occurrence
*/ Implementation, a pressure control to stop the welding machine if the value of pressure out the tolerance
For non detection
*/ Update the Final control instruction with adding the indication to do not manipulate the components during the visual control

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurrence
*/ Implementation, a pressure control to stop the welding machine if the value of pressure out the tolerance
For non detection
*/ Update the Final control instruction with adding the indication to do not manipulate the components during the visual control

CHECKING

What is the method (who, what, how) for the countermeasures?

WHO : Quality agent and Process quality
What / How :
For occurence
*/ checking in SOP the value of pressure and the pressure control is activate by Quality agent and Process quality
For non detection
*/ Verification the application of standart (No manipulation of composants) by Quality agent and Process quality.

SIGNALING

What is the countermeasure supposed to do or make o detecting a non conformity ?

In case of detection NOK parts with lack capacitor in th production line :
+ alert and block all stock for the sorting
+ ALert and block the parts in the transit

5. What has been modified?

a. Proces is modified according to Before/ After sheet:	☑	g. Vis	
b. All documents have been updated and has been validated with the operators:	☑	h. Operators and other fu	
c. Procedures and work instructions:	☑	i. Proof of training is avalaible (r	
d. Control Plan and PFMEA:	☑	j. Operators can correctly describe	
e. Maintenance instructions:	☐		

f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☑

An evidance of modification:

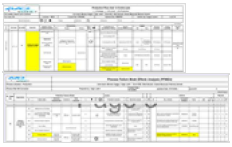

training session.pdf

Process_audit_11TA-B8_production_line_

Process_audit_11TA-B8_production_line___claim_1822 (1).pdf

6. Potential applicability

LLC Applicability Product: **(A18116507G)**

LLC Applicability Line / process: **11TA**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: **Lledo Alfons**

Position: **Supplier Quality Assurance**

Phone: **+34 93 5447067**

Fax:

Email: **Alfons.Lledo@nidec-ma.com**

CLAIM RECEIVER

Name: **Othmani Anis**

Position: **Quality Manager**

Phone: **216**

Fax:

Email: **anis.othmani@avocarbon.com**

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

Lack Of Capacitor

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: **0.00**

Parts at Nidec logistics platfrom: **0.00**

Parts at Nidec's customer (C1): **0.00**

Parts in transport: **0.00**

Part Number & Description: **BRUSH CARD HOLDER 11TA (A18116507G)**

Suspected delivery notes and batches#: will be deleved week 33

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:

Company Address:

Company Website:

Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation.

Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.

New tab