Claim Management Panel

Supplier: **AVO Carbon France (NMAP551841)**

Type: **C2 : Production claim**

Problem description: **choke wire not welded**

Claim reference: **NMAP/551841/7/2024/1798**

Settings

C2/C3 REMINDER PANEL

(QR) D2-D3 Defualt Due Date :	**7/10/2024**	9:11:43 AM (your local time)	D2-D3 Revised Due Date:	(QR) D2-D3 Actual Date:	**7/10/2024**	2:04:11 PM (your local time)	(QR) D2-D3
D4 Default Due Date :	**7/12/2024**	9:11:43 AM (your local time)	D4 Revised Due Date :	D4 Actual Date :	**9/4/2024**	11:56:57 AM (your local time)	D4
D5-D6 Default Due Date:	**7/23/2024**	9:11:43 AM (your local time)	D5-D6 Revised Due Date:	D5-D6 Actual Date:	**10/9/2024**	9:05:49 AM (your local time)	D5-D6
D7-D8 Default Due Date:	**7/23/2024**	9:11:43 AM (your local time)	D7-D8 Revised Due Date C2/C3:	D7-D8 Actual Date:	**10/9/2024**	2:02:45 PM (your local time)	D7-D8

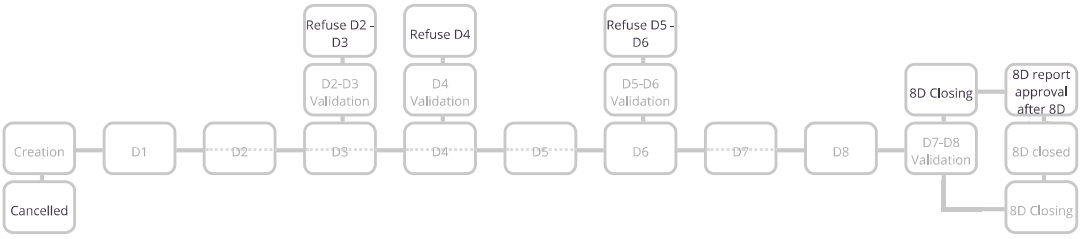

NOTIFICATIONS SENT

0 Result(s)

NIDEC APPROVALS & REFUSALS HISTORY

Steps approved

Step	Date of validation	User name
D8	10/9/2024	Marwen Haggui
D1	7/9/2024	Dominik Dudek
D4 Validation	9/4/2024	Dominik Dudek
D2	9/4/2024	Marwen Haggui
D2-D3 Validation	7/10/2024	Dominik Dudek
D3	9/4/2024	Marwen Haggui
D4	9/4/2024	Marwen Haggui
D5	10/9/2024	Marwen Haggui
D5-D6 Validation	10/9/2024	Dominik Dudek
D6	10/9/2024	Marwen Haggui
D7	10/9/2024	Marwen Haggui
D7-D8 Validation	10/10/2024	Dominik Dudek
8D closed	10/11/2024	Dorota Siekaniec
8D Closing	10/11/2024	Dorota Siekaniec
Creation	7/9/2024	Dominik Dudek

15 Result(s)

Steps rejected

Step	Date of refusal	User name	Reason for rejection
D4 Validation	8/23/2024	Dominik Dudek	Please do necesery corection. Details in email.
D5-D6 Validation	9/9/2024	Dominik Dudek	In D6.A (action for occurrence) lack of information regards frequency to check value of current.

2 Result(s)

Forum

Filter

Keywords:

0 Result(s)

Quick Response (D1-D3)

ALERTS

-Component without PPAP

Plant issued a claim: NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.
Supplier: **AVO Carbon France (NMAP551841)**
Date of Claim: **7/9/2024**

Customer Contact: **Dudek Dominik**
SAP Vendor Code: **551841**
Date of QR: **7/10/2024**

Claim reference: **NMAP/551841/7/2024/1798**
Author: **DUDEK Dominik**
Update of QR: **7/10/2024**

Status: **Closed**
Type: **C2 : Production claim**

CLAIM PPM: 0.00

D1-D3 evaluation score: 22

D1. Description of the problem

1.A WHAT IS THE PROBLEM ? USE 5W+2H TO DESCRIBE WHAT IS THE CURRENT SITUATION.

Problem description: **choke wire not welded**
What happened?: **choke wire not welded**

Part Number & Description: **Brush mounting plate assy (503-773-99-99)**
Why is it a problem?: **motor was rejected on EOL**

Traceability of nok parts: **DMC 5037732415341212, ASN 180393916**
When did it happen? : **7/7/2024** 11:00:00 PM (your local time)

Recurrence: **Recurrent defect**
Who detected it?: **operator**

Defect S/R: **No**
Where was it detected? : **CM4**

How was it detected?: **During defect analysis**

How many parts ?: **1.00**

nok part picture / sketch:

ok part picture / sketch:

Other files::

1.B SUPPLIER PROBLEM SOLVING TEAM

Supplier Team

Add ar

Name		Contact	Email	Phone	Cell Phone	Fax	Position	Pr
Bechikh Wissal		• wissal.bechikh@avocarbon.com	wissal.bechikh@avocarbon.com	+216 58598711			Customer Quality	Su
Ben Mallek Bassem			bassem.benmallek@avocarbon.com	00216 58588811			Project quality engineer	{pr
Ghribi Mohamed Aymen		• mohamedaymen.ghribi@avocarbon.com	mohamedaymen.ghribi@avocarbon.com	0021658352210			Quality	Su
Haggui Marwen		• marwen.haggui@avocarbon.com	marwen.haggui@avocarbon.com	+21656057189	+21656057189		Customer Quality	Su

NidecTeam

Contact	Email	Profile
DUDEK Dominik	dominik.dudek@nidec-ma.com	{profile} Local Quality (Local SQE) (Full) (Claim)

1.C TOOL TO USE (DEFINED BY NIDEC)

Ishikawa: ☑ FTA: ☑ 5 Whys : ☑ LLC: ☑ Audit: ☐ Other: ☐

1.D PROBLEM DESCRIPTION FROM SUPPLIER / FIRST ANALYSE OF PROBLEM / POTENTIAL ROOT CAUSES

Problem description from Supplier: **bad welding between thermal switch leg and choke leg**

Samples of nok parts required at supplier location: ☑ Express shipping supplier account: **Regular express**

D2. Risk on similar products and processes

Can this defect happen on similar parts?: Comments (compulsory if yes): **503-773-99-99**

Other family product: ☐

Other machine: ☐

Other tooling: ☐

Other Nidec plants: ☐

Other: ☐

D3. Containment

WHAT ARE THE ACTIONS TO DETECT ALL NON-CONFORMING PARTS IN THE PROCESS FLOW?

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Delivery note and batch #	Responsible
Parts at Nidec plant	1,442.00	0.00	1.00			
Parts at Nidec logistics platform	0.00	0.00	0.00			
Parts at Nidecs customer (C1 claim)	0.00	0.00	0.00			

Location in the process flow	Nb to be sorted	Nb parts sorted	Nb nok parts	Date	Responsible	Delivery note and batch #
Parts in transport	39,519.00	0.00	0.00	7/10/2024	Supplier	In NUNNER
Parts at supplier / supplier platform	5,000.00	5,000.00	0.00	7/10/2024	Supplier	AVO
Parts at sub-supplier	0.00	0.00	0.00			
Other Nidec plant/s	0.00	0.00	0.00			

4 Result(s)

How are the ok parts identified?: **100% secured regarding bad welding thermal switch and chock wire**

First contained shipment information: **Delevery for week W29**

How are the ok paletts identified?: **100% secured regarding bad welding thermal switch and chock wire**

How are the ok parts identified? ::

WHAT ARE THE IMMEDIATE ACTIONS TO PREVENT PRODUCTION/DELIVERY OF NOK PARTS?

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
Express delivery to Nidec to avoid production stop				
Nidec suspect stocks to be sent to supplier				

Actions	Nidec decision	Responsible	Date Plan.	Date Clos.
QRQC meeting with team	Required	Supplier	7/9/2024	7/9/2024
Quality alert in production line			7/9/2024	7/9/2024
start selection to secure the product in AVO side	Required		7/9/2024	7/9/2024

3 Result(s)

D4-D8

ALERTS

-Component without PPAP

Plant issued a claim:	NIDEC MOTORS & ACTUATORS (POLAND) Sp z o.o.	Supplier:	**AVO Carbon France (NMAP551841)**	Creation Date:	**7/9/2024**
Customer Contact:	**Dudek Dominik**	SAP Vendor Code:	**551841**	Date of QR:	**7/10/2024**
Claim reference:	**NMAP/551841/7/2024/1798**	Created by:	**DUDEK Dominik**	Update of QR:	**7/10/2024**
Status:	**Closed**	Type:	**C2 : Production claim**	Date of D4-D8:	**8/21/2024**
		CLAIM PPM:	0.00		
D4-D8 evaluation score:	75			Update of D4-D8:	

D 4. Root cause of occurrence

Work out the root causes using first Ishikawa, then FTA and finally 5 why's (Tools to use chosen by Nidec).

ROOT CAUSE OF OCCURRENCE

the current was controlled but not efficient , the intervall were not well defined , the claimed parts were welded with lack current

HOW WAS THE DEFECT REPRODUCED ?

the current was controlled but not efficient , the intervall were not well defined , the claimed parts were welded with lack current

Link of video :
https://drive.google.com/file/d/10DSFzF2TA-E-7I2zZYrhWOiBnzlOWeGC/view?usp=sharing

Attachment:

Current conrole in welding station .mp4

D 5. Root casue of non detection

ROOT CAUSE OF NON DETECTION :

The control method, not enough to describe the defect

Attachments:

D 6. Countermeasure to non detection and occurrence

6.A ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan	Date Clos.	Attachments Please click 'Save' to activate attachment fiel
Implement control current in welding station to avoid any welding operation with lack of power	hajer	7/19/2024	7/19/2024	PH 3.75 Soudure Self sur PTH.pdf

1 Result(s)

6.B ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attac
updated the control instruction to mention the method of control on the front and back of the part	marwan haggui	8/30/2024	8/30/2024	IC700__A_CM4_CM3_updated_.pc
training session for the control opeartor dedicate for the EOL control	training departement	8/30/2024	8/30/2024	session training of welding therm

2 Result(s)

D 7. Effectiveness of action plan

7A ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR OCCURENCE

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit on production line CM4 to check the effecacity of the corrective action	haggui marwan	10/8/2024	10/8/2024	Questionnaire audit process CM4..pdf

1 Result(s)

7B ACTIONS TO CHECK EFFECTIVENESS ACTIONS FOR NON-DETECTION

Action	Responsible	Date Plan.	Date Clos.	Attachments Please click 'Save' to activate attachment field
Process audit on production line CM4 to check the effecacity of the corrective action	haggui marwan	10/8/2024	10/8/2024	Questionnaire audit process CM4..pdf

1 Result(s)

D 8. Action(s) to prevent recurrence

8.1 DO FOLLOWING DOCUMENTS REQUIRE AN UPDATE ?

Name of the document	Responsible	Date Plan	Date Clos.	Attachments
PFMEA				
Control Plan				
Work instruction	Hajer	7/19/2024	7/19/2024	PH_3.75__Soudure_Self_sur_PTH.pdf
Control instruction	marwan haggui	8/30/2024	8/30/2024	IC700__A_CM4_CM3_updated_ (1).pdf
Procedure				
Control gage				
Maintenance instruction				
Lesson Learned Card				
Other	training departement	8/30/2024	8/30/2024	session_training_of_welding_thermal_switch_choke.pdf
Other	haggui marwan	10/8/2024	10/8/2024	Questionnaire_audit_process_CM4..pdf
Other				Current_conrole_in_welding_station_ (1).mp4

8.2 GENERALIZATION OF COUNTERMEASURES TO SIMILAR LINES/ PRODUCTS

8.3 AUDIT DONE BY SUPPLIER (IF REQUIRED)

8D Audit required?:

Date of audit done by supplier: **10/8/2024**

Supplier Audit Results: **results of process audit is OK**

Supplier Audit Comment:

8.4 VALIDATION OF 8D CLOSURE FROM SUPPLIER MANAGEMENT

Name: **haggui marwan**

Supplier Management Position: **customer quality**

Date of validation of 8D closure from supplier management: **10/9/2024**

Closure of 8D from Nidec

Chargeback:

Efficiency of 8D proven:

Nok stocks at zero:

8D eval value (%): **100.00**

Date of closure:

Supplier 8D Report Evaluation Sheet

EVALUATION

D#	Discipline	Unsatisfactory/Not OK	Acceptable	Requirements f
D1B	Supplier problem solving team	☐ Minimum standard not reached	☐ - Champion named - Cross functional team - Champion contact data available	☑ - Names and all function team are available
D1D	Problem description from supplier / first analysis of the problem / potential root cause	☐ Minimum standard not reached	☐ - Clear and complete description of potential root cause - Express shipping account avaliable	☑ - Relevant attachments root cause provided
D2	Risk on similar products and processes	☐ Minimum standard not reached	☐ - Risk analysis for simmliar products/lines performed and adequate information provided	☑ - Information about risk numbers/family provide
D3	Containment	☐ Minimum standard not reached	☐ - Overview of actions in all material postions (e.g. in transit) available - Effectivity confirmed	☑ - Proof of containment documentation availabl
D4	Root cause of occurrence	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for occurence - Appropriate methods applied	☑ - Proof for actions to re pictures, records from p
D5	Root cause of non detection	☐ Minimum standard not reached	☐ - Root cause identified - Quality tools marked (Ishikawa, FTA, 5 Why's) used for non-detection - Appropriate methods applied	☑ - Proof for actions to re pictures) provided
D6a	Actions for occurence	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines respected
D6b	Actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of corrective actions per identified cause with verification - Timline for permanent actions	☑ - Announced deadlines f respected
D7a	Actions to check effectiveness actions for occurence	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions s after introduction of pe action
D7b	Actions to check effectiveness actions for non-detection	☐ Minimum standard not reached	☐ - Complete list of permanent corrective actions with details - Verification of actions (statistics)	☑ - Containment actions s after introduction of pe action

D8.1	Do following documents require an update ?	☐ Minimum standard not reached	☐ - Documented lessons learned - Relevant documents updated (FMEA, Control Plan, etc.)	☑ - Analysis of generalizat to similar lines/product
D8.4	Validation of 8D closure from supplier management	☐ Minimum standard not reached	☐ - All dates in logical order	☑ - 8D is cross-checked an champion/managemen
Report		☐ Minimum standard not reached	☐ - All content is understandable	☑ - No abbreviations and used

EVALUATION RESULT

Evaluation result: 100

New tab

Ishikawa Diagram

Date of Ishikawa: **8/21/2024** Update of Ishikawa:

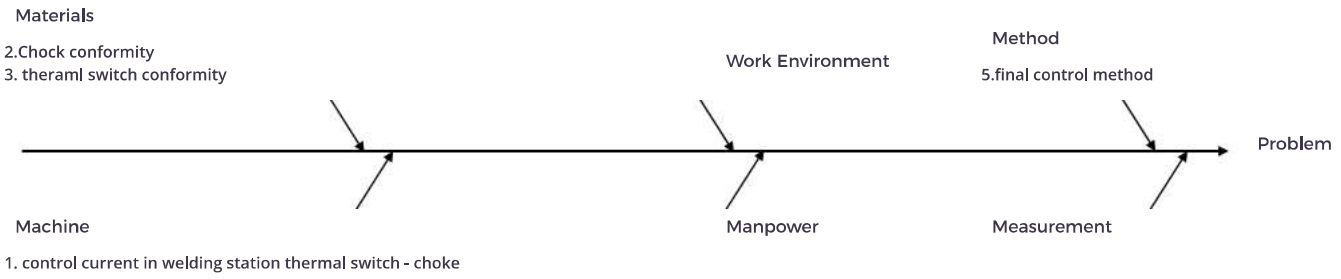

Nidec Comments

Factor Tree Analysis

Date of FTA: **8/21/2024** Update of FTA:

PROBLEM DESCRIPTION

Problem description: **choke wire not welded**

OCCURENCE

Factors	Control Point	Standard	OK parts	NOK parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?	
1. control current in welding station thermal switch - choke	controle the current in welding machine during the opeartion of welding	according the work instruction PS12.1-M3 ind. 2 the machine will be stoped if the current out the specification : min = 1.3KA Max = 2.5KA	Ok part welding with current lower than 1.66 KA	NOk part welding with current lower than 1.26KA	Yes	No	the current was controlled but not efficient , the intervall were not well defined , the claimed parts were welded with lack current		Yes	OK Curre in weldir statior .mp4
2. choke wire leg conformity	- conformity of dimension of choke coil legs - material conformity of choke coil legs	According the drawing of choke coil reference 503-661-99-99 Document N°10000024315 version N°2	Ok parts according the drawing	NOk parts according the drawing	Yes	Yes	action not reproduce the defect		No	
3. theraml switch conformity	- conformity of dimension of thermal switch	According the drawing of choke coil	Ok parts according the drawing	NOk parts according the drawin	Yes	Yes	action not reproduce the defect		No	

	legs - material conformity of theram switch	reference 503-661-99-99 Document N°10000025735 version 00								

3 Result(s)

NON DETECTION

Factor	Control Point	Standard	OK Parts	NOK Parts	Std Meet?	Std OK?	Action to reproduce the defect	Date	Direct Link?
5.final control method	IC700 instruction	100% of visual control of all points mentionned in the IC700 instruction	OK parts were controled according to the work instruction IC700	NOK parts were controled according to the work instruction IC700	Yes	No	the choke wire leg and thermal switch are welded but with lack current --> the instruction of control did't mention that the welding point must be a little crushed		Yes

1 Result(s)

Nidec Comment

5 Whys's

Date of 5 why's: **8/21/2024** Update of 5 Why's:

PROBLEM DESCRIPTION

Problem description: **choke wire not welded**

OCCURENCE

Relevant factors from FTA	1st WHY?	1st Check	2nd WHY?	2nd Check	3rd WHY?	3rd Check	4th WHY?	4th C
1. control current in welding station thermal switch - choke	the claimed part were welded with lack current	>	The welding done with inadequate current	>	the parameters of control current not defined	X		

1 Result(s)

NON DETECTION

Relevant factors from FTA	1st WHY?	1st Check	2nd Check	2nd WHY?	3rd WHY?	3rd Check	4th WHY?	4th C
5.final control method	The control instruction missing description the control method	>	>	The control method, not enough to describe the defect	The risk not considerate	X		

1 Result(s)

Nidec Comment

Lesson Learned Card

LLC Type

Date of LLC: **10/9/2024**

Logistics: ☐ Management: ☐

Product: ☐ Detection: ☑

Occurence: ☑ Process: ☐

1. What was the problem?

What happened?

choke wire not welded

Who detected it?

operator

Where was it detected?

CM4

How was it detected?

During defect analysis

Why is it a problem?

motor was rejected on EOL

When did it happen?

7/7/2024 11:00:00 PM (your local time)

How many parts ?

1.00

2. What is the cause?

the current was controlled but not efficient , the intervall were not well defined , the claimed parts were welded with lack current

3. Description of the applied modification

BEFORE	AFTER
No control of current in welding machine	Implement control current in welding station to avoid any welding operation with lack of power

4. What we learned?

ERADICATION

What is the countermeasure that was put in place to avoid recurrence ?

For occurence
***/ Implement control current in welding station to avoid any welding operation with lack of power**
For non detection
***/ updated the control instruction to mention the method of control on the front and back of the part**
***/ training session for the control opeartor dedicate for the EOL control**

CHECKING

What is the method (who, what, how) for the countermeasures?

Who : AVO
What :
***/ For occurence : Each SOP check the activiation of control current and start the production**
***/ For non detection :**
follow up the final control opeartion and check the level of opeartor in control station

SIGNALING

What is the countermeasure supposed to do or mal non conformity ?

When is identifing non conformity, all transportatio pallets should be
inspected

5. What has been modified?

a. Proces is modified according to Before/ After sheet: ☐
b. All documents have been updated and has been validated with the operators: ☑
c. Procedures and work instructions: ☑
d. Control Plan and PFMEA: ☐
e. Maintenance instructions: ☑
f. Records (start-up checklists, reaction sheets, preventive maintenance...): ☐
g. Visual aids are posted: ☑
h. Operators and other functions are trained: ☑
i. Proof of training is avalaible (records,5 ' meeting): ☐
j. Operators can correctly describe what they must do: ☐
k. Other: ☐

An evidance of modification:
- PH_3.75__Soudure_Self_sur_PTH.pdf
- IC700__A_CM4_CM3_updated_ (1).pdf
- Current_conrole_in_welding_station_ (1).mp4
- Questionnaire_audit_process_CM4..pdf
- session_training_of_welding_thermal_switch_choke.pdf

6. Potential applicability

LLC Applicability Product: **(503-773-99-99)**

LLC Applicability Line / process: **CM4**

LLC Applicability Plant: **AVO**

Sorting Approval

Approval of sorting / rework

This document must be sent to Nidec within 24 hour(s) after claim notification

Date of page: Update:

CLAIM ISSUER

Author: Dudek Dominik
Position: SQA Engineer
Phone: +48 12 297 27 86
Fax:
Email: dominik.dudek@nidec-ma.com

CLAIM RECEIVER

Name: Haggui Marwen
Position: Customer Quality
Phone: +21656057189
Fax:
Email: marwen.haggui@avocarbon.com

IMMEDIATE ACTIONS REQUIRED AT NIDEC

PROBLEM DESCRIPTION

choke wire not welded

DESCRIPTION OF SORTING/REWORK

QUANTITY AND PART NUMBERS CONCERNED

Parts at Nidec plant: 1,442.00
Parts at Nidec logistics platfrom: 0.00
Parts at Nidec's customer (C1): 0.00
Parts in transport: 0.00
Part Number & Description: Brush mounting plate assy (503-773-99-99)
Suspected delivery notes and batches#: In NUNNER , AVO

SORTING COMPANY CHOSEN TO DO THE SORTING/REWORK

Company Name:
Company Address:
Company Website:
Phone:

COMMENTS FROM NIDEC

All costs for semi-finished goods and finished goods with nok components will be invoiced to the supplier. Nok components will be returned to the supplier.

UPLOAD SIGNED FILE

LIST OF SORTING APPROVAL FILES

0 Result(s)

New tab

8D Report Explanation

D1
Nidec opens and incident and issues an 8D to the Supplier
D2-D3
The Supplier undertakes to: • **Contain all defective Supplies which have the same defect from all stocks (finished and semi-finished) and in transportation and at all affected Nidec locations worldwide,** • **Upon request, send a team to carry out sorting and inspection operations at Nidec and Nidec's Customers locations,** • **Upon request, send a team at Nidec's site to address the issue, even if the responsibility of the Supplier has not been proven yet,** • **Replace defective batch (es),** • **Label non-defective batch(es) accordingly,**
D4-D5-D6
The Supplier undertakes to: • **Perform an exhaustive analysis to identify the root cause of the non-conformity with the defined methods,** • **Provide Nidec with an action plan to be validated by Nidec prior to any action being implemented.** • **Update the production CP accordingly to be validated by Nidec.**
D7-D8
The Supplier undertakes to: • **Check the efficiency of the actions implemented. Results have to be validated by Nidec.** • **Update all related documents.** • **Implement the actions to similar Supplies and processes (elimination of recurrences).** • **Issue a Lesson Learned Card.**
Supplier 8D Report Evaluation Sheet
8D Evaluation Sheet has to be presented with final version of 8D report. Evaluation sheet is a tool for assessing compliance of 8D content with Nidec requirements. There are with three levels of acceptance: • **0% - 79% - 8D does not meet minimum requirements and cannot be accepted** • **80% - 89% - 8D meets minimum requirements and can be accepted** • **90% - 100% - 8D evaluated with bonus points and can be accepted** **8D Evaluation Sheet has three levels of points:** • **Unsatisfactory/Not OK** • **Acceptable** • **Requirements fulfilled/Bonus**
Incidents closure
8D following C1 and C2 incidents will be closed after Nidec validation. **Nidec may perform an 8D audit to assess 8D application for C1 incidents. The standard template (Supplier 8D audit) to be used is provided with the RFQ package.**

New tab