

PARTS LIST

HAULMAAX® 40K • 46K Rear Suspension


LIT NO: SP-171


DATE: August 2019

REVISION: L

CONTENTS

DESCRIPTION	PAGE	DESCRIPTION	PAGE
Parts List – HAULMAAX 40K • 46K	2	Aftermarket Service Kits	
Notes	4	■ Aftermarket Dual Rebound Strap Enhancement Kit for Outrigger Applications	7
Selection Guides		■ Aftermarket Shock Absorber Service Kits	7
■ Outboard Frame Bracket	5	Special Tools	8
■ Inboard Frame Bracket	5		
Production Dual Rebound Straps – Outrigger Applications	6		

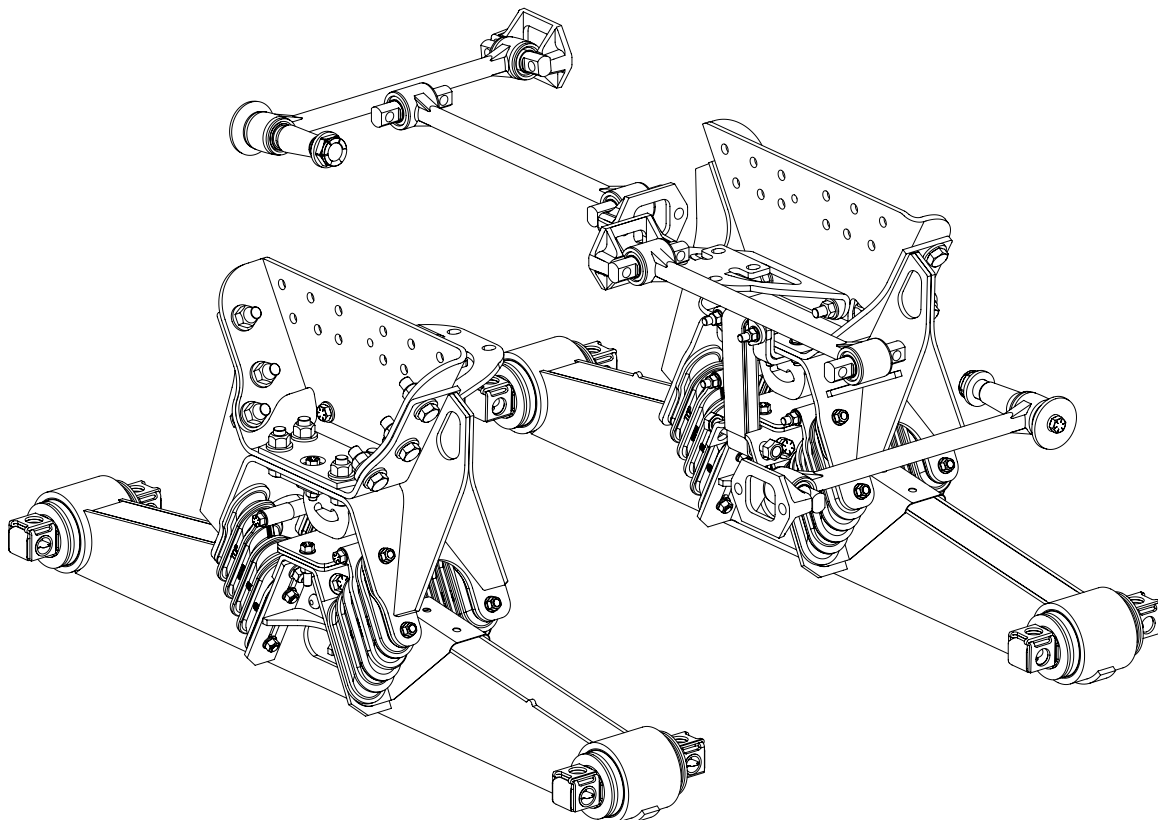

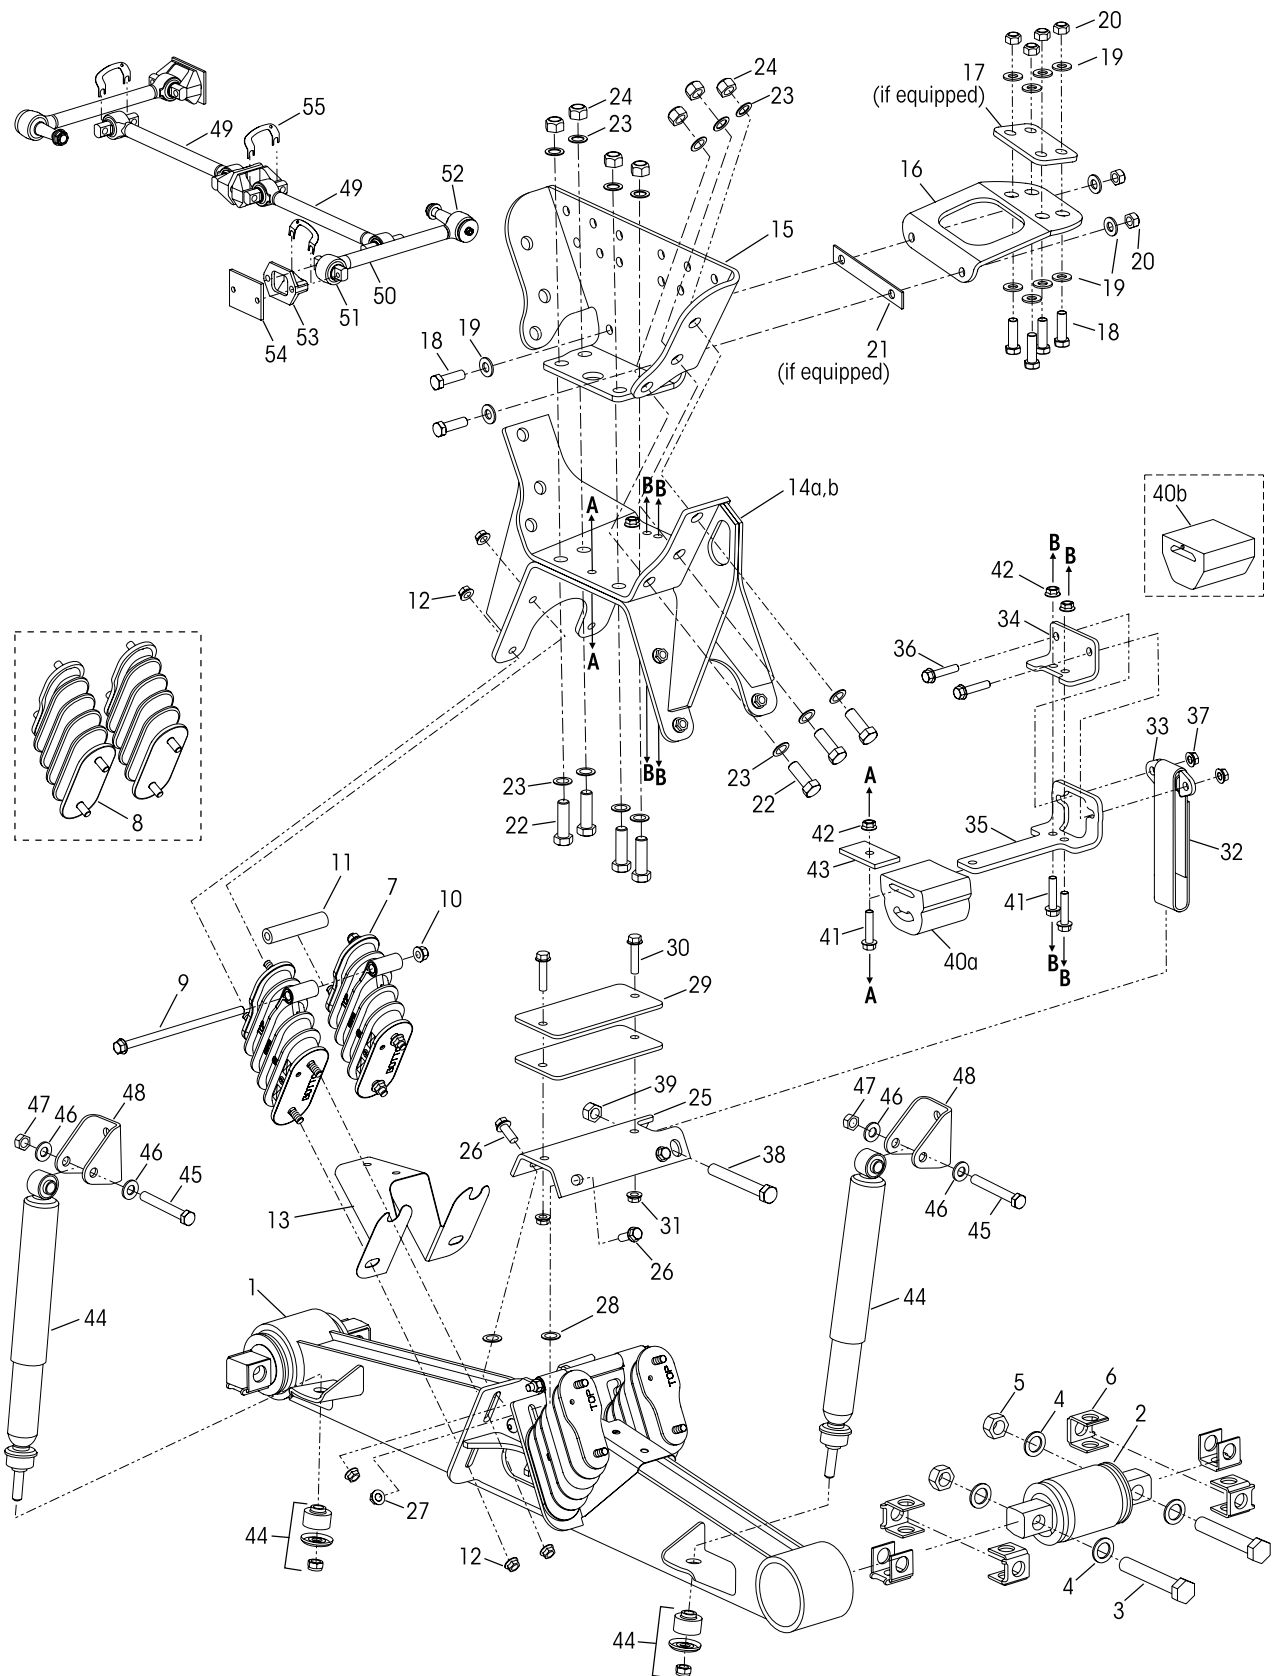



			VEHICLE				VEHICLE
KEY NO.	PART NO.	DESCRIPTION	QTY.	KEY NO.	PART NO.	DESCRIPTION	QTY.
1		****Equalizing Beam Assembly, 40K • 46K	2	21		Inboard Spacer (<i>if equipped</i>)	As Req.
	64846-003	52", with Shock Bracket			60618-001	1/8" Thick	
	64847-003	52", without Shock Bracket			60618-002	3/8" Thick	
	64846-001	54", with Shock Bracket				Outboard Frame Bracket to Saddle Assembly Fastener Kit , Includes Key Nos. 22-24	
	64847-001	54", without Shock Bracket			64179-038	Tandem Set	
	64846-002	60", with Shock Bracket			64179-039	One Side	
	64847-002	60", without Shock Bracket		22		*M20 x 2.5-6G x 65 mm Hex Bolt	20
		****Equalizing Beam Assembly, 40K • 46K, with dual straps		23		*M20 Hardened Washer	40
	64846-006	52", with Shock Bracket		24		*M20 x 2 1/2-6H Locknut	20
	64847-006	52", without Shock Bracket			57974-046	Contact Plate Service Kit, One Side , Includes Key Nos. 25-27	
	64846-004	54", with Shock Bracket		25	59191-000	Load Spring Contact Plate	2
	64847-004	54", without Shock Bracket		26		*5/8"-11 UNC x 1 1/2" Flange Bolt for Vehicles built after 11/07 ****Replaces 60818-001	8
	64846-005	60", with Shock Bracket		27		*5/8"-11 UNC Flange Nut for Vehicles built after 11/07 ****Replaces 60819-000	8
	64847-005	60", without Shock Bracket		28		****Load Spring Contact Plate Spacer for Vehicles built prior to 11/07	8
		Bar Pin End Bushing Service Kit, One Wheel End , Includes Key Nos. 2-6a		29	60791-000	Load Spring Shim 1/4" Thickness Quantity may vary for vehicles built prior to 07/15/14 equipped with Auxiliary Load Spring	4
	34013-088L	Shim Type		30	60818-002	1/2"-13 UNC x 2 1/4" Flange Bolt	4
	34013-188L	Rotating, Shim Type		31	60819-000	1/2"-13 UNC Flange Nut	4
2		*Bar Pin Bushing	4		64179-028	Rebound Strap Service Kit, One Side , Includes Key Nos. 32-33, 36-39	
	34013-104	Bar Pin End Bushing Fastener Kit, One Wheel End , Includes Key Nos. 3-5		32		*Rebound Strap	2
3		*1"-8 UNC x 6" Hex Bolt	8	33		*Rebound Clip	2
4		*1" Hardened Washer	16	34	60613-000	Rebound Support Angle	2
5		*1"-8 UNC Locknut	8	35	59384-000	Load Spring Bracket	2
6		Bar Pin Shim	8	36	60818-002	1/2"-13 UNC x 2 1/4" Flange Bolt	4
a	50131-000	0.25"/0.12" Standard		37	60819-000	1/2"-13 UNC Flange Nut	4
b	50130-000	0.19"/0.19" Optional		38	21867-007	3/4"-16 UNF x 6" Hex Bolt	2
c	57026-000	0.375" Optional flat shim		39	30191-000	3/4"-16 UNF Locknut	2
	60961-712	Tie-bar Bolster Springs and Progressive Load Spring Service Kit, One Side , Includes two 64179-048 and one 60961-745 Service Kits				Progressive Load Spring Service Kits for vehicles built after 07/15/14	
	64179-048	**Tie-bar Bolster Spring Service Kit , 2 Bolsters with 1 Wear Plate, Includes Key Nos. 7, 9-13		60961-745		One Side , Includes Key Nos. 40a, 41-42	
	64179-049	**Bolster Spring Service Kit , 2 Bolsters with 1 Wear Plate, Includes Key Nos. 8, 12-13		60961-747		Tandem Set , Includes Key Nos. 40a, 41-42 • Also use as a conversion kit for vehicles built prior to 07/15/14	
7		*Tie-bar Bolster Spring	8	60961-746		Weight Bias Kit with Shims, Includes Key Nos. 29-31, 40a, b, 41-42, <i>Replaces 65902-004</i>	
8		*Bolster Spring	8		64179-004	Auxiliary Load Spring Service Kit , One Side, for vehicles built prior to 07/15/14 Includes Key Nos. 40b, 41-42	
9	60818-003	1/2"-13 UNC x 10" Flange Bolt for Tie-bar	4	40		Load Spring	2
10	60819-000	1/2"-13 UNC Flange Nut for Tie-bar	4	a		*Progressive	
11	65742-000	Tie-bar Bolster Spring Spacer	4	b		*Auxiliary	
12	60819-000	1/2"-13 UNC Flange Nut	32	41		*1/2"-13 UNC x 2 1/4" Flange Bolt	6
13	64890-000L	Wear Plate, <i>Replaces 60498-001 and 60498-002</i>	4	42		*1/2"-13 UNC Flange Nut	6
		Saddle Assembly Service Kit, Tandem Set , HAULMAAX 40K, Includes Key No. 14a and Kit No. 57974-048		43	60874-000	Load Spring Spacer	2
	57974-051					Single Shock Absorber Service Kit , (<i>if equipped</i>) Includes Key Nos. 44-47	
	57974-050	HAULMAAX 46K, Includes Key No. 14b and Kit No. 57974-049			64178-005	16 1/2" Saddle Height	
		Saddle Assembly Fastener Kit, Tandem Set , HAULMAAX 40K, Includes Key Nos. 12, 22-24, 26-27, 36-37, 41-42			64178-006	17 1/2" / 18 1/2" Saddle Height	
	57974-048					Aftermarket Shock Absorber Kit , for vehicles built with equalizing beams without welded shock absorber mounts, <i>see Page 7</i>	
	57974-049	HAULMAAX 46K, Includes Key Nos. 9-12, 22-24, 26-27, 36-37, 41-42		44		Shock Absorber Assembly (<i>if equipped</i>)	4
14		***Saddle Assembly, Vehicles built after 01/13/03	2		60680-004L	16 1/2" Saddle Height (<i>see Figure 2</i>)	
a	64642-000	HAULMAAX 40K			60680-005L	17 1/2" / 18 1/2" Saddle Height (<i>see Figure 2</i>)	
b	64643-000	HAULMAAX 46K		45	32043-005	5/8"-11 UNC x 4 1/4" Hex Bolt (<i>if equipped</i>)	4
15		***Outboard Frame Bracket, <i>see Page 5</i> Vehicles built after 01/12/03	2	46	22962-004	5/8" Hardened Washer (<i>if equipped</i>)	8
16		Inboard Frame Bracket, <i>see Page 5</i>	2	47	47764-000	5/8"-11 UNC Locknut (<i>if equipped</i>)	4
17	78441-000	Inboard Frame Bracket Shim, (<i>46K, if equipped, International Truck Only</i>)	2	48	60304-000	Upper Shock Bracket (<i>if equipped</i>)	4
18	32043-004	5/8"-11 UNC x 2 1/4" Hex Bolt *****M16 Hex Bolt	12				
19	22962-004	5/8" Hardened Washer *****M16 Hardened Washer	24				
20	47764-000	5/8"-11 UNC Locknut *****M16 Locknut	12				

KEY NO.	PART NO.	DESCRIPTION	VEHICLE QTY.	KEY NO.	PART NO.	DESCRIPTION	VEHICLE QTY.
49		One-piece Longitudinal Torque Rod Assembly, Straddle/Straddle		52		Taper Bushing	2
		ULTRA ROD®, Includes Key No. 51a		a	64697-000L	ULTRA ROD	
	62000-XXX	Front, Specify Length in mm	1	b	64400-004L	ULTRA ROD PLUS	
	62001-XXX	Rear, Specify Length in mm	1	c	66649-004L	XTRB	
		ULTRA ROD® PLUS™, Includes Key No. 51b		Optional Two-Piece Torque Rod Assembly with Bushings Service Kit			
	72000-XXX	Front, Specify Length in mm	1		60218-000	ULTRA ROD Straddle/Straddle	
	72001-XXX	Rear, Specify Length in mm	1		60215-000	ULTRA ROD Straddle/Taper	
	82XX-XXX-XXX	*****TRAAX ROD™, Specify Length in mm	1		65781-000	ULTRA ROD PLUS Straddle/Taper	
50		*****One-piece Transverse Torque Rod Assembly, Straddle/Taper, Specify Length in mm	2		65781-001	XTRB Straddle/Straddle	
	62350-XXX	ULTRA ROD, Includes Key Nos. 51a-52a			65781-002	XTRB Straddle/Taper	
	72350-XXX	ULTRA ROD PLUS, Includes Key Nos. 51b-52b		53	22186-000	Torque Rod Frame Bracket	2
	92350-XXX	XTRB, Includes Key Nos. 51c-52c		54	45045-003	Back-up Plate (for Torque Rod)	2
	82XX-XXX-XXX	*****TRAAX ROD		55	49689-000L	Torque Rod Shim	As Req.
51		Straddle Bushing	4		70867-001	P-80 Lubricant - 10 ml (Not Shown)	per Bushing 1
a	47691-000L	ULTRA ROD					
b	64400-002L	ULTRA ROD PLUS					
c	66649-002L	XTRB					

Figure 1

Outboard Frame Bracket Top View


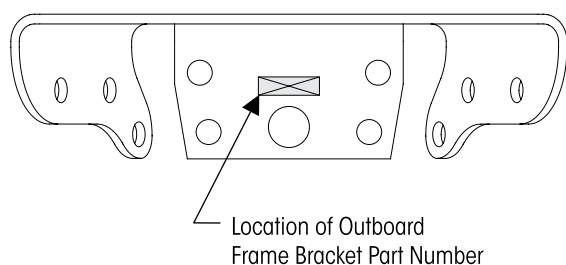


Figure 2

Sideview

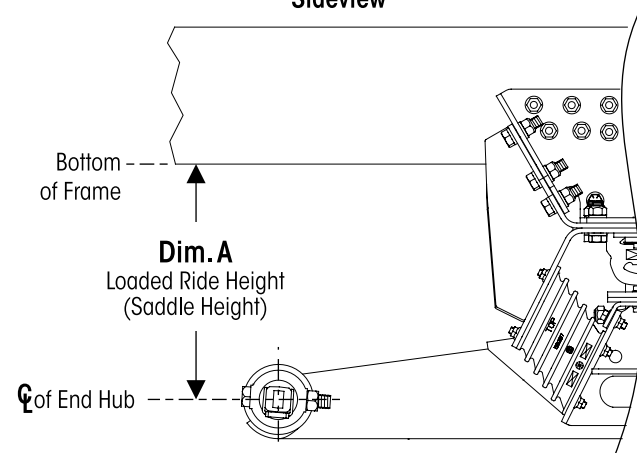

NOTES:

- * Item included in kit / assembly only, part not sold separately.
- ** HAULMAAX 46K suspensions must be serviced with the new tie-bar bolster spring Kit No. 64179-048. All HAULMAAX 40K suspensions can be serviced using the existing bolster springs Kit No. 64179-049 or if preferred, tie-bar bolster spring Kit No. 64179-048. Refer to Hendrickson Technical Bulletin Literature No. SEU-0225 for more information.
- *** For vehicles built prior to January 2003 it will be necessary to replace the saddle assembly with the current production saddle assembly and corresponding outboard frame bracket.
- **** For vehicles built prior to November 2007, Kit No. 57974-046 is required when replacing the load spring contact plate or equalizing beam.
- ***** Transverse torque rods are mandatory for the HAULMAAX suspensions regardless of axle spacing, see Literature No. 59310-004 and 59310-058 for more information.
- ***** Not supplied by Hendrickson, used for reference only. Refer to vehicle manufacturer for more information. Hendrickson is not responsible for components supplied by vehicle manufacturer.
- ***** TRAAX RODs are non-rebushable. The entire torque rod assembly must be replaced.

Hendrickson HAULMAAX / HN Gauge can be obtained on-line at www.hendrickson-intl.com/Litform

- Literature number 48422-546 – Bolster Spring
- Literature number 48422-590 – Progressive Load Spring

To obtain a new Hendrickson HAULMAAX Decal, No. 60905-002, contact Hendrickson.



■ Outboard • Inboard Frame Bracket Selection Guides


Key No. 15

Key No. 15		Outboard Frame Bracket — Vehicles built after 01/13/03					
Vehicle Manufacturer	Frame Width	Saddle Height = Dim. A in Figure 2					
		16½"	17½"	18½"	20¼"	22½"	25½"
Autocar	34"	64595-611	64595-612	64595-613			
CCC		64595-801 <i>replaces 64595-001</i>					
Freightliner	34.3" - 34.5"	64636-001	64636-002	64636-003			
GM	34.75"		64595-701				
International Truck	34.12" - 34.25"	64595-101			64595-105	64595-107	
	34.68" - 34.94"	64595-104		64595-114	64595-106	64595-108	64595-110
Mack	33.5"	64595-301	64595-302	64595-303			
	34.3"		64595-307				
Oshkosh	34"			64595-003			
Paccar		64595-001	64595-002	64595-003	64595-105		
	34.75"	64595-004	64595-005	64595-006			
Volvo	33.5"	64595-301					
Western Star	34"	64595-001	64595-002	64595-003			

Key No. 16

			Inboard Frame Bracket					
Vehicle Manufacturer	Frame Width	Equalizing Beam Length	Saddle Height = Dim. A in Figure 2					
			16½"	17½"	18½"	20¼"	22½"	25½"
Autocar	34"	All	60617-601	60617-602	60617-603			
CCC			65078-001	65078-002	65078-003			
Freightliner	34.3" - 34.5"		60617-501	60617-502	60617-503			
GM	34.75"			60617-701				
International Truck	34.12" - 34.25" 34.68" - 34.94"		60617-101		60617-104	60617-103		69681-000
International Truck with shim	34.5"		60617-201					
Oshkosh	34"				65078-003			
Paccar with liner	34", 34.75"		67545-001 <i>replaces 65078-001</i>	67545-002 <i>replaces 65078-002</i>	67545-003 <i>replaces 65078-003</i>			
Paccar without liner	34", 34.75"		65079-001	65079-002	65079-003			
Western Star	34"		60617-501	60617-502	60617-503			
Mack	33.5", 34.3"	52", 60"	64988-311					
		54"	64988-301					
Volvo	33.5"	54"	64988-302					
		52", 60", 72.5"	64988-312					

■ Production Dual Rebound Straps – Outrigger Applications

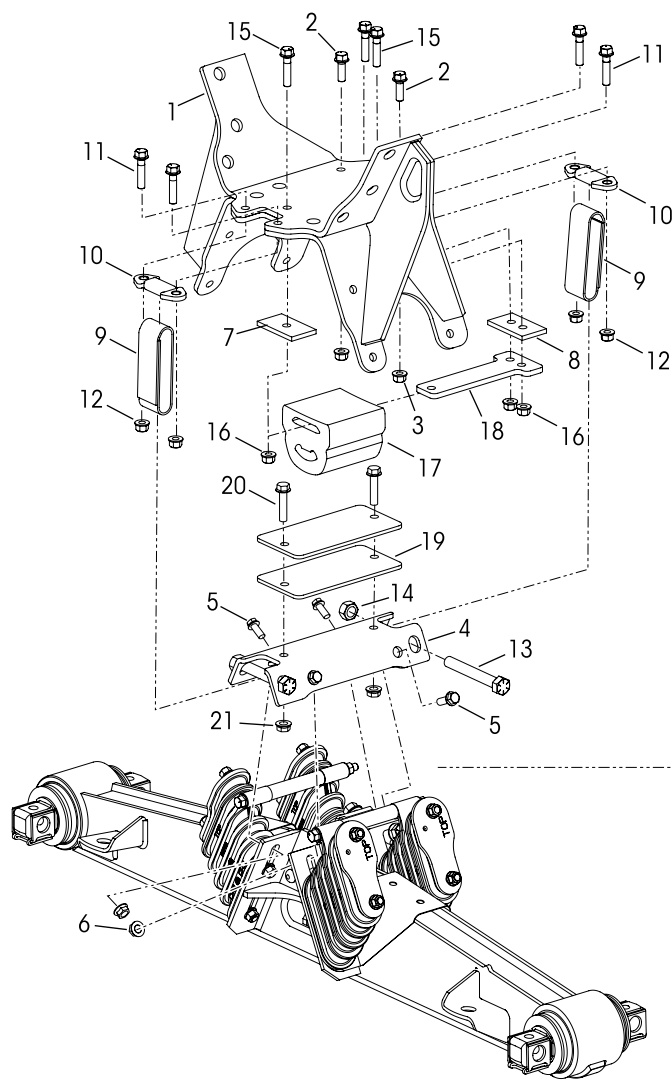

• Refer to Page 2 and 3 for equalizing beam part information.

• Refer to Page 5 for Outboard • Inboard Frame Bracket Selection Guides.

KEY NO.	PART NO.	DESCRIPTION	VEHICLE QTY.
	34013-335	Saddle Assembly Service Kits, One Side, HAULMAAX 40K, Includes Key No. 1 and Kit No. 34013-336	
	34013-337	HAULMAAX 46K, Includes Key No. 1 and Kit No. 34013-338	
	34013-336	Saddle Assembly Fastener Kits, One Side, HAULMAAX 40K, Includes Key Nos. 5-6, 11-12, 15-16 (Refer to Page 3 for more information on Key Nos. 12, 22-24)	
	34013-338	HAULMAAX 46K, Includes Key Nos. 5-6, 11-12, 15-16 (Refer to Page 3 for more information on Key Nos. 9-12, 22-24)	
1	79564-000	Saddle Assembly, Vehicles built with Dual Rebound Straps	2
2	60818-001	½"-13 UNC x 1½" Flange Bolt	4
3	60818-002	½"-13 UNC Flange Nut	4
	34013-339	Contact Plate Service Kit, One Side, Includes Key Nos 4-6	
4	59191-004	Load Spring Contact Plate	2
5	67290-001	⅝"-11 UNC x 1½" Flange Bolt	8
6	67291-000	⅝"-11 UNC Flange Nut	8

KEY NO.	PART NO.	DESCRIPTION	VEHICLE QTY.
7	60874-000	3⅜" Load Spring Spacer	2
8	60874-001	3¾" Load Spring Spacer	2
	34013-340	Rebound Strap Service Kit, One Side, Includes Key Nos. 9-14	
9		*Rebound Strap	4
10		*Rebound Clip	4
11	60818-002	½"-13 UNC x 2¼" Flange Bolt	8
12	60819-000	½"-13 UNC Flange Nut	8
13	21867-026	¾"-16 UNF x 5½" Bolt	4
14	30191-000	¾"-16 UNF Locknut	4
	34013-341	Progressive Load Spring Service Kit, One Side, Includes Key Nos. 15-17	
15	60818-002	½"-13 UNC x 2¼" Flange Bolt	6
16	60819-000	½"-13 UNC Flange Nut	6
17		*Progressive Load Spring	2
18	59384-005	Load Spring Bracket	2
19	60791-000	Load Spring Shim ¼" Thickness	4
20	60818-002	½"-13 UNC x 2¼" Flange Bolt	4
21	60819-000	½"-13 UNC Flange Nut	4




■ Aftermarket Service Kits

AFTERMARKET DUAL REBOUND STRAP ENHANCEMENT KIT FOR OUTRIGGER APPLICATIONS

Service Kit No.**64179-046** with Bolster Springs Tandem Set**64179-045** Tandem Set

Reference Lit. No. 59310-048

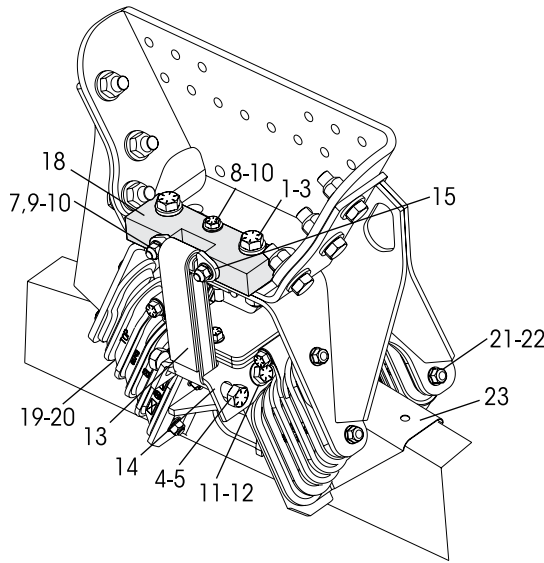

KEY NO.	PART NO.	DESCRIPTION	KIT QTY.
	64179-046	Aftermarket Dual Rebound Strap Enhancement with Bolster Springs, Tandem Set, Includes Key Nos. 1-23	
	64179-045	Aftermarket Dual Rebound Strap Enhancement Tandem Set, Includes Key Nos. 1-18	
1	21867-007	3/4"-16 UNF x 6" Bolt	4
2	30191-000	3/4"-16 UNF Locknut	4
3	22962-001	3/4" Hardened Washer	4
4	50764-016	3/4"-10 UNC x 4" Bolt	4
5	66137-000	3/4"-10 UNC Flange Locknut	4
6	60818-002	1/2"-13 UNC x 2 1/4" Flange Bolt (Not Shown)	4
7	24531-009	1/2"-13 UNC x 4" Bolt	12
8	24531-014	1/2"-13 UNC x 5" Bolt	2
9	60819-000	1/2"-13 UNC Flange Nut	18
10	22962-011	1/2" Hardened Washer	14
11	67290-001	5/8"-11 UNC x 1 1/2" Flange Bolt	8
12	67291-000	5/8"-11 UNC Flange Nut	8
13	57878-017	Rebound Strap	4
14	59191-002	Load Spring Contact Plate	2
15	60612-000	Rebound Clip	2
16	60874-001	Load Spring Spacer (Not Shown)	2
17	68851-001	Inboard Rebound Support Block (Not Shown)	2
18	69026-000	Outboard Rebound Support Block	2
19		*Tie-bar Bolster Spring	4
20	65742-000	Bolster Spring Spacer	4
21	60818-003	1/2"-13 UNC x 10" Flange Bolt	4
22	60819-000	1/2"-13 UNC Flange Nut	36
23	64890-000	Wear Plate	4


AFTERMARKET SHOCK ABSORBER SERVICE KITS

Service Kit Nos.	Saddle Ht.	For equalizing beams not equipped with lower shock mount
64178-003	16 1/2"	
64178-004	17 1/2" / 18 1/2"	
64178-009	16 1/2" (Mack)	

Reference Lit. No. 59310-012

NOTE:

Not available with 315 mm tires

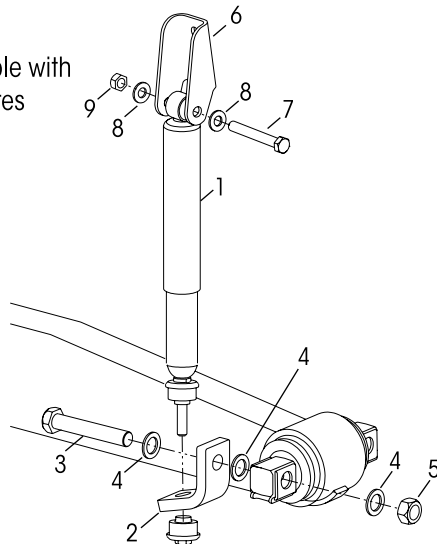

KEY NO.	PART NO.	DESCRIPTION	KIT QTY.
	64178-003	Shock Absorber Service Kit, Tandem Set 16 1/2" Saddle Height, Includes Key Nos. 1a, 2a-b, 3-9	
	64178-004	17 1/2"/18 1/2" Saddle Height, Includes Key Nos. 1b, 2a-b, 3-9	
	64178-009	16 1/2" Saddle Height - Mack Only, Includes Key Nos. 1c, 2c, 3-9	
1		Shock Absorber Assembly	4
a	60680-004L	16 1/2" Saddle Height	
b	60680-005L	17 1/2"/18 1/2" Saddle Height	
c	60680-006L	16 1/2" Saddle Height - Mack	
2		Lower Shock Bracket	
a	64148-001	Front	2
b	64148-002	Rear (Not Shown)	2
c	64835-000	Mack Only, Front and Rear (Not Shown)	4
3	48941-006	1"-8 UNC x 7" Hex Bolt, Replaces 48941-001	4
4	22962-008	1" Hardened Washer	12
5	48942-000	1"-8 UNC Locknut	4
6	64146-000	Upper Shock Bracket	4
7	32043-005	5/8"-11 UNC x 4 1/2" Hex Bolt	4
8	22962-004	5/8" Hardened Washer	8
9	47764-000	5/8"-11 UNC Locknut	4

■ Special Tools

BAR PIN END BUSHING TOOLS

INSTALLATION TOOLS

Hendrickson Part No. **66086-103**
 OTC Part No. **1757** Visit otctools.com



Special tooling is required to service the bar pin end bushings. Hendrickson part number 66086-103 tool is used with the equalizing beam removed from the truck, and in conjunction with OTC No. 51100 press plate and a 100-ton hydraulic shop press.

REMOVAL TOOLS


Hendrickson Part No. **66086-104**
 OTC Part No. **206457** Visit otctools.com



Hendrickson Part No. **66086-105**
 OTC Part No. **302030** Visit otctools.com



TORQUE ROD FUNNEL TOOLS

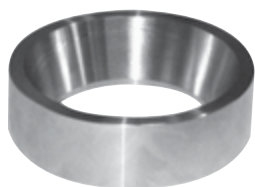

ULTRA ROD
 Hendrickson Part No. **66086-001L**

ULTRA ROD PLUS
 Hendrickson Part No. **66086-000L**

This is a general parts list to provide directional information. Components may vary by model. Questions in regards to parts, contact Hendrickson Truck Parts at 1.866.755.5968 (Toll-free U.S. and Canada), 630.910.2800 (Outside U.S. and Canada) or e-mail: truckparts@hendrickson-intl.com.

Actual product performance may vary depending upon vehicle configuration, operation, service and other factors.

All applications must comply with applicable Hendrickson specifications and must be approved by the respective vehicle manufacturer with the vehicle in its original, as-built configuration. Contact Hendrickson for additional details regarding specifications, applications, capacities, and operation, service and maintenance instructions.

Call Hendrickson at 1.866.755.5968 (toll-free) or 1.630.910.2800 for additional information.



www.hendrickson-intl.com

TRUCK COMMERCIAL VEHICLE SYSTEMS
 800 South Frontage Road
 Woodridge, IL 60517-4904 USA
 1.866.755.5968 (Toll-free U.S. and Canada)
 1.630.910.2800 (Outside U.S. and Canada)
 Fax 1.630.910.2899

SP-171 Rev L 08-19

© 2002-2019 Hendrickson USA, L.L.C. All Rights Reserved. All trademarks shown are owned by Hendrickson USA, L.L.C., or one of the affiliates, in one or more countries.

Information contained in this literature was accurate at the time of publication. Product changes may have been made after the copyright date that are not reflected.

Printed in United States of America