


Schematic Sheets

#	Name	File	Description
1	Main	SensWear_Debug_Main	Block Interconnect
2	DEBUG Connector	SensWear_Debug_DEBUG	Debug Connector
3	SWD Connectors	SensWear_Debug_SWD	MCU and MPU SWD header connectors
4	UART2USB converter	SensWear_Debug_UART2USB	FT232RL based UART to USB converter and USB Type C Connector

Revision History


Revision	Date	Description
A0	May 2025	Initial validation design
B0	March 2026	Charger AC connection to USB VBUS for easier development

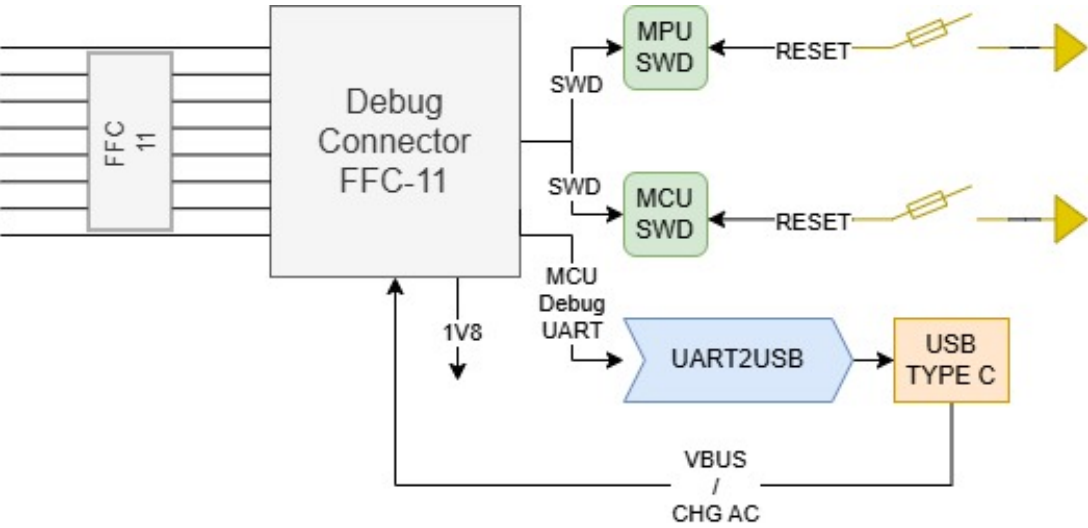




SenseWare-V1R1



Designer/Engineer	Board Title		
Yusein Ali	SensWear-Debug		
Drawn By	Document Name		
Yusein Ali	SensWear-V1R1-Debug-		
Approved By	Ver.	Rev.	Date
Dariush Salami	1.0	B0	01.03.2026

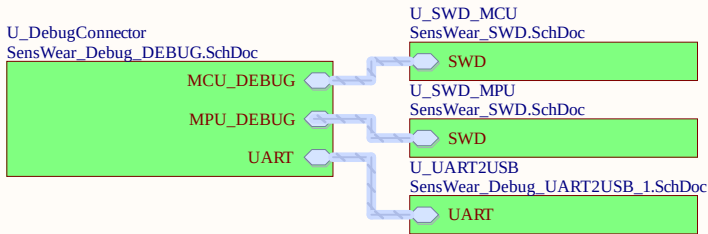

		SenseWare-V1R1		
Designer/Engineer Yusein Ali		Board Title SensWear-Debug		
Drawn By Yusein Ali		Document Name SensWear_Debug_Main.SchDoc		
Approved By Dariush Salami		Rev. B0	Sheet 1	of 5 Size A4 Date 01.03.2026



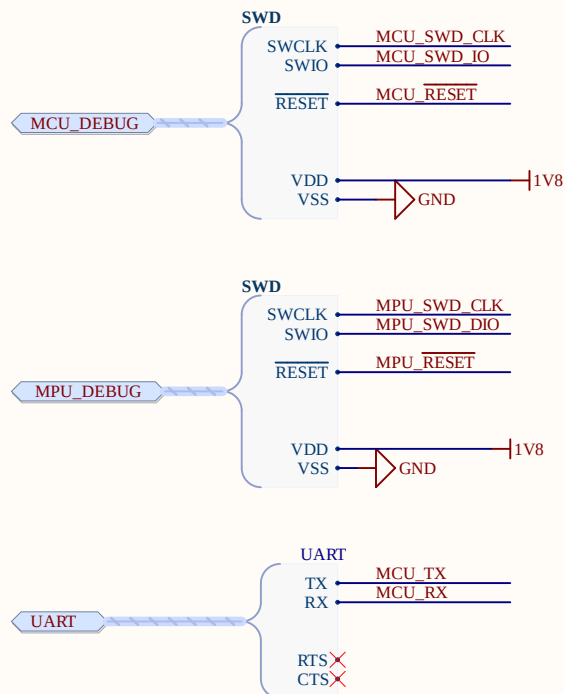


Must mate with the conenctor below

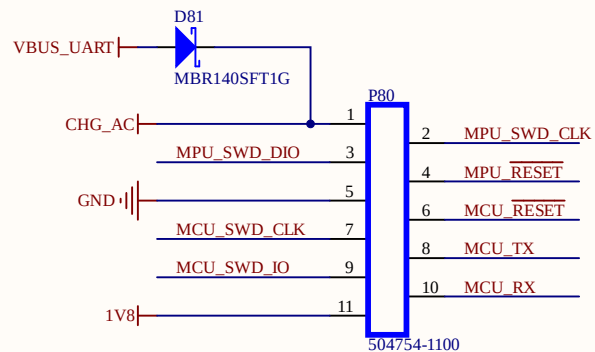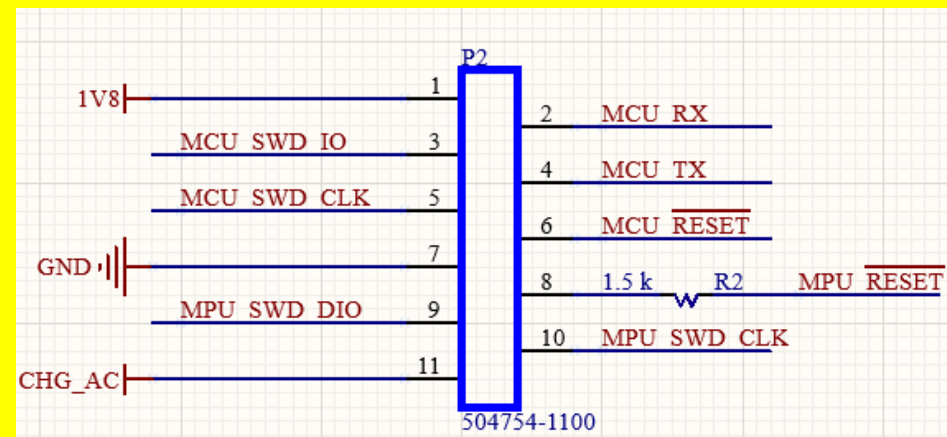


CABLE

0150310411

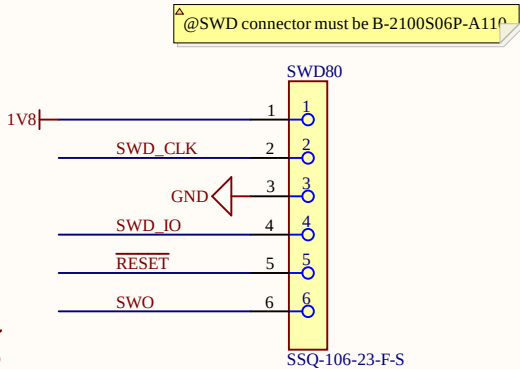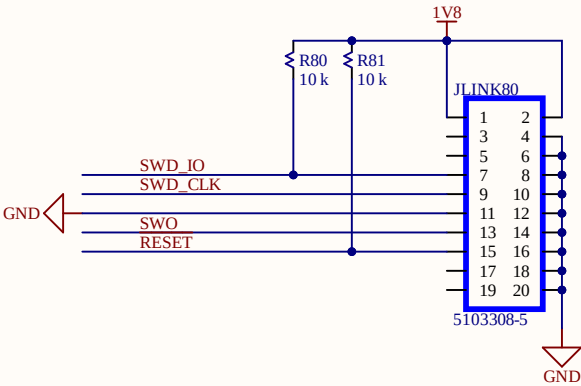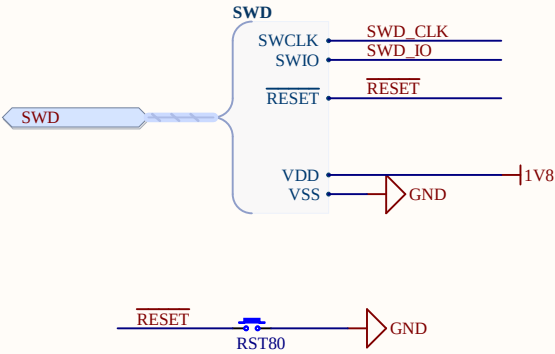


		SenseWare-V1R1			
Designer/Engineer Yusein Ali		Board Title SensWear-Debug			
Drawn By Yusein Ali		Document Name SensWear_SWD.SchDoc			
Approved By Dariush Salami		Rev. B0	Sheet Date	5 of 5 01.03.2026	Size A4

View from Top side (Scale 5:2)

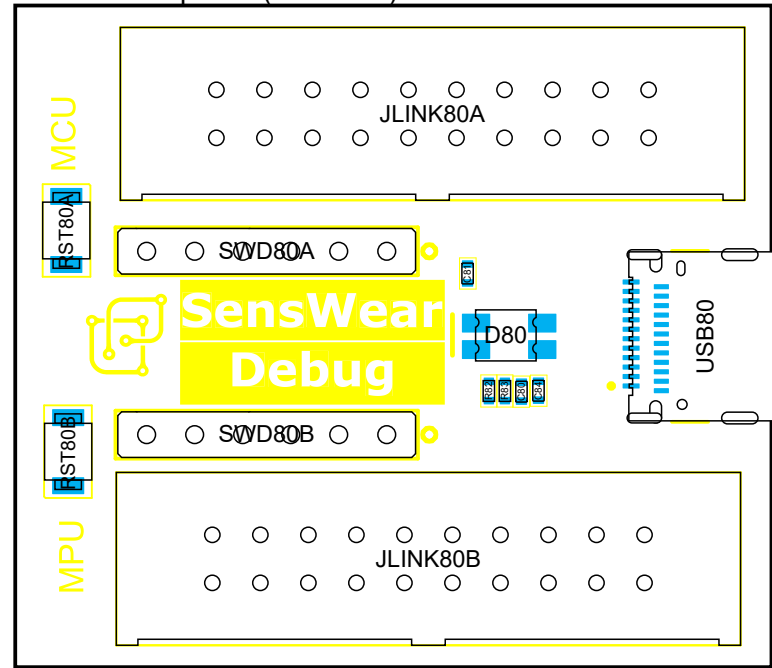

View from Bottom side (Scale 5:2)

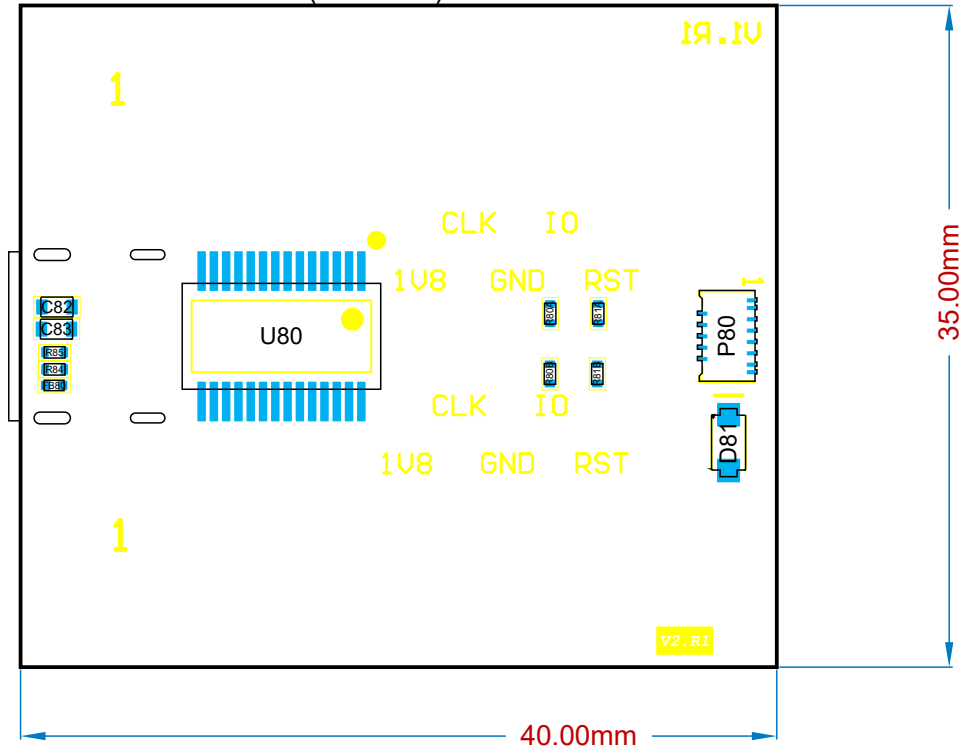

Bill Of Materials

Line #	Designator	Comment	Quantity
1	C80, C81, C84	0.1 uF	3
2	C82, C83	4.7uF	2
3	CABLE	0150310411	1
4	D80	LTST-C155KGJRKT	1
5	D81	MBR140SFT1G	1
6	FB80	BLM15AG601SN1D	1
7	JLINK80A, JLINK80B	5103308-5	2
8	P80	504754-1100	1
9	R80A, R80B, R81A, R81B	10 k	4
10	R82, R83	100 R	2
11	R84, R85	5.1 k	2
12	RST80A, RST80B	B3U-1000P	2
13	SWD80A, SWD80B	SSQ-106-23-F-S	2
14	U80	FT232RL	1
15	USB80	DX07S024JJ3R1300	1



SenseWare-V1R1

Designer/Engineer	Board Title		
Yusein Ali	SensWear-Debug		
Drawn By	Document Name		
Yusein Ali	SensWear-V1R1-Debug-		
Approved By	Ver.	Rev.	Date
Dariush Salami	1.0	B0	01.03.2026