


QE-001 | SHAFT INSPECTION EXERCISE

REV B LEARNING ADDENDUM / dimensions in mm / schematic, not to scale

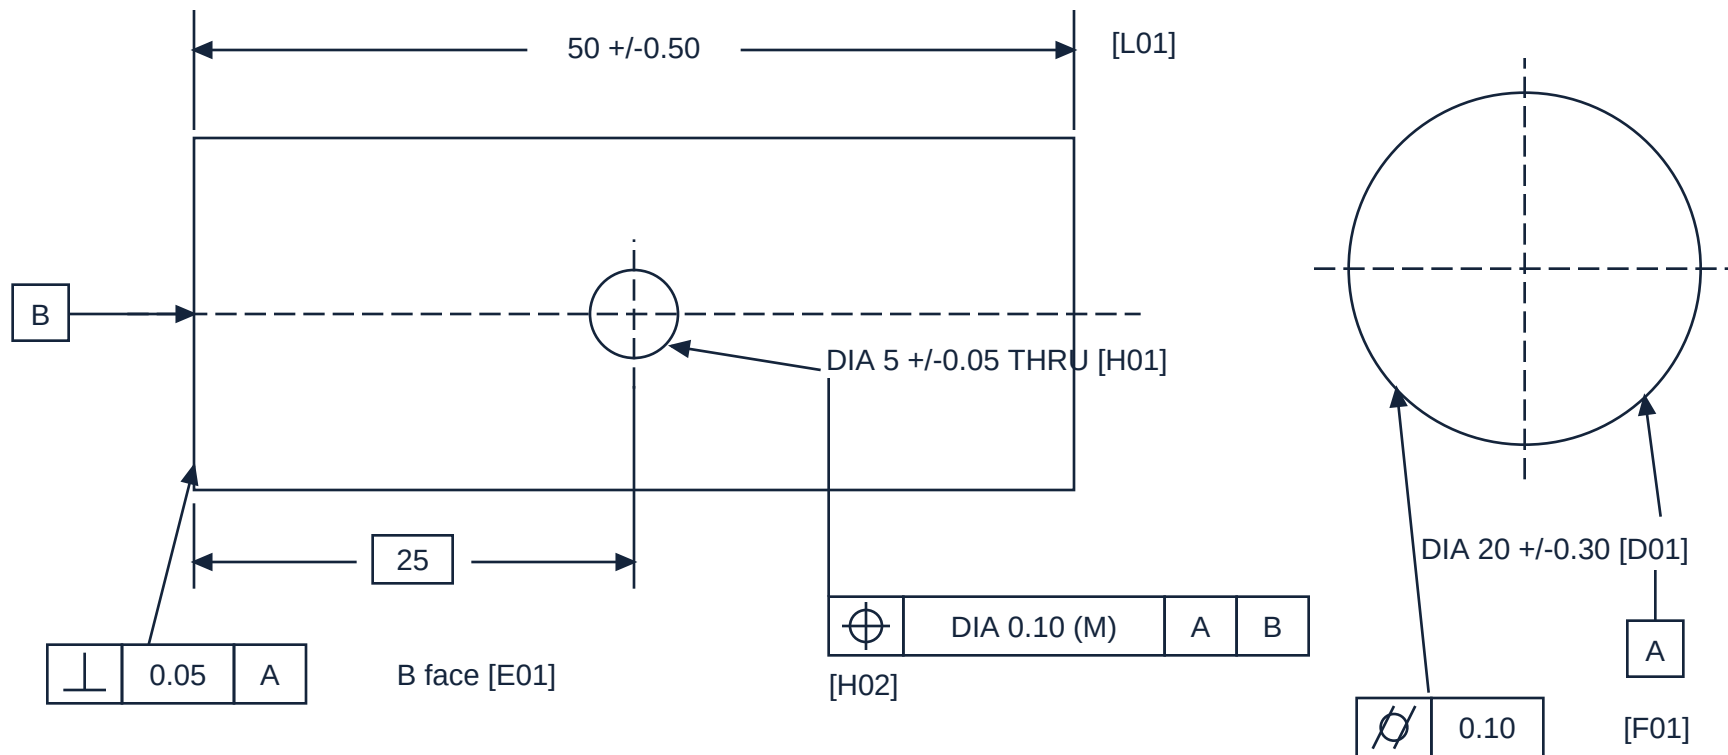

1. A = OD cylindrical datum feature; B = left end face. Datum A precedes B.
2. Hole axis: basic 90 deg to A; basic 25 from B. Clocking about A is unrestricted.
3. OD surface finish $R_a \leq 3.2$ micrometres [S01]; define profilometer procedure before use.
4. Position example assumes straight ideal bore. Evaluate full axis and size; do not use center alone.
5. Learning drawing only. Native Onshape Rev A retained separately; this is not its revised export.
6. No manufacturing release, formal FAI approval or standards-conformance certification.