73-75

RING MODULATOR

BOM

Qty	Value	
1	10n	
1	220p	
2	470n	
1	1N4148	
1	LM307	(TL071)
1	CA3080	
3	2N3906	
3	330	
2	1k	
1	2k2	
2	15k	
2	22k	
4	47k	
1	150k	
4	220k	
2	68k	
3	25k	TRIMMER
1	25k	LINEAR POTENTIOMETER

7 3 - 7 5


TRIM INSTRUCTIONS

START BY SETTING 3 TO CENTER POSITION, SET 2 TO FULL CCW. INPUT A 500Hz SAWTOOTH, INTO X AND PAD A. ADJUST 1 FOR A SYMMETRICAL OUTPUT.



DISCONNECT SAWTOOTH FROM X. ADJUST 3 FOR MINUM FEED THROUGH. REPEAT ADJUSTING 1 NOW THAT 3 IS SET.

CONNECT 1kHz SAWTOOTH TO BOTH X AND Y. ADJUST 2 FOR A SYM-METRICAL OUTPUT.

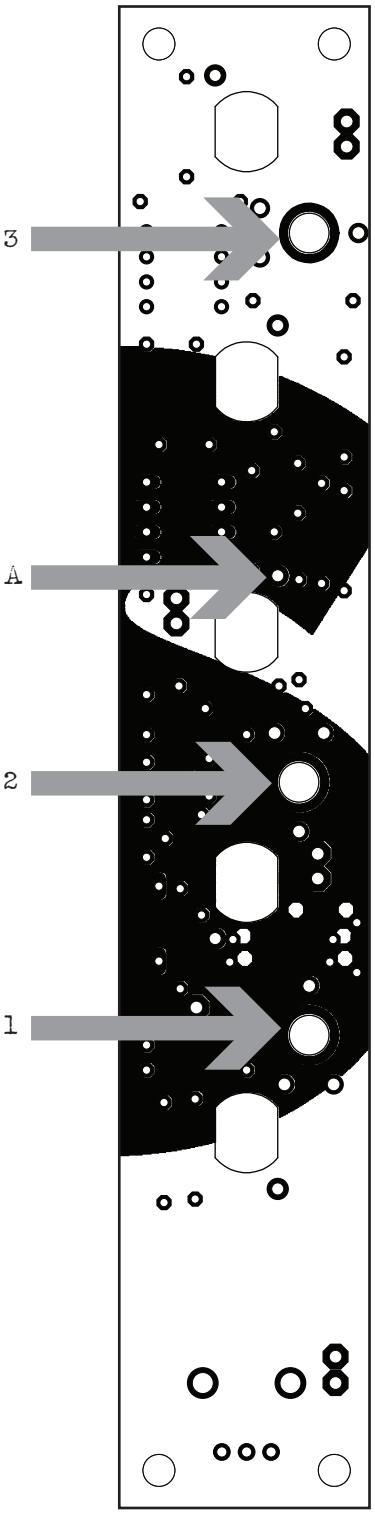

BACKSIDE OF CIRCUIT BOARD

7 3 - 7 5

RING MODULATOR SCHEMATICS

