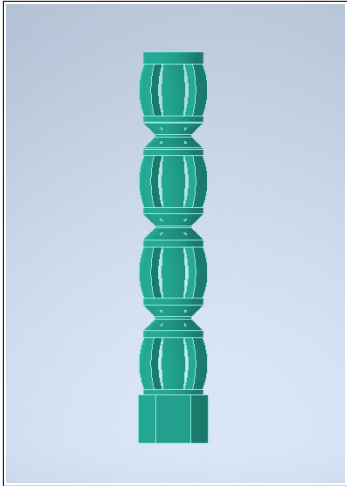


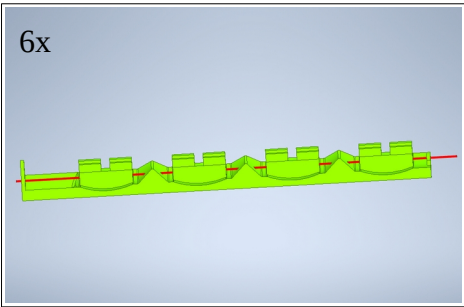
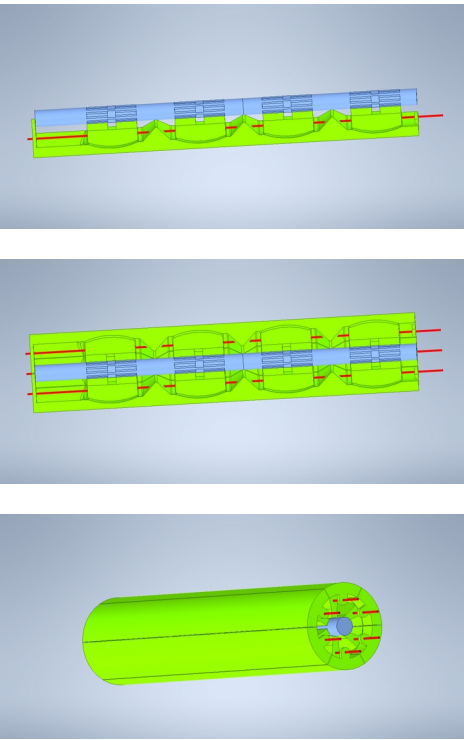
Manufacturing Instructions: Robot Retractable

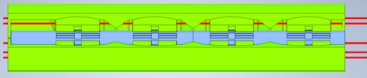
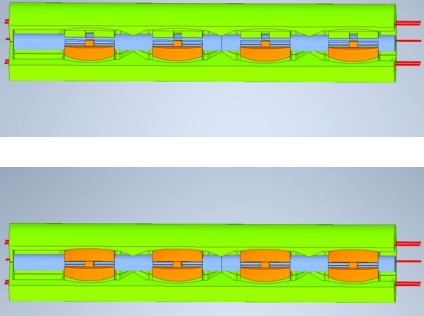
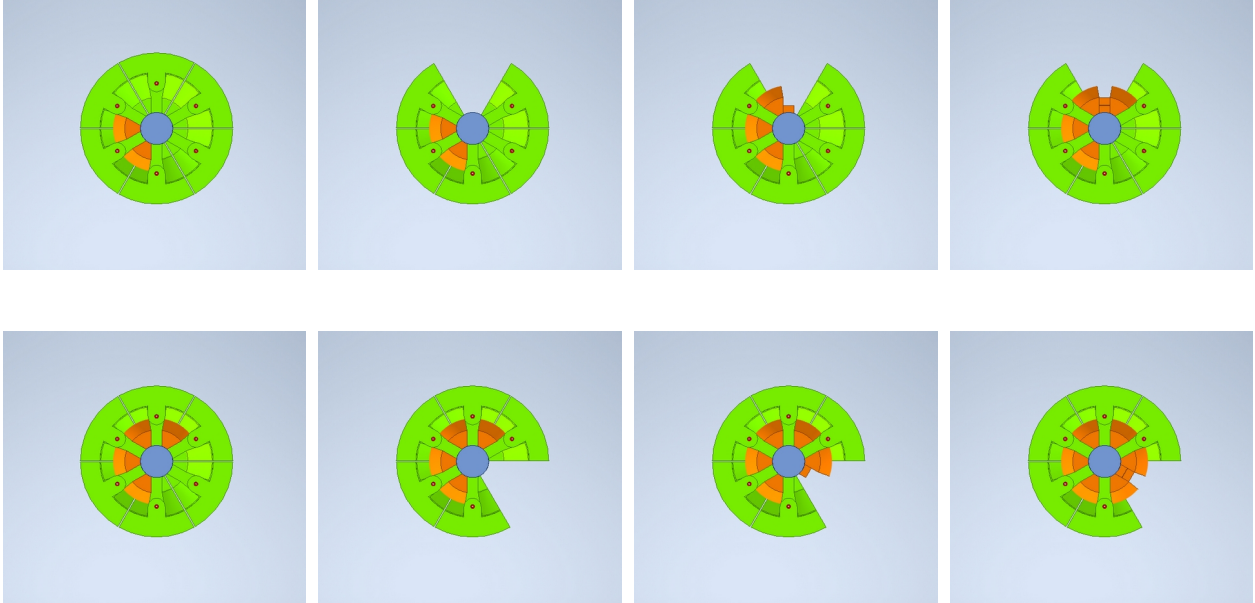
Required Parts:

Part	Qty.	File Path
3D-Printed Parts		
RR-M_001_core	24	20_Robots/RR_Robot_retractable/20_Molding/Mold_4-Elements/RR-M_001_core
RR-M_002_shell	6	20_Robots/RR_Robot_retractable/20_Molding/Mold_4-Elements/RR-M_002_shell
RR-M_003_centerA	1	20_Robots/RR_Robot_retractable/20_Molding/Mold_4-Elements/RR-M_003_centerA
RR-M_004_centerB	1	20_Robots/RR_Robot_retractable/20_Molding/Mold_4-Elements/RR-M_004_centerB
Other Materials		
Tubes (26 cm)	6	
Silicone (HT 33)	180 g	



Mold Assembly:

	Parts: - Tubes (6x) - RR-M_002_shell (6x) Instructions: - Insert the tubes (red) into the shell parts (green).
	Parts: - RR-M_003_centerA - RR-M_004_centerB Instructions: - Fit the two center parts (blue) together. - Attach the shell parts (green) one by one to the assembled center parts (blue). - Make sure all parts are firmly pressed together.

	Instructions: - Remove one of the shell parts.
	Parts: - RR-M_001_core (8x) Instructions: - Insert the core parts (orange). - Reattach the previously removed shell part (green).
Parts: - RR-M_001_core (16x) Instructions: - Insert the remaining core parts (orange). As with the first core parts, remove one shell part (green) at a time to insert the cores. - Note: During this process, only every second shell part is removed.	
	

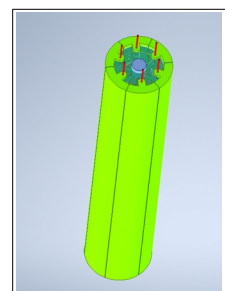
Casting:

The mold should be fully assembled, and any existing gaps or slots should be sealed with tape before casting.

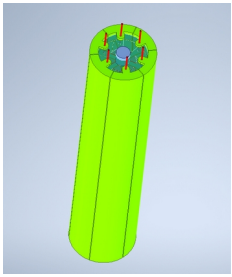
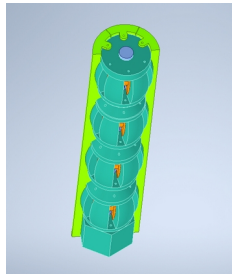
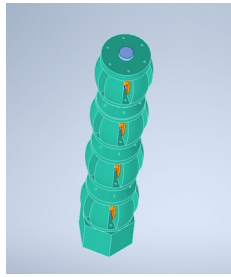
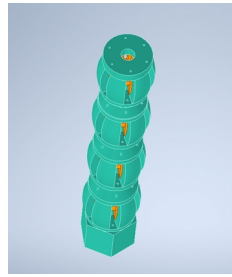
For the Mold_4-Elements version (August 26):

- Material: HT 33 Transparent (30 ShA)
- Amount: approx. **180 g** of **Silicone** (90 g of each component)

Cast the soft robot with the mold in an upright position.



Entformen:

				
1. Pull out the tubes (red).	2. Remove the shell parts (green).	3. Pull out the center parts (blue).	4. Remove the core parts (orange).	