


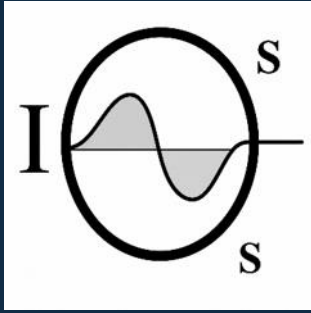

INSPECTION & SPECIFICATION SERVICES CC

CONTROLLED ENGINEERING INSPECTION REPORT

UPPER GANTRY GUIDE SHEAVES

Inspection & Specification Services cc.

Reg. No. 1990/020258/23

24 Jonkershoek Street, Vaalpark, 1947

Office: +27 (016) 971-2259

Cell: +27 (083) 442-7913

Email: iss@inspecserv.co.za

MECHANICAL ASSET CONDITION ASSESSMENT

Upper Gantry Guide Sheaves Inspection Report

Inspection report · groove assessment · engineering review · maintenance recommendations



Client	South32	Mine / site	Wessels Mine
Area / system	Cable Belt - Upper Gantry	Asset / asset group	Upper Gantry Guide Sheaves
Report number	IRS32-Wessels-180726_1	Revision	1.3
Issue date	11/08/2026	Inspection date	18/07/2026
Issue status	Approved	Prepared by	Inspection & Specification Services cc.
Reviewed by	Kevin Wood	Approved by	Kevin Wood
Client reference	South32 - Wessels	ISS job number	IRS32-Wessels-180726_1

CONFIDENTIALITY & RELIANCE

Prepared for the named client and stated purpose only. Reliance, distribution and operational decisions remain subject to the agreed scope, contractual requirements, stated limitations and responsible engineering review.

Controlled Document Notice

This inspection report records the condition assessment of the Upper Gantry Guide Sheaves at South32 Wessels Mine. It is compiled from the supplied inspection photographs, visible OEM/nameplate information and the report compilation notes. All findings remain subject to the stated limitations.

The report findings are limited to the agreed scope, access conditions, inspection methods, information supplied and evidence recorded. Visual inspection does not establish the internal condition of bearings, shafts, welds or other inaccessible components unless supporting examination or test evidence is recorded.

No external standard, acceptance criterion, measurement or NDT result may be included unless it has been verified for the specific project.

Document Control

Table 1 - Document control and report metadata

Report title	Upper Gantry Guide Sheaves Inspection Report
Report number	IRS32-Wessels-180726_1
Revision	1.3
Issue status	Approved
Issue date	11/08/2026
Client	South32
Mine / site	Wessels Mine
Area / system	Cable Belt - Upper Gantry
Asset / asset group	Upper Gantry Guide Sheaves
Template version	2.1

Document Authorization Record

Table 2 - Document authorization record

Role	Name	Title / discipline	Email	Date	Initials
Prepared by	Brendan Wood	Projects/Systems	brendan@inspecserv.co.za	05/08/2026	BM
Reviewed by	Kevin Wood	Managing Engineer	iss@inspecserv.co.za	10/08/2026	KC
Approved by	Kevin Wood	Managing Engineer	iss@inspecserv.co.za	11/08/2026	KC

Revision History

Table 3 - Revision history

Revision	Date	Issue status	Description of change	Prepared by	Approved by
0.1	04/08/2026	Preliminary Draft	Initial compiled draft from supplied inspection notes and photographic evidence.	Brendan Wood	Brendan Wood
1.1	05/08/2026	Preliminary Draft	Under Review	Brendan Wood	Brendan Wood
1.2	07/08/2026	Review	Under Review	Brendan Wood	Brendan Wood
1.3	11/08/2026	Approved	Issued to client.	Brendan Wood	Kevin Wood

Distribution List

Table 4 - Controlled distribution list

Recipient	Role	Organization	Email	Format	Distribution date
Lebohang Motete	Specialist Condition Monitoring	South32 – Wessels	Lebo.Motete@south32.net	PDF	11/08/2026
Alfonso Damon	Planner – Maintenance workforce management planning	South32 – Wessels	Alfonso.Damon@south32.net	PDF	11/08/2026
Kevin Wood	ISS file copy	Inspection & Specification Services cc.	iss@inspecserv.co.za	PDF	11/08/2026

Table of Contents

1 Purpose	9
2 Executive Summary	9
2.1 Executive Dashboard.....	10
3 Introduction	12
4 Scope of Inspection.....	12
5 Inspection Limitations.....	13
6 Applicable Standards and References.....	13
7 Definitions and Abbreviations.....	14
8 Responsibilities	14
9 Asset Informatio	15
9.1 Rear Gantry Guide Sheave North.....	15
9.2 Rear Gantry Guide Sheave South	15
9.3 Front Gantry Guide Sheave North	16
9.4 Front Gantry Guide Sheave South	16
10 Inspection Team and Equipment Used	17
10.1 Inspection Team	17
10.2 Inspection Equipment	17
11 Inspection Methodology	18
12 Inspection Criteria	18
13 Condition Rating, Defect Severity and Maintenance Priority	19
14 Engineering Sketches and Reference Arrangement.....	20
15 Asset Descriptions	21
15.1 Rear Gantry Guide Sheave North.....	21
15.2 Rear Gantry Guide Sheave South	21
15.3 Front Gantry Guide Sheave North	22
15.4 Front Gantry Guide Sheave South	22
16 Inspection Findings	23
16.1 Rear Gantry Guide Sheave North.....	23
16.2 Rear Gantry Guide Sheave South	27
16.3 Front Gantry Guide Sheave North	31
16.4 Front Gantry Guide Sheave South	34
17 Summary of Defects.....	37
18 Inspection Observation Log	37
19 Engineering Assessment	38
20 Recommendations	39
21 Conclusion	40
22 Technical Review and Report Issue Sign-off	40
Appendix A - Photographic Register	41
Appendix B - Inspection Checklist.....	59
Appendix C - Measurements and Dimensional Records	59
Appendix D - NDT Results	61

Appendix E - Drawings, Schematics and Reference Information	61
Appendix F - Supporting Documentation	62

List of Figures

Figure 1 - Upper Gantry Guide Sheaves reference arrangement - UGGS-REF001	20
Figure 2 - Rear Gantry Guide Sheave North evidence - URGN-002 / DEF-001	25
Figure 3 - Rear Gantry Guide Sheave North evidence - URGN-003 / DEF-001	26
Figure 4 - Rear Gantry Guide Sheave South evidence - URGS-002 / DEF-002	29
Figure 5 - Rear Gantry Guide Sheave South evidence - URGS-003 / DEF-002	30
Figure 6 - Front Gantry Guide Sheave North evidence - UFGN-002 / DEF-003.....	33
Figure 7 - Front Gantry Guide Sheave South evidence - UFGS-002 / DEF-004	36
Figure 8 - Rear Gantry Guide Sheave North evidence - URGN-001 / DEF-001	43
Figure 9 - Rear Gantry Guide Sheave North evidence - URGN-002 / DEF-001	44
Figure 10 - Rear Gantry Guide Sheave North evidence - URGN-003 / DEF-001	45
Figure 11 - Rear Gantry Guide Sheave North evidence - URGN-004 / DEF-001	46
Figure 12 - Rear Gantry Guide Sheave North evidence - URGN-005 / DEF-001	47
Figure 13 - Rear Gantry Guide Sheave South evidence - URGS-001 / DEF-002	48
Figure 14 - Rear Gantry Guide Sheave South evidence - URGS-002 / DEF-002	49
Figure 15 - Rear Gantry Guide Sheave South evidence - URGS-003 / DEF-002	50
Figure 16 - Rear Gantry Guide Sheave South evidence - URGS-004 / DEF-002	51
Figure 17 - Rear Gantry Guide Sheave South evidence - URGS-005 / DEF-002	52
Figure 18 - Front Gantry Guide Sheave North evidence - UFGN-001 / DEF-003.....	53
Figure 19 - Front Gantry Guide Sheave North evidence - UFGN-002 / DEF-003.....	54
Figure 20 - Front Gantry Guide Sheave South evidence - UFGS-001 / DEF-004	55
Figure 21 - Front Gantry Guide Sheave South evidence - UFGS-002 / DEF-004	56
Figure 22 - Front Gantry Guide Sheave North identification evidence - UFGN-003 / DEF-003.....	57
Figure 23 - Front Gantry Guide Sheave South identification evidence - UFGS-003 / DEF-004	58

List of Tables

Table 1 - Document control and report metadata	2
Table 2 - Document authorization record	3
Table 3 - Revision history.....	3
Table 4 - Controlled distribution list.....	3
Table 5 - Executive asset summary matrix	10
Table 6 - Executive recommendation register.....	11
Table 7 - Assets and activities included in scope.....	12
Table 8 - Scope exclusions	12
Table 9 - Inspection limitations register.....	13
Table 10 - Applicable standards and references register.....	13
Table 11 - Definitions and abbreviations.....	14
Table 12 - Responsibility and interface matrix	14
Table 13 - Asset data sheet - Rear Gantry Guide Sheave North	15

Table 14 - Asset data sheet - Rear Gantry Guide Sheave South	15
Table 15 - Asset data sheet - Front Gantry Guide Sheave North	16
Table 16 - Asset data sheet - Front Gantry Guide Sheave South.....	16
Table 17 - Inspection team register.....	17
Table 18 - Inspection equipment and calibration register	17
Table 19 - Inspection methodology matrix	18
Table 20 - Inspection criteria and evidence requirements	18
Table 21 - Condition rating.....	19
Table 22 - Defect severity classification.....	19
Table 23 - Maintenance priority guidance.....	19
Table 24 - Inspection orientation key	20
Table 25 - Asset description summary - Rear Gantry Guide Sheave North	21
Table 26 - Asset description summary - Rear Gantry Guide Sheave South.....	21
Table 27 - Asset description summary - Front Gantry Guide Sheave North.....	22
Table 28 - Asset description summary - Front Gantry Guide Sheave South	22
Table 29 - Finding classification and action - DEF-001.....	25
Table 30 - Photographic evidence assessment - URGN-002	25
Table 31 - Photographic evidence assessment - URGN-003	26
Table 32 - Finding classification and action - DEF-002.....	29
Table 33 - Photographic evidence assessment - URGs-002	29
Table 34 - Photographic evidence assessment - URGs-003	30
Table 35 - Finding classification and action - DEF-003.....	33
Table 36 - Photographic evidence assessment - UFGN-002.....	33
Table 37 - Finding classification and action - DEF-004.....	36
Table 38 - Photographic evidence assessment - UFGS-002.....	36
Table 39 - Consolidated defect register	37
Table 40 - Inspection observation and evidence log.....	37
Table 41 - Detailed recommendation and action register	39
Table 42 - Technical review and issue sign-off.....	40
Table 43 - Photographic register.....	41
Table 44 - Photographic evidence assessment - URGN-001	43
Table 45 - Photographic evidence assessment - URGN-002	44
Table 46 - Photographic evidence assessment - URGN-003	45
Table 47 - Photographic evidence assessment - URGN-004	46
Table 48 - Photographic evidence assessment - URGN-005	47
Table 49 - Photographic evidence assessment - URGs-001	48
Table 50 - Photographic evidence assessment - URGs-002	49
Table 51 - Photographic evidence assessment - URGs-003	50
Table 52 - Photographic evidence assessment - URGs-004	51
Table 53 - Photographic evidence assessment - URGs-005	52
Table 54 - Photographic evidence assessment - UFGN-001.....	53
Table 55 - Photographic evidence assessment - UFGN-002.....	54
Table 56 - Photographic evidence assessment - UFGS-001.....	55
Table 57 - Photographic evidence assessment - UFGS-002.....	56

Table 58 - Photographic evidence assessment - UFGN-003.....	57
Table 59 - Photographic evidence assessment - UFGS-003.....	58
Table 60 - Upper gantry guide sheave inspection checklist.....	59
Table 61 - Measurements and dimensional records	59
Table 62 - NDT results register	61
Table 63 - Drawings and schematics register	61
Table 64 - Supporting documentation register	62

SECTION A**REPORT BASIS & GOVERNANCE**

Purpose, executive reporting, scope boundaries, references and responsibility interfaces.



1 Purpose

This report documents the inspection of the Upper Gantry Guide Sheaves at South32 Wessels Mine. The scope covers the Rear Gantry Guide Sheave North, Rear Gantry Guide Sheave South, Front Gantry Guide Sheave North and Front Gantry Guide Sheave South. It records the supplied inspection evidence, groove-depth measurements where available, visible groove-profile condition, engineering assessment and recommended follow-up actions arising from the inspection conducted on 18 July 2026.

2 Executive Summary

Four Upper Gantry Guide Sheaves were inspected. The Rear North and Rear South sheaves are assessed as being in good, serviceable condition within the scope of the inspection, with no immediate remedial intervention indicated. Their KEW plates record a 1,900 mm sheave diameter, 45 mm rope diameter, nominal groove depth of 90 mm and maximum wear depth of 120 mm. Recorded groove depths were 97 mm (Rear North) and 96 mm (Rear South), leaving approximately 23 mm and 24 mm respectively before the photographed 120 mm maximum. The Rear South sheave is fitted with a rope-groove liner, which was observed to remain serviceable. Based on the current condition, both rear sheaves should be re-inspected six months from the 18 July 2026 inspection to obtain repeat groove-depth and profile data for condition trending.

Historical ISS records identify the Front North and Front South guide sheaves as the same 3,658 mm / 45 mm rope configuration, with historical groove-depth references of 117 mm minimum and 142 mm maximum. Recorded groove depths were 121 mm (Front North) and 123 mm (Front South), leaving approximately 21 mm and 19 mm respectively before the historical 142 mm maximum. The front groove profiles are generally symmetrical with no evident abnormal side-wall loading; however, pronounced longitudinal scoring is visible along the base of both grooves within the rope-contact zone. The front sheaves are therefore recommended for an initial repeat inspection three months from the 18 July 2026 inspection to determine the rate and progression of groove wear and scoring.

Following the three-month Front North and Front South re-inspection, the recorded groove-depth, profile and scoring condition should be compared with the current baseline and the monitoring interval reviewed by the responsible engineer. Where the condition remains stable and no accelerated deterioration is identified, the interval may be extended to six months or another approved longer interval, potentially up to twelve months where supported by subsequent trend data and the mine's maintenance strategy. The historical front-sheave dimensional, manufacturing and identification records remain subject to cross-reference and validation against the Wessels Mine asset records.

2.1 Executive Dashboard

ASSETS INSPECTED	OVERALL CONDITION	HIGHEST PRIORITY	OPEN ACTIONS
4	Good - Minor	P4 – Monitor	4

Table 5 - Executive asset summary matrix

Asset	Asset tag / ID	Overall condition	Highest severity	Priority	Open findings	Executive comment
Rear Gantry Guide Sheave North	URGN	Good	Level 1 – (Minor)	P4 - monitor	1	97 mm groove depth; groove/profile condition serviceable. Re-inspect at six months and trend from current baseline.
Rear Gantry Guide Sheave South	URGS	Good	Level 1 – (Minor)	P4 - monitor	1	96 mm groove depth; installed liner/profile remains serviceable. Re-inspect at six months and trend liner/profile condition.
Front Gantry Guide Sheave North	UFGN	Good	Level 1 – (Minor)	P4 - monitor	1	121 mm groove depth; generally symmetrical profile with pronounced groove-base scoring. Initial re-inspection at three months; review interval after trending. Historical criterion requires mine validation.
Front Gantry Guide Sheave South	UFGS	Good	Level 1 – (Minor)	P4 - monitor	1	123 mm groove depth; generally symmetrical profile with pronounced groove-base scoring. Initial re-inspection at three months; review interval after trending. Historical criterion requires mine validation.

Table 6 - Executive recommendation register

Action ID	Asset	Recommended action	Priority	Responsible discipline	Target / shutdown	Status
REC-001	Rear Gantry Guide Sheave North	Re-inspect six months from the last inspection. Repeat indexed groove-depth and groove-profile measurements and trend against the 97 mm baseline and verified 120 mm maximum.	P4 - monitor	Mechanical / inspection	6 months from 18/07/2026 Target: 18/01/2027	Open
REC-002	Rear Gantry Guide Sheave South	Re-inspect six months from the last inspection. Repeat indexed groove-depth and liner/profile measurements, trend against the 96 mm baseline and current liner condition, and confirm the Wessels asset identity.	P4 - monitor	Mechanical / inspection	6 months from 18/07/2026 Target: 18/01/2027	Open
REC-003	Front Gantry Guide Sheave North	Initial re-inspection three months from the last inspection. Repeat indexed groove-depth/profile measurements, trend against the 121 mm baseline, document progression of groove-base scoring, and validate ID 10072-3 / historical 117-142 mm data. Review the subsequent interval after trend evaluation.	P4 - monitor	Mechanical / inspection	3 months from 18/07/2026 Target: 18/10/2026	Open
REC-004	Front Gantry Guide Sheave South	Initial re-inspection three months from the last inspection. Repeat indexed groove-depth/profile measurements, trend against the 123 mm baseline, document progression of groove-base scoring, and validate ID 10072-1 / historical 117-142 mm data. Review the subsequent interval after trend evaluation.	P4 - monitor	Mechanical / inspection	3 months from 18/07/2026 Target: 18/10/2026	Open

3 Introduction

Inspection & Specification Services cc. was requested to inspect and document the condition of the Upper Gantry Guide Sheaves associated with the Wessels Mine cable-belt system. The inspected group comprises rear and front guide sheaves on the north and south sides of the upper gantry. The evidence supplied for compilation consists of contextual photographs, groove-depth measurements, groove-profile photographs and OEM/nameplate photographs where available. The report provides an evidence-based record for engineering review, maintenance planning and future condition trending.

4 Scope of Inspection

Table 7 - Assets and activities included in scope

Asset	Asset tag / ID	Location	Inspection activity	Access / operating state
Rear Gantry Guide Sheave North	URGN	Upper gantry - rear / north	Visual, groove-depth measurement, groove-profile review	Stopped / isolated
Rear Gantry Guide Sheave South	URGS	Upper gantry - rear / south	Visual, groove-depth measurement, groove-profile review	Stopped / isolated
Front Gantry Guide Sheave North	UFGN	Upper gantry - front / north	Visual, groove-depth measurement, groove-profile review	Stopped / isolated
Front Gantry Guide Sheave South	UFGS	Upper gantry - front / south	Visual, groove-depth measurement, groove-profile review	Stopped / isolated

Table 8 - Scope exclusions

Excluded item	Reason / access constraint	Assessment implication	Recommended follow-up
Internal bearing / shaft condition	No disassembly or internal examination evidence supplied.	Internal condition cannot be established from photographs.	Assess separately if required by maintenance/risk review.
NDT	No NDT evidence or report supplied.	Subsurface/crack condition not established.	Perform only where required by approved inspection plan.
Dynamic rope tracking / alignment survey	No operating observation or alignment readings supplied.	Dynamic alignment/tracking not quantified.	Verify separately if abnormal tracking is suspected.

5 Inspection Limitations

The inspection assessment is limited to the supplied access evidence, photographs, visible measurements and nameplate information. Internal bearing, shaft, weld and other inaccessible component condition must not be inferred from this visual record. No NDT results were supplied.

Table 9 - Inspection limitations register

Limitation ID	Affected asset / area	Limitation	Impact on assessment	Follow-up requirement
LIM-001	All four guide sheaves	No formal alignment survey, dynamic rope-tracking observation or quantitative alignment readings were supplied.	Geometric alignment cannot be confirmed from the static inspection evidence.	Verify separately if abnormal tracking is suspected or where alignment confirmation is required.
LIM-002	All four guide sheaves	Only one groove-depth reading per sheave is presently recorded; the rear readings are photographically evidenced, while the front readings are supplied in the compilation notes.	Circumferential wear variation cannot be quantified from a single reading per sheave.	Repeat at indexed circumferential positions and retain the measurement datum and equipment identification.

6 Applicable Standards and References

Table 10 - Applicable standards and references register

Ref. ID	Type	Title / description	Document number	Revision / date	Source	Status
REF-001	OEM / identification plates	Rear North and Rear South identification plates	URGN-004 / URGs-004	Photos 18/07/2026	KEW / site photographs	Verified from supplied photographs
REF-002	OEM / specification plates	Rear North and Rear South groove specification plates	URGN-005 / URGs-005	Photos 18/07/2026	KEW / site photographs	Verified from supplied photographs
REF-003	Historical ISS record	Front guide sheave dimensional and manufacturing reference	ISS historical records / compilation notes	Historical record	ISS	Reference basis only; validate against Wessels Mine records
REF-004	Reference schematic	Upper Gantry Guide Sheaves reference arrangement	UGGS-REF001	Rev 1.0	ISS generated from compilation notes	Included in Section 14; reference only; not to scale

7 Definitions and Abbreviations

Table 11 - Definitions and abbreviations

Term	Definition
IR	Inspection Report
ISS	Inspection & Specification Services cc.
NDT	Non-destructive testing
UT	Ultrasonic testing
MPI	Magnetic particle inspection
OEM	Original equipment manufacturer
P1-P4	Maintenance priority classifications defined in this report

8 Responsibilities

Table 12 - Responsibility and interface matrix

Party / role	Responsibility	Report interface / deliverable
Client management / responsible site authority	Provide scope confirmation, access, isolation, asset information, operational context and formal site decisions.	Review findings, determine operational response and authorize corrective actions.
ISS inspector / project manager	Perform the agreed inspection, record evidence, compile findings and recommendations within the stated limitations.	Issue draft and final inspection report.
ISS reviewing engineer	Review technical content, evidence traceability, engineering assessment and recommendations.	Technical review and approval.
Maintenance contractor / specialist, where appointed	Verify repair scope, execute approved work and provide completion evidence.	Repair records, measurements, NDT and close-out evidence.

SECTION B

ASSET & INSPECTION
FRAMEWORK

Asset data, inspection equipment, methodology, assessment criteria and reference orientation.



9 Asset Informatio

9.1 Rear Gantry Guide Sheave North

Table 13 - Asset data sheet - Rear Gantry Guide Sheave North

Asset name	Rear Gantry Guide Sheave North	Asset tag / ID	URGN
Location	Upper gantry - rear / north	Service / duty	Cable-belt rope guide sheave
Manufacturer / OEM	Kimberley Engineering Works (Pty) Ltd / KEW Foundries	Model / serial number	Order 4541939716; Job 6463
Sheave diameter	1900 mm	Number of grooves	1 (visible)
Rope diameter	45 mm	Groove profile / radius	A = 90 mm nominal groove depth; B = 120 mm maximum wear depth; 22 mm minimum section shown
Bearing type	Not supplied	Shaft / axle reference	Not supplied
Design speed / duty	Not supplied	Commissioned / installation date	Not supplied; manufacture plate dated 02-2021
Drawing / OEM reference	URGN-004 / URGN-005	Inspection date	18/07/2026
Inspector(s)	ISS inspection team	Overall condition rating	Good

9.2 Rear Gantry Guide Sheave South

Table 14 - Asset data sheet - Rear Gantry Guide Sheave South

Asset name	Rear Gantry Guide Sheave South	Asset tag / ID	URGS
Location	Upper gantry - rear / south	Service / duty	Cable-belt rope guide sheave
Manufacturer / OEM	Kimberley Engineering Works (Pty) Ltd	Model / serial number	Order 4200917155; Job 1267; Sheave No. 3; mass 1600 kg; inertia 975 kg/m ²
Sheave diameter	1900 mm	Number of grooves	1 (visible)
Rope diameter	45 mm	Groove profile / radius	A = 90 mm nominal groove depth; B = 120 mm maximum wear depth; 22 mm minimum section shown. Rope-groove liner fitted, as evidenced in URGS-003.
Bearing type	Not supplied	Shaft / axle reference	Not supplied
Design speed / duty	Not supplied	Commissioned / installation date	Not supplied; manufacture plate dated 08-2008.
Drawing / OEM reference	URGS-004 / URGS-005	Inspection date	18/07/2026
Inspector(s)	ISS inspection team	Overall condition rating	Good

9.3 Front Gantry Guide Sheave North

Table 15 - Asset data sheet - Front Gantry Guide Sheave North

Asset name	Front Gantry Guide Sheave North	Asset tag / ID	UFGN
Location	Upper gantry - front / north	Service / duty	Cable-belt rope guide sheave
Manufacturer / OEM	Thomas Foundries (casting); Eco Tech Engineering (machining/prefabrication) - historical ISS record, pending mine validation	Model / serial number	Visible identification marking 10072-3 (UFGN-003)
Sheave diameter	3,658 mm - historical ISS record; validate with mine records	Number of grooves	1 (visible)
Rope diameter	45 mm	Groove profile / radius	Historical ISS record: minimum groove depth 117 mm; maximum groove depth 142 mm - validate with mine records
Bearing type	Not supplied / Inaccessible	Shaft / axle reference	Not supplied
Design speed / duty	Not supplied / Inaccessible	Commissioned / installation date	Not supplied / Inaccessible
Drawing / OEM reference	UFGN-001 / UFGN-002 / UFGN-003; historical ISS records	Inspection date	18/07/2026
Inspector(s)	ISS inspection team	Overall condition rating	Good - monitor

9.4 Front Gantry Guide Sheave South

Table 16 - Asset data sheet - Front Gantry Guide Sheave South

Asset name	Front Gantry Guide Sheave South	Asset tag / ID	UFGS
Location	Upper gantry - front / south	Service / duty	Cable-belt rope guide sheave
Manufacturer / OEM	Thomas Foundries (casting); Eco Tech Engineering (machining/prefabrication) - historical ISS record, pending mine validation	Model / serial number	Visible identification marking 10072-1 (UFGS-003)
Sheave diameter	3,658 mm - historical ISS record; validate with mine records	Number of grooves	1 (visible)
Rope diameter	45 mm	Groove profile / radius	Historical ISS record: minimum groove depth 117 mm; maximum groove depth 142 mm - validate with mine records
Bearing type	Not supplied	Shaft / axle reference	Not supplied
Design speed / duty	Not supplied	Commissioned / installation date	Not supplied
Drawing / OEM reference	UFGS-001 / UFGS-002 / UFGS-003; historical ISS records	Inspection date	18/07/2026
Inspector(s)	ISS inspection team	Overall condition rating	Good - monitor

10 Inspection Team and Equipment Used

10.1 Inspection Team

Table 17 - Inspection team register

Name	Role / discipline	Company	Competency / authorization	Site induction / permit reference
Brendan Wood	Inspector / Projects and Systems	ISS	Technician	N/A
Kevin Wood	Technical reviewer / Managing Engineer	ISS	Managing Engineer	N/A

10.2 Inspection Equipment

Table 18 - Inspection equipment and calibration register

Equipment	Purpose	Manufacturer / model	Equipment ID	Calibration certificate	Calibration due	Accuracy / range	Comment
Digital camera / mobile device	Photographic documentation	Not supplied	Not supplied	N/A	N/A	N/A	Image capture device not identified.
Laser distance meter	Groove-depth reading	Bosch PLR 50	009741746	Not supplied	Not verified	Manufacturer accuracy/range not verified from supplied documentation	Visible in URGN-002 / URGs-002.
Steel rule / straight reference	Reference across groove for depth reading	Not supplied	Not supplied	N/A	N/A	Not supplied	Visible with rear groove-depth measurements.
Flexicurve profile	Qualitative groove-profile comparison	Not supplied	Not supplied	N/A	N/A	Profile size / reference criterion not supplied	Visible in groove-profile assessment photographs; used for qualitative comparative profile assessment.

11 Inspection Methodology

The inspection methodology comprised visual examination, photographic documentation, rope-groove condition review, groove-depth measurement records where available, and qualitative groove-profile comparison. Rear-sheave depth readings are photographically evidenced; front-sheave depth values are supplied in the compilation notes. No NDT, internal bearing examination, dynamic tracking measurement or formal alignment survey is evidenced in the scoped inspection.

Table 19 - Inspection methodology matrix

Method ID	Inspection activity	Purpose	Evidence captured	Acceptance / reference basis	Limitation / note
M-01	Visual inspection	Record visible condition and anomalies	Context/detail photographs	Engineering assessment from observed evidence	Internal/inaccessible condition excluded.
M-02	Rope groove depth assessment	Compare recorded groove depth with the applicable documented reference values.	URGN-002 / URGS-002; front depth values from supplied compilation notes (UFGN 121 mm / UFGS 123 mm).	Rear: photographed KEW plate A=90 mm, B=120 mm. Front: historical ISS record minimum 117 mm / maximum 142 mm, pending mine validation.	Single localized reading per sheave; front dimensional reference requires cross-validation with Wessels records.
M-03	Groove profile comparison	Record qualitative groove profile/contact condition	URGN-003 / URGS-003 / UFGN-002 / UFGS-002	Comparative visual evidence	Single localized reading per sheave evidenced where accessible.

12 Inspection Criteria

Table 20 - Inspection criteria and evidence requirements

Attribute	Assessment basis	Evidence required	Typical record	Reference / note
Rope groove and rim condition	Visible groove surface, local damage and measured depth	Photographs / dimensional reading	Finding / Defect Ref ID	Rear: photographed KEW plate 90 mm nominal / 120 mm maximum. Front: historical ISS records indicate 117 mm minimum / 142 mm maximum; front values must be validated against Wessels Mine records before being treated as confirmed acceptance criteria.
Groove profile / contact	Visible profile fit/contact and surface continuity	Profile photographs	Finding / Defect Ref ID	Visual Qualitative.

13 Condition Rating, Defect Severity and Maintenance Priority

The following classifications support consistent reporting and maintenance planning. They do not replace the mine's formal risk assessment, statutory obligations or decisions by the responsible site authority.

Table 21 - Condition rating

Rating	General meaning	Typical reporting response
Excellent	No material defect observed within the inspection scope.	Record condition and routine inspection interval.
Good	Minor condition observations only.	Monitor through routine maintenance and inspection.
Fair	Serviceable with deterioration requiring planned attention.	Plan maintenance, measurement or enhanced monitoring.
Poor	Significant deterioration requiring priority engineering or maintenance review.	Define corrective action and verification requirements.
Critical	Potentially unacceptable condition requiring immediate responsible-site review.	Escalate immediately and determine operational response.

Table 22 - Defect severity classification

Level	Classification	Definition	Default action
Level 1	Minor	Low-significance observation requiring monitoring or routine correction.	Record and monitor.
Level 2	Moderate	Defect requiring planned corrective action.	Schedule corrective work.
Level 3	Significant	Defect requiring priority engineering review and corrective action.	Repair at the next suitable shutdown or earlier.
Level 4	Critical	Potentially critical condition requiring immediate responsible-site review.	Immediate escalation and corrective action.

Table 23 - Maintenance priority guidance

Priority	Meaning	Typical timeframe guidance	Required response
P1	Immediate	Before continued operation where required by responsible review.	Escalate and define immediate controls / corrective action.
P2	Urgent	Earliest practicable maintenance opportunity.	Plan and execute short-term corrective action.
P3	Planned	Next suitable scheduled shutdown or maintenance cycle.	Include in approved maintenance plan.
P4	Monitor	Routine inspection and maintenance interval.	Trend and verify at future inspection.

14 Engineering Sketches and Reference Arrangement

UGGS-REF001 - Upper Gantry Guide Sheaves reference arrangement (Rev 1.0) is an ISS-generated schematic compiled from the supplied notes for inspection orientation. It is included for reference only and is not to scale.

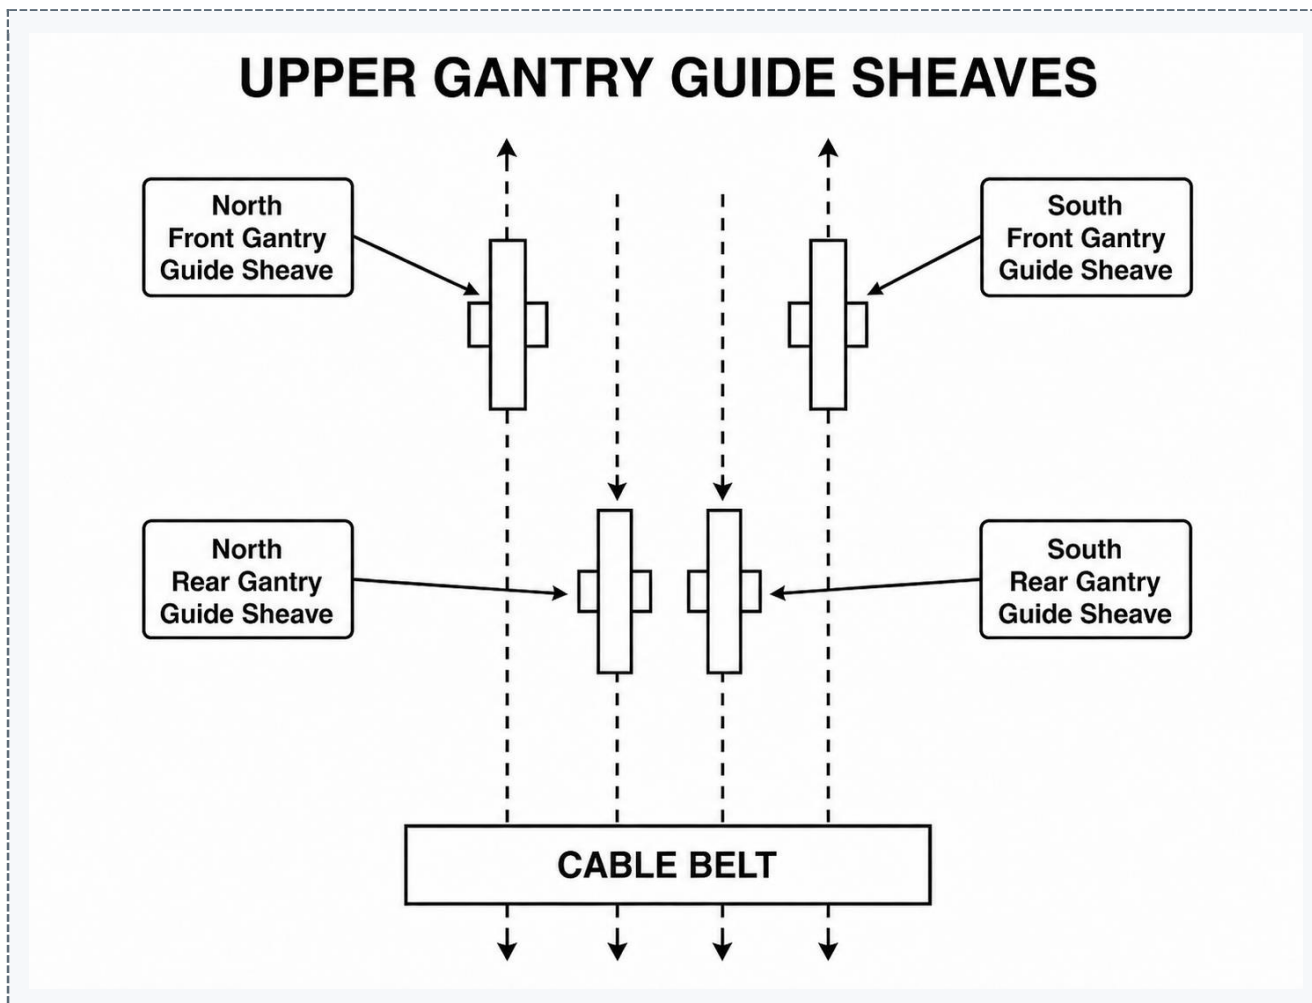


Figure 1 - Upper Gantry Guide Sheaves reference arrangement - UGGS-REF001

Table 24 - Inspection orientation key

Reference	Description	Direction / datum	Source drawing / photograph
URGN	Rear Gantry Guide Sheave North	Upper gantry - rear / north	UGGS-REF001 / URGN-001
URGS	Rear Gantry Guide Sheave South	Upper gantry - rear / south	UGGS-REF001 / URGS-001
UFGN	Front Gantry Guide Sheave North	Upper gantry - front / north	UGGS-REF001 / UFGN-001
UFGS	Front Gantry Guide Sheave South	Upper gantry - front / south	UGGS-REF001 / UFGS-001

15 Asset Descriptions

15.1 Rear Gantry Guide Sheave North

Rear Gantry Guide Sheave North is located at Upper gantry - rear / north and performs the function of guiding the cable-belt rope through the upper gantry rope path. Single-groove sheave assembly. The visible KEW plate records 1900 mm sheave diameter, 45 mm rope diameter and manufacture date 02-2021. Relevant evidence is referenced in URGN-001, URGN-004, URGN-005.

Table 25 - Asset description summary - Rear Gantry Guide Sheave North

Field	Entry
Asset	Rear Gantry Guide Sheave North / URGN
Operational duty	Guides the cable-belt rope through the upper gantry rope path.
Location	Upper gantry - rear / north
Principal components	Single-groove sheave assembly. The visible KEW plate records 1900 mm sheave diameter, 45 mm rope diameter and manufacture date 02-2021.
Reference drawing / figure	URGN-001, URGN-004, URGN-005; UGGS-REF001
Inspection access state	Stopped / isolated state

15.2 Rear Gantry Guide Sheave South

Rear Gantry Guide Sheave South is located at Upper gantry - rear / south and performs the function of guiding the cable-belt rope through the upper gantry rope path. It is a single-groove sheave assembly fitted with a rope-groove liner, which forms the principal rope-contact surface. The visible plate records a 1,900 mm sheave diameter, 45 mm rope diameter, manufacture date 08-2008 and historical Samancor/Hotazel identification. Relevant evidence is referenced in URGs-001, URGs-003, URGs-004 and URGs-005.

Table 26 - Asset description summary - Rear Gantry Guide Sheave South

Field	Entry
Asset	Rear Gantry Guide Sheave South / URGs
Operational duty	Guides the cable-belt rope through the upper gantry rope path.
Location	Upper gantry - rear / south
Principal components	Single-groove sheave assembly fitted with a rope-groove liner forming the principal rope-contact surface. The visible plate records a 1,900 mm sheave diameter, 45 mm rope diameter, manufacture date 08-2008 and historical Samancor/Hotazel identification.
Reference drawing / figure	URGS-001, URGs-003, URGs-004, URGs-005; UGGS-REF001
Inspection access state	Stopped / isolated state

15.3 Front Gantry Guide Sheave North

Front Gantry Guide Sheave North is located at Upper gantry - front / north and performs the function of guiding the cable-belt rope through the upper gantry rope path. It is a single-groove guide sheave assembly. Historical ISS records identify the front sheave configuration as 3,658 mm diameter operating with a 45 mm rope, with a minimum groove depth of 117 mm and maximum groove depth of 142 mm. The historical records indicate casting by Thomas Foundries and machining/prefabrication by Eco Tech Engineering. No KEW-style identification/specification plate was recorded; the current visible identification marking is 10072-3 in UFGN-003. The historical dimensional and manufacturing information must be cross-referenced with the Wessels Mine records. Relevant evidence is referenced in UFGN-001, UFGN-002 and UFGN-003.

Table 27 - Asset description summary - Front Gantry Guide Sheave North

Field	Entry
Asset	Front Gantry Guide Sheave North / UFGN
Operational duty	Guides the cable-belt rope through the upper gantry rope path.
Location	Upper gantry - front / north
Principal components	Single-groove guide sheave assembly. Historical ISS record: 3,658 mm sheave diameter, 45 mm rope, groove depth 117 mm minimum / 142 mm maximum; cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. Visible identification marking 10072-3. Historical data requires mine validation.
Reference drawing / figure	UFGN-001, UFGN-002, UFGN-003; UGGS-REF001; historical ISS records
Inspection access state	Stopped / isolated state

15.4 Front Gantry Guide Sheave South

Front Gantry Guide Sheave South is located at Upper gantry - front / south and performs the function of guiding the cable-belt rope through the upper gantry rope path. It is a single-groove guide sheave assembly of the same type and configuration as the Front North sheave. Historical ISS records identify a 3,658 mm sheave diameter operating with a 45 mm rope, with a minimum groove depth of 117 mm and maximum groove depth of 142 mm. The historical records indicate casting by Thomas Foundries and machining/prefabrication by Eco Tech Engineering. No KEW-style identification/specification plate was recorded; the current visible identification marking is 10072-1 in UFGS-003. The historical dimensional and manufacturing information must be cross-referenced with the Wessels Mine records. Relevant evidence is referenced in UFGS-001, UFGS-002 and UFGS-003.

Table 28 - Asset description summary - Front Gantry Guide Sheave South

Field	Entry
Asset	Front Gantry Guide Sheave South / UFGS
Operational duty	Guides the cable-belt rope through the upper gantry rope path.
Location	Upper gantry - front / south
Principal components	Single-groove guide sheave assembly, same type/configuration as Front North. Historical ISS record: 3,658 mm sheave diameter, 45 mm rope, groove depth 117 mm minimum / 142 mm maximum; cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. Visible identification marking 10072-1. Historical data requires mine validation.
Reference drawing / figure	UFGS-001, UFGS-002, UFGS-003; UGGS-REF001; historical ISS records
Inspection access state	Stopped / isolated state

16 Inspection Findings

16.1 Rear Gantry Guide Sheave North

Defect Ref ID	DEF-001	Asset	Rear Gantry Guide Sheave North
Finding title	Recorded groove depth remains below photographed OEM maximum wear depth	Location	Rear / North rope groove

16.1.1 Asset Overview and General Condition

Rear Gantry Guide Sheave North | Rear / North rope groove | Overall condition: Good.

16.1.2 Inspection Observation

URGN-002 records a groove-depth reading of 0.097 m (97 mm). URGN-005 records nominal rope-groove depth A = 90 mm and maximum wear depth B = 120 mm. URGN-003 documents the groove/profile condition. The photographed groove surface appears continuous within the visible inspection area, with no gross localized material loss or open discontinuity evident in the supplied close-up.

Photo URGN-003 records approximately 1.5 mm of local groove-profile wear at position DEF-001-A. The OEM nameplate identifies a nominal 1,900 mm sheave operating with a 45 mm rope. The supplied photographs document the visible groove profile and rope-contact surface.

16.1.3 Rope Groove and Rim Condition

Recorded groove depth: 97 mm. This represents an approximately 7 mm increase from the photographed 90 mm nominal groove depth, leaving approximately 23 mm before the photographed OEM maximum wear depth of 120 mm is reached. The recorded depth therefore represents approximately 23.3% of the available 30 mm nominal-to-maximum depth allowance. Evidence: URGN-002 and URGN-003. Only one groove-depth measurement position is presently evidenced.

Approximately 1.5 mm of local groove-profile wear was recorded at position DEF-001-A. This represents approximately 3.3% of the nominal 45 mm rope diameter and is retained as a supplementary condition-monitoring value for future comparative trending. The recorded profile wear does not supersede the photographed OEM groove-depth criteria or the requirement to assess continued groove-profile conformity.

The OEM plate identifies a nominal sheave diameter of 1,900 mm operating with a 45 mm rope, giving a nominal sheave-to-rope diameter ratio of approximately 42.2:1.

Groove / rim condition: The visible groove profile remains generally uniform and serviceable, with no evident significant profile deformation, localized material loss or pronounced asymmetric side-wall wear within the photographed area.

16.1.4 Rope Tracking and Alignment

Rope tracking: The observed groove wear/contact pattern is generally symmetrical and consistent with normal rope tracking through the groove.

Rim condition: No evident pronounced asymmetric wear, abnormal side-wall loading or improper rope contact was identified within the visible inspection area.

Overall status: Good | Monitor | No immediate remedial action required.

16.1.5 Hub, Shaft and Bearing Housing

Only external contextual views were supplied. Internal bearing and shaft condition were not assessed and must not be inferred from the photographs.

16.1.6 Structural Components, Fasteners and Guards

No material structural defect was specifically identified from the available inspection evidence. The contextual photographs are not a substitute for a dedicated structural, fastener or NDT inspection.

16.1.7 Engineering Assessment

ENGINEERING INTERPRETATION

Based on the photographed KEW OEM plate, the nominal rope-groove depth is 90 mm, with a stated maximum wear depth of 120 mm, providing a total nominal-to-maximum depth allowance of 30 mm. The recorded groove-depth measurement of 97 mm is therefore approximately 7 mm deeper than the nominal profile, representing approximately 23.3% of the available 30 mm depth allowance. Approximately 23 mm, or 76.7% of the stated allowance, remains before the photographed 120 mm maximum depth is reached.

Separately, approximately **1.5 mm of local groove-profile wear** was recorded at position **DEF-001-A**. Relative to the nominal **45 mm rope diameter**, this corresponds to approximately **3.3% of the rope diameter**. This localized measurement is retained as a baseline condition indicator for future comparative trending and should not be interpreted as an independent discard criterion. Continued acceptance should be assessed against the applicable OEM groove-depth/profile requirements and the observed progression of wear at repeat inspections.

The OEM plate identifies a **1,900 mm sheave operating with a 45 mm steel wire rope**, giving a nominal sheave-to-rope diameter ratio of approximately **42.2:1**. This provides a relatively large rope-bending radius and does not, in itself, indicate an adverse rope-bending condition.

The photographed groove profile appears **generally continuous and symmetrical within the visible inspection area**. No evident gross localized material loss, open discontinuity, pronounced asymmetric side-wall wear or other visible indication of sustained abnormal rope contact was identified. The observed wear/contact pattern is therefore **consistent with normal rope tracking through the groove**; however, this should not be interpreted as confirmation of geometric alignment in the absence of a formal alignment survey or dynamic rope-tracking assessment.

On the evidence presently available, the **97 mm measured groove depth, approximately 1.5 mm recorded local profile wear and overall visual condition of the rope groove** indicate that the groove remains within the referenced operating condition. **No immediate groove re-machining, sheave replacement or other remedial intervention is indicated**. The condition may therefore reasonably be classified as **Good / Level 1 – Minor, with continued monitoring**.

The assessment remains subject to confirmation because the **97 mm groove-depth measurement represents only one evidenced circumferential position**, while the ~1.5 mm groove-profile wear measurement is similarly localized. Circumferential variation, groove eccentricity and full-profile conformity have therefore not been established. At future scheduled inspections, the **rope-groove depth and profile should be rechecked at repeatable indexed circumferential positions and the results trended against the current recorded baseline condition and applicable OEM limits**. Particular attention should be given to progression of groove wear, profile conformity and development of any asymmetric rope-contact pattern.

16.1.8 Defect Classification and Recommended Action

Table 29 - Finding classification and action - DEF-001

Defect Ref ID	Condition rating	Severity	Priority	Recommended action	Responsible discipline	Verification requirement
DEF-001	Good	Level 1 - Minor	P4	Repeat groove-depth readings at indexed circumferential positions using a documented datum and equipment ID. Trend results against the verified 120 mm maximum wear depth and record the profile-gauge identification/criterion.	Mechanical / inspection	Repeat measurements / verified criteria and close-out record

Photographic Evidence Sheet

Photo ID
URGN-002

Finding ID
DEF-001

Asset
Rear Gantry Guide Sheave North

Component / location
Rope groove / depth measurement

View / direction
Close-up / measurement

Date / time
18/07/2026

Caption
Rear North groove-depth measurement showing 0.097 m (97 mm).

Figure 2 - Rear Gantry Guide Sheave North evidence - URGN-002 / DEF-001

Table 30 - Photographic evidence assessment - URGN-002

Observation	Engineering assessment	Recommended action
Rear North groove-depth measurement showing 0.097 m (97 mm). Recorded measurement: 97 mm.	Using the photographed KEW plate as the reference, 97 mm is approximately 7 mm deeper than the 90 mm nominal groove depth. This represents about 23.3% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 23 mm before the 120 mm plate maximum. The recorded single reading is therefore below the photographed maximum wear depth. This is provisional because circumferential variation and profile-gauge conformance have not been established.	Repeat groove-depth readings at indexed circumferential positions using a documented datum and equipment ID. Trend results against the verified 120 mm maximum wear depth.

Photographic Evidence Sheet

**Photo ID**

URGN-003

Finding ID

DEF-001

Asset

Rear Gantry Guide Sheave North

Component / location

Rope groove / profile

View / direction

Close-up / groove profile

Date / time

18/07/2026

Caption

Rear North groove-profile/contact condition.

Figure 3 - Rear Gantry Guide Sheave North evidence - URGN-003 / DEF-001

Table 31 - Photographic evidence assessment - URGN-003

Observation	Engineering assessment	Recommended action
Rear North groove-profile/contact condition. Profile is visible against the groove profile; the notes record ~1.5 mm wear at position DEF-001-A.	The recorded ~1.5 mm local profile wear represents approximately 3.3% of the nominal 45 mm rope diameter and is retained as a baseline condition-monitoring value for future comparative trending. The photographed profile appears generally symmetrical, with no evident abnormal side-wall loading or gross profile deterioration in the visible area. When considered together with the 97 mm groove-depth measurement and the photographed OEM maximum depth of 120 mm, the available evidence indicates that the groove remains within the referenced operating limits. No immediate repair or re-machining is indicated. Continued monitoring using an identified groove/profile gauge and repeatable circumferential measurement positions is recommended to establish wear progression and confirm continued profile conformity.	Recheck the rope-groove profile at the next scheduled inspection and trend the results against the current recorded baseline to monitor wear progression and confirm continued profile conformity

16.2 Rear Gantry Guide Sheave South

Defect Ref ID	DEF-002	Asset	Rear Gantry Guide Sheave South
Finding title	Recorded groove depth remains below photographed OEM maximum wear depth; installed groove liner remains serviceable	Location	Rear / South rope groove

16.2.1 Asset Overview and General Condition

Rear Gantry Guide Sheave South | Rear / South rope groove | Overall condition: Good.

16.2.2 Inspection Observation

URGS-002 records a groove-depth reading of 0.096 m (96 mm). URGS-005 records nominal rope-groove depth A = 90 mm and maximum wear depth B = 120 mm. URGS-003 documents the groove/profile condition. URGS-004 records Mine: SAMANCOR and Shaft No.: HOTAZEL, while this inspection report concerns Wessels Mine.

Photo URGS-003 records approximately 1 mm of local liner/groove-profile wear at the base of the rope-contact profile. The Rear Gantry Guide Sheave South is fitted with a rope-groove liner, which was observed to be in good overall condition. The OEM nameplate identifies a 1,900 mm sheave operating with a 45 mm rope. The supplied photographs document the visible liner/profile and rope-contact condition.

16.2.3 Rope Groove and Rim Condition

Recorded groove depth: 96 mm. This represents an approximately **6 mm increase from the photographed 90 mm nominal groove depth**, leaving approximately **24 mm before the photographed OEM maximum wear depth of 120 mm is reached**. The recorded depth therefore represents approximately **20% of the available 30 mm nominal-to-maximum depth allowance**. Evidence: URGS-002 and URGS-003. Only one groove-depth measurement position is presently evidenced.

The Rear Gantry Guide Sheave South is fitted with a **rope-groove liner, which forms the principal rope-contact and wear surface**. The liner is visually assessed as being in **good overall condition**, with no evident gross deterioration, displacement or significant localized damage within the photographed area. Approximately **1 mm of local liner/groove-profile wear** was recorded at position DEF-002-A.

The recorded ~1 mm local liner/profile wear represents approximately **2.2% of the nominal 45 mm rope diameter**. This localized measurement is retained as a supplementary condition-monitoring value for future comparative trending and does not supersede the applicable OEM groove-depth requirements or assessment of the installed liner/profile condition.

The OEM plate identifies a nominal sheave diameter of **1,900 mm operating with a 45 mm rope**, giving a nominal sheave-to-rope diameter ratio of approximately **42.2:1**.

Liner / rim condition: The visible liner profile remains generally uniform and serviceable, with no evident abnormal side-wall loading, significant profile deformation or localized deterioration within the photographed area.

16.2.4 Rope Tracking and Alignment

Rope tracking: The observed wear pattern is generally symmetrical and consistent with normal rope tracking through the lined groove.

Liner / rim condition: No evident asymmetric wear pattern, abnormal side-wall loading or improper rope contact was identified within the visible inspection area.

Overall status: Good | Monitor | No immediate remedial action required.

16.2.5 Hub, Shaft and Bearing Housing

Only external contextual views were supplied. Internal bearing and shaft condition were not assessed and must not be inferred from the photographs.

16.2.6 Structural Components, Fasteners and Guards

No material structural defect was specifically identified from the available inspection evidence. The contextual photographs are not a substitute for a dedicated structural, fastener or NDT inspection.

16.2.7 Engineering Assessment

ENGINEERING INTERPRETATION

Based on the photographed KEW OEM plate, the nominal rope-groove depth is **90 mm**, with a stated maximum wear depth of **120 mm**, providing a total nominal-to-maximum depth allowance of **30 mm**. The recorded groove-depth measurement of **96 mm** is therefore approximately **6 mm deeper than the nominal profile**, representing approximately **20.0% of the available 30 mm depth allowance**. Approximately **24 mm, or 80.0% of the stated allowance, remains** before the photographed 120 mm maximum depth is reached.

An important distinction for the Rear Gantry Guide Sheave South is that the rope groove is fitted with a **liner, which forms the principal rope-contact and sacrificial wear surface**. The available photographic evidence indicates that the liner remains in **good overall condition**, with no evident gross deterioration, displacement, significant cracking, localized material loss or pronounced asymmetric wear visible in the inspected area. Accordingly, the observed rope-contact condition is principally interpreted as wear of the **liner profile rather than direct wear of the parent sheave groove surface**.

The profile assessment at position **DEF-002-A** records approximately **1 mm of local liner/groove-profile wear**. Relative to the nominal **45 mm rope diameter**, this corresponds to approximately **2.2% of the rope diameter**. This localized measurement is retained as a baseline condition indicator for future comparative trending and should not be interpreted as an independent discard criterion. Continued acceptance should be assessed against the applicable OEM groove-depth/profile requirements, liner condition and the observed progression of wear at repeat inspections.

The OEM plate identifies a 1,900 mm sheave operating with a 45 mm steel wire rope, giving a nominal sheave-to-rope diameter ratio of approximately 42.2:1. This provides a relatively large rope-bending radius and does not, in itself, indicate an adverse rope-bending condition.

The photographed liner and groove profile appear generally **continuous and symmetrical within the visible inspection area**. No evident pronounced one-sided wear pattern, abnormal side-wall contact or other visible indication of sustained rope side loading was identified. The observed condition is therefore consistent with the rope tracking normally through the lined groove.

On the evidence presently available, the **96 mm measured groove depth, approximately 1 mm recorded local liner wear, and overall visual condition of the installed liner** indicate that the rope groove remains in a serviceable condition. The liner continues to provide an effective rope-contact surface, and **no immediate liner replacement, groove re-machining or other remedial intervention is indicated**. The condition may therefore reasonably be classified as **Good / Level 1 – Minor, with continued monitoring**.

The assessment remains subject to confirmation because the **96 mm groove-depth measurement represents only one evidenced circumferential position**, while the ~1 mm liner-profile wear measurement is similarly localized. Full circumferential variation and liner-profile conformity have therefore not been established. At future scheduled inspections, the **liner and rope-groove profile should be rechecked at repeatable indexed circumferential positions and the results trended against the current recorded baseline condition**. Particular attention should be given to progression of liner wear, profile conformity, localized deterioration and any evidence of liner movement or asymmetric rope contact.

16.2.8 Defect Classification and Recommended Action

Table 32 - Finding classification and action - DEF-002

Defect Ref ID	Condition rating	Severity	Priority	Recommended action	Responsible discipline	Verification requirement
DEF-002	Good	Level 1 - Minor	P4	Repeat indexed groove-depth readings and trend against the verified 120 mm limit. Confirm the current asset identity in the Wessels register and retain the plates as traceability evidence. Record profile-gauge identification/criterion for future inspections.	Mechanical / inspection	Repeat measurements / verified criteria and close-out record

Photographic Evidence Sheet

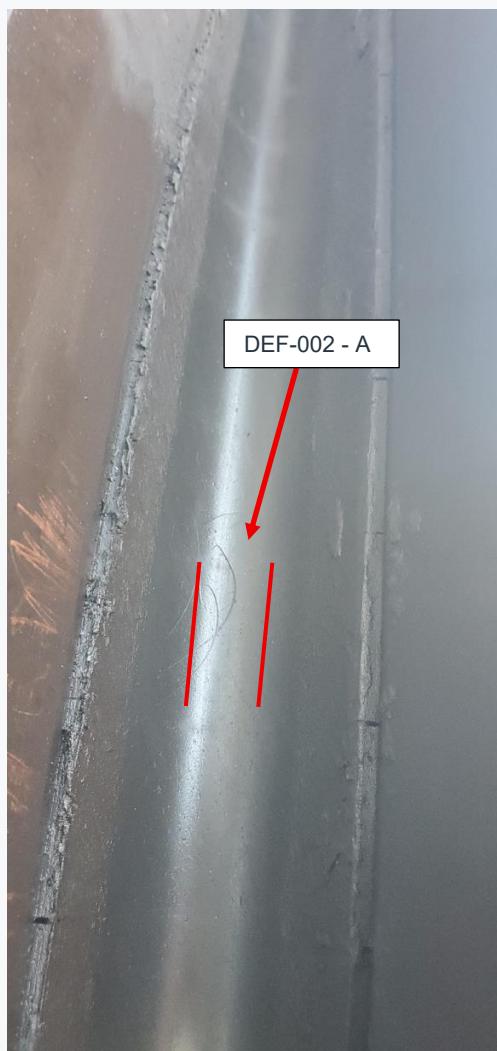
	Photo ID URGS-002 Finding ID DEF-002 Asset Rear Gantry Guide Sheave South Component / location Rope groove / depth measurement View / direction Close-up / measurement Date / time 18/07/2026 Caption Rear South groove-depth measurement showing 0.096 m (96 mm).
--	--

Figure 4 - Rear Gantry Guide Sheave South evidence - URGS-002 / DEF-002

Table 33 - Photographic evidence assessment - URGS-002

Observation	Engineering assessment	Recommended action
Rear South groove-depth measurement showing 0.096 m (96 mm). Recorded measurement: 96 mm.	Using the photographed KEW plate as the reference, 96 mm is approximately 6 mm deeper than the 90 mm nominal groove depth. This represents about 20.0% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 24 mm before the 120 mm plate maximum. The single recorded reading is below the recorded maximum wear depth.	Repeat indexed groove-depth readings and trend against the verified 120 mm limit. Confirm the current asset identity in the Wessels register and retain the plates as traceability evidence. Record profile-gauge identification/criterion for future inspections.

Photographic Evidence Sheet

**Photo ID**

URGS-003

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

Rope groove / profile

View / direction

Close-up / groove profile

Date / time

18/07/2026

Caption

Rear South groove-profile/contact condition.

Figure 5 - Rear Gantry Guide Sheave South evidence - URGS-003 / DEF-002

Table 34 - Photographic evidence assessment - URGS-003

Observation	Engineering assessment	Recommended action
Rear South rope-groove liner/profile condition. Approximately 1 mm of local wear was recorded at position DEF-002-A at the base of the rope-contact profile. The sheave is fitted with a rope-groove liner, which was observed to be in good overall condition, with no significant local damage or deterioration evident within the photographed area.	The approximately 1 mm of local wear recorded at DEF-002-A represents approximately 2.2% of the nominal 45 mm rope diameter and is retained as a baseline condition-monitoring value for future comparative trending. The installed rope-groove liner remains visually serviceable, with the photographed rope-contact profile appearing generally uniform and symmetrical. No significant localized material loss, liner displacement, abnormal side-wall wear or other visible indication of adverse rope contact was identified within the inspected area. When considered together with the separately recorded 96 mm groove-depth measurement, which remains below the photographed OEM maximum depth of 120 mm, the available evidence indicates that the lined rope groove remains within the referenced operating condition. No immediate liner replacement or other remedial intervention is indicated. Continued monitoring is recommended to establish the rate and pattern of liner wear over successive inspections.	Recheck the rope-groove liner/profile at the next scheduled inspection and trend the measured condition against the current ~1 mm wear baseline to monitor liner wear progression and continued profile conformity

16.3 Front Gantry Guide Sheave North

Defect Ref ID	DEF-003	Asset	Front Gantry Guide Sheave North
Finding title	Recorded groove depth remains below historical maximum; groove-base scoring requires monitoring	Location	Front / North rope groove

16.3.1 Asset Overview and General Condition

Front Gantry Guide Sheave North | Front / North rope groove | Overall condition: Good | Monitor. This rating is based on the recorded groove-depth value and visual groove-profile evidence; the historical dimensional reference remains subject to validation against Wessels Mine records.

16.3.2 Inspection Observation

UFGN-001 documents the Front North guide sheave in context, UFGN-002 records the groove/profile condition, and UFGN-003 records the visible sheave identification marking 10072-3. A groove-depth value of 121 mm was recorded for the Front North sheave.

Historical ISS records identify the front guide sheaves as the same type and configuration, with a 3,658 mm sheave diameter, 45 mm rope, minimum groove depth of 117 mm and maximum groove depth of 142 mm. The records indicate that the sheaves were cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. These historical details must be cross-referenced and validated against the Wessels Mine asset records.

The groove profile in UFGN-002 appears generally symmetrical with no evident abnormal side-wall loading within the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the principal rope-contact band.

16.3.3 Rope Groove and Rim Condition

Recorded groove depth: 121 mm. Relative to the historical minimum groove depth of 117 mm, this is approximately 4 mm deeper, leaving approximately 21 mm before the historical maximum depth of 142 mm is reached. The recorded depth therefore occupies approximately 16.0% of the 25 mm historical minimum-to-maximum depth range. The historical dimensional reference is derived from ISS records and remains subject to validation against the Wessels Mine records. Only one groove-depth reading is presently recorded for this sheave.

Based on the historical sheave diameter of 3,658 mm and the 45 mm rope, the nominal sheave-to-rope diameter ratio is approximately 81.3:1. This ratio is recorded as a geometric reference and does not supersede the requirement to validate the historical groove-depth criteria.

Groove / rim condition: The photographed groove profile appears generally symmetrical and serviceable, with no evident pronounced asymmetric side-wall loading or gross profile deformation. Pronounced longitudinal scoring is, however, visible along the base of the groove within the rope-contact zone. The depth and extent of this scoring were not quantified by the supplied evidence and should therefore be monitored for progression.

16.3.4 Rope Tracking and Alignment

Rope tracking: The visible groove contact/wear pattern is generally symmetrical and no evident abnormal side-wall loading is apparent in the supplied static photograph. This is consistent with generally centered rope contact through the groove but does not constitute confirmation of geometric alignment.

Alignment limitation: No formal alignment survey, dynamic rope-tracking observation or quantitative alignment reading was supplied. Geometric alignment therefore remains outside the verified scope.

Overall status: Good | Monitor | No immediate remedial action required. The groove-base scoring and dimensional condition should be trended at future scheduled inspections.

16.3.5 Hub, Shaft and Bearing Housing

Only external contextual views were supplied. Internal bearing and shaft condition were not assessed and must not be inferred from the photographs.

16.3.6 Structural Components, Fasteners and Guards

No material structural defect was specifically identified from the available inspection evidence. The contextual photographs are not a substitute for a dedicated structural, fastener or NDT inspection.

16.3.7 Corrosion, Coating and Housekeeping

General surface contamination and coating wear are visible in contextual photographs. No separate corrosion defect was quantified in the supplied notes.

16.3.8 Engineering Assessment

ENGINEERING INTERPRETATION

Historical ISS records identify the Front Gantry Guide Sheave North as a 3,658 mm diameter sheave operating with a 45 mm rope, with a minimum groove depth of 117 mm and maximum groove depth of 142 mm. The recorded groove-depth value of 121 mm is therefore approximately 4 mm deeper than the historical minimum and leaves approximately 21 mm before the historical maximum is reached. This represents approximately 16.0% of the 25 mm historical minimum-to-maximum depth range, with approximately 84.0% of that range remaining. These values are based on ISS historical records and must be cross-referenced and validated against the Wessels Mine asset records before being treated as confirmed acceptance criteria.

The Front North sheave does not carry the same KEW identification/specification plate arrangement as the rear guide sheaves. Historical records indicate that the front sheaves were cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. The current visible physical identification is the marking 10072-3 recorded in UFGN-003, which should be retained as traceability evidence and reconciled with the mine asset register.

Based on the historical 3,658 mm sheave diameter and 45 mm rope diameter, the nominal sheave-to-rope diameter ratio is approximately 81.3:1. This is a geometric reference only and does not replace verified OEM or client acceptance criteria.

The photographed groove profile appears generally symmetrical within the visible inspection area and no evident abnormal side-wall loading is apparent. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band. The supplied evidence does not quantify the depth of this scoring or establish its rate of progression; it should therefore be retained as a condition baseline and monitored at subsequent inspections.

On the evidence presently available, the 121 mm recorded groove depth remains below the historical 142 mm maximum, and the overall groove profile remains serviceable. No immediate groove re-machining or sheave replacement is indicated from the supplied evidence. The condition may therefore reasonably remain classified as Good / Level 1 - Minor, with continued monitoring; this classification remains conditional on validation of the historical dimensional basis against the Wessels Mine records.

At future scheduled inspections, the groove depth and profile should be rechecked at repeatable indexed circumferential positions using a documented datum and equipment identification. Results should be trended against the current 121 mm baseline and the validated dimensional criteria, with particular attention to progression of the groove-base scoring, profile conformity and development of any asymmetric contact pattern.

16.3.9 Defect Classification and Recommended Action

Table 35 - Finding classification and action - DEF-003

Defect Ref ID	Condition rating	Severity	Priority	Recommended action	Responsible discipline	Verification requirement
DEF-003	Good	Level 1 - Minor	P4	Cross-reference the stamped identification 10072-3 and the historical 3,658 mm / 117-142 mm groove data with the Wessels Mine asset records. At the next scheduled inspection, repeat groove-depth readings at indexed circumferential positions, recheck the groove profile, trend results against the current 121 mm baseline, and monitor progression of the groove-base scoring.	Mechanical / inspection	Mine record validation + indexed groove-depth/profile trend record

Photographic Evidence Sheet

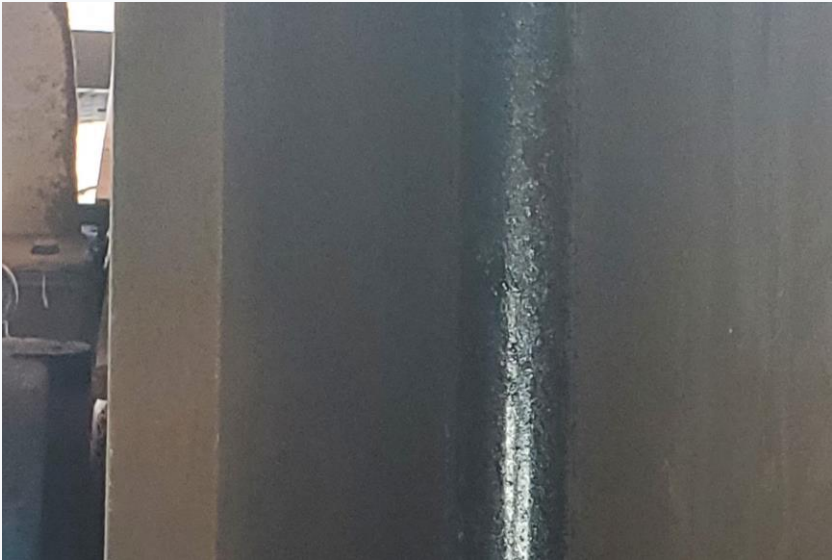
	Photo ID UFGN-002 Finding ID DEF-003 Asset Front Gantry Guide Sheave North Component / location Rope groove / profile View / direction Close-up / groove profile Date / time 18/07/2026 Caption Front North groove-profile/contact condition.
--	---

Figure 6 - Front Gantry Guide Sheave North evidence - UFGN-002 / DEF-003

Table 36 - Photographic evidence assessment - UFGN-002

Observation	Engineering assessment	Recommended action
Front North groove-profile/contact condition. The groove profile appears generally symmetrical with no evident abnormal side-wall loading in the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band.	The recorded groove depth of 121 mm is 4 mm deeper than the historical 117 mm minimum and remains approximately 21 mm below the historical 142 mm maximum. This occupies approximately 16.0% of the 25 mm historical minimum-to-maximum depth range. The dimensional comparison is provisional pending validation of the historical ISS record against Wessels Mine records. The generally symmetrical groove profile does not show evident abnormal side-wall loading; however, the pronounced scoring along the groove base represents localized surface deterioration within the primary rope-contact zone and should be monitored for progression. No immediate re-machining is indicated from the supplied evidence.	Recheck the groove depth and profile at the next scheduled inspection and trend the measured condition against the current 121 mm baseline. Monitor the groove-base scoring for progression and validate the historical 117/142 mm dimensional reference against the Wessels Mine records.

16.4 Front Gantry Guide Sheave South

Defect Ref ID	DEF-004	Asset	Front Gantry Guide Sheave South
Finding title	Recorded groove depth remains below historical maximum; groove-base scoring requires monitoring	Location	Front / South rope groove

16.4.1 Asset Overview and General Condition

Front Gantry Guide Sheave South | Front / South rope groove | Overall condition: Good | Monitor. This rating is based on the recorded groove-depth value and visual groove-profile evidence; the historical dimensional reference remains subject to validation against Wessels Mine records.

16.4.2 Inspection Observation

UFGS-001 documents the Front South guide sheave in context, UFGS-002 records the groove/profile condition, and UFGS-003 records the visible sheave identification marking 10072-1. A groove-depth value of 123 mm was recorded for the Front South sheave.

Historical ISS records identify the front guide sheaves as the same type and configuration, with a 3,658 mm sheave diameter, 45 mm rope, minimum groove depth of 117 mm and maximum groove depth of 142 mm. The records indicate that the sheaves were cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. These historical details must be cross-referenced and validated against the Wessels Mine asset records.

The groove profile in UFGS-002 appears generally symmetrical with no evident abnormal side-wall loading within the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the principal rope-contact band.

16.4.3 Rope Groove and Rim Condition

Recorded groove depth: 123 mm. Relative to the historical minimum groove depth of 117 mm, this is approximately 6 mm deeper, leaving approximately 19 mm before the historical maximum depth of 142 mm is reached. The recorded depth therefore occupies approximately 24.0% of the 25 mm historical minimum-to-maximum depth range. The historical dimensional reference is derived from ISS records and remains subject to validation against the Wessels Mine records. Only one groove-depth reading is presently recorded for this sheave.

Based on the historical sheave diameter of 3,658 mm and the 45 mm rope, the nominal sheave-to-rope diameter ratio is approximately 81.3:1. This ratio is recorded as a geometric reference and does not supersede the requirement to validate the historical groove-depth criteria.

Groove / rim condition: The photographed groove profile appears generally symmetrical and serviceable, with no evident pronounced asymmetric side-wall loading or gross profile deformation. Pronounced longitudinal scoring is, however, visible along the base of the groove within the rope-contact zone. The depth and extent of this scoring were not quantified by the supplied evidence and should therefore be monitored for progression.

16.4.4 Rope Tracking and Alignment

Rope tracking: The visible groove contact/wear pattern is generally symmetrical and no evident abnormal side-wall loading is apparent in the supplied static photograph. This is consistent with generally centered rope contact through the groove but does not constitute confirmation of geometric alignment.

Alignment limitation: No formal alignment survey, dynamic rope-tracking observation or quantitative alignment reading was supplied. Geometric alignment therefore remains outside the verified scope.

Overall status: Good | Monitor | No immediate remedial action required. The groove-base scoring and dimensional condition should be trended at future scheduled inspections.

16.4.5 Hub, Shaft and Bearing Housing

Only external contextual views were supplied. Internal bearing and shaft condition were not assessed and must not be inferred from the photographs.

16.4.6 Structural Components, Fasteners and Guards

No material structural defect was specifically identified from the available inspection evidence. The contextual photographs are not a substitute for a dedicated structural, fastener or NDT inspection.

16.4.7 Corrosion, Coating and Housekeeping

General surface contamination and coating wear are visible in contextual photographs. No separate corrosion defect was quantified in the supplied notes.

16.4.8 Engineering Assessment

ENGINEERING INTERPRETATION

Historical ISS records identify the Front Gantry Guide Sheave South as the same type and configuration as the Front North sheave: 3,658 mm diameter operating with a 45 mm rope, with a minimum groove depth of 117 mm and maximum groove depth of 142 mm. The recorded groove-depth value of 123 mm is therefore approximately 6 mm deeper than the historical minimum and leaves approximately 19 mm before the historical maximum is reached. This represents approximately 24.0% of the 25 mm historical minimum-to-maximum depth range, with approximately 76.0% of that range remaining. These values are based on ISS historical records and must be cross-referenced and validated against the Wessels Mine asset records before being treated as confirmed acceptance criteria.

The Front South sheave does not carry the same KEW identification/specification plate arrangement as the rear guide sheaves. Historical records indicate that the front sheaves were cast at Thomas Foundries and machined/prefabricated at Eco Tech Engineering. The current visible physical identification is the marking 10072-1 recorded in UFGS-003, which should be retained as traceability evidence and reconciled with the mine asset register.

Based on the historical 3,658 mm sheave diameter and 45 mm rope diameter, the nominal sheave-to-rope diameter ratio is approximately 81.3:1. This is a geometric reference only and does not replace verified OEM or client acceptance criteria.

The photographed groove profile appears generally symmetrical within the visible inspection area and no evident abnormal side-wall loading is apparent. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band. The supplied evidence does not quantify the depth of this scoring or establish its rate of progression; it should therefore be retained as a condition baseline and monitored at subsequent inspections.

On the evidence presently available, the 123 mm recorded groove depth remains below the historical 142 mm maximum, and the overall groove profile remains serviceable. No immediate groove re-machining or sheave replacement is indicated from the supplied evidence. The condition may therefore reasonably remain classified as Good / Level 1 - Minor, with continued monitoring; this classification remains conditional on validation of the historical dimensional basis against the Wessels Mine records.

At future scheduled inspections, the groove depth and profile should be rechecked at repeatable indexed circumferential positions using a documented datum and equipment identification. Results should be trended against the current 123 mm baseline and the validated dimensional criteria, with particular attention to progression of the groove-base scoring, profile conformity and development of any asymmetric contact pattern.

16.4.9 Defect Classification and Recommended Action

Table 37 - Finding classification and action - DEF-004

Defect Ref ID	Condition rating	Severity	Priority	Recommended action	Responsible discipline	Verification requirement
DEF-004	Good	Level 1 - Minor	P4	Cross-reference the stamped identification 10072-1 and the historical 3,658 mm / 117-142 mm groove data with the Wessels Mine asset records. At the next scheduled inspection, repeat groove-depth readings at indexed circumferential positions, recheck the groove profile, trend results against the current 123 mm baseline, and monitor progression of the groove-base scoring.	Mechanical / inspection	Mine record validation + indexed groove-depth/profile trend record

Photographic Evidence Sheet

	Photo ID UFGS-002 Finding ID DEF-004 Asset Front Gantry Guide Sheave South Component / location Rope groove / profile View / direction Close-up / groove profile Date / time 18/07/2026 Caption Front South groove-profile/contact condition.
---	---

Figure 7 - Front Gantry Guide Sheave South evidence - UFGS-002 / DEF-004

Table 38 - Photographic evidence assessment - UFGS-002

Observation	Engineering assessment	Recommended action
Front South groove-profile/contact condition. The groove profile appears generally symmetrical with no evident abnormal side-wall loading in the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band.	The recorded groove depth of 123 mm is 6 mm deeper than the historical 117 mm minimum and remains approximately 19 mm below the historical 142 mm maximum. This occupies approximately 24.0% of the 25 mm historical minimum-to-maximum depth range. The dimensional comparison is provisional pending validation of the historical ISS record against Wessels Mine records. The generally symmetrical groove profile does not show evident abnormal side-wall loading; however, the pronounced scoring along the groove base represents localized surface deterioration within the primary rope-contact zone and should be monitored for progression. No immediate re-machining is indicated from the supplied evidence.	Recheck the groove depth and profile at the next scheduled inspection and trend the measured condition against the current 123 mm baseline. Monitor the groove-base scoring for progression and validate the historical 117/142 mm dimensional reference against the Wessels Mine records.

17 Summary of Defects

Table 39 - Consolidated defect register

Defect Ref ID	Asset	Component / location	Defect / observation	Condition	Severity	Priority	Evidence	Responsible discipline	Status
DEF-001	Rear Guide Sheave North	Rear / North rope groove	97 mm depth; below 120 mm plate max.	Good	L1 Minor	P4	URGN-002, URGN-003	Mechanical	Open
DEF-002	Rear Guide Sheave South	Rear / South rope groove	96 mm depth; below 120 mm plate max.	Good	L1 Minor	P4	URGS-002, URGS-003	Mechanical	Open
DEF-003	Front Guide Sheave North	Front / North rope groove	121 mm depth; 21 mm below historical 142 mm max.; groove-base scoring; criterion pending mine validation.	Good	L1 Minor	P4	UFGN-002/003; notes	Mechanical	Open
DEF-004	Front Guide Sheave South	Front / South rope groove	123 mm depth; 19 mm below historical 142 mm max.; groove-base scoring; criterion pending mine validation.	Good	L1 Minor	P4	UFGS-002/003; notes	Mechanical	Open

18 Inspection Observation Log

Table 40 - Inspection observation and evidence log

Observation ID	Asset	Location	Observation	Evidence reference	Condition rating	Related Defect Ref ID	Status
OBS-001	Rear Guide Sheave North	Rear / North rope groove	97 mm groove depth recorded; plate nominal 90 mm / maximum wear 120 mm.	URGN-002, URGN-003	Good	DEF-001	Open
OBS-002	Rear Guide Sheave South	Rear / South rope groove	96 mm groove depth recorded; plate nominal 90 mm / maximum wear 120 mm; plate records Samancor/Hotazel.	URGS-002, URGS-003	Good	DEF-002	Open
OBS-003	Front Guide Sheave North	Front / North rope groove	121 mm depth; historical 117/142 mm reference; generally symmetrical profile with groove-base scoring; ID 10072-3.	UFGN-002/003; notes	Good	DEF-003	Open
OBS-004	Front Guide Sheave South	Front / South rope groove	123 mm depth; historical 117/142 mm reference; generally symmetrical profile with groove-base scoring; ID 10072-1.	UFGS-002/003; notes	Good	DEF-004	Open

19 Engineering Assessment

Based on the supplied inspection evidence, the four Upper Gantry Guide Sheaves remain in a serviceable condition within the verified scope of this inspection, with no immediate remedial intervention indicated. The principal condition-monitoring requirement is continued measurement and trending of the rope-groove depth, profile and visible wear characteristics against the current inspection baseline.

The Rear Gantry Guide Sheaves North and South remain below the maximum groove depth recorded on their photographed KEW specification plates. Rear North measured 97 mm, approximately 7 mm deeper than the 90 mm nominal groove depth and approximately 23 mm below the 120 mm maximum. Rear South measured 96 mm, approximately 6 mm deeper than nominal and approximately 24 mm below the photographed 120 mm maximum. These measurements represent approximately 23.3% and 20.0% respectively of the available 30 mm nominal-to-maximum depth allowance. As only one groove-depth reading is presently recorded for each sheave, circumferential wear variation has not been established.

The Rear North groove profile appears generally continuous and symmetrical within the visible inspection area, with approximately 1.5 mm of localized groove-profile wear recorded. The Rear South sheave is fitted with a rope-groove liner forming the principal rope-contact and sacrificial wear surface. Approximately 1 mm of localized liner/profile wear was recorded, and the liner remains visually serviceable with no evident gross deterioration, displacement, significant localized damage or pronounced asymmetric wear within the photographed area. The available rear-sheave evidence is therefore consistent with continued service subject to scheduled condition monitoring.

The rear-sheave groove/profile photographs provide qualitative condition evidence only. The profile-gauge identification and formal acceptance criterion were not supplied, and the photographed profile comparisons should therefore not be represented as certified dimensional conformance measurements. The profile condition should instead be retained as a baseline for repeatable comparative assessment and wear trending at subsequent inspections.

For the Front Gantry Guide Sheaves North and South, historical ISS records identify a common 3,658 mm sheave / 45 mm rope configuration, with historical groove-depth references of 117 mm minimum and 142 mm maximum. Recorded groove-depth values are 121 mm for Front North and 123 mm for Front South, leaving approximately 21 mm and 19 mm respectively before the historical 142 mm maximum. These values occupy approximately 16.0% and 24.0% respectively of the historical 25 mm minimum-to-maximum depth range.

The front groove profiles appear generally symmetrical, with no evident pronounced asymmetric side-wall loading within the photographed areas. However, pronounced longitudinal scoring is visible along the base of both grooves within the principal rope-contact zone. The depth and progression rate of this scoring have not yet been established. The current inspection should therefore be retained as the baseline against which subsequent groove-depth, profile and scoring measurements are compared.

The Front North and Front South sheaves are physically identified by visible markings 10072-3 and 10072-1 respectively. The associated dimensional, manufacturing and identification information is derived from historical ISS records rather than currently available OEM specification plates. These records should therefore be cross-referenced and validated against the Wessels Mine asset records before the historical dimensional values are treated as confirmed acceptance criteria.

The difference in observed condition supports different initial monitoring intervals for the rear and front sheaves. The rear sheaves are presently assessed as being in good and serviceable condition and are suitable for repeat inspection at six months from the current inspection to establish their next groove-depth and profile trend point. The front sheaves remain serviceable but, due to the visible groove-base scoring and the presently unknown rate of progression, warrant an initial three-month repeat inspection. The results of that inspection should be used to establish the rate of change and determine whether the subsequent monitoring interval can reasonably be extended.

No NDT, internal bearing or shaft examination, dynamic rope-tracking observation or formal alignment survey formed part of the verified inspection evidence. No conclusion regarding those conditions should therefore be inferred from this assessment.

20 Recommendations

Based on the observed condition and engineering assessment, no immediate remedial intervention is recommended for any of the four Upper Gantry Guide Sheaves. The principal follow-up action is structured condition monitoring using repeatable groove-depth and groove-profile measurements so that the current inspection establishes a controlled baseline for future wear trending.

Rear guide sheaves - six-month follow-up: The Rear Gantry Guide Sheaves North and South are presently assessed as being in good, serviceable condition. They should be re-inspected six months from the 18 July 2026 inspection (target date 18 January 2027). The follow-up inspection should repeat groove-depth and groove-profile measurements at repeatable indexed circumferential positions using a documented datum and identified equipment/profile gauge. Results should be trended against the current 97 mm Rear North and 96 mm Rear South groove-depth baselines, together with the recorded profile condition and the Rear South liner condition.

Front guide sheaves - initial three-month follow-up: The Front Gantry Guide Sheaves North and South remain serviceable, but the pronounced longitudinal scoring visible along the groove base warrants a shorter initial monitoring interval. Both front sheaves should therefore be re-inspected three months from the 18 July 2026 inspection (target date 18 October 2026). Groove depth, groove profile and groove-base scoring should be re-recorded at repeatable indexed positions and compared with the current 121 mm Front North and 123 mm Front South baselines. The stamped identification and historical 117/142 mm dimensional basis should also be cross-referenced with the Wessels Mine asset records.

Subsequent inspection interval: Following the three-month front-sheave re-inspection, the responsible engineer should evaluate the measured change in groove depth, groove-profile conformity and the extent of groove-base scoring. If the condition remains stable and no accelerated deterioration or adverse contact pattern is identified, the monitoring interval may be extended to six months or another approved longer interval, potentially up to twelve months where supported by subsequent trend data and the mine's maintenance/risk strategy. If measurable progression is identified, the shorter interval should be retained or reduced as appropriate and the need for remedial intervention reassessed.

Table 41 - Detailed recommendation and action register

Action ID	Related Defect Ref ID	Asset	Recommendation	Priority	Responsible discipline	Target / shutdown	Verification requirement	Close-out evidence	Status
REC-001	DEF-001	Rear North	6-month re-inspection; repeat indexed depth/profile checks and trend the 97 mm baseline to the verified 120 mm maximum.	P4	Mech.	18/01/2027	Depth/profile log	Photos + log	Open
REC-002	DEF-002	Rear South	6-month re-inspection; repeat indexed depth/liner-profile checks, trend the 96 mm baseline, and verify Wessels asset identity.	P4	Mech.	18/01/2027	ID + trend log	Photos + log	Open
REC-003	DEF-003	Front North	3-month re-inspection; repeat indexed depth/profile checks, trend the 121 mm baseline and base scoring, validate historical criterion, then review interval.	P4	Mech.	18/10/2026	Mine + trend log	Trend review	Open
REC-004	DEF-004	Front South	3-month re-inspection; repeat indexed depth/profile checks, trend the 123 mm baseline and base scoring, validate historical criterion, then review interval.	P4	Mech.	18/10/2026	Mine + trend log	Trend review	Open

21 Conclusion

The Upper Gantry Guide Sheave inspection covered four assets: Rear North, Rear South, Front North and Front South. The photographed manufacturer data and depth readings indicate that the two rear guide sheaves remain below the recorded 120 mm maximum groove depth: Rear North measured 97 mm and Rear South 96 mm, leaving approximately 23 mm and 24 mm respectively to that photographed limit when compared with the 90 mm nominal depth.

The front guide sheaves are supported by recorded groove-depth values and supplementary identification evidence. Front North measured 121 mm and carries visible identification 10072-3; Front South measured 123 mm and carries visible identification 10072-1. Against the historical ISS record of 117 mm minimum and 142 mm maximum groove depth, these readings leave approximately 21 mm and 19 mm respectively to the historical maximum. Both groove profiles appear generally symmetrical with no evident abnormal side-wall loading, but pronounced scoring is visible along the groove base and should be trended. The historical front-sheave dimensions, manufacturing information and identification mapping must be cross-referenced with the Wessels Mine records before being treated as verified asset/OEM acceptance data.


The recommended monitoring intervals reflect the difference in observed condition between the rear and front sheaves. Rear North and Rear South should be re-inspected six months from the last inspection. Front North and Front South should receive an initial three-month follow-up because of the groove-base scoring, after which the inspection interval should be reviewed against the measured wear/profile trend and extended only where the recorded condition supports it.

No conclusion is made regarding internal bearing/shaft condition, NDT status, dynamic alignment or fitness for continued operation beyond the supplied evidence. Final maintenance and operational decisions remain with the responsible site authority following technical review and closure of the outstanding verification items.

22 Technical Review and Report Issue Sign-off

This sign-off confirms technical review and issue of the report; it does not transfer the client's responsibility for site risk assessment, operational decisions or implementation of corrective actions.

Table 42 - Technical review and issue sign-off

Role	Name	Title / discipline	Review status	Date	Signature
Prepared by	Brendan Wood	Projects / Systems	Report preparation	05/08/2026	
Technical reviewer	Kevin Wood	Managing Engineer	Review Complete.	10/08/2026	
Approved for issue	Kevin Wood	Managing Engineer	Approval	11/08/2026	

SECTION D

APPENDICES &
EVIDENCE

Photographic records, checklists, measurements, NDT, drawings and supporting documentation.



Appendix A - Photographic Register

Table 43 - Photographic register

Photo ID	Asset	Component / location	View direction	Description / observation	Related Defect Ref ID	Date / time	File name / source	Report page
URGN-001	Rear Gantry Guide Sheave North	General sheave	Context view	Overview of rear north guide sheave	DEF-001	18/07/2026	URGN-001-Rear Guide Sheave Context View.jpg	Appendix A
URGN-002	Rear Gantry Guide Sheave North	Rope groove	Depth measurement	0.097 m / 97 mm groove-depth reading	DEF-001	18/07/2026	URGN-002-Rear Guide Sheave Noth Groove Depth Measurement 97mm.jpg	Appendix A
URGN-003	Rear Gantry Guide Sheave North	Rope groove	Profile close-up	Rear north groove-profile/contact condition	DEF-001	18/07/2026	URGN-003-Rear Guide Sheave Noth Groove Profile.jpg	Appendix A
URGN-004	Rear Gantry Guide Sheave North	Identification plate	Close-up	KEW identification plate	DEF-001	18/07/2026	URGN-004-Rear Guide Sheave Noth Identification Plate.jpg	Appendix A
URGN-005	Rear Gantry Guide Sheave North	Specification plate	Close-up	KEW groove specification : A=90 mm, B=120 mm	DEF-001	18/07/2026	URGN-005-Rear Guide Sheave Noth Specification Plate.jpg	Appendix A
URGS-001	Rear Gantry Guide Sheave South	General sheave	Context view	Overview of rear south guide sheave	DEF-002	18/07/2026	URGS-001-Rear Guide Sheave South Context View.jpg	Appendix A
URGS-002	Rear Gantry Guide Sheave South	Rope groove	Depth measurement	0.096 m / 96 mm groove-depth reading	DEF-002	18/07/2026	URGS-002-Rear Guide Sheave South Groove Depth Measurement	Appendix A

Photo ID	Asset	Component / location	View direction	Description / observation	Related Defect Ref ID	Date / time	File name / source	Report page
							nt 96 mm.jpg	
URGS-003	Rear Gantry Guide Sheave South	Rope groove	Profile close-up	Rear south groove-profile/contact condition	DEF-002	18/07/2026	URGS-003-Rear Guide Sheave South Groove Profile.jpg	Appendix A
URGS-004	Rear Gantry Guide Sheave South	Identification plate	Close-up	KEW identification plate; records Samancor / Hotazel	DEF-002	18/07/2026	URGS-004-Rear Guide Sheave South Identification Plate.jpg	Appendix A
URGS-005	Rear Gantry Guide Sheave South	Specification plate	Close-up	KEW groove specification : A=90 mm, B=120 mm	DEF-002	18/07/2026	URGS-005-Rear Guide Sheave South Specification Plate.jpg	Appendix A
UFGN-001	Front Gantry Guide Sheave North	General sheave	Context view	Overview of front north guide sheave	DEF-003	18/07/2026	UFGN-001-Front Guide Sheave North Context View.jpg	Appendix A
UFGN-002	Front Gantry Guide Sheave North	Rope groove	Profile close-up	Front north groove-profile/contact condition	DEF-003	18/07/2026	UFGN-002-Front Guide Sheave North Groove Profile.jpg	Appendix A
UFGS-001	Front Gantry Guide Sheave South	General sheave	Context view	Overview of front south guide sheave	DEF-004	18/07/2026	UFGS-001-Front Guide Sheave South Context View.jpg	Appendix A
UFGS-002	Front Gantry Guide Sheave South	Rope groove	Profile close-up	Front south groove-profile/contact condition	DEF-004	18/07/2026	UFGS-002-Front Guide Sheave South Groove Profile.jpg	Appendix A
UFGN-003	Front Gantry Guide Sheave North	Identification marking	Close-up	Visible sheave identification marking 10072-3	DEF-003	18/07/2026	UFGN-003-Front Guide Sheave North Identification .png	Appendix A
UFGS-003	Front Gantry Guide Sheave South	Identification marking	Close-up	Visible sheave identification marking 10072-1	DEF-004	18/07/2026	UFGS-003-Front Guide Sheave South Identification .jpg	Appendix A

The following evidence sheets reproduce all photographs supplied for this report compilation. Images used in Section 16 are intentionally repeated here to preserve a complete photographic record.

Photographic Evidence Sheet



Photo ID
URGN-001

Finding ID
DEF-001

Asset
Rear Gantry Guide Sheave North

Component / location
General sheave

View / direction
Context view

Date / time
18/07/2026

Caption
Overview of rear north guide sheave

Figure 8 - Rear Gantry Guide Sheave North evidence - URGN-001 / DEF-001

Table 44 - Photographic evidence assessment - URGN-001

Observation	Engineering assessment	Recommended action
Overview of rear north guide sheave	Context view confirms the visible sheave arrangement and general inspection context only; it does not establish internal component condition or dimensional acceptance.	Retain as contextual evidence and correlate with detailed groove/profile evidence.

Photographic Evidence Sheet

**Photo ID**

URGN-002

Finding ID

DEF-001

Asset

Rear Gantry Guide Sheave North

Component / location

Rope groove

View / direction

Depth measurement

Date / time

18/07/2026

Caption

0.097 m / 97 mm groove-depth reading

Figure 9 - Rear Gantry Guide Sheave North evidence - URGN-002 / DEF-001

Table 45 - Photographic evidence assessment - URGN-002

Observation	Engineering assessment	Recommended action
0.097 m / 97 mm groove-depth reading	Using the photographed KEW plate as the reference, 97 mm is approximately 7 mm deeper than the 90 mm nominal groove depth. This represents about 23.3% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 23 mm before the 120 mm plate maximum. The recorded single reading is therefore below the photographed maximum wear depth. This is provisional because circumferential variation and profile-gauge conformance have not been established.	Repeat groove-depth readings at indexed circumferential positions using a documented datum and equipment ID. Trend results against the verified 120 mm maximum wear depth and record the profile-gauge identification/criterion.

Photographic Evidence Sheet

**Photo ID**

URGN-003

Finding ID

DEF-001

Asset

Rear Gantry Guide Sheave North

Component / location

Rope groove

View / direction

Profile close-up

Date / time

18/07/2026

Caption

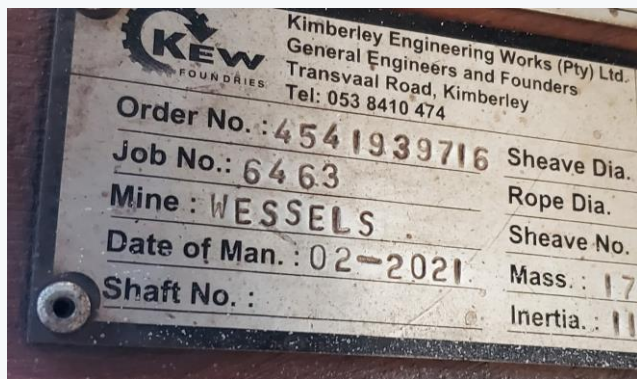
Rear north groove-profile/contact condition

Figure 10 - Rear Gantry Guide Sheave North evidence - URGN-003 / DEF-001

Table 46 - Photographic evidence assessment - URGN-003

Observation	Engineering assessment	Recommended action
Rear north groove-profile/contact condition	Using the photographed KEW plate as the reference, 97 mm is approximately 7 mm deeper than the 90 mm nominal groove depth. This represents about 23.3% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 23 mm before the 120 mm plate maximum. The recorded single reading is therefore below the photographed maximum wear depth. This is provisional because circumferential variation and profile-gauge conformance have not been established.	Repeat groove-depth readings at indexed circumferential positions using a documented datum and equipment ID. Trend results against the verified 120 mm maximum wear depth and record the profile-gauge identification/criterion.

Photographic Evidence Sheet

**Photo ID**

URGN-004

Finding ID

DEF-001

Asset

Rear Gantry Guide Sheave North

Component / location

Identification plate

View / direction

Close-up

Date / time

18/07/2026

Caption

KEW identification plate

Figure 11 - Rear Gantry Guide Sheave North evidence - URGN-004 / DEF-001

Table 47 - Photographic evidence assessment - URGN-004

Observation	Engineering assessment	Recommended action
KEW identification plate	Identification information is legible and has been transferred to the asset data sheet. It should be reconciled with the current Wessels asset register as part of the asset-record verification process.	Retain the plate photograph in the controlled asset record and verify the current asset identity/location.

Photographic Evidence Sheet

**Photo ID**

URGN-005

Finding ID

DEF-001

Asset

Rear Gantry Guide Sheave North

Component / location

Specification plate

View / direction

Close-up

Date / time

18/07/2026

Caption

KEW groove specification: A=90 mm, B=120 mm

Figure 12 - Rear Gantry Guide Sheave North evidence - URG-005 / DEF-001

Table 48 - Photographic evidence assessment - URG-005

Observation	Engineering assessment	Recommended action
KEW groove specification: A=90 mm, B=120 mm	The plate provides the photographed manufacturer groove-depth reference used for the rear-sheave groove-depth comparison.	Retain as the reference basis unless superseded by a verified OEM drawing or client criterion.

Photographic Evidence Sheet

**Photo ID**

URGS-001

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

General sheave

View / direction

Context view

Date / time

18/07/2026

Caption

Overview of rear south guide sheave

Figure 13 - Rear Gantry Guide Sheave South evidence - URGS-001 / DEF-002

Table 49 - Photographic evidence assessment - URGS-001

Observation	Engineering assessment	Recommended action
Overview of rear south guide sheave	Context view confirms the visible sheave arrangement and general inspection context only; it does not establish internal component condition or dimensional acceptance.	Retain as contextual evidence and correlate with detailed groove/profile evidence.

Photographic Evidence Sheet

**Photo ID**

URGS-002

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

Rope groove

View / direction

Depth measurement

Date / time

18/07/2026

Caption

0.096 m / 96 mm groove-depth reading

Figure 14 - Rear Gantry Guide Sheave South evidence - URGS-002 / DEF-002

Table 50 - Photographic evidence assessment - URGS-002

Observation	Engineering assessment	Recommended action
0.096 m / 96 mm groove-depth reading	Using the photographed KEW plate as the reference, 96 mm is approximately 6 mm deeper than the 90 mm nominal groove depth. This represents about 20.0% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 24 mm before the 120 mm plate maximum. The single recorded reading is below the photographed maximum wear depth. The historical Samancor/Hotazel identification should be reconciled with the current Wessels asset register as part of the asset-identity verification process.	Repeat indexed groove-depth readings and trend against the verified 120 mm limit. Confirm the current asset identity in the Wessels register and retain the plates as traceability evidence. Record profile-gauge identification/criterion for future inspections.

Photographic Evidence Sheet

**Photo ID**

URGS-003

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

Rope groove

View / direction

Profile close-up

Date / time

18/07/2026

Caption

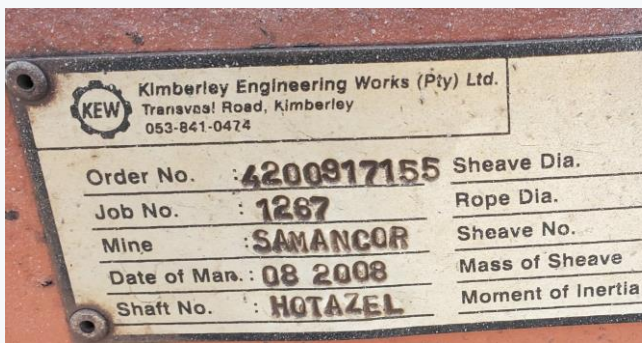
Rear south groove-profile/contact condition

Figure 15 - Rear Gantry Guide Sheave South evidence - URGS-003 / DEF-002

Table 51 - Photographic evidence assessment - URGS-003

Observation	Engineering assessment	Recommended action
Rear south groove-profile/contact condition	Using the photographed KEW plate as the reference, 96 mm is approximately 6 mm deeper than the 90 mm nominal groove depth. This represents about 20.0% of the 30 mm nominal-to-maximum depth allowance and leaves approximately 24 mm before the 120 mm plate maximum. The single recorded reading is below the photographed maximum wear depth.	Repeat indexed groove-depth readings and trend against the verified 120 mm limit. Confirm the current asset identity in the Wessels register and retain the plates as traceability evidence. Record profile-gauge identification/criterion for future inspections.

Photographic Evidence Sheet

**Photo ID**

URGS-004

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

Identification plate

View / direction

Close-up

Date / time

18/07/2026

Caption

KEW identification plate; records Samancor / Hotazel

Figure 16 - Rear Gantry Guide Sheave South evidence - URGS-004 / DEF-002

Table 52 - Photographic evidence assessment - URGS-004

Observation	Engineering assessment	Recommended action
KEW identification plate; records Samancor / Hotazel	Identification information is legible and has been transferred to the asset data sheet. It should be reconciled with the current Wessels asset register as part of the asset-record verification process.	Retain the plate photograph in the controlled asset record and verify the current asset identity/location.

Photographic Evidence Sheet

**Photo ID**

URGS-005

Finding ID

DEF-002

Asset

Rear Gantry Guide Sheave South

Component / location

Specification plate

View / direction

Close-up

Date / time

18/07/2026

Caption

KEW groove specification: A=90 mm, B=120 mm

Figure 17 - Rear Gantry Guide Sheave South evidence - URGS-005 / DEF-002

Table 53 - Photographic evidence assessment - URGS-005

Observation	Engineering assessment	Recommended action
KEW groove specification: A=90 mm, B=120 mm	The plate provides the photographed manufacturer groove-depth reference used for the rear-sheave groove-depth comparison.	Retain as the reference basis unless superseded by a verified OEM drawing or client criterion.

Photographic Evidence Sheet

**Photo ID**

UFGN-001

Finding ID

DEF-003

Asset

Front Gantry Guide Sheave North

Component / location

General sheave

View / direction

Context view

Date / time

18/07/2026

Caption

Overview of front north guide sheave

Figure 18 - Front Gantry Guide Sheave North evidence - UFGN-001 / DEF-003

Table 54 - Photographic evidence assessment - UFGN-001

Observation	Engineering assessment	Recommended action
Overview of front north guide sheave	Context view confirms the visible sheave arrangement and general inspection context only; it does not establish internal component condition or dimensional acceptance.	Retain as contextual evidence and correlate with detailed groove/profile evidence.

Photographic Evidence Sheet

	Photo ID UFGN-002 Finding ID DEF-003 Asset Front Gantry Guide Sheave North Component / location Rope groove View / direction Profile close-up Date / time 18/07/2026 Caption Front north groove-profile/contact condition
---	---

Figure 19 - Front Gantry Guide Sheave North evidence - UFGN-002 / DEF-003

Table 55 - Photographic evidence assessment - UFGN-002

Observation	Engineering assessment	Recommended action
Front North groove-profile/contact condition. The groove profile appears generally symmetrical with no evident abnormal side-wall loading in the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band.	The recorded groove depth of 121 mm is 4 mm deeper than the historical 117 mm minimum and remains approximately 21 mm below the historical 142 mm maximum. This occupies approximately 16.0% of the 25 mm historical minimum-to-maximum depth range. The dimensional comparison is provisional pending validation of the historical ISS record against Wessels Mine records. The generally symmetrical groove profile does not show evident abnormal side-wall loading; however, the pronounced scoring along the groove base represents localized surface deterioration within the primary rope-contact zone and should be monitored for progression. No immediate re-machining is indicated from the supplied evidence.	Recheck the groove depth and profile at the next scheduled inspection and trend the measured condition against the current 121 mm baseline. Monitor the groove-base scoring for progression and validate the historical 117/142 mm dimensional reference against the Wessels Mine records.

Photographic Evidence Sheet



Photo ID
UFGS-001

Finding ID
DEF-004

Asset
Front Gantry Guide Sheave South

Component / location
General sheave

View / direction
Context view

Date / time
18/07/2026

Caption
Overview of front south guide sheave

Figure 20 - Front Gantry Guide Sheave South evidence - UFGS-001 / DEF-004

Table 56 - Photographic evidence assessment - UFGS-001

Observation	Engineering assessment	Recommended action
Overview of front south guide sheave	Context view confirms the visible sheave arrangement and general inspection context only; it does not establish internal component condition or dimensional acceptance.	Retain as contextual evidence and correlate with detailed groove/profile evidence.

Photographic Evidence Sheet

**Photo ID**

UFGS-002

Finding ID

DEF-004

Asset

Front Gantry Guide Sheave South

Component / location

Rope groove

View / direction

Profile close-up

Date / time

18/07/2026

Caption

Front south groove-profile/contact condition

Figure 21 - Front Gantry Guide Sheave South evidence - UFGS-002 / DEF-004

Table 57 - Photographic evidence assessment - UFGS-002

Observation	Engineering assessment	Recommended action
Front South groove-profile/contact condition. The groove profile appears generally symmetrical with no evident abnormal side-wall loading in the photographed area. Pronounced longitudinal scoring is visible along the base of the groove within the rope-contact band.	The recorded groove depth of 123 mm is 6 mm deeper than the historical 117 mm minimum and remains approximately 19 mm below the historical 142 mm maximum. This occupies approximately 24.0% of the 25 mm historical minimum-to-maximum depth range. The dimensional comparison is provisional pending validation of the historical ISS record against Wessels Mine records. The generally symmetrical groove profile does not show evident abnormal side-wall loading; however, the pronounced scoring along the groove base represents localized surface deterioration within the primary rope-contact zone and should be monitored for progression. No immediate re-machining is indicated from the supplied evidence.	Recheck the groove depth and profile at the next scheduled inspection and trend the measured condition against the current 123 mm baseline. Monitor the groove-base scoring for progression and validate the historical 117/142 mm dimensional reference against the Wessels Mine records.

Photographic Evidence Sheet

**Photo ID**

UFGN-003

Finding ID

DEF-003

Asset

Front Gantry Guide Sheave North

Component / location

Identification marking

View / direction

Close-up

Date / time

18/07/2026

Caption

Front Gantry Guide Sheave North visible identification marking 10072-3

Figure 22 - Front Gantry Guide Sheave North identification evidence - UFGN-003 / DEF-003

Table 58 - Photographic evidence assessment - UFGN-003

Observation	Engineering assessment	Recommended action
Visible identification marking 10072-3 recorded on the Front Gantry Guide Sheave North.	The marking provides physical identification/traceability evidence for the inspected sheave. It is not an OEM specification plate and does not independently establish dimensional acceptance criteria. Historical ISS records associate the front sheave configuration with a 3,658 mm diameter, 45 mm rope and 117/142 mm groove-depth reference; this association must be validated against the Wessels Mine asset records.	Retain the photograph in the controlled asset record and cross-reference identification 10072-3 with the Wessels Mine asset register and historical sheave documentation.

Photographic Evidence Sheet

**Photo ID**

UFGS-003

Finding ID

DEF-004

Asset

Front Gantry Guide Sheave South

Component / location

Identification marking

View / direction

Close-up

Date / time

18/07/2026

Caption

Front Gantry Guide Sheave South visible identification marking 10072-1

Figure 23 - Front Gantry Guide Sheave South identification evidence - UFGS-003 / DEF-004

Table 59 - Photographic evidence assessment - UFGS-003

Observation	Engineering assessment	Recommended action
Visible identification marking 10072-1 recorded on the Front Gantry Guide Sheave South.	The marking provides physical identification/traceability evidence for the inspected sheave. It is not an OEM specification plate and does not independently establish dimensional acceptance criteria. Historical ISS records associate the front sheave configuration with a 3,658 mm diameter, 45 mm rope and 117/142 mm groove-depth reference; this association must be validated against the Wessels Mine asset records.	Retain the photograph in the controlled asset record and cross-reference identification 10072-1 with the Wessels Mine asset register and historical sheave documentation.

Appendix B - Inspection Checklist

Table 60 - Upper gantry guide sheave inspection checklist

Item	Inspection check	Result	Observation / limitation	Evidence reference	Related Defect Ref ID
1	Asset identification confirmed	Partial / historical cross-check required	Rear KEW plates recorded. Front stamped identification markings 10072-3 (North) and 10072-1 (South) are recorded; historical configuration data requires validation against mine records.	URGN-004/005; URGs-004/005; UFGN-003; UFGS-003	DEF-003 / DEF-004
2	Rope groove and rim condition examined	Evidence recorded	All four groove surfaces photographed. Rear depth readings are photographically evidenced; front depth values of 121 mm and 123 mm are supplied in the compilation notes.	URGN-002/003; URGs-002/003; UFGN-002; UFGS-002; compilation notes	DEF-001 to DEF-004
3	Rope tracking and alignment indicators examined	Not verified	No alignment survey or operating tracking evidence supplied.	LIM-001	
4	Hub, shaft and bearing housing externally examined	Partial	Context photos supplied; no internal examination.	URGN-001; URGs-001; UFGN-001; UFGS-001	
5	Structural supports, fasteners and guards examined	Partial	No dedicated structural/fastener evidence supplied.	Context photographs	
6	Corrosion, coating and housekeeping assessed	Partial	General contamination/coating condition visible; no separate quantified defect.	Context photographs	

Appendix C - Measurements and Dimensional Records

Table 61 - Measurements and dimensional records

Measurement ID	Asset	Location / feature	Instrument / equipment ID	Measured value	Unit	Reference / criterion	Deviation	Comment
MEAS-001	Rear Guide Sheave North	Rope groove depth	Bosch PLR 50 / equipment ID 00974174 6; steel-rule reference / ID N/A	97	mm	Plate nominal 90 mm; max 120 mm	+7 mm from nominal; 23 mm to max	Single photograph had reading; ~23.3% of 30 mm allowance.

Measurement ID	Asset	Location / feature	Instrument / equipment ID	Measured value	Unit	Reference / criterion	Deviation	Comment
MEAS-002	Rear Guide Sheave South	Rope groove depth	Bosch PLR 50 / equipment ID 009741746; steel-rule reference / ID N/A	96	mm	Plate nominal 90 mm; max 120 mm	+6 mm from nominal; 24 mm to max	Single photographed reading; ~20.0% of 30 mm allowance.
MEAS-003	Front Guide Sheave North	Rope groove depth	Instrument / equipment ID not recorded in supplied notes	121	mm	Historical ISS record: minimum 117 mm; maximum 142 mm - validate with mine records	+4 mm from historical minimum; 21 mm to historical maximum	Single recorded reading; approximately 16.0% of the 25 mm historical minimum-to-maximum range. Criterion pending mine validation.
MEAS-004	Front Guide Sheave South	Rope groove depth	Instrument / equipment ID not recorded in supplied notes	123	mm	Historical ISS record: minimum 117 mm; maximum 142 mm - validate with mine records	+6 mm from historical minimum; 19 mm to historical maximum	Single recorded reading; approximately 24.0% of the 25 mm historical minimum-to-maximum range. Criterion pending mine validation.

Appendix D - NDT Results

Table 62 - NDT results register

NDT ID	Asset	Location	Method	Procedure / technique	Operator / certification	Result	Report reference	Comment
NDT-001	All four guide sheaves	Not applicable to supplied evidence	Not performed / not supplied	Not supplied	Not supplied	No NDT result available	Not supplied	No NDT evidence was included in the compilation package.

Appendix E - Drawings, Schematics and Reference Information

Table 63 - Drawings and schematics register

Reference ID	Drawing / document number	Title	Revision	Source	Status	Comment
UGGS-REF001	UGGS-REF001	Upper Gantry Guide Sheaves reference arrangement	1.0	ISS / compilation notes	Included in Section 14	ISS-generated reference arrangement based on the supplied compilation notes; reference only and not to scale.
OEM-RN	URGN-005	Rear North groove specification plate	As photographed	KEW / site photo	Reference only	A=90 mm; B=120 mm; 22 mm minimum section shown.
OEM-RS	URGS-005	Rear South groove specification plate	As photographed	KEW / site photo	Reference only	A=90 mm; B=120 mm; 22 mm minimum section shown.

Appendix F - Supporting Documentation

Table 64 - Supporting documentation register

Document ID	Title / description	Document number	Revision / date	Source	Report relevance	Status
DOC-001	Upper Gantry Guide Sheaves Report Summary Notes and Compile Instructions	Not assigned	Uploaded compilation notes	User supplied	Primary compilation source, including front-sheave historical dimensional/ manufacturing notes	Included / source
DOC-002	Upper Gantry Guide Sheaves inspection photograph set	URGN / URGS / UFGN / UFGS	18/07/2026	User supplied	Photographic evidence for Sections 9, 16 and Appendix A	Included / source
DOC-003	UGGS-REF001 Upper Gantry Guide Sheaves reference arrangement	UGGS-REF001	Rev 1.0	ISS / compilation notes	Section 14 inspection orientation reference	Included in report - reference only