

Field Change Note

Ref:

1. Technical Advisory Note (TAN 3.0), RDSO-SIG0KVCH(GEN)/2/2024 dated 13/7/2026

#	Parameter	Description
1	Project / Module/ Zone	Wayside Kavach projects - All zones
2	Applicable systems with serial #	RFID Turnout Tags (Point Zone)
3	Change description	Currently, the RFID Turnout Tags are assembled with metal bottom reflective plate and being in use. In recent times some of the locomotives wrongly detecting the data in these tags and applying the EBs. In-order to avoid this situation, RDSO has issued a TAN recommending the replacement of the existing metal reflective plates with G10/FR4. Glass Epoxy Laminates.
4	Affected drawings / documents	A New assembly drawing has been released for RFID Turnout Tags, RFID_TAG_SUB_ASSY_TURN-OUT-FRP- 516900045 and new ML BOM 6000064906
5	Instructions to production team	Use the MLBOM 6000064906 for manufacturing the RFID Turnout Tags
6	Instructions to I&C team	Use the installation drawing # 5 53 76 0068 and do carry the dismantling and reassembly the RFID turnout tags.

Subrahmanyam Y
Subrahmanyam Y (Jul 31, 2026 14:50:27 GMT+5.5)

FCN #: SKavach/ Jul-26/05

Released by:

Date: 28-07-2026

Madhu A
Madhu A (Aug 3, 2026 09:55:57 GMT+5.5)

Production In-Charge

U. Greenwald

QC In-Charge:

Ch.Vamsi
Ch.Vamsi (Aug 11, 2026 15:44:10 GMT+5.5)

I&C Team In-Charge:

Rajesh

QA In-Charge:

DISMANTLING AND RE ASSEMBLY OF RFID TAG'S TURN-OUT POINT FRP



Fig-1a

Step-1: Remove by unscrew the M8 bolt's on existing RFID Tag bracket as shown in fig 1a & fig-1b



Fig-1b



Fig-2a

Step-2: Remove the existing RFID Tag with bracket from the sleeper as shown in fig-2a & fig-2b



Fig-2b



Fig-3

Step-3: Use Top cover FRP Mould for removing the bottom cover as shown in fig-3

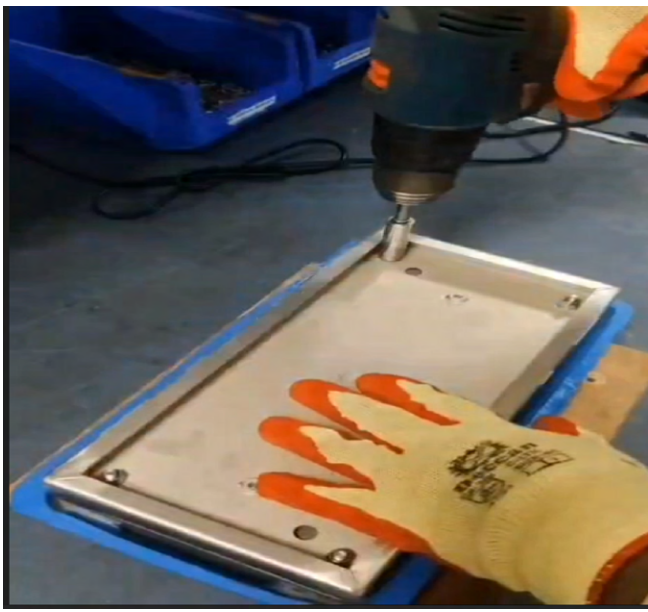


Fig-4

Step-4: Remove the TOP FRP cover by using mould jig by unscrewing the M6 nylock nut's as shown in fig-4

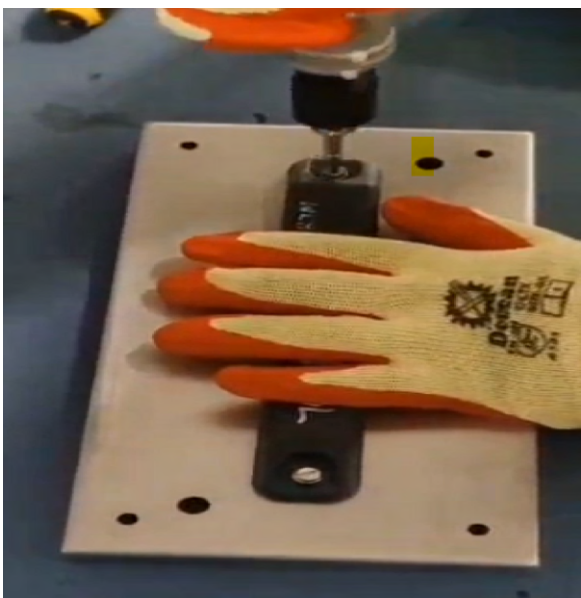


Fig-5

Step-5: Remove the RFID TAG by unscrewing the M5 chisel head screws as shown in fig-5



Fig-6

Step-6: Replace the existing RFID Bottom cover with NEW RFID Bottom cover RFP strap design as shown in fig-6



Fig-7

Step-7: Fix the RFID TAG With new M5 chisel head screws & spring washer & apply torque 5Nm as shown in fig-7



Fig-8a

Step-8: Place the RFID TAG Bottom FRP cover on the top cover mould jig as shown in fig-8a & fig-8b



Fig-8b

Step-9: Fix the RFID TOP FRP cover with BOTTOM cover FRP by new M6 nylock nut's & spring washer's & apply torque 8Nm as shown in fig-8b



Fig-9

Step-10: Final view of the assembly please ensure all the 4 screw's are properly inserted as shown fig-9.

After following step's from 1 to 10, follow the assembly Procedure as per
1. RFID_TAG_STRAP_INSTALLATION_PROCEDURE_553760035. &
2. RFID TAG STRAPPING-MANNUAL INSTALLATION PROCEDURE_553760055.

PROJECT: KAVACH		HBL® HBL Engineering Ltd.		NAME	DESIGNATION	SIGN,
ASSEMBLY: RFID TAG STRAPPING			DESIGN	P SHIVA KUMAR	SR.ENGINEER	
			CHECKED	K SREENU	SR.ENGINEER	
			APPROVED	Y SUBRAHMANYAM	GENERAL MANAGER (ENGINEERING)	
SCALE: 1:2	A2	TITLE :	HBL DRAWING NO. 5 53 76 0068			REV
		DISMANTLING AND RE ASSEMBLY OF RFID TAG FRP TURN-OUT-POINT			HBL PART NO.	1.0
EFFECTIVE FROM : ---			TOLERANCE NOT SPECIFIED SHALL BE AS PER IS : 2102 - 1993.			
ALL DIMENSIONS ARE IN mm			THIS DRAWING IS THE PROPERTY OF HBL ENGINEERING LIMITED AND MUST NOT BE COPIED,REPRODUCED,TRANSMITTED OR DISCLOSED TO ANY THIRD PARTY WITHOUT THE WRITTEN CONSENT OF THE COMPANY.			

Signature: Subrahmanyam Y
Subrahmanyam Y (Jul 31, 2026 14:50:27 GMT+5.5)
Email: subrahmanyam.yadavalli@hbl.in
Title: GM - Engineering

Signature: Ch.Vamsi
Ch.Vamsi (Aug 11, 2026 15:44:10 GMT+5.5)
Email: vamshi.chilukuri@hbl.in
Title: AGM-Projects

Signature: Madhu A
Madhu A (Aug 3, 2026 09:55:57 GMT+5.5)
Email: madhu.allam@hbl.in
Title: Manager

Signature: Prabhakar Gundu
Prabhakar Gundu (Aug 11, 2026 15:44:10 GMT+5.5)
Email: prabhakar.gundu@hbl.in
Title: Sr Manager QA

Signature: U. Sreenivasu
U. Sreenivasu (Aug 11, 2026 15:44:10 GMT+5.5)
Email: usreenivasu@hbl.in
Title: DGM - QC

Field Change Note for RFID TAG Assemblies for Turnout Tags 290726

Final Audit Report

2026-08-11

Created:	2026-07-31 (India Standard Time)
By:	Subrahmanyam Y (subrahmanyam.yadavalli@hbl.in)
Status:	Signed
Transaction ID:	CBJCHBCAABAA7ITcnduPfVqhR6TvFW_jKkniWh0jmfg

"Field Change Note for RFID TAG Assemblies for Turnout Tags 290726" History

-  Document created by Subrahmanyam Y (subrahmanyam.yadavalli@hbl.in)
2026-07-31 - 2:47:45 PM GMT+5.5- IP address: 122.187.81.114
-  Document emailed to Subrahmanyam Y (subrahmanyam.yadavalli@hbl.in) for signature
2026-07-31 - 2:49:58 PM GMT+5.5
-  Document e-signed by Subrahmanyam Y (subrahmanyam.yadavalli@hbl.in)
Signature Date: 2026-07-31 - 2:50:27 PM GMT+5.5 - Time Source: server- IP address: 122.187.81.114 - Signature Appearance Selected: TYPE
-  Document emailed to madhu.allam@hbl.in for signature
2026-07-31 - 2:50:29 PM GMT+5.5
-  Email viewed by madhu.allam@hbl.in
2026-08-03 - 8:48:48 AM GMT+5.5- IP address: 122.187.81.114
-  Signer madhu.allam@hbl.in entered name at signing as Madhu A
2026-08-03 - 9:55:55 AM GMT+5.5- IP address: 106.192.12.209
-  Document e-signed by Madhu A (madhu.allam@hbl.in)
Signature Date: 2026-08-03 - 9:55:57 AM GMT+5.5 - Time Source: server- IP address: 106.192.12.209 - Signature Appearance Selected: MOBILE_TYPE
-  Document emailed to Sreenivasu U (usreenivasu@hbl.in) for signature
2026-08-03 - 9:55:59 AM GMT+5.5
-  Email viewed by Sreenivasu U (usreenivasu@hbl.in)
2026-08-03 - 12:22:59 PM GMT+5.5- IP address: 122.187.81.114



Document e-signed by Sreenivasu U (usreenivasu@hbl.in)

Signature Date: 2026-08-03 - 12:23:56 PM GMT+5.5 - Time Source: server- IP address: 122.187.81.114 - Signature Appearance Selected: IMAGE



Document emailed to vamshi.chilukuri@hbl.in for signature

2026-08-03 - 12:23:59 PM GMT+5.5



Email viewed by vamshi.chilukuri@hbl.in

2026-08-11 - 3:30:00 PM GMT+5.5- IP address: 223.187.31.4



New document URL requested by vamshi.chilukuri@hbl.in

2026-08-11 - 3:43:12 PM GMT+5.5- IP address: 223.187.31.4



Signer vamshi.chilukuri@hbl.in entered name at signing as Ch.Vamsi

2026-08-11 - 3:44:08 PM GMT+5.5- IP address: 223.187.31.4



Document e-signed by Ch.Vamsi (vamshi.chilukuri@hbl.in)

Signature Date: 2026-08-11 - 3:44:10 PM GMT+5.5 - Time Source: server- IP address: 223.187.31.4 - Signature Appearance Selected: TYPE



Document emailed to Prabhakar Gundu (prabhakar.gundu@hbl.in) for signature

2026-08-11 - 3:44:13 PM GMT+5.5



Email viewed by Prabhakar Gundu (prabhakar.gundu@hbl.in)

2026-08-11 - 3:50:46 PM GMT+5.5- IP address: 182.60.128.173



Document e-signed by Prabhakar Gundu (prabhakar.gundu@hbl.in)

Signature Date: 2026-08-11 - 3:51:19 PM GMT+5.5 - Time Source: server- IP address: 182.60.128.173 - Signature Appearance Selected: IMAGE



Agreement completed.

2026-08-11 - 3:51:19 PM GMT+5.5