WARNING

THIS DRAWING GIVES THE BASIC INSTRUCTIONS FOR PROVIDING THE SUPPLY SERVICES AND ENVIRONMENT THAT GUARANTEES THE PROPER FUNCTIONNING OF THE PRODUCTS FROM THIS COMPANY, THE PURCHASER AND THE PURCHARSER'S INSTALLERS SHALL PROVIDE THE SUPPLY LINES NECESSARY FOR EACH PRODUCT IN ACCORDANCE WITH ESTABLISHED APPLICABLE NORMS AND REGULATIONS. THE COMPANY DECLINES ALL RESPONSABILITY FOR FAILURE TO COMPLY WITH SUCH LAWS AND REGULATIONS

THIS COMPANY RESERVES THE RIGHT TO MODIEY THIS DRAWING ACCORDING TO THE TECHNICAL DEVELOPMENT OF THE FOLIPMENT

This equipment has been designed for use in accordance with the International EMC(Electromagnetic Compatibility) Standards. In view of different lenvironments please follow the instructions given below to eliminate interference if necessary.

- Move the equipment or rotate its direction-
- Enlarge the space between the equipment and other machines:
- Put the plug into other outlets.
- Please consult with the local distributor or qualified electrician

Installation:

- 1. If will require at least two (2) or more people to carry the sterilizer to avoid dropping it off by mistake.
- 2. While installation, please make sure that the hearing capacity of installation table is enough to carry the sterilizer. For the weight information of the sterilizer please refer to "Specifications"
- 3. Located position the sterilizer on a stable bench or work surface.
- 4. Position the sterilizer on a stable laboratory bench or work surface, ensuring at least 10 cm clearance between the wall or other pieces of equipment and the sides of the unit for free circulation of air.
- 5. Make sure that the door can be opened freely after installation.
- 6. Do not install or operate the sterilizer in areas where flammable items or volatile substances are used or stored. An explosion could occur, causing personal injury. An installation site with good air circulation is required.
- 7. A separate (dedicated) socket is required for the sterilizer. Make sure the socket is earthed and can offer the capacity of

ENVIRONMENT CONDITIONS IN THE STERILE AREA:

- Indoor use
- Under 1.000m (altitude):
- Temperature 5°C to 40°C
- Relative Humidity 80%RH@31°C to Relative Humidity 50%RH@40°C;
- Voltage fluctuation ±10 %;
- Transient overvoltages category II):
- (Pollution degree 2)

Important Safety Instructions:

- 1. Connect the external water supplier to the water inlet with presure greather than 2 bar.
- 2. Refer to the table for the requirements of water quality.
- 3. Connect the drainage pipe to exhaust the used water according to the local authority's law.
- 4. Do not obstruct the drainage system.
- 5. Consult technicians for the correct connections.

ATTENTION:

- CHAMBER DIMENSIONS: (A)
- DEVICE OUTSIDE DIMENSIONS: (B)
- ALL THE OUTLETS MUST BE INSTALLED ACCORDING TO LOCAL APPLICABLE NORMS. - THE INSTALLATION UP TO THE MACHINE AS WELL AS THE SUPPLY OF ACCESSIBLE KEY ACCORDING TO THE SPECIFICATIONS INDICATED IN THE DRAWING, ARE
- CHARGEABLE TO THE PURCHASERS.
- THE MEASUREMENTS OF THIS DRAWING ARE CONSIDERING FINISHED WALLS.
- THE SPACES OF MAINTENANCE MUST BE SUFFICIENTLY ILLUMINATED.

ITEM	MODEL	CHAMBER DIMENSIONS (A)	X	Y	Z	, ,
1 SA	1-230FA	Ø230x410	522	410	594	6.1A/230VAC/1400W
2 SA	1-260FA	ø260x450	533	442	655	7.9A/230VAC/1800W
3 SA	1-300FA	ø300x570	620	489	766	13.6A/230VAC/3126W

3	SA-300FA	ø300x570	620	489	766	13.6A/230VAC/3126W
2	SA-260FA	ø260x450	533	442	655	7.9A/230VAC/1800W
1	SA-230FA	ø230x410	522	410	594	6.1A/230VAC/1400W
	MODEL	CHANDED DANGEROUS (A)	X	Y	Z	
CEM MODEL		CHAMBER DIMENSIONS (A)	DEVICE OUTSIDE DIMENSIONS (B)			(L)

	Silicium oxide ,Sio ₂
	Iron
	Cadmium
1	Lead
	Rest of heavy metals ,exclude cadmium,lead
Min100	Chloride
	Phosphate
	Conductivity(at20°C)
	pH value
	Appearance
	Hardness
	NOTE The use of water for ste exceeding those given in this T a sterilizer and can invalidate i
TOP VIEW	
Min 100	
Min100	Min100

X


FRONT VIEW

MARK	REVISION RECORD變更內容	DATE日期	DRAWN修改
1			

Table Consected manipus limits of anti-size to in anti-size to

Lable : Suggested maximum limits of cor			
for water for steam	sterilization		
	feed water		
Evaporate residue	≤10 mg/l		
Silicium oxide ,Sio ₂	≤ 1 mg/l		
Iron	≤0.2 mg/l		
Cadmium	≤0.005 mg/l		
Lead	≤0.05 mg/l		
Rest of heavy metals ,excluding iron, cadmium,lead	≤0.1 mg/l		
Chloride	≤2 mg/l		
Phosphate	≤0.5 mg/l		
Conductivity(at20°C)	≤15 μ s/cm		
pH value	5 to 7.5		
Appearance	colourless,clean, without sediment		
Hardness	≤0.02mmol/l		

eam generation with contaminants at levels Table can greatly shorten the working life of the manufactacure's warranty of quarantee.

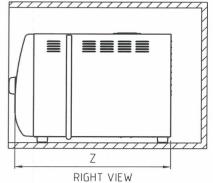



HORIZONTAL PLAN

STIRTY 新驗實業股份有限公司 STURDY INDUSTRIAL CO LTD

The second secon			indeciring co., gib.
TOLERANCE未標註者一般公差表	未標示之圓角為R1導角為C1	DESIGNED DRAWI 設計: 繪圖	VERIFIED APPROVED 校核:, ¼ 核准:, ↓
	201~500±0.30 ANGLE ±1°		enny Maria Maria
11~50 ±0.15 101~200±0.25	501~X ±0.35 視角 ⊕ €	20171206 20	171206 2018-6.6 2018.6.6
MATERIAL 材質	比例 1:15 單位 mm	MAME 名 SA-FA	INSTALLATION PLAN
SURFACE FINISHING 表面處理	MODEL NO. 代表機種	DWG.NO. 圖號 SA-FA-	-HE-001-01