EAGLE EYE

Cabinet QC report · drawing-first verification

EE-DEMO-01

Run 20261024-202502-bfc6
2026-10-24 20:25:02


HOLD · 1 fault to fix before shipping

Every FAIL is boxed on the photo with expected-vs-found proof.

40	1	0	0
PASS	FAIL · FIX BEFORE SHIPPING	REVIEW · EVIDENCE UNRESOLVED	SKIP · ROOT CAUSE ELSEWHERE

Inspection details

Cabinet	EE-DEMO-01
Photo	05_after_fix_one_left_open.jpg
Re-check of	20261024-202456-25cf
GA drawing	GA_EE-DEMO-01.pdf
Wire list	WireList_EE-DEMO-01.xlsx
QC checklist	QC_Checklist_EE-DEMO-01.xlsx
Checks	GA · ORDER · LABEL · FERRULE · COLOUR
Items checked	41 expected items from the drawing and wire list
Registration	backplate outline + 17 label/ferrule anchors, 17 RANSAC inliers
Processing	1.6 s on CPU
Engine	EAGLE EYE 3.3.0 · Tesseract OCR · OpenCV · PyMuPDF

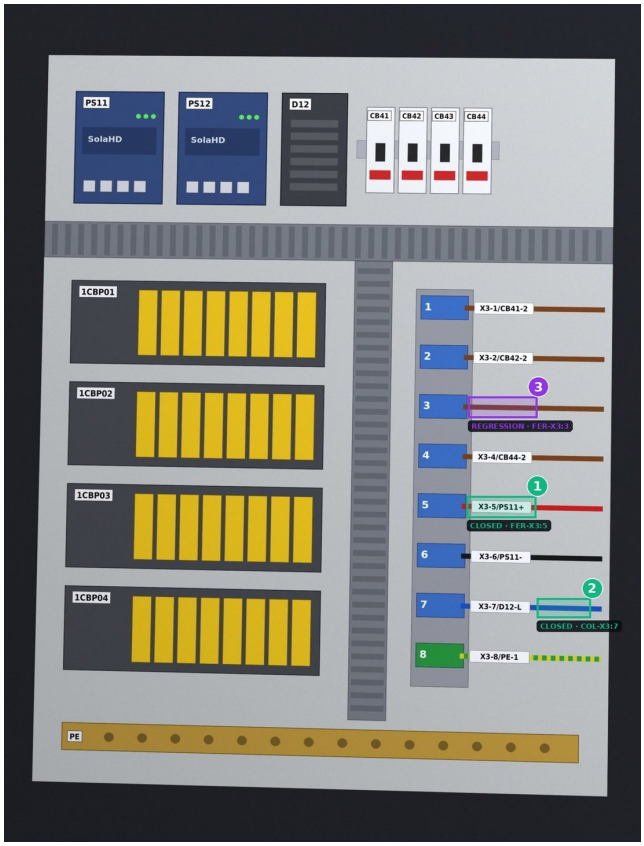

How to read this report


Every item is checked one at a time at the spot the GA drawing gives it. An item is FAIL only when independent evidence agrees; anything unclear is REVIEW (re-photo that zone) instead of a guess. SKIP means the root cause is already reported by another item (a missing part is one FAIL, not five). Numbers match the boxes on the photo.

Re-check findings (3)


1 FER-X3:5 Ferrule text

CLOSED

EXPECTED · GA drawing

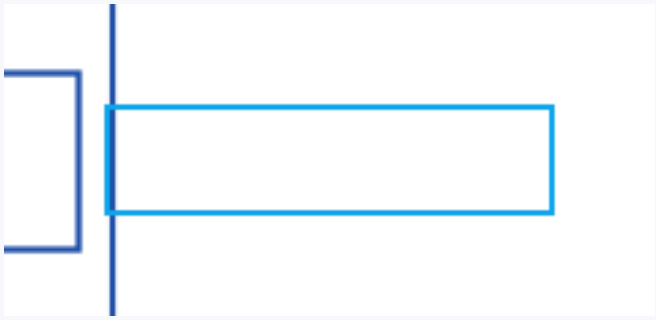

FOUND · photo

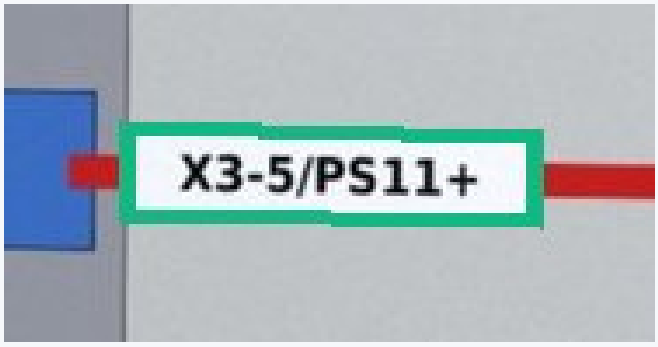

Expected (drawing)	X3-5/PS11+
Found (photo)	X3-5/PS11+
Evidence	OCR votes ['X3-5/PS11+', 'X3-5/PS11+', 'X3-5/PS11+', 'X3-5/PS11+']
Before re-check	FAIL: Wrong ferrule: X3-6/PS11-


2 COL-X3:7 Wire colour

CLOSED

EXPECTED · GA drawing



FOUND · photo

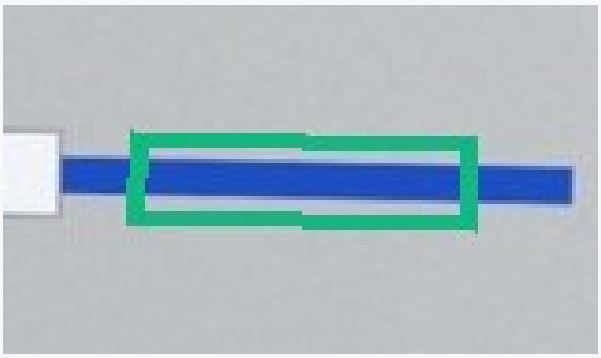


Expected (drawing)	BU
Found (photo)	BU
Evidence	green 0% yellow 0%
Before re-check	FAIL: BK


3 FER-X3:3 Ferrule text

REGRESSION

EXPECTED · GA drawing

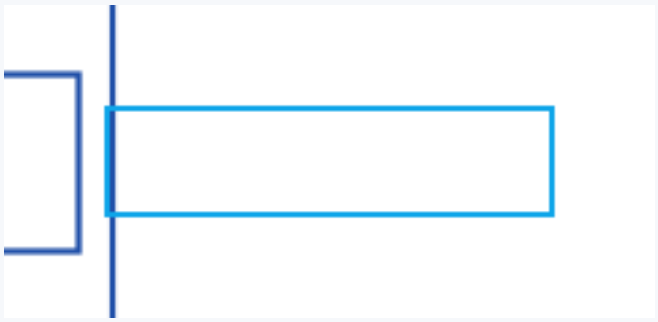

FOUND · photo

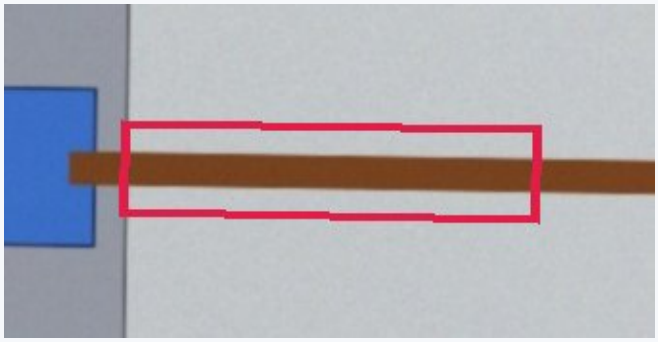

Expected (drawing)	X3-3/CB43-2
Found (photo)	No ferrule
Evidence	sleeve pixels 0%
Before re-check	PASS: X3-3/CB43-2

Re-check against the previous inspection

CLOSED 2 · OPEN 0 · REGRESSION 1 · NEW 0

#	Item	Before	Now	Status
1	FER-X3:5	FAIL: Wrong ferrule: X3-6/PS11-	PASS: X3-5/PS11+	CLOSED
2	COL-X3:7	FAIL: BK	PASS: BU	CLOSED
3	FER-X3:3	PASS: X3-3/CB43-2	FAIL: No ferrule	REGRESSION

QC checklist (41 items)

Item	Check	Expected (drawing)	Found (photo)	Result
GA-PS11	Part present	Installed	Present	PASS
GA-PS12	Part present	Installed	Present	PASS
GA-D12	Part present	Installed	Present	PASS
GA-CB41	Part present	Installed	Present	PASS
GA-CB42	Part present	Installed	Present	PASS
GA-CB43	Part present	Installed	Present	PASS
GA-CB44	Part present	Installed	Present	PASS
GA-1CBP01	Part present	Installed	Present	PASS
GA-1CBP02	Part present	Installed	Present	PASS
GA-1CBP03	Part present	Installed	Present	PASS
GA-1CBP04	Part present	Installed	Present	PASS
GA-PE	Part present	Installed	Present	PASS
ORD-RAIL-1	Rail order	CB41-CB42-CB43-CB44	CB41-CB42-CB43-CB44	PASS
LBL-PS11	Device label	PS11	PS11	PASS
LBL-PS12	Device label	PS12	PS12	PASS
LBL-D12	Device label	D12	D12	PASS
LBL-CB41	Device label	CB41	CB41	PASS
LBL-CB42	Device label	CB42	CB42	PASS
LBL-CB43	Device label	CB43	CB43	PASS
LBL-CB44	Device label	CB44	CB44	PASS
LBL-1CBP01	Device label	1CBP01	1CBP01	PASS
LBL-1CBP02	Device label	1CBP02	1CBP02	PASS
LBL-1CBP03	Device label	1CBP03	1CBP03	PASS
LBL-1CBP04	Device label	1CBP04	1CBP04	PASS
LBL-PE	Device label	PE	PE	PASS
FER-X3:1	Ferrule text	X3-1/CB41-2	X3-1/CB41-2	PASS
FER-X3:2	Ferrule text	X3-2/CB42-2	X3-2/CB42-2	PASS
FER-X3:3	Ferrule text	X3-3/CB43-2	No ferrule	FAIL · REGRESSION #3
FER-X3:4	Ferrule text	X3-4/CB44-2	X3-4/CB44-2	PASS
FER-X3:5	Ferrule text	X3-5/PS11+	X3-5/PS11+	PASS · CLOSED #1
FER-X3:6	Ferrule text	X3-6/PS11-	X3-6/PS11-	PASS
FER-X3:7	Ferrule text	X3-7/D12-L	X3-7/D12-L	PASS
FER-X3:8	Ferrule text	X3-8/PE-1	X3-8/PE-1	PASS
COL-X3:1	Wire colour	BN	BN	PASS
COL-X3:2	Wire colour	BN	BN	PASS
COL-X3:3	Wire colour	BN	BN	PASS
COL-X3:4	Wire colour	BN	BN	PASS
COL-X3:5	Wire colour	RD	RD	PASS
COL-X3:6	Wire colour	BK	BK	PASS
COL-X3:7	Wire colour	BU	BU	PASS · CLOSED #2
COL-X3:8	Wire colour	GNYE	GNYE	PASS

Generated 2026-10-24 20:25:03 by EAGLE EYE. Every result is traceable to the drawing item it checks and to the evidence listed above.