EAGLE EYE

Cabinet QC report · drawing-first verification

EE-DEMO-01

Run 20261017-041253-e0ea
2026-10-17 04:12:59


HOLD · 4 faults to fix before shipping

Every FAIL is boxed on the photo with expected-vs-found proof.

37	4	0	0
PASS	FAIL · FIX BEFORE SHIPPING	REVIEW · RE-PHOTO ZONE	SKIP · ROOT CAUSE ELSEWHERE

Inspection details

Cabinet	EE-DEMO-01
Photo	forge_357.jpg
GA drawing	GA_EE-DEMO-01.pdf
Wire list	WireList_EE-DEMO-01.xlsx
QC checklist	QC_Checklist_EE-DEMO-01.xlsx
Checks	GA · ORDER · LABEL · FERRULE · COLOUR
Items checked	41 expected items from the drawing and wire list
Registration	backplate outline + 18 label/ferrule anchors, 15 RANSAC inliers; off-pattern: CB42, CB41, X3-3/CB43-2
Processing	4.8 s on CPU
Engine	EAGLE EYE 2.0.0 · Tesseract OCR · OpenCV · PyMuPDF

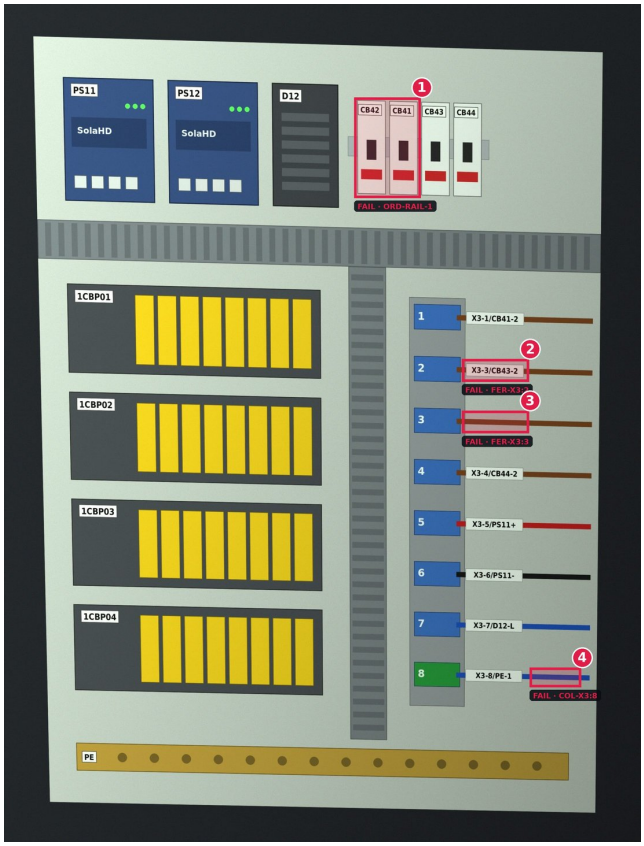

How to read this report

Every item is checked one at a time at the spot the GA drawing gives it. An item is FAIL only when independent evidence agrees; anything unclear is REVIEW (re-photo that zone) instead of a guess. SKIP means the root cause is already reported by another item (a missing part is one FAIL, not five). Numbers match the boxes on the photo.


Findings (4)

1 ORD-RAIL-1 Rail order — FAIL

EXPECTED · GA drawing




FOUND · photo

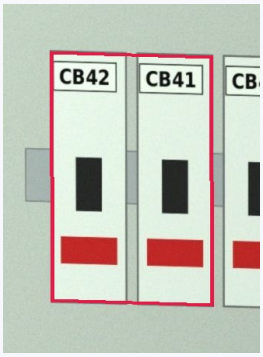


Expected (drawing)	CB41-CB42-CB43-CB44
Found (photo)	CB41 <-> CB42 swapped
Evidence	read along rail: CB42-CB41-CB43-CB44

2 FER-X3:2 Ferrule text — FAIL

EXPECTED · GA drawing

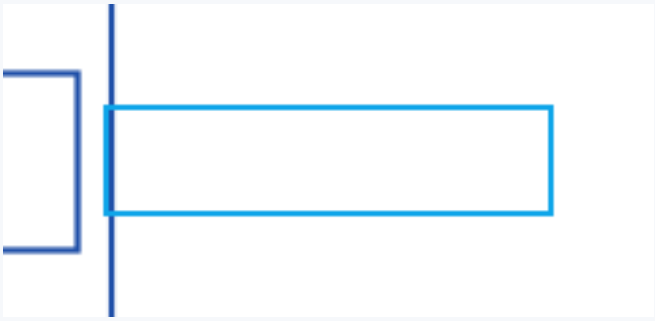

FOUND · photo

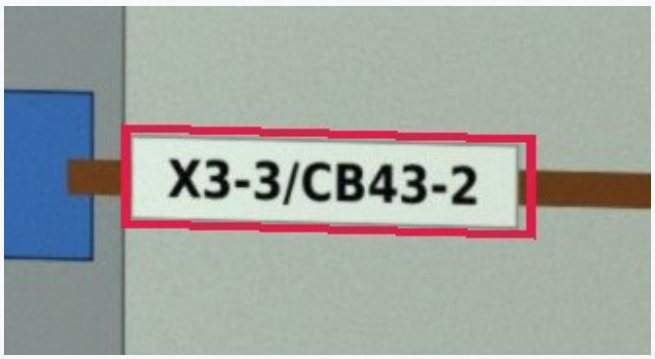


Expected (drawing)	X3-2/CB42-2
Found (photo)	Wrong ferrule: X3-3/CB43-2
Evidence	OCR votes ['X3-3/CB43-2', 'X3-3/CB43-2', 'X3-3/CB43-2', 'X3-3/CB43-2']


3 FER-X3:3 Ferrule text

FAIL

EXPECTED · GA drawing

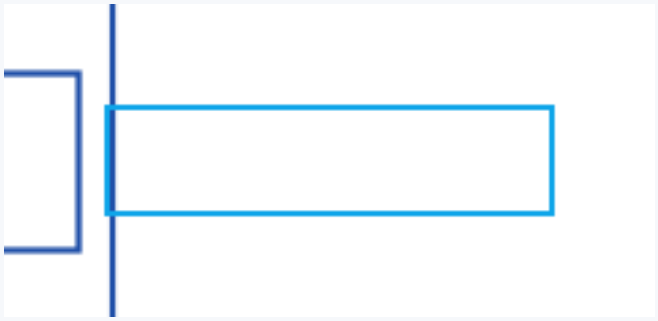

FOUND · photo

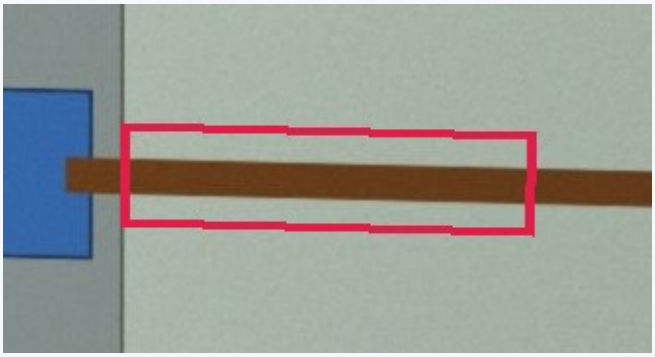


Expected (drawing)	X3-3/CB43-2
Found (photo)	No ferrule
Evidence	sleeve pixels 0%


4 COL-X3:8 Wire colour

FAIL

EXPECTED · GA drawing



FOUND · photo

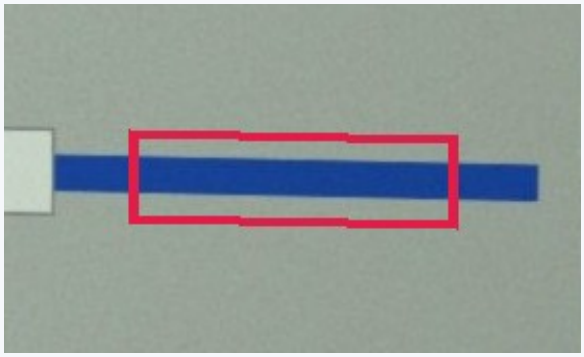

Expected (drawing)	GNYE
Found (photo)	BU
Evidence	green 0% yellow 0%

QC checklist (41 items)

Item	Check	Expected (drawing)	Found (photo)	Result
GA-PS11	Part present	Installed	Present	PASS
GA-PS12	Part present	Installed	Present	PASS
GA-D12	Part present	Installed	Present	PASS
GA-CB41	Part present	Installed	Present	PASS
GA-CB42	Part present	Installed	Present	PASS
GA-CB43	Part present	Installed	Present	PASS
GA-CB44	Part present	Installed	Present	PASS
GA-1CBP01	Part present	Installed	Present	PASS
GA-1CBP02	Part present	Installed	Present	PASS
GA-1CBP03	Part present	Installed	Present	PASS
GA-1CBP04	Part present	Installed	Present	PASS
GA-PE	Part present	Installed	Present	PASS
ORD-RAIL-1	Rail order	CB41-CB42-CB43-CB44	CB41 <-> CB42 swapped	FAIL #1
LBL-PS11	Device label	PS11	PS11	PASS
LBL-PS12	Device label	PS12	PS12	PASS
LBL-D12	Device label	D12	D12	PASS
LBL-CB41	Device label	CB41	CB41	PASS
LBL-CB42	Device label	CB42	CB42	PASS
LBL-CB43	Device label	CB43	CB43	PASS
LBL-CB44	Device label	CB44	CB44	PASS
LBL-1CBP01	Device label	1CBP01	1CBP01	PASS
LBL-1CBP02	Device label	1CBP02	1CBP02	PASS
LBL-1CBP03	Device label	1CBP03	1CBP03	PASS
LBL-1CBP04	Device label	1CBP04	1CBP04	PASS
LBL-PE	Device label	PE	PE	PASS
FER-X3:1	Ferrule text	X3-1/CB41-2	X3-1/CB41-2	PASS
FER-X3:2	Ferrule text	X3-2/CB42-2	Wrong ferrule: X3-3/CB43-2	FAIL #2
FER-X3:3	Ferrule text	X3-3/CB43-2	No ferrule	FAIL #3
FER-X3:4	Ferrule text	X3-4/CB44-2	X3-4/CB44-2	PASS
FER-X3:5	Ferrule text	X3-5/PS11+	X3-5/PS11+	PASS
FER-X3:6	Ferrule text	X3-6/PS11-	X3-6/PS11-	PASS
FER-X3:7	Ferrule text	X3-7/D12-L	X3-7/D12-L	PASS
FER-X3:8	Ferrule text	X3-8/PE-1	X3-8/PE-1	PASS
COL-X3:1	Wire colour	BN	BN	PASS
COL-X3:2	Wire colour	BN	BN	PASS
COL-X3:3	Wire colour	BN	BN	PASS
COL-X3:4	Wire colour	BN	BN	PASS
COL-X3:5	Wire colour	RD	RD	PASS
COL-X3:6	Wire colour	BK	BK	PASS
COL-X3:7	Wire colour	BU	BU	PASS
COL-X3:8	Wire colour	GNYE	BU	FAIL #4

Generated 2026-10-17 04:12:59 by EAGLE EYE. Every result is traceable to the drawing item it checks and to the evidence listed above.