




PROCESS BASE



DUMP STACK



ROS/PDOS PROCESS STRUCTURE

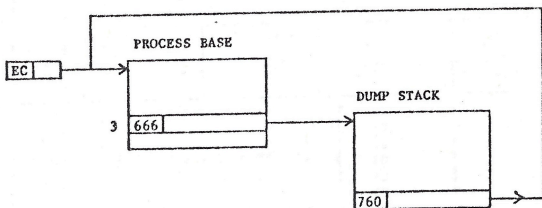

ROS/PDOS STATE AND INTERNAL PRIORITY WORD

23	22	21	20	19	18	17	16	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
0	1	0	x	q	q	q	q	q	p	p	p	p	p	c	c	c	c	r	w	f	s	b	b

- $r = 0$ Process currently running on a CPU
- $r = 1$ Process not running
- $cccc$ CPU No. ($0 \rightarrow n$) if $r = 0$
- $ppppp$ (23 - Current Priority)
- $qqqqq$ (23 - Standard Priority)
- $x = 1$ If process is on the Ready List
- $s = 1$ If suspended on WAITFOR
- $f = 1$ If process has faulted
- $bb = 00$ Double unblocked
- $\quad = 01$ Unblocked
- $\quad = 10$ Blocked
- $\quad = 11$ Double blocked
- w May be 0 or 1

PROCESS DUMP STACK FORMAT

OFFSET (OCTAL)	COS	POS	ROS	PDOS
0 1 2 3 4 5	C0 C1 C2 C3 C4 C5	CAPABILITY REGISTERS		
6 7 10 11 12 13 14 15	D0 D1 D2 D3 D4 D5 D6 D7			
DATA REGISTERS				
16 17 20	PUSHDOWN POINTER FOR CALL STACK WATCHDOG TIMER REGISTER MIP (PRIMARY INDICATOR REGISTER)			
21 22 23 24 25 26 27 30 31 32 33 34 35 36	C6 Initial C7 Code IAR BLOCK C6 1st C7 Subrou- IAR tine C6 2nd C7 Subrou- IAR tine " " " " "	C6 Initial C7 Code IAR Block C6 1st C7 Subrou- IAR tine C6 2nd C7 Subrou- IAR tine " " " " "	MIF LOKK WORD Error Control Process Base SIP C6 Initial C7 Code IAR Block C6 1st C7 Subrou- IAR tine " " " "	MIF LOKK Word 3 words for Ptmigan Error Control Process Base SIP C6 Initial C7 Code IAR Block C6 1st C7 Subrou- IAR tine " " " "

MIF = Copy of CPU Fault Indicator Register

LOKK = Used by privileged system facilities


Error Control = Process Error Control Parameter from Process Template

SIP = State and Internal Priority Word

SPECIAL PURPOSE CPU REGISTERS

D10	ABSOLUTE D/S PUSHDOWN POINTER
D11	WATCHDOG TIMER
D12	FIRST FAULT MIF COPY
D13	
D14	
D15	INTERRUPT ACCEPT REGISTER
D16	
D17	INSTRUCTION ADDRESS REGISTER (IAR)
C10	C(D) DUMPSTACK
C11	C(I) INTERVAL TIMER
C12	C(C) SCT
C13	C(N) NORMAL INTERRUPT BLOCK
C14	
C15	
C16	
C17	
-	C(S) FAULT START-UP BLOCK

INTERNAL MODE ADDRESSING

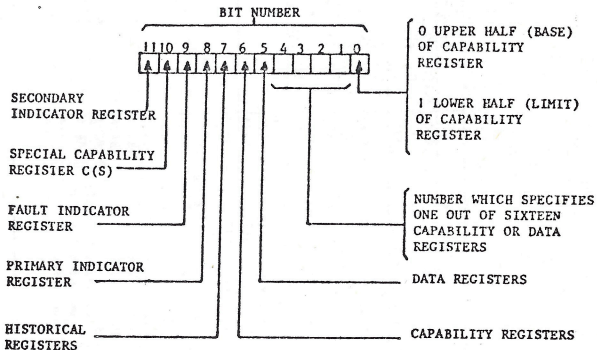

MIP = 8R400
MIF = 8R1000
D11 = 8R62