
M-01 1:1 PRINT - STAGE10 HISTORICAL LABELS (mirrored; superseded, do not use for design)


J17909 HARTING 09032966824 female on A01-middle (rear face, board plane z = 50 mm)

COMPONENT SIDE: viewed from the connector body toward the board, from the rear along -z (panel +x points LEFT).

PRINT AT 100% / ACTUAL SIZE. Turn off "fit to page". Measure both 100 mm bars before use; reject the print if either is off by more than 0.5 mm.

Holes: dia 1.0 contact drill centres (2.54 mm pitch). Large circles: dia 2.8 fixing holes, 90 mm apart, 0.3 mm from row b toward row a.

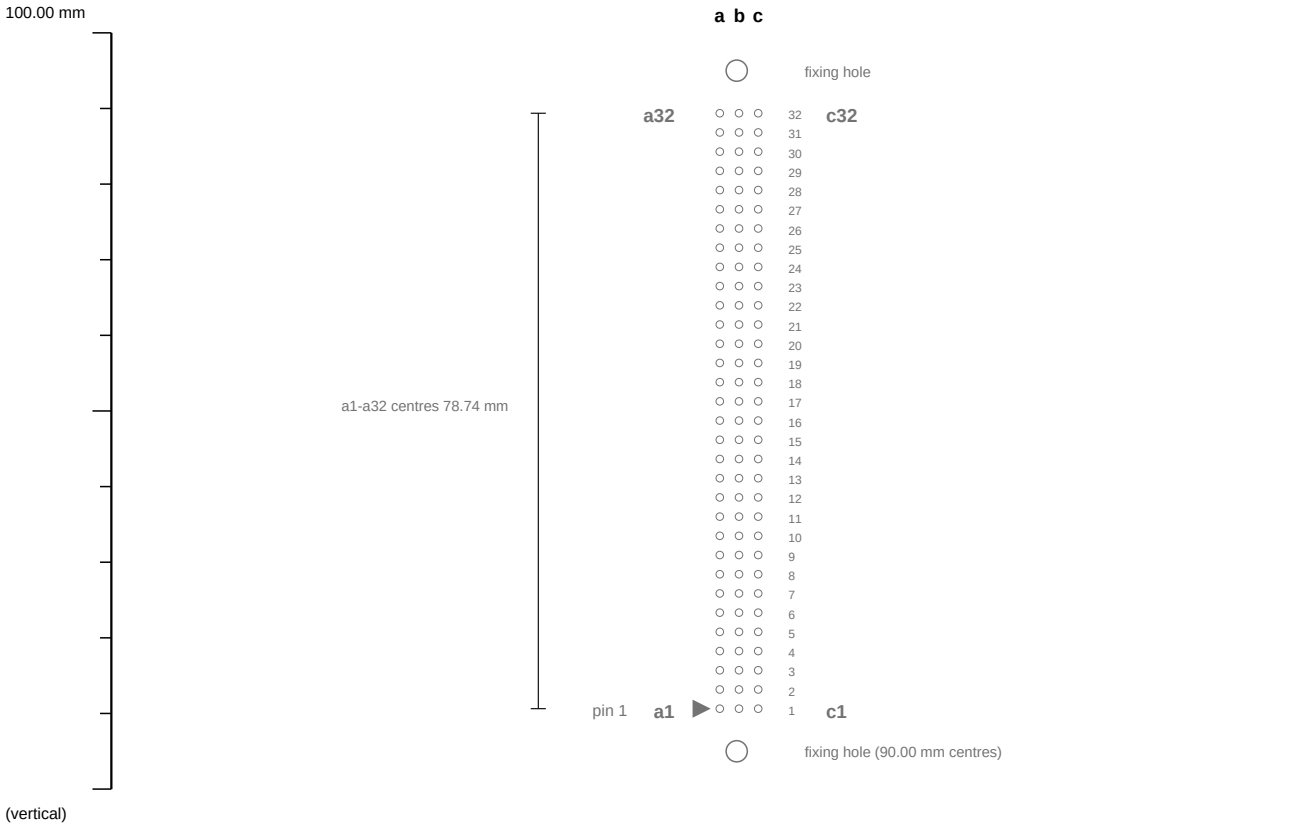

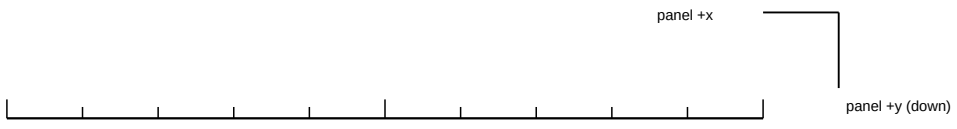

SCALE CHECK: 100.00 mm (horizontal)

Check: set the UNSOLDERED part on this print, body side toward you as shown, pins over the circles; photograph a1, c1, a32, c32 and the pin-1 mark.

Record the result on the M-01 record sheet (last page). Compare with the other variant of the same connector. M-01 is NOT RUN until the sheet is filled in.

DESIGN STUDY ONLY - not for fabrication. D02 stays CONFLICT_REQUIRES_DECISION. Mapping (design): candidate_position(row,n) = Stage10_position(row,33-n).

Source: stage30_din_design_integration.py from 00266037a7e2 inputs; geometry from stage29/contact-map.json and stage10/mechanical-report.json.


M-01 1:1 PRINT - STAGE30 DESIGN-ONLY PROVISIONAL LABELS (column reversal)

J17909 HARTING 09032966824 female on A01-middle (rear face, board plane z = 50 mm)

COMPONENT SIDE: viewed from the connector body toward the board, from the rear along -z (panel +x points LEFT).

PRINT AT 100% / ACTUAL SIZE. Turn off "fit to page". Measure both 100 mm bars before use; reject the print if either is off by more than 0.5 mm.

Holes: dia 1.0 contact drill centres (2.54 mm pitch). Large circles: dia 2.8 fixing holes, 90 mm apart, 0.3 mm from row b toward row a.

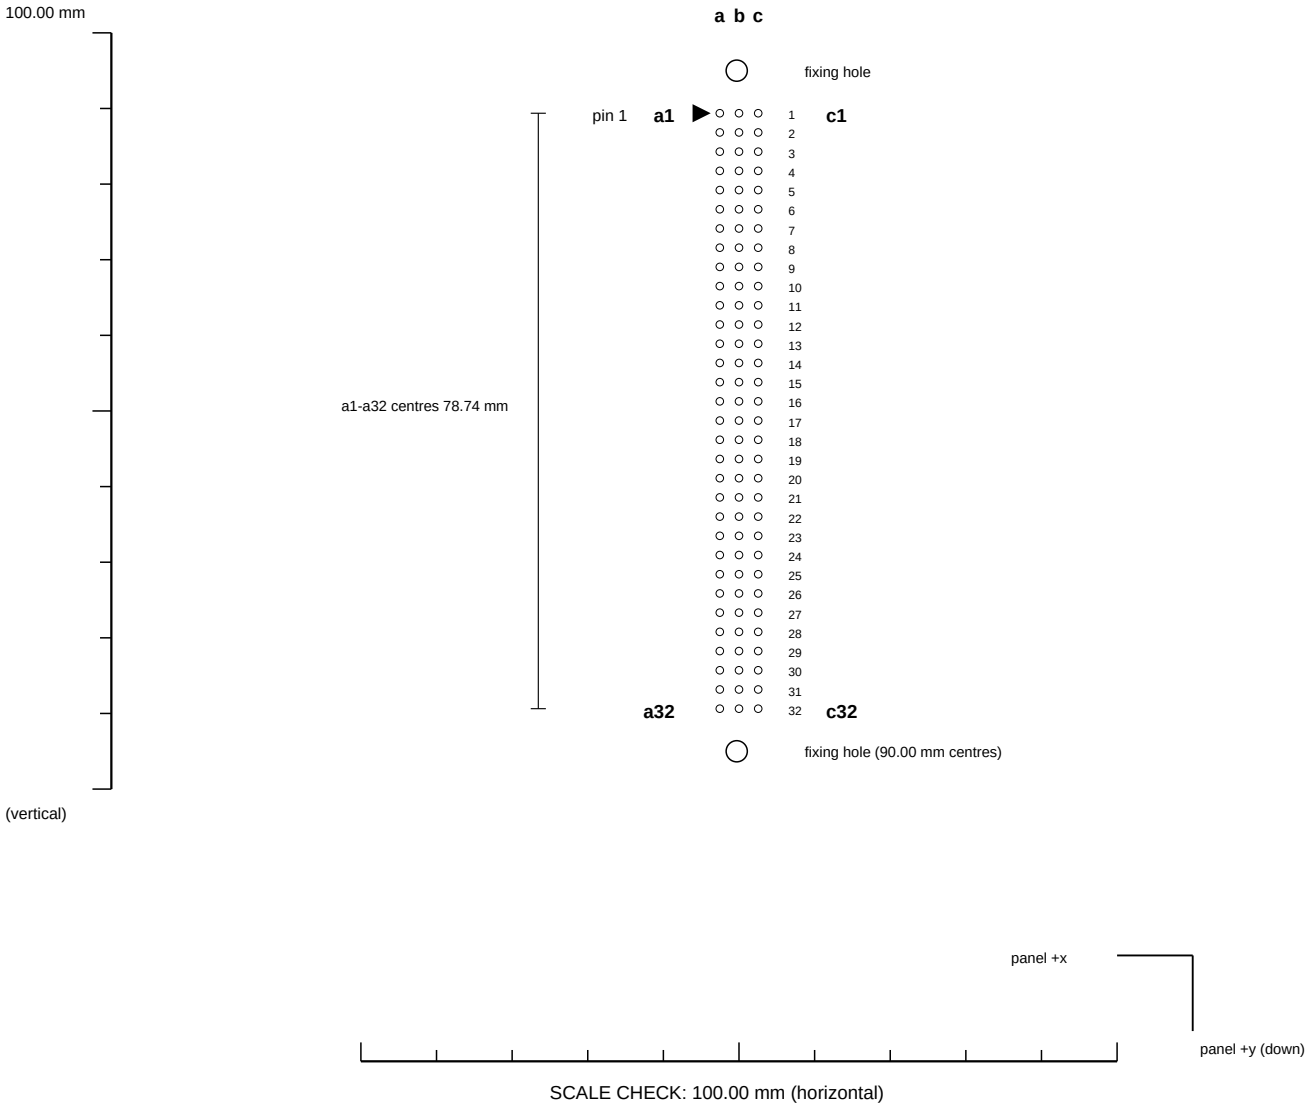

SCALE CHECK: 100.00 mm (horizontal)

Check: set the UNSOLDERED part on this print, body side toward you as shown, pins over the circles; photograph a1, c1, a32, c32 and the pin-1 mark.

Record the result on the M-01 record sheet (last page). Compare with the other variant of the same connector. M-01 is NOT RUN until the sheet is filled in.

DESIGN STUDY ONLY - not for fabrication. D02 stays CONFLICT_REQUIRES_DECISION. Mapping (design): candidate_position(row,n) = Stage10_position(row,33-n).

Source: stage30_din_design_integration.py from 00266037a7e2 inputs; geometry from stage29/contact-map.json and stage10/mechanical-report.json.


M-01 1:1 PRINT - STAGE10 HISTORICAL LABELS (mirrored; superseded, do not use for design)

J17910 HARTING 09031966922 male on A01-core (front face, board plane z = 69.2 mm)

COMPONENT SIDE: viewed from the connector body toward the board, from the front along +z (panel +x points RIGHT).

PRINT AT 100% / ACTUAL SIZE. Turn off "fit to page". Measure both 100 mm bars before use; reject the print if either is off by more than 0.5 mm.

Holes: dia 1.0 contact drill centres (2.54 mm pitch). No board fixing holes on the male (its dia 2.55 holes are body flange features).

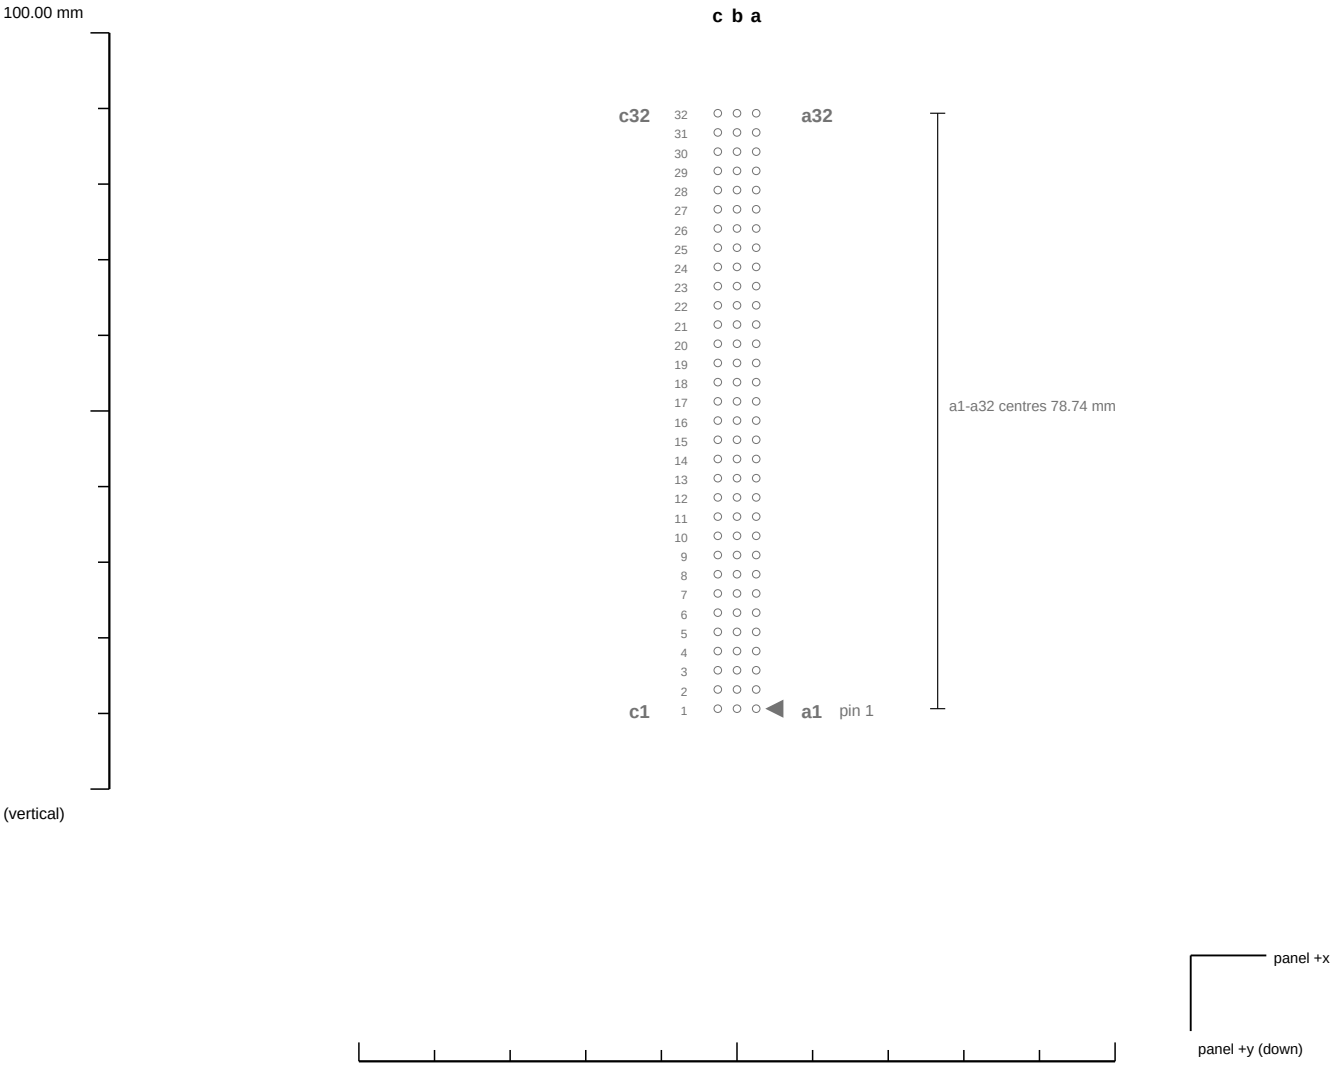

Check: set the UNSOLDERED part on this print, body side toward you as shown, pins over the circles; photograph a1, c1, a32, c32 and the pin-1 mark.

Record the result on the M-01 record sheet (last page). Compare with the other variant of the same connector. M-01 is NOT RUN until the sheet is filled in.

DESIGN STUDY ONLY - not for fabrication. D02 stays CONFLICT_REQUIRES_DECISION. Mapping (design): candidate_position(row,n) = Stage10_position(row,33-n).

Source: stage30_din_design_integration.py from 00266037a7e2 inputs; geometry from stage29/contact-map.json and stage10/mechanical-report.json.


M-01 1:1 PRINT - STAGE30 DESIGN-ONLY PROVISIONAL LABELS (column reversal)

J17910 HARTING 09031966922 male on A01-core (front face, board plane z = 69.2 mm)

COMPONENT SIDE: viewed from the connector body toward the board, from the front along +z (panel +x points RIGHT).

PRINT AT 100% / ACTUAL SIZE. Turn off "fit to page". Measure both 100 mm bars before use; reject the print if either is off by more than 0.5 mm.

Holes: dia 1.0 contact drill centres (2.54 mm pitch). No board fixing holes on the male (its dia 2.55 holes are body flange features).

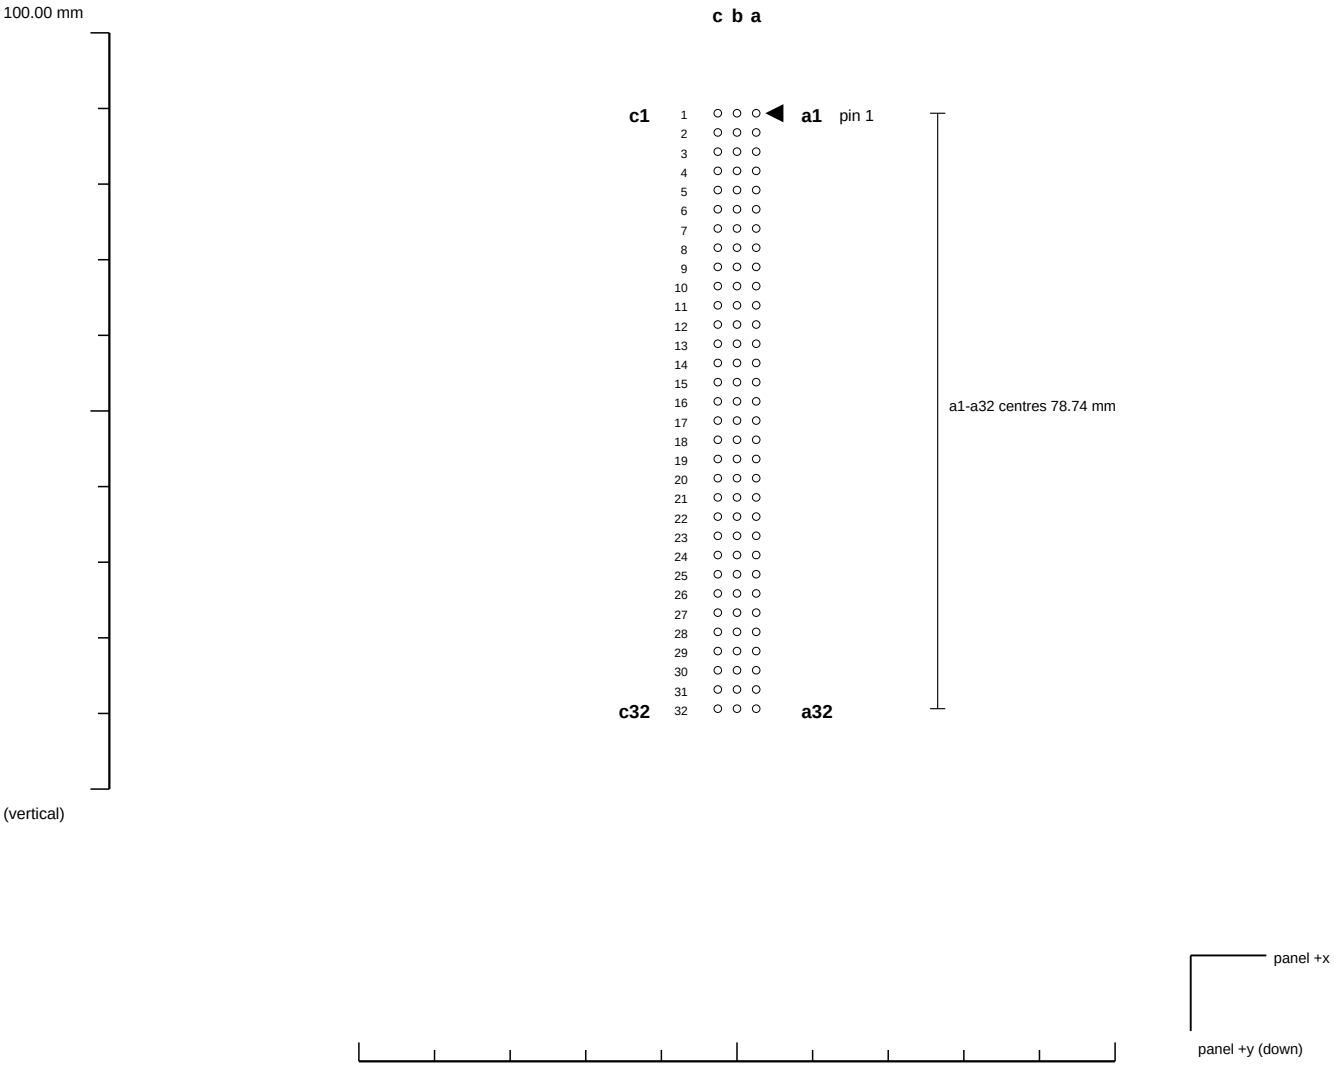

SCALE CHECK: 100.00 mm (horizontal)

Check: set the UNSOLDERED part on this print, body side toward you as shown, pins over the circles; photograph a1, c1, a32, c32 and the pin-1 mark.

Record the result on the M-01 record sheet (last page). Compare with the other variant of the same connector. M-01 is NOT RUN until the sheet is filled in.

DESIGN STUDY ONLY - not for fabrication. D02 stays CONFLICT_REQUIRES_DECISION. Mapping (design): candidate_position(row,n) = Stage10_position(row,33-n).

Source: stage30_din_design_integration.py from 00266037a7e2 inputs; geometry from stage29/contact-map.json and stage10/mechanical-report.json.

M-01 RECORD SHEET (empty) - DIN contact orientation check, unpowered, unsoldered parts

Status: NOT RUN. Fill in by hand. Do not mark PASS here; the owner decides Q-O01 from this record.

Date / operator: _____

Printer, paper, scaling setting (must be 100% / actual size): _____

Part lot / marking: J17909 09032966824: _____

Part lot / marking: J17910 09031966922: _____

Per sheet

Sheet	H bar mm	V bar mm	a1 at label?	c1?	a32?	c32?	pin-1 mark?	fixing holes?	photo IDs
1 J17909 Stage10									
2 J17909 design									
3 J17910 Stage10									
4 J17910 design									

Which variant matches the part (labels, pin-1 mark, body side)? J17909: _____ J17910: _____

Fixing-hole offset side seen on the J17909 part (row a / row c): _____

Notes / deviations:

_____

_____

_____

_____

DESIGN STUDY ONLY - not for fabrication. Physical result fields are empty by design; machine-readable template: stage30/m01-record-template.json.

Source: stage30_din_design_integration.py from 00266037a7e2 inputs; geometry from stage29/contact-map.json and stage10/mechanical-report.json.