



Catching Kowa

Moving Minds - Delivering Results

WELCOME TO Catching Kowa DSL Training

- Network WF

Connection problem

- To be able to use the internet , customer should configure the router to get IP (internet protocol) .
- we have two kinds of configuration type:
 - 1- PPPOE (Username same as on Siebel)
 - 2- IPOE (8 and 16 Static IP)

**Configuration for dynamic or 1
static customer**

(PPPOE) & (port forward)

**Please refer to the Router devices
Pp**

Configuration for 8, 16 static Ips (Copper) (IPOE)

Find in page



Find

ON THIS PAGE

[Basic Information](#)[Common Asked Questions](#)[Plans](#)[How to Pay](#)[How to Manage My Account](#)[How to Complain](#)[Siebel](#)[Related Offers](#)[Related VASs](#)[Operating system](#)[Routers](#)[Mobile](#)[Tablets](#)[Laptops](#)[Router gateway](#)[Routers vendors](#)[Zhong](#)[Tp-link](#)[Zyxel](#)[Vodafone](#)[Thomson](#)[Teranet](#)[▶ View all](#)Status : **Active**

عربي





Search Devices



Products--- ▾ Services ▾ Promotions ▾ Devices - test ▾ Global Scripts - Channels ▾ Internal Guideline ▾

Devices

Content Editor

- Any different router rather than Orange , agent should advise the customer to change the software of his/her router in case of being locked from another provider (TE-Dat

Documents



✓		Name	Modified	Modified By
		CPE Configuration IPs	... April 23, 2021	☐ Muhammad Hassan Muhammad Hassan Ext
		Feb 2021 Offers	... February 25, 2021	☐ Karim El Kholy
		Huawei March 2021 Deals	... March 14, 2021	☐ Karim El Kholy
		Iphone March Deal - Updated 16.03.2021	... March 17, 2021	☐ Karim El Kholy
		Low End VDSL Reallocation	... August 30, 2022	☐ Aya Abdu Kamel Ext



Search Devices

Products---

Services

Promotions

Devices - test

Devices

Content Editor

- Any different router rather than Orange , agent should advise the customer to change the software of his/her router

Documents

✓		Name	Modified	Modified By
		D- Link	... March 16, 2021	☐ Esraa Ehab Samir Ext
		Huawei ADSL	... April 23, 2021	☐ Muhammad Hassan Muhammad Hassan Ext
		Huawei VDSL	... April 23, 2021	☐ Muhammad Hassan Muhammad Hassan Ext
		TP-Link	... April 23, 2021	☐ Muhammad Hassan Muhammad Hassan Ext
		ZTE VDSL	... April 23, 2021	☐ Muhammad Hassan Muhammad Hassan Ext

For D-link 2730U Wireless maybe the power led come to red and its mean the router need to reload it's Firmware and it works fine



Main	PPPOA	PPPOE	IPOA Real	IPOA Real+Virtual	IPOE Real	MSAN IPOE Real	IPOE Real+Virtual	MSAN IPOE Real+Virtual
Wireless SSID	Wireless Encryption	MTU	Port Forward	DMZ	Firewall	Password	Reset	Firmware

Please click here :



Static P:
Configu

IP Address 192.168.1.1
User Name admin
Password admin



**For MSAN customer
IPOE**

Authentication

Authentication

- General definition : customer line is physically up with no IP (internet protocol)

IP tool

IPAddress	Logdate
45.246.216.133	1/26/2020 12:59:34 PM

OCTOPUS Tool

Username

Port

0483847191

Search

Line Information

Copper Line Parameters

Traffic

0483847191

Account statusSuspend

PackageTypeCopper

Physical Connection

Pop nameSabk El Dhak

Port Number148

DSLAM NameIPDSL-SBDK-KOM-ATO

DSLAM IP172.24.39.142

Port MappingIPDSL-SBDK-KOM-ATO:1-1-3-48

Session Logs

User name	Bras	Interface	Date	Status
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 4:04:55 PM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 3:49:57 PM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 3:38:35 PM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 2:14:42 PM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 9:09:40 AM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 8:46:57 AM	✓
0483847191	bras-ato	ae1:809-378	Nov 29, 2022, 8:01:25 AM	✓

Line Checker

Checking Session IP✓

Checking Sessions Logs✓

Checking Service Profile✓

Logical Connection

BRAS Namebras-ato

BRAS Interfaceae1:809-378

IP Address197.165.157.229

Username0483847191

Service Profile30M

How to open Authentication WF

The screenshot displays the Orange website's navigation and product sections. At the top left is the Orange logo. A search bar labeled "Search Products" is positioned next to it. On the top right, the user's name "Sara Adel Mohamed Ab..." is shown alongside a notification bell icon. Below the header is a horizontal navigation menu with the following items: "Products", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a downward arrow indicating a dropdown menu. An orange arrow points from the "Products" menu item to a card titled "FREEMAX (OLD) ...". Another orange arrow points from the "Internal Guideline" menu item to a card titled "Home Internet".

Products ▾ **Services** ▾ **Promotions** ▾ **Devices - test** ▾ **Global Scripts - Channels** ▾ **Internal Guideline** ▾ **Customer Support Tools** ▾ **Application Guides** ▾

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

Wi-Fi

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows

Authentication WF

Find in page v ^ Find

ON THIS PAGE

Basic Information ?

Common Asked Questions

Plans

How to Pay ?

How to Manage My Account ?

How to Complain ?

Siebel

Related Offers

Related VASs

Work Instructions

How to Complain

VAS

View All

Premier Customer Bundling with DSL WF

Network

View All

Wlan2

Quota Consumption Issues

Slow Browaing

Transfer from Reseller to another Reseller

Slow Upload

No Browaing

			
	 Authentication Problem	 Browsing Sites Problems	 Connection Unstable
	 No Browsing	 Quota Consumption Issues	 Siebel & Portal problems
	 Slow Browsing	 Slow Upload	 Transfer from Reseller to another Reseller
	 Wlan		




Authentication Problem Troubleshooting

- In case receiving customer complaining that the DSL service isn't working due to Internet led is Off or Red.
- Agent should confirm that the line is physically up through [ADSL Assurance](#) for MSAN and [Octopus](#) for Copper.
- Open IP Tool and confirm that the customer has no IP.

Enter username :	
GET IP	
IPAddress	Logdate

For MSAN Lines Only

- Agent should confirm all the below through ADSL Assurance before creating 40030 SR:
 - Account status should be Active.
 - Connectivity should be MSAN.
 - Customer has no due bills with TE and the voice is working fine.
- In case agent found the dial status is (No Account or any Error except With another ISP):
 - Agent should check the account activation date:
 - In case before 09/2021: agent should create the SR.
 - In case after 09/2021: agent should search for NTRA Reservation from in 14032 SR to attach it in 40030 SR.

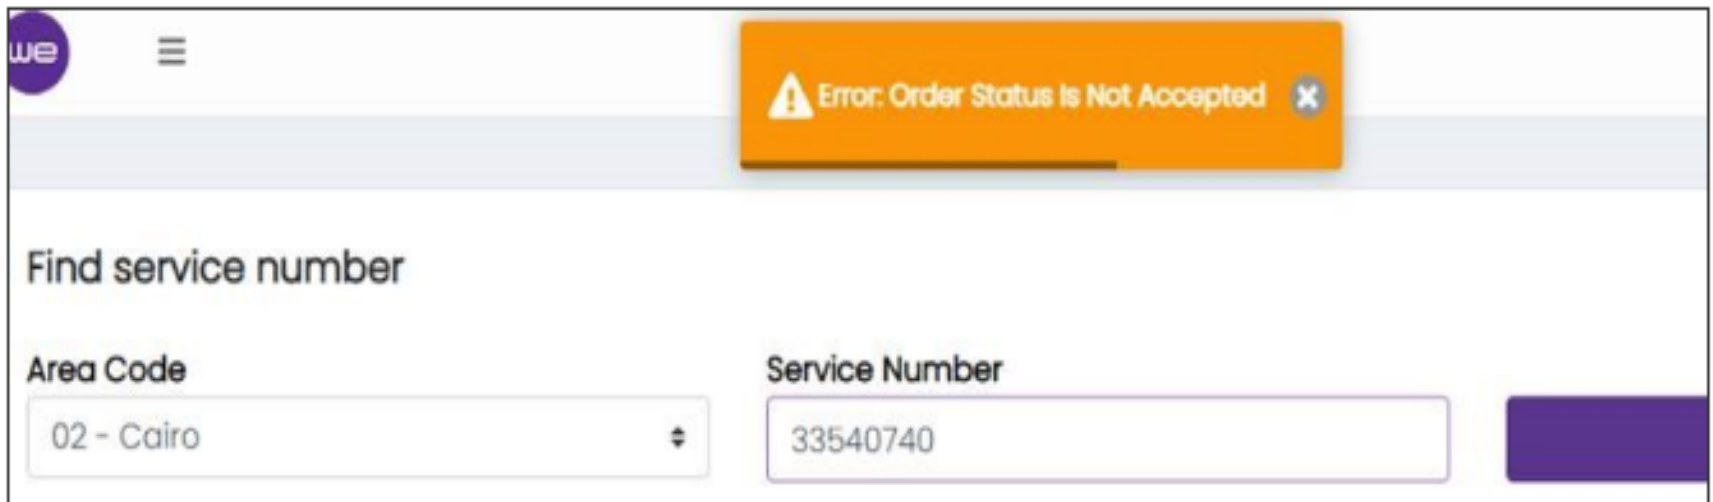

The screenshot shows a web interface with a purple header bar containing a 'we' logo and a menu icon. An orange error banner at the top right reads 'Error: Order Status is Not Accepted' with a close button. Below the banner, the text 'Find service number' is displayed. The form consists of two input fields: 'Area Code' with a dropdown menu showing '02 - Cairo' and a search icon, and 'Service Number' with the text '33540740'. A purple button is located to the right of the 'Service Number' field.

we

Error: Order Status is Not Accepted

Find service number

Area Code

02 - Cairo


Service Number

33540740

- In case agent found the dial status is (Another ISP):

- Agent should check the account activation date:

- In case before 09/2021: agent advise the customer to sign the NTRA Reservation form.
 - In case after 09/2021: agent should search for NTRA Reservation form in 14032 SR to attach it in 40030 SR.

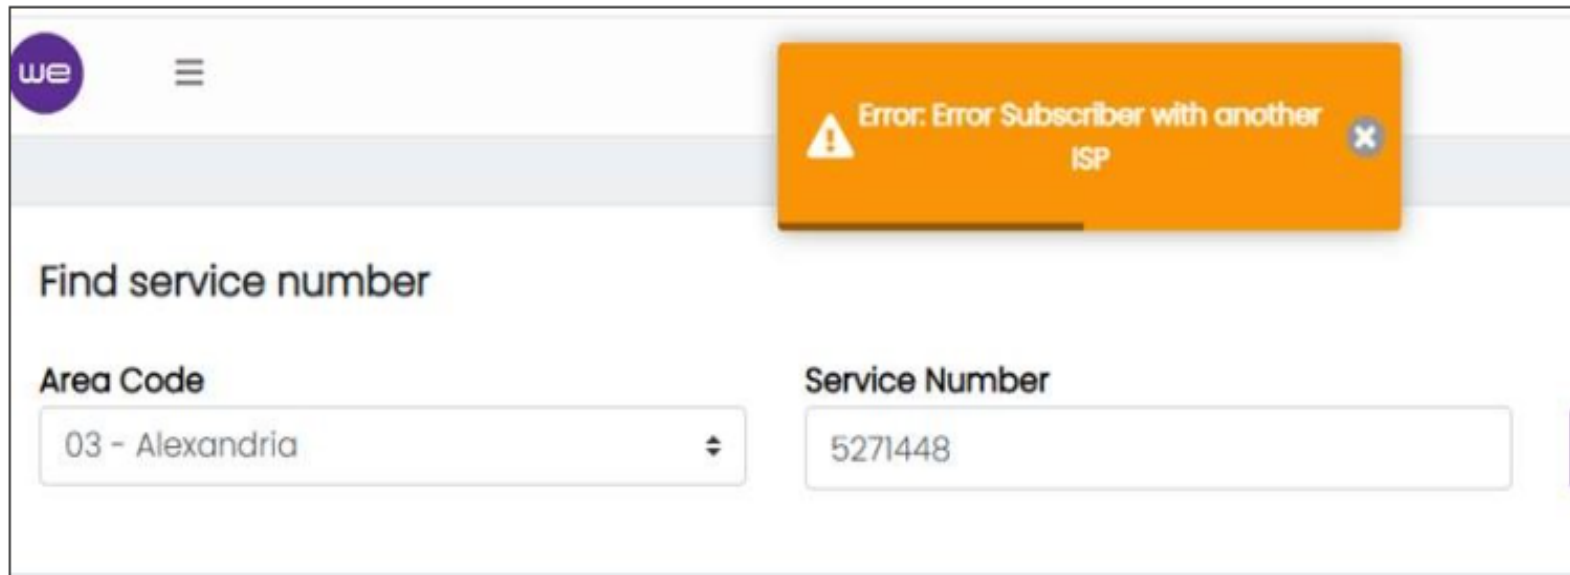

The screenshot displays a web application interface. At the top left, there is a purple circular logo with the letters 'we' and a hamburger menu icon. A prominent orange error message box is overlaid on the right side of the header, containing a warning icon, the text 'Error: Error Subscriber with another ISP', and a close button. Below the header, the main content area is titled 'Find service number'. It features two input fields: 'Area Code' with a dropdown menu currently showing '03 - Alexandria' and a small up/down arrow, and 'Service Number' with a text input field containing the value '5271448'.

Siebel SR

Short Code	Type	Area	Sub Area	Product	Owner Group	SLA	Description
40030	DSL Fault For Connectivity	No Account On Bitstream	--	ADSL	DSL TE Apply	24 Whrs	In case of no account on ADSL Assurance
					2 WDs	In case of no account on Octopus	
			- Unpaid Invoice - Permanently Disconnection - Another ISP - Delegation Required - No data		--	--	In case agent found the line is Copper or NTRA missing/wrong documents

- In case of escalation send mail to: Egypt DSL-Apply-Gov / Egypt DSL-Apply-Cairo and a feedback will be received within 24 working hours.
- Agent should check the old closed SRs subareas before creating new one.
- Agent should check the SR notes in case of unclear closure reason.

Authentication problem

-check username status on octopus

To open octopus, open web page and write the URL : <http://41.128.176.199:8025/#/>

We have three scenarios in Authentication

Login ok

Log in Failed

No logs



 No logs found

To check logs status from Octopus we will check the following points



1- Login OK



Session Logs


User name	Bras	Interface	Date	Status
0248248694	bras05-ram	ae4:97-885	Nov 29, 2022, 10:08:26 AM	
0248248694	bras05-ram	ae4:97-885	Nov 29, 2022, 10:04:07 AM	
0248248694	bras05-ram	ae4:97-885	Nov 29, 2022, 10:01:04 AM	
0248248694	bras05-ram	ae4:97-885	Nov 29, 2022, 6:15:47 AM	

- Reset the customer port via FTTH Tool or octopus.

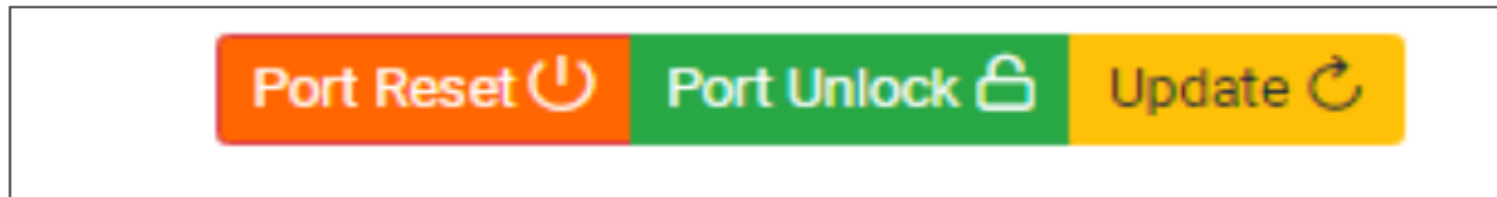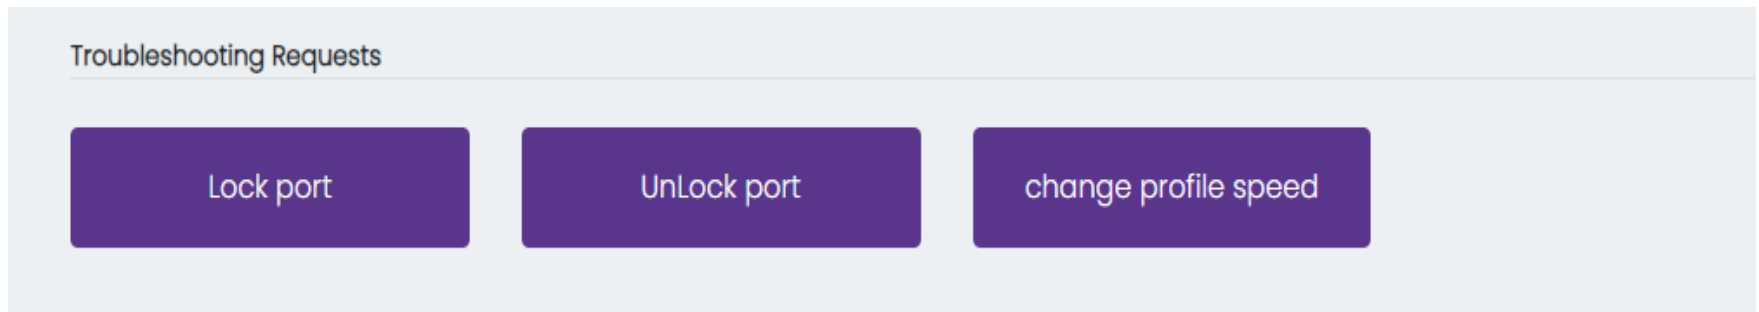

Short Code	Type	Area	Sub Area	Product	Owner Group	Description
40008	Fault For Connectivity	Authentication Problem	Solved - Port Reset	ADSL	DSL Call Center	If customer can browse after resetting the port

- If customer can't browse after resetting the port and problem **isn't solved** please let customer restart the router.

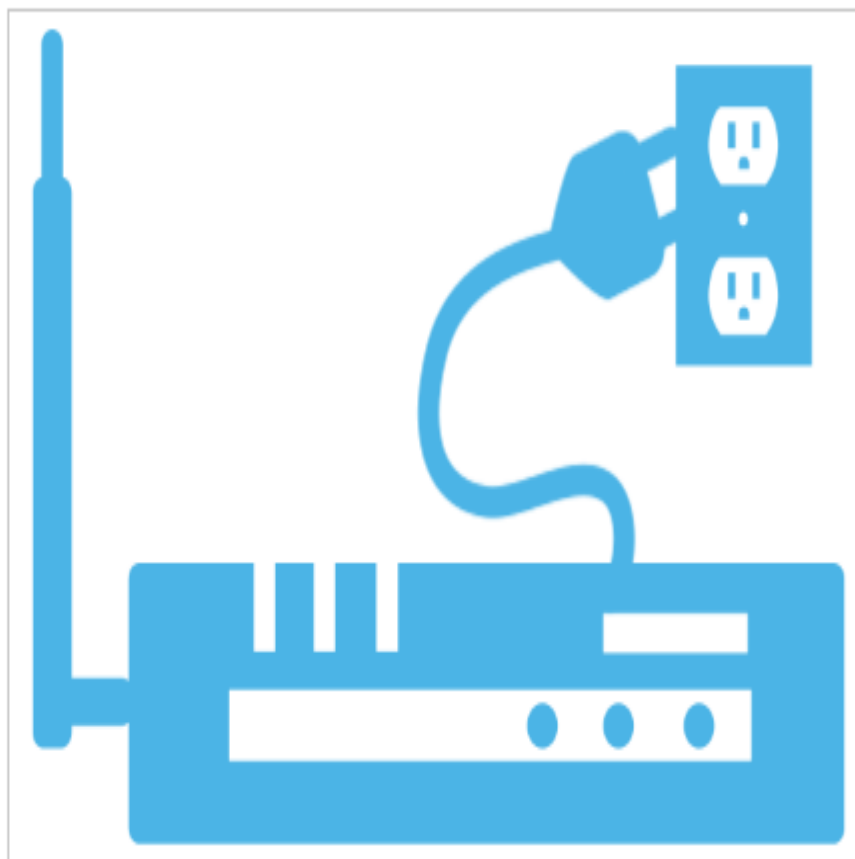

Short Code	Type	Area	Sub Area	Product	Owner Group	Description
40008	Fault For Connectivity	Authentication Problem	Solved - CPE Restarted	ADSL	DSL CC	If customer can browse after restarting the router

Open SR

تمام يااستاذنا انا قدمت لحضرتك طلب والمشكلة هتكون اتحلت خلال ال 24 ساعه القادمة محتاج حضرتك
(تسيب الراوتر شغال ولو بعد 24 ساعه المشكلة لسه موجوده ممكن حضرتك تشرفنا بالاتصال مره تانيه

- Agent should make sure that once authentication SR is opened, it should be auto-assigned to robot (DSL Authentication Admin), if not please assign it manually:

Short Code	Type	Area	Owner Group	SLA	Product	Description
40008	Fault For Connectivity	Authentication Problem	L3-DSL Fixed Technical Consumer Support	24 Hours	ADSL	In case problem isn't solved after restarting the router, Inform our customer to keep the router connected during the next 24H



Login Ok



Login Failed



No Logs

- Agent should check and confirm that Username on Siebel is the same Username on Octopus
- If both are matched as below [Press Here](#)

Username Port

0932559928

Line Information Cabinet Information TE Information Realtime Graph

0932559928 Session Logs

Account status

Some logs are mismatched

- If both are not matched [Press Here](#)



Username Port

0473590369

Line Information Cabinet Information TE Information Realtime Graph

0473590369

Account status NA MSAN

Physical Connection

Cabinet Code 09-2-25-01

Shelf Number 1

Peering Point ATC-0th Peering

Session Logs

Some logs are mismatched.

User name	Bras	Interface	Date	Status
0473630312-aun	bras-ato	ae4:1962-185	Oct 1, 2024, 11:05:37 AM	×
0473630312-cun	bras-ato	ae4:1962-185	Oct 1, 2024, 11:05:28 AM	×
0473630312-cun	bras-ato	ae4:1962-185	Oct 1, 2024, 11:05:20 AM	×
0473630312-aun	bras-ato	ae4:1962-185	Oct 1, 2024, 11:05:13 AM	×
0473630312-aun	bras-ato	ae4:1962-185	Oct 1, 2024, 11:04:57 AM	×
0473630312-aun	bras-ato	ae4:1962-185	Oct 1, 2024, 10:34:49 AM	×
0473630312-cun	bras-ato	ae4:1962-185	Oct 1, 2024, 10:34:37 AM	×

We should match the username on session logs with username on Siebel



 Wrong Username	 TR069	 Another ISP
---	---	--

- In case agent found the Log on Octopus has a minor difference in the username than Siebel username (Such as only 1 missing/wrong digit, a symbol, a space capital/small letter,...etc):
 - Agent should open the router's page and modify the username to be same as Siebel username.
 - In case solved, agent should create the relevant SR and close it with the proper Sub Area.
 - In case not solved, agent should reset the customer's router and re-configure.
 - If Solved, Create the relevant SR and close it with the proper Sub Area.
 - If Not Solved, create the relevant SR to be assigned to the concerned team.

Siebel SR

Short Code	Type	Area	Sub Area	Product	Owner Group	Description
40008	Fault For Connectivity	Authentication Problem	Solved - Username configuration	ADSL	DSL Call Center	In case problem solved after modifying the username customer's page
			Solved Cpe Reset And Configure			In case problem solved after router reset & configuration
					L3-DSL Fixed Technical	Agent should make sure that once authentication is successful, the customer can access the internet.



 Wrong Username	 TR069	 Another ISP
---	--	--

- In case agent found the username on the Log on Octopus is totally different than Siebel username (another land line number):
- Agent should Check if wrong username due to TR069 problem by checking router simulation then opening router page and Remove TR069 Mark and configure the offline:

Cabinet Information

TE Information

Realtime Graph

2048/1024

MSAN

Session Logs

Some logs are mismatched.

User name	Bras	Interface	Date	Status
0932710610	bras-ato	ae4.262-1257	Dec 13, 2023, 3:51:40 PM	✗
0932710610	bras-ato	ae4.262-1257	Dec 13, 2023, 3:51:36 PM	✗
0932710610	bras-ato	ae4.262-1257	Dec 13, 2023, 3:51:31 PM	✗
0932710610	bras-ato	ae4.262-1257	Dec 13, 2023, 3:51:00 PM	✗

Line Checker

Checking Session IP

✗

Checking Sessions Logs

✓

Checking Cabinet Status

✓

Checking Service Profile

✗

Logical Connection

Short Code	Type	Area	Sub Area	Product	Owner Group	Description
40008	Fault For Connectivity	Authentication Problem	Solved By Removed TR609	ADSL	DSL Call Center	In case problem solved after removing TR069 Mark
			--		L3-DSL Fixed Technical Consumer Support or Data Tech Con Support-Network 24 Hours	Agent should make sure that once authentication SR is opened, it should be auto-assigned to robot (DSL Authentication Admin), if not please assign it manually

- In case of exceeding SLA with no feedback, agent should send email to "Data Tech Con Support-Network" or "L3-DSL Fixed Technical Consumer Support "and feedback will be recieved within 1 WD.



 Wrong Username	 TR069	 Another ISP
---	---	--

- In case the log contains another ISP name (TE Data, Vodafone, Etisalat,...etc):
- Agent should ask the customer if the router is from Orange side or not.
- If yes, agent should reset the router and re-configure.
- If no, agent should ask the customer to check his/her router's software.

Information

Cabinet Information

TE Information

Realtime Graph

0233537695

ent status

age

NA

MSAN

Physical Connection

net Code

04-1-07-49

Session Logs

Some logs are mismatched.

User name	Bras	Interface	Date	Status
76155484@tedata.net.eg	bras03-ram	ae12:1094-524	Dec 13, 2023, 6:50:38 PM	✖
76155484@tedata.net.eg	bras03-ram	ae12:1094-524	Dec 13, 2023, 6:48:22 PM	✖
76155484@tedata.net.eg	bras03-ram	ae12:1094-524	Dec 13, 2023, 6:48:09 PM	✖
76155484@tedata.net.eg	bras03-ram	ae12:1094-524	Dec 13, 2023, 6:46:05 PM	✖

Line Checker

Checking Session IP

Checking Sessions Logs

Checking Cabinet Status

Checking Service Profile

Logical Connection

Short Code	Type	Area	Sub Area	Product	Description
40008	Fault For Connectivity	Authentication Problem	Solved Cpe Reset And Configure	ADSL	In case problem solved after Router's Reset & Reconfigure
			Not Solved Customer Side Issue		In case not solved due to customer's router issue

- In case customer has login failed with matched username, call assist hunt (08100) even if customer doesn't have Inner VLAN or Cabinet code mismatch to confirm that there is no mismatch on falcon as well.

Compare between Octopus & TE-Portal (Cabinet Code & Inner VLAN)

1-If Customer has Cabinet code Miss match

*OCTOPUS



Physical Connection	
Cabinet Code	02-2-71-08
Shelf Number	1
Peering Point	RAM-7th Peering

*FTTH Tool

port_TYPE VDSL	VOICE_STATUS USED	DATA_STATUS USED	SERVICE_ID UBBT
EXCHANGE_NAME BOLAQELDAKROR_1...GZ;BLIGZ;- 1 بولاق الدائم	MSAN_VENDOR HUAWEI	MSAN_CODE 04-1-01-31	DATA_SLOT 12
DATA_PORT 2	TE_SHELF 2	PACKAGE_NAME WE30	VPI 0
VCI 35			

Short Code	Type	Area	Product	Description
40025	Fault For Connectivity	Mismatch Cabinet Code	ADSL	Create SR & Call 08100 to fix it and Assist member will close it

2- If Customer has Inner VLAN Mismatch

*OCTOPUS

Logical Connection	
Bras	bras02-ram
Interface	ae8:3806-669
IP Address	41.129.237.194
Username	0503942604
Login Time	Dec 16, 2024, 6:29:16 PM



*FTTH Tool

GetCrossConnection

Dec 17, 2024, 12:04:40 PM

True

Profile Index: 22, Outer Vlan: 1705, Inner Vlan: 422,



Short Code	Type	Area	Product	Description
40024	Fault For Connectivity	Mismatch Inner VLAN	ADSL	In case Mismatch Inner VLAN & CVLAN call 08100 to fix it and Assist member will close it

3- No Account on Falcon

Short Code	Type	Area	Product	Owner Group	SLA	Description
40027	Fault For Connectivity	Auth Prob no account on Falcon	• DSL-Active Account • DSL-Candidate Account • FTTH	Data Tech Con Support-Network	24H	In case customer has No Account On Falcon after referring to Assist Team

4- If customer hasn't problem in Cabinet Code or Inner VLAN

Troubleshooting Requests

Lock port

UnLock port

change profile speed

Port Reset



Port Unlock




Update



Short Code	Type	Area	Sub Area	Product	Description
40008	Fault For Connectivity	Authentication Problem	Solved-Port Reset	ADSL	If customer can browse and problem solved

If customer can't browse and problem **isn't solved** so let customer restart the router

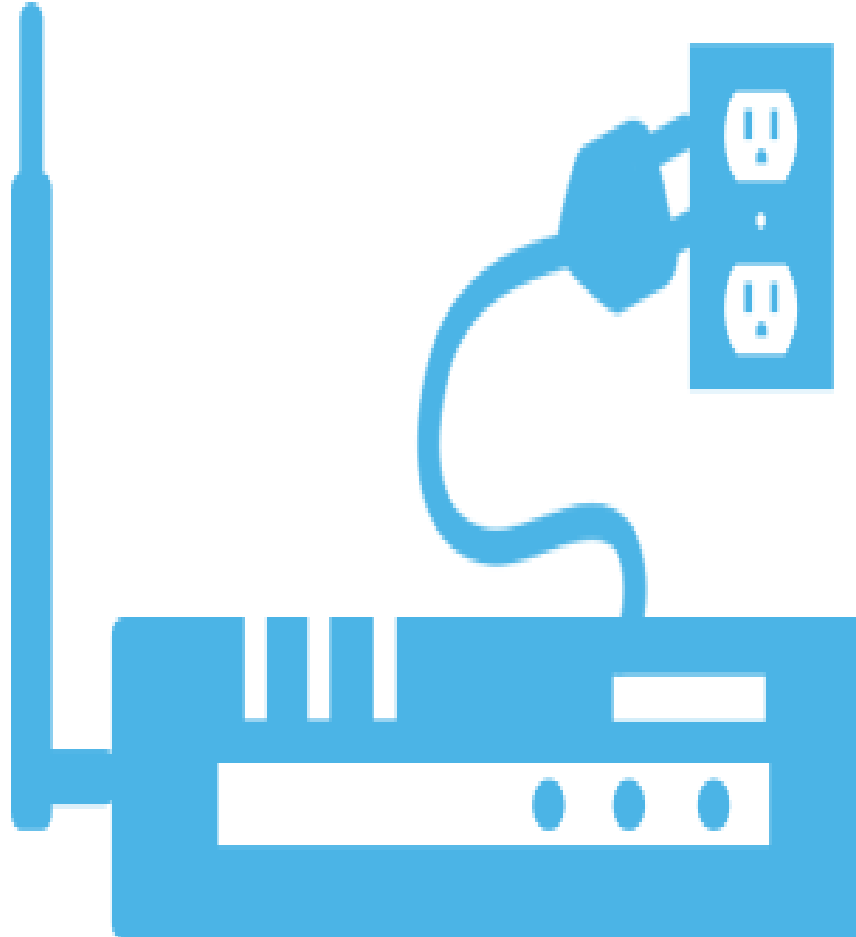



Open SR

تمام يااستاذنا انا قدمت لحضرتك طلب والمشكلة هتكون اتحلت خلال ال 24 ساعه القادمة
محتاج حضرتك تسبب الراوتر شغال ولو بعد 24 ساعه المشكلة لسه موجوده ممكن حضرتك
تشرفنا بالاتصال مره تانية

Short Code	Type	Area	Sub Area	Product	Description
40008	Fault For Connectivity	Authentication Problem	Solved-CPE Restarted	ADSL	If the problem solved after restarting the router

Short Code	Type	Area	Owner Group	SLA	Description
40008	Fault For Connectivity	Authentication Problem	DSL Authentication Admin	24 hours	If the problem isn't solved after restarting the router Inform the customer to keep the router connected during the next 24 H

- Agent should make sure that once authentication SR is opened, it should be auto-assigned to robot (DSL Authentication Admin), if not please assign it manually.
- In case of exceeding SLA with no feedback, agent should send email to "Egypt L3 technical consumer support <L3consumersupport-eg@orange.com>" and feedback will be recieved within 1 WD.

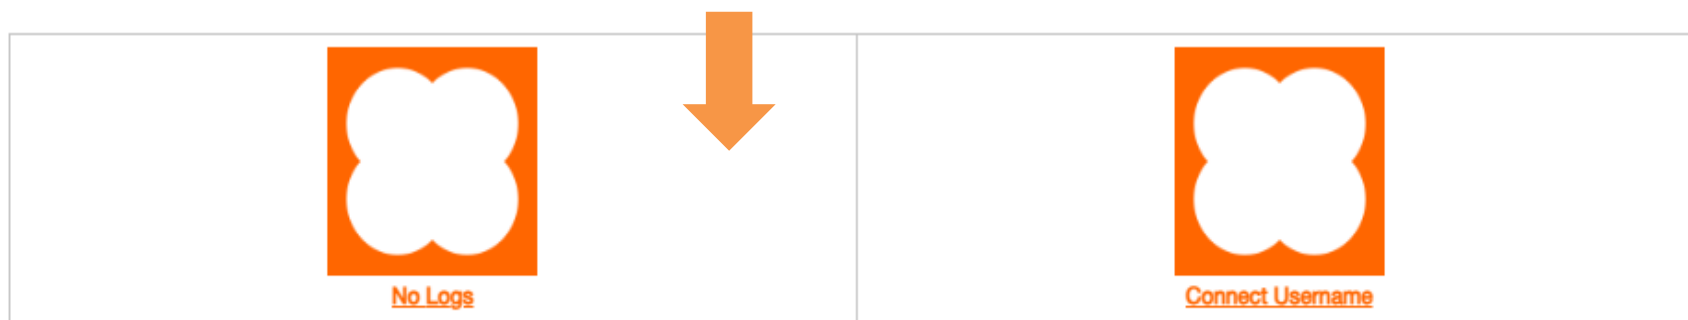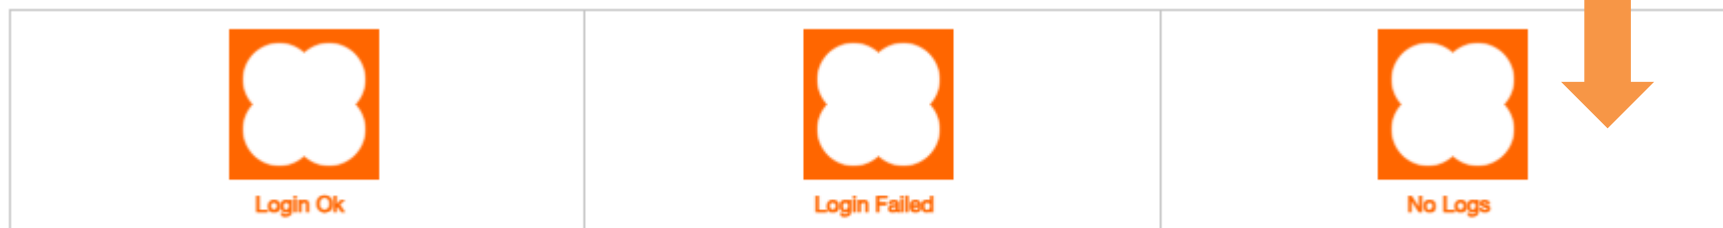


- In case the line is physically up and not authenticated with no logs on Octopus, check the TCP tool <http://41.128.176.206:9030> , and if the cabinet has no traffic create the following SR: MSAN CPM Tool Guide.pptx
- Tool's UN and PW:

USER	PASS
csuser	123456

Siebel SR

Short Code	Type	Area	Sub Area	Product	Owner Group	SLA
40031	DSL Fault For Connectivity	Cabinet Has No Traffic	--	- DSL-Active Account - DSL-Candidate Account - FTTH	L3-DSL Fixed Technical Consumer Support	48 Hours

- If the cabinet has traffic normally:
- Reset the customer port via TE Portal by pressing on "Lock port then Unlock port" for MSAN Lines:

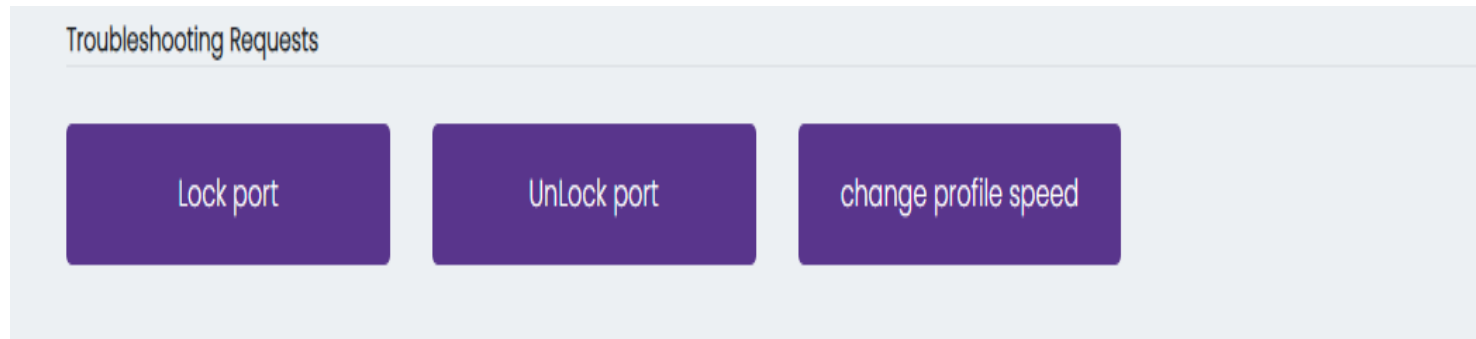

Short Code	Type	Area	Sub Area	Product	Owner Group	Description
40008	Fault For Connectivity	Authentication Problem	Solved - Port Reset	ADSL	DSL Call Center	If customer can browse after resetting the port

- If customer can't browse after resetting the port and problem **isn't solved** please let customer restart the router:



Login Ok



Login Failed



No Logs

Open SR

تمام يااستاذنا انا قدمت لحضرتك طلب والمشكلة هتكون اتحلت خلال ال 24 ساعه القادمة
محتاج حضرتك تسيب الراوتر شغال ولو بعد 24 ساعه المشكلة لسه موجوده ممكن حضرتك
تشرفنا بالاتصال مره تانيه

- In case not solved after restarting the router, agent should reset & reconfigure the router.
- If problem still exists after router configuration, agent should create the below SR and make sure it is auto-assigned to robot (DSL Authentication Admin), if not please assign it manually:

Short Code	Type	Area	Owner Group	SLA	Product	Description
40008	Fault For Connectivity	Authentication Problem	L3-DSL Fixed Technical Consumer Support	24 Hours	ADSL	In case problem isn't solved after restarting the router, Inform our customer to keep the router connected during the next 24H



- In case agent was checking the logical connection on **Octopus** and found the customer has "**Connect Issue**":
 - Agent should open the router's page and modify the username to be same as Siebel username.
 - In case solved, agent should create the relevant SR and close it with the proper Sub Area.
 - If Not Solved, create the relevant SR to be assigned to the concerned team.

Logical Connection

Bras	HUA-BNG01-RAM
Interface	Eth-Trunk1:574-303
IP Address	45.246.216.125
Username	connect@TR069
Login Time	Dec 17, 2023, 11:12:06 AM
Service Profile	default

Short Code	Type	Area	Sub Area	Owner Group	Product	Description
40008	Fault For Connectivity	Authentication Problem	Solved - Username configuration	DSL CC	ADSL	In case problem solved after modifying the username on customer's page
			--	L3-DSL Fixed Technical Consumer Support 24 Hours		In case not solved after modifying the username on customer's page

No Browsing

That's mean customer authenticated with IP ,all router leds are up with right light but he can't browse **all** web sites .

How to open no browsing WF



Search Products

Sara Adel Mohamed Ab...

Products---

Services

Promotions

Devices - test

Global Scripts - Channels

Internal Guideline

Customer Support Tools

Application Guides

↑

Orange portfolio introducing new, s... and attractiv...

↑

Name is El-Primo C&C line valid for 1 year for on...

↑

attractive tariffs p... Dolphin" to meet all of...

↑

monthly promises to expand the choosing base & to...


FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...



WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

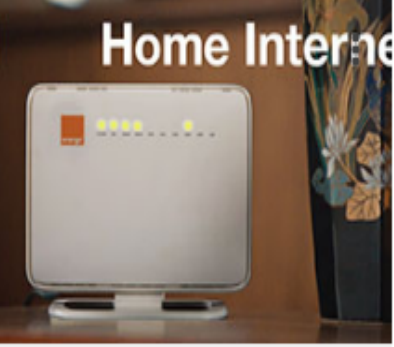

HOME DSL PACKA...

Home DSL Packages.



DSL BACK OFFICE

DSL Back Office Workflows

No Browsing WF

ON THIS PAGE

Basic Information 

Common Asked Questions

Plans

How to Pay 

How to Manage My Account 

How to Complain  

Siebel

Related Offers

How to Complain

Network

[View All](#)

 [Transfer from Reseller to another Reseller](#)

 [Quota Consumption Issues](#)

 [Slow Upload](#)

 [Slow Browsing](#)

 [No Browsing](#) 

 [Wlan](#)

- We have to confirm that line is up , authenticated and doesn't have redirection page
- **Check IP on IP Tool as below**

IPAddress	Logdate
45.246.216.133	1/26/2020 12:59:34 PM

Check if there is any redirection page or not through Siebel as below

RedirectionFlag1	0
RedirectionFlag2	0
RedirectionFlag3	0

ErrorCode	er0000
ErrorMsg	Success
Status	1

- Confirm that the line is physically up, stable & authenticated.
- Advise the customer to open any browser and type this IP (172.217.23.100).
-
- Check which page the customer is directed to.



Short Code	Type	Area	Product	Owner Group	SLA
40016	DSL Fault For Connectivity	TE-Redirection	- DSL-Active Account - DSL-Candidate Account - FTTH	L3-DSL Fixed Technical Consumer Support	48 Hours

انا واضح عندي يافندم ان في مشكلة فنية على خط حضرتك.
 انا هقدم لحضرتك شكوى وهيتم التواصل مع حضرتك خلال 48 ساعه



- Reset the port for Copper line.
- Lock & Unlock for MSAN Line.



- Create and close the following Siebel SR:


Siebel SR

Short Code	Type	Area	Sub Area	Product
40013	DSL Fault For Connectivity	No Browsing	Solved-Port Reset	ADSL

- Reset the port for Copper line.
- Lock & Unlock for MSAN Line.



- Ask the customer to restart the router.

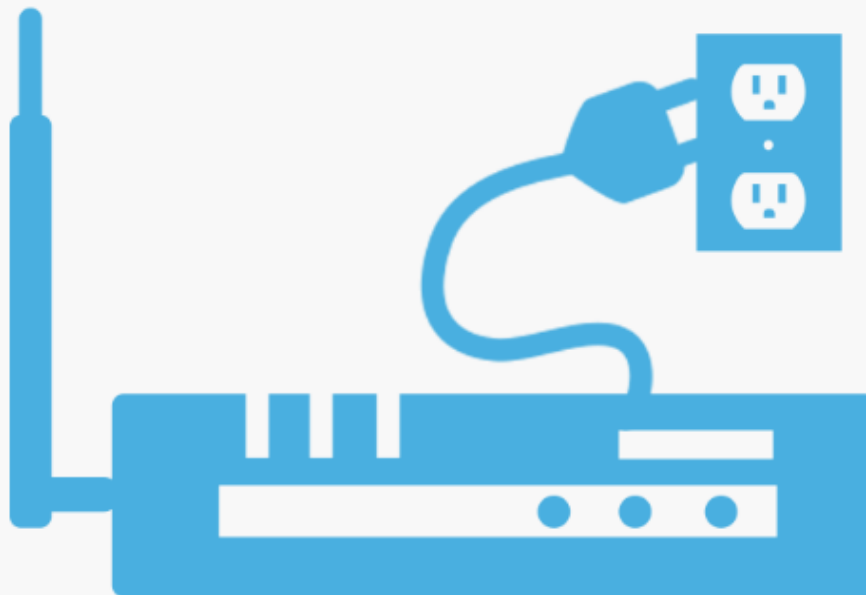


- If issue is solved after CPE restart

- Create and close the following Siebel SR:

Siebel SR

Short Code	Type	Area	Sub Area	Product
40013	DSL Fault For Connectivity	No Browsing	Solved CPE Restarted	ADSL

- Ask the customer to restart the router.

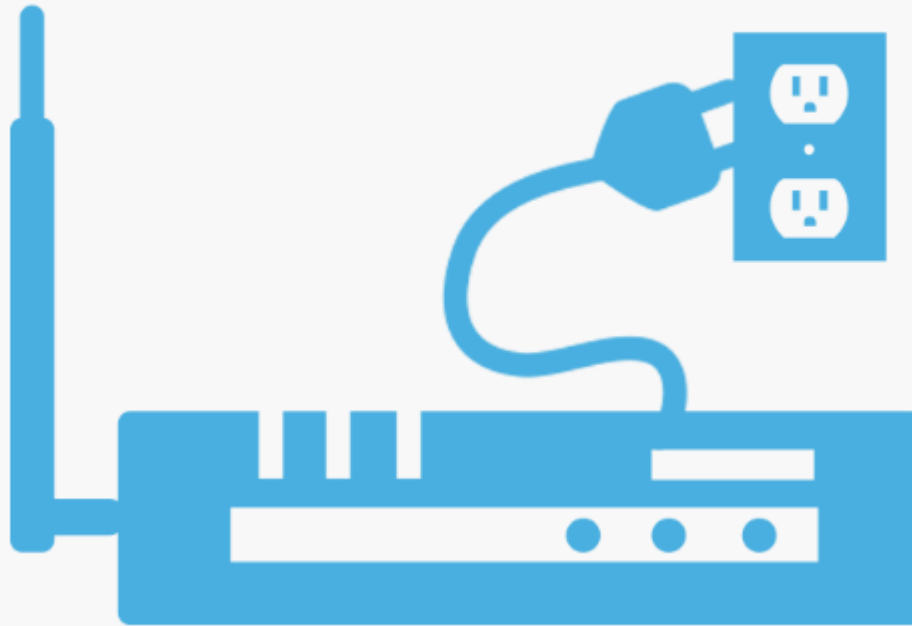

Customer Can browse



Customer Can't browse



- Check customer's QOS Profile through PCRF and Connected with IP through tool

QOS Found



PCRF Main Package ADSL Usage	
Main Package Data	
PackageName	Home Internet 225
CurrentDownload	30720 KBs
CurrentUpload	3072 KBs

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

QOS not found

PCRF Main Package ADSL Usage	
Main Package Data	
PackageName	Home Internet 160 (30 Mbps)
CurrentDownload	0 KBs
CurrentUpload	0 KBs

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

Redirection Problem

RedirectionFlag1	REDIRECT_ACTIVATION
RedirectionFlag2	0
RedirectionFlag3	0

If Customer can't browse, Check customer services type Dynamic IP or 1 Static IP from SRs on Siebel:

- Check customer's connection type through Siebel.

 Dynamic	 1 Static IP	 8 Or 16 Static IPs
--	---	---





Connected Using PC



Connected Using Mobile/tablet



- In case the customer faced this message "no internet secured" guide the customer to:
- Check date & time on his/her PC.
- If solved, create and close the following Siebel SR:

Siebel SR

Short Code	Type	Area	Sub Area	Product
40013	DSL Fault For Connectivity	No Browsing	Solved PC setting	ADSL

- If not solved:

Check IPs & GW on TCP/IP Settings

Windows 98

Windows me

Windows XP



Windows Vista


Windows 7

Windows 8 & 10


MAC




- Open Start Menu and open Control Panel

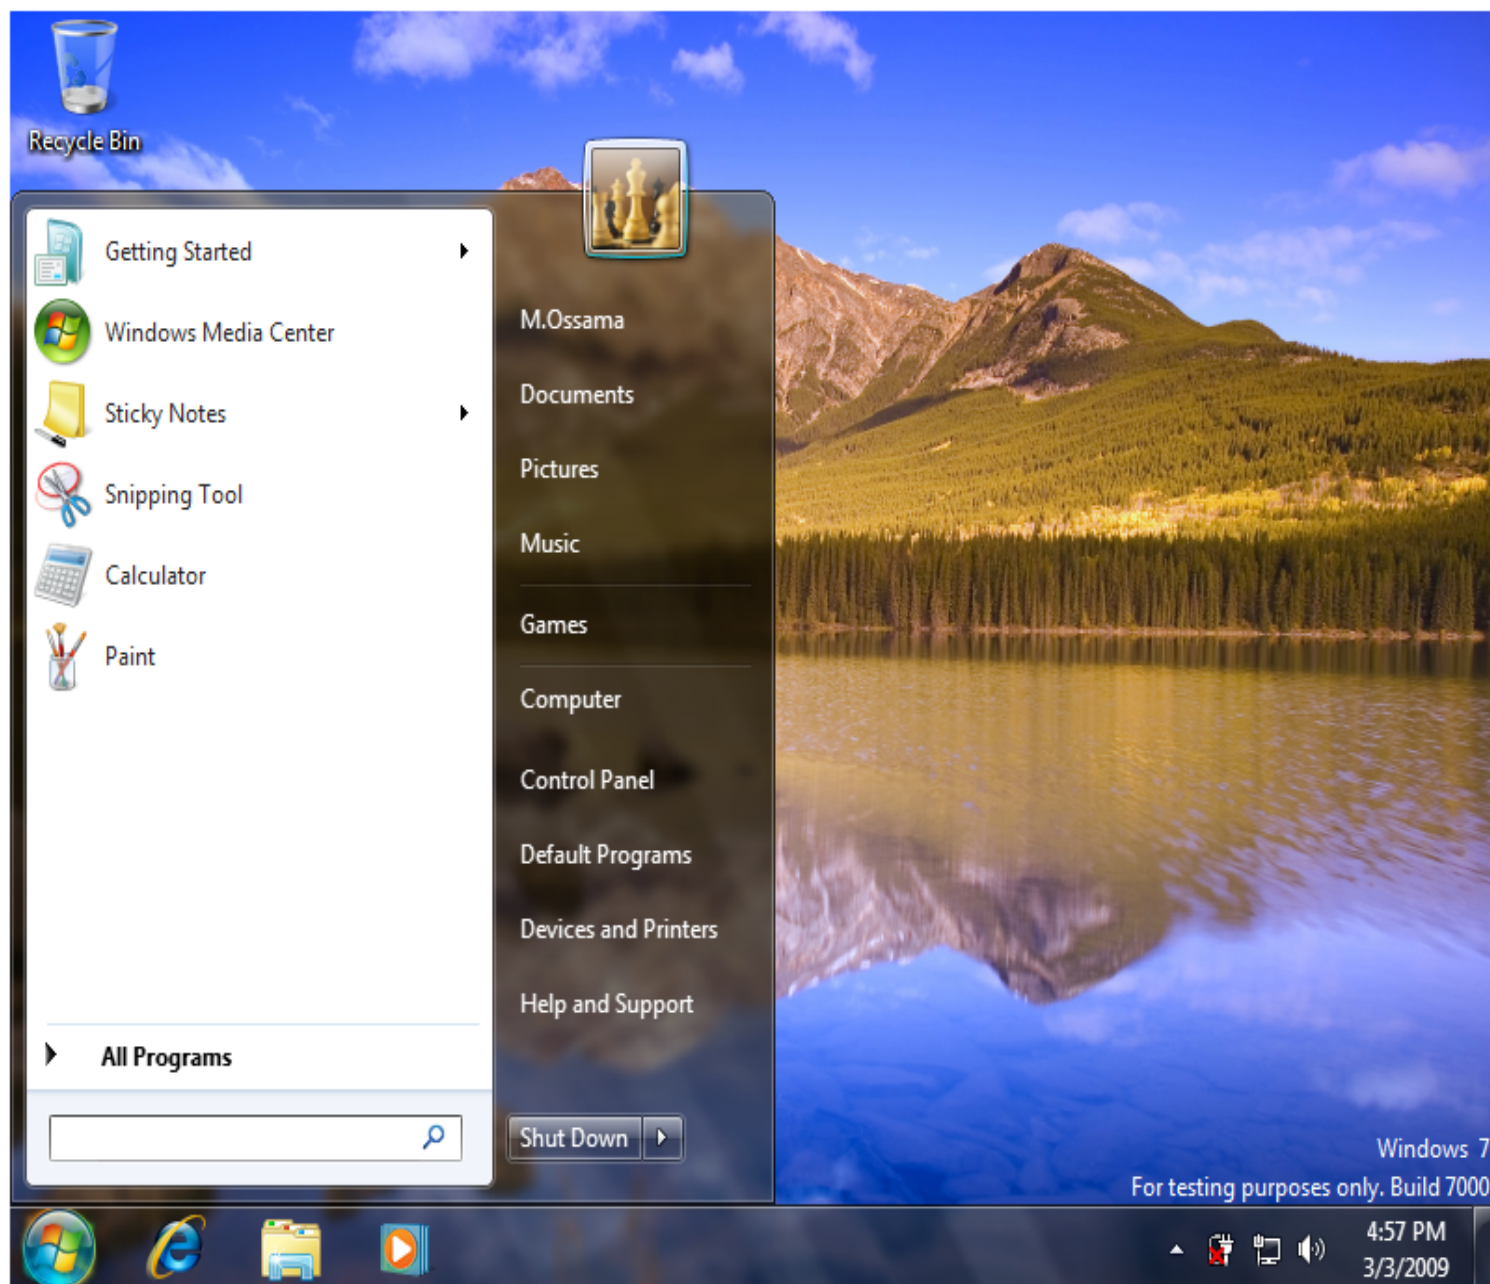


Open Network and Sharing Center (or Network and Internet then Network and Sharing Center)

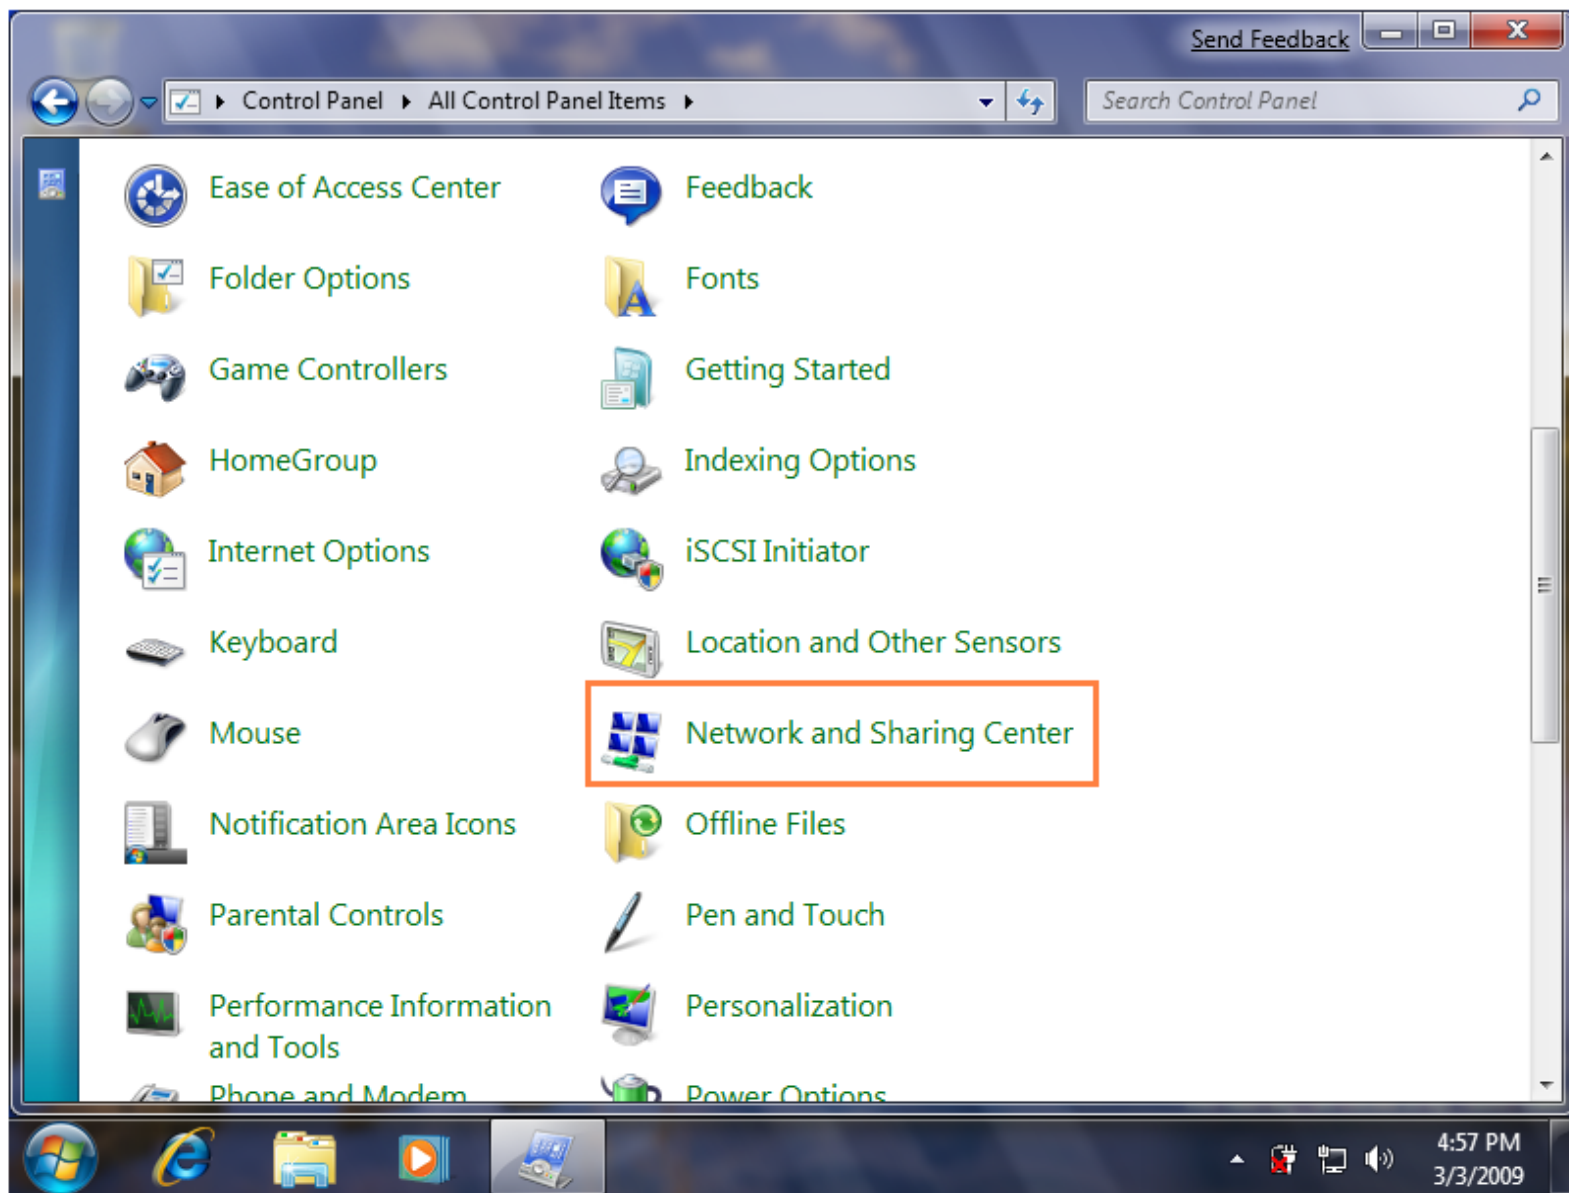


- Click on Change adapter settings on the left menu

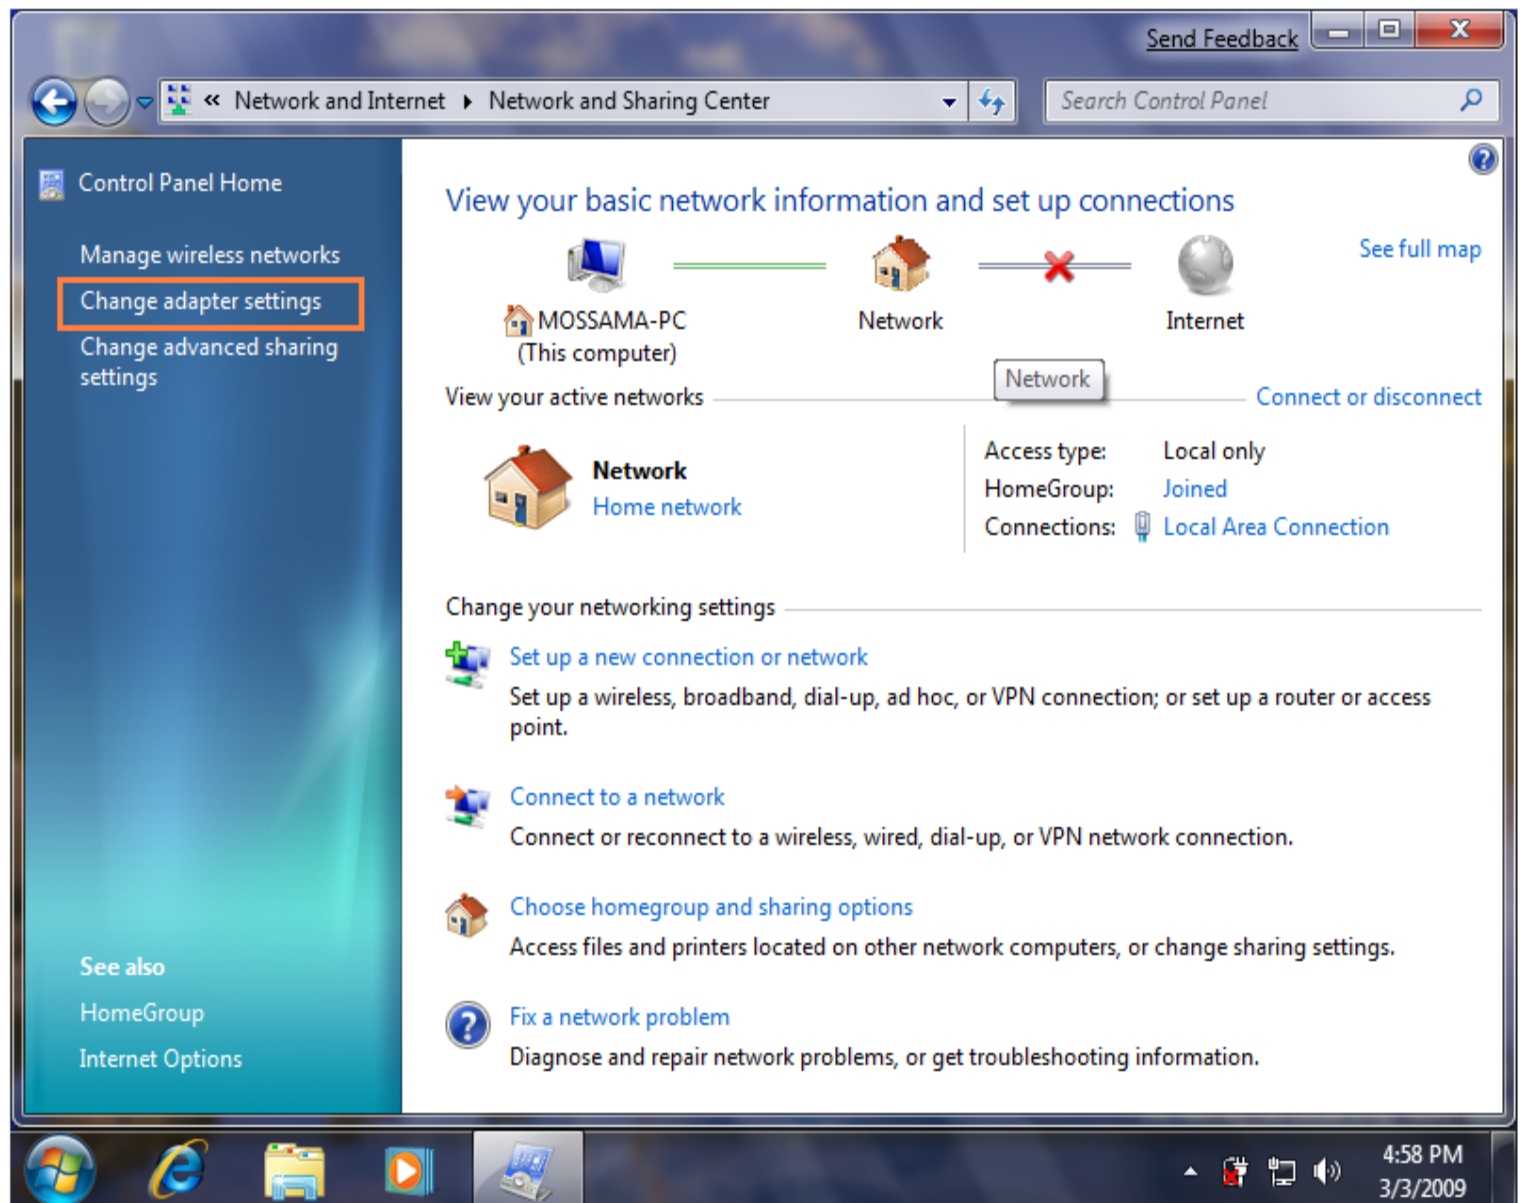


Press right click on whatever the Local Area Connection or the Wireless Network Connection and choose Properties

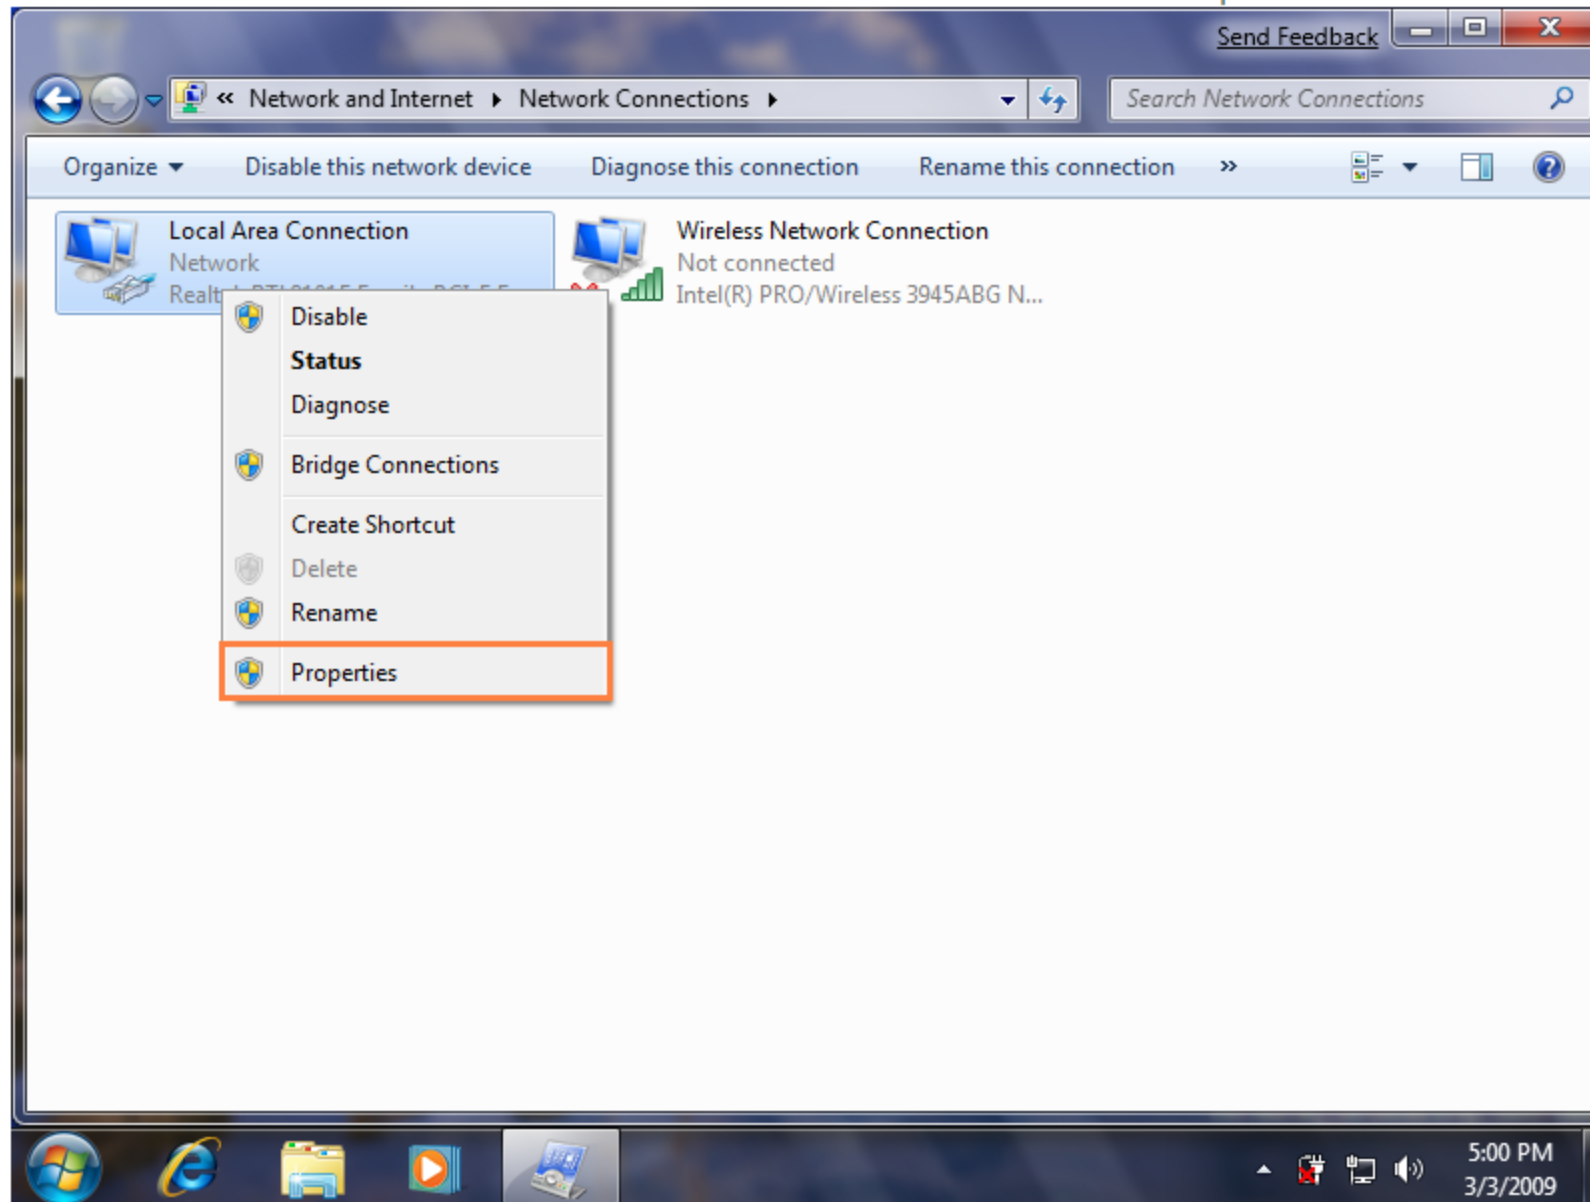

Double Click on Internet Protocol Version 4 (TCP/IPv4)

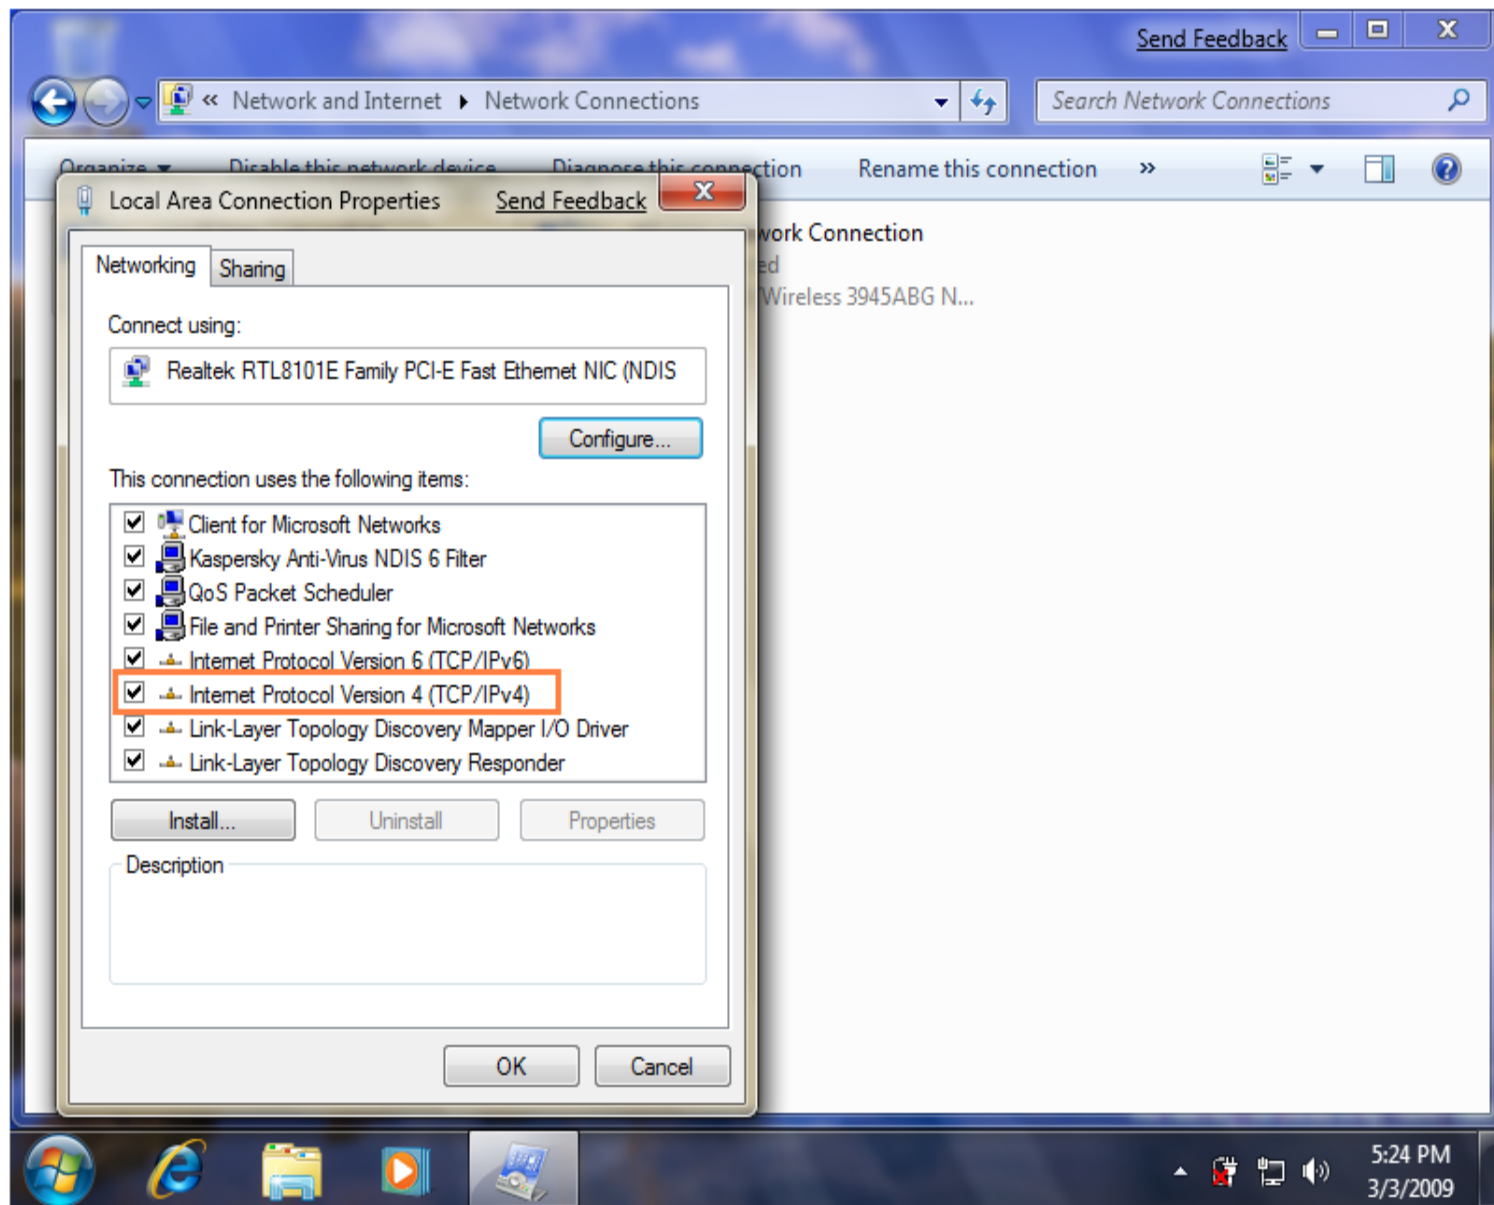

- Chose Use the following IP address , add the IPs , DNS and click OK

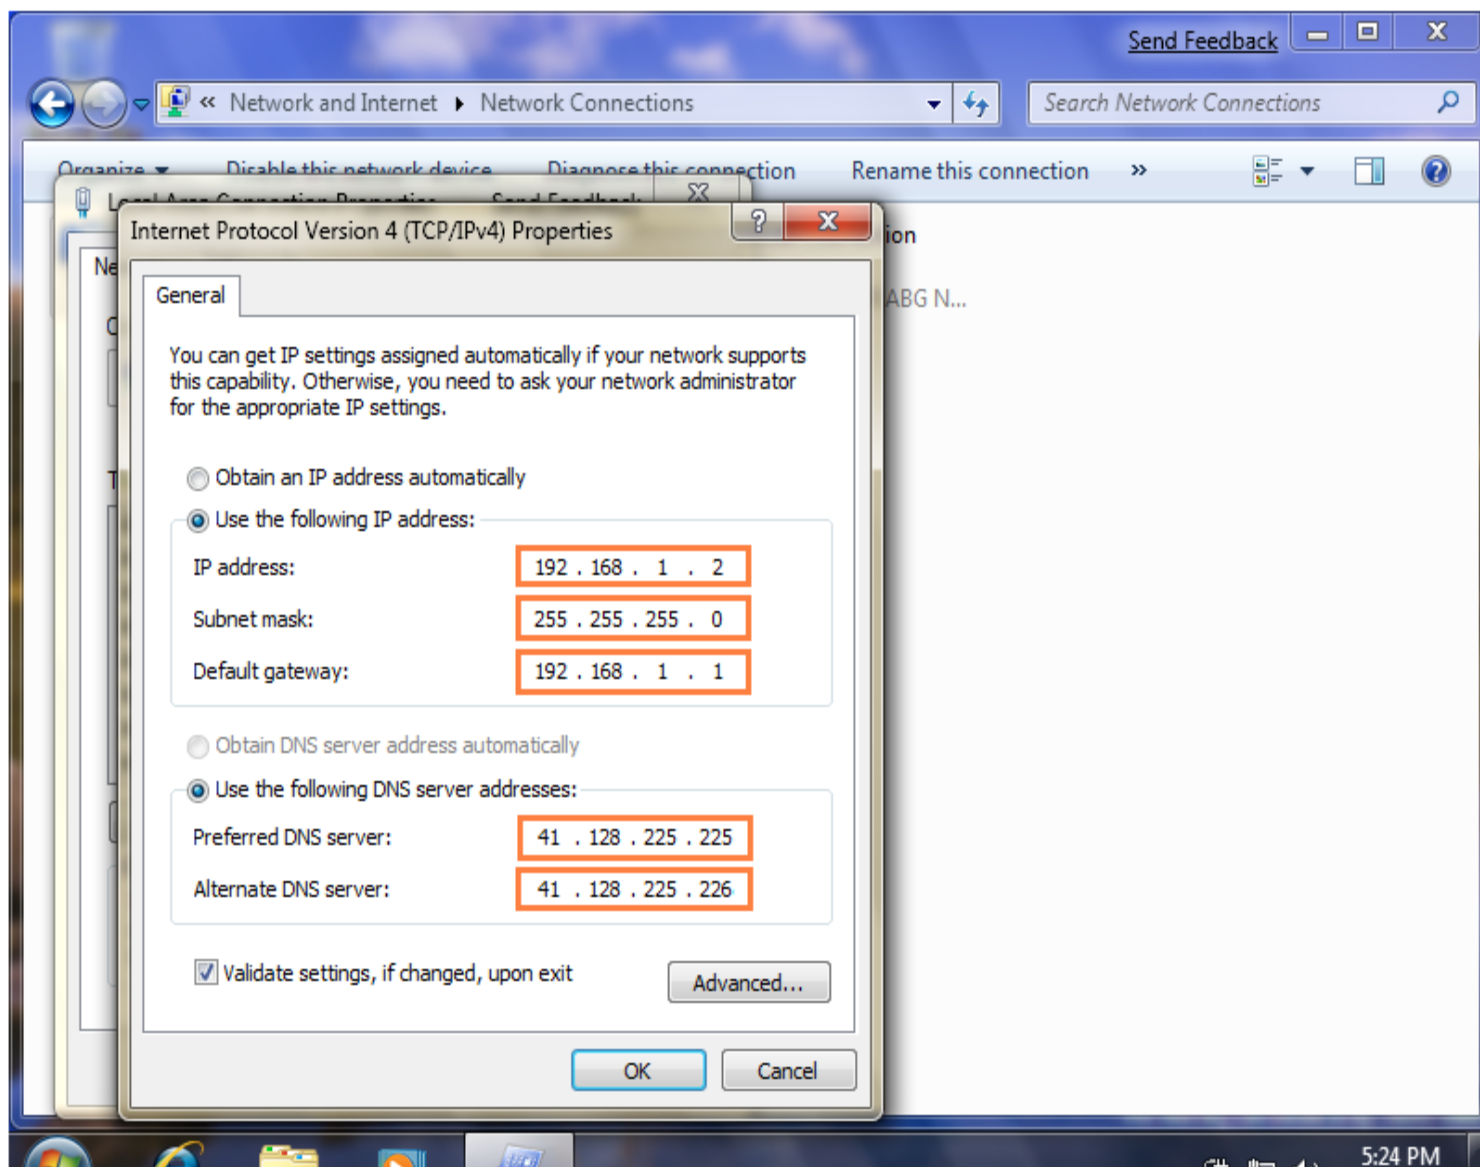

If issue is solved after checking TCP/IP Setting create the below SR

 Solved	 Not Solved
--	--



Close the below SR:

Short Code	Type	Area	Product	Owner Group	Sub Area	Status	Smart Script
40013	DSL Fault For Connectivity	No Browsing	ADSL	DSL Call Center	Solved PC setting	Closed	No



Solved



Not Solved



- Try to reset and Re-configure CPE
- You can check router simulation



Customer Can browse



Customer Can't browse

If Issue is solved after reset and Re-configure CPE ,create the below SR

Short Code	Type	Area	Sub Area	Product	Description
40013	Fault For Connectivity	No Browsing	Solved-CPE Reset And Configure	ADSL	If the customer can browse and problem solved



Script:

تمام يا أستاذة..... أنا سجلت الطلب لحضرتك وفي خلال الـ 24 ساعة اللي جاية فيه حد هيتواصل مع حضرتك من جانبنا لحل المشكلة ونستأذنك تسبب الراوتر شغال .

Short Code	40013
Type	DSL Fault For Connectivity
Area	No Browsing
Product	ADSL
Owner Group	Data Tech Con Support-Network
Sub Area	Empty
Status	Open
Smart Script	Yes
SLA	24 H

No Browsing

No Browsing

customer connected and had QoS★

Configure DNS★

Can ping Google.com★

Reconfigure CPE★

Customer mobile Number★

Username★

PreviousNext

Service Requests

Activities

360° View

Attachment

Service Requests

Record Count	Smart Script					
Short Code	Type	Area	Sub Area	Product	Status	
40013	DSL Fault For Connectivity	No Browsing		ADSL	Opened	

In case customer has no browsing while using mobile and doesn't have PC

Orange DSL



- Forget network name and reconnect again, If problem solved, Please create the below SR:

Short Code	Type	Area	Sub Area	Product
40013	DSL Fault For Connectivity	No Browsing	Solved - Mobile Settings	ADSL

If Problem Still Exists,

Reset and reconfigure the customer's router

Solved



Not Solved

Short Code	Type	Area	Sub Area	Product	Description
40013	Fault For Connectivity	No Browsing	Solved-CPE Reset And Configure	ADSL	If the customer can browse and problem solved

If issue is still existed



Solved



Not Solved



Script:

تمام يا استاذة..... انا قدمت طلب لحضرتك وفي خلال ال 24 ساعه اللي جايه هيثم التواصل مع حضرتك من جانبنا لحل المشكلة الفنية

Short Code	40013
Type	DSL Fault For Connectivity
Area	No Browsing
Product	ADSL
Owner Group	Data Tech Con Support-Network
Sub Area	Empty
Status	Open
Smart Script	Yes
SLA	24 H

No Browsing

No Browsing

customer connected and had QoS★

Configure DNS★

Can ping Google.com★

Reconfigure CPE★

Customer mobile Number★


Username★

Service Requests						
Record Count	Smart Script					
Short Code	Type	Area	Sub Area	Product	Status	
40013	DSL Fault For Connectivity	No Browsing		ADSL	Opened	

- Check customer's connection type through Siebel.



- Agent should check customer's IP through Siebel either from "Activation Request Details" or from "Add Static IP" SR.
- In case not found, agent can call Assist team on hunt in order to check it through Falcon tool.

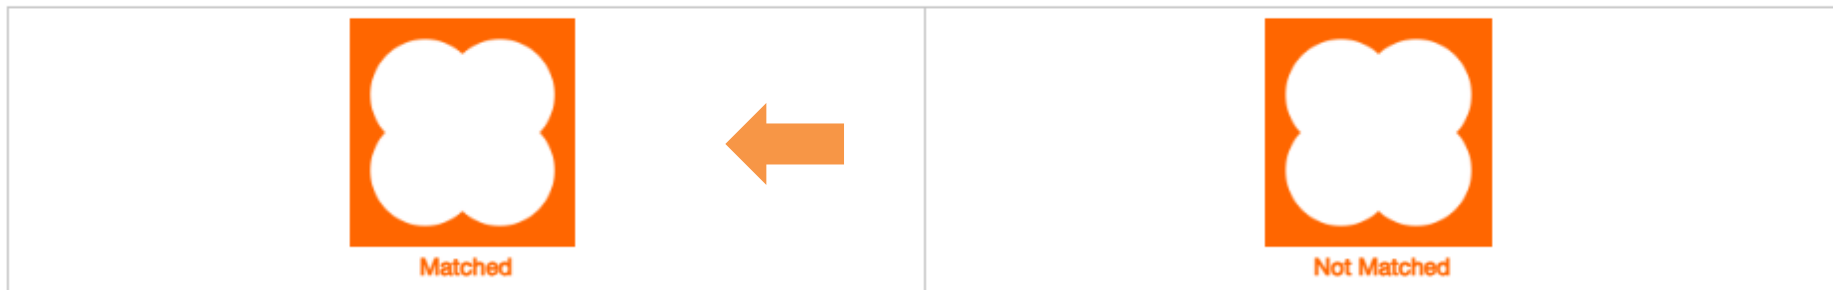

If Matched, we will continue the same previous WF steps from the below point



Connected Using PC



Connected Using Mobile/tablet

If not Matched



Matched



Not Matched



Script

تمام يااستاذنا انا قدمت لحضرتك طلب والمشكله هتكون اتحلت خلال ال 24 ساعه القادمه محتاج حضرتك تسبب الراوتر شغال ولو بعد 24 ساعه المشكله لسه موجوده ممكن حضرتك تشرفنا بالاتصال مره ثانيه

- If the problem isn't solved, Create the below SR:

Short Code	Type	Area	Product	Owner Group	SLA	Smart Script
40034	DSL Fault For Connectivity	Not Matched Static IP	ADSL	L3-DSL Fixed Technical Consumer Support	24 Hours	• Customer Name • Customer Mobile Number • Static IP Number

- Check customer's QOS Profile through PCRF and Connected with IP through IP tool

QOS Found

PCRF Main Package		ADSL Usage	
Main Package Data			
PackageName	Home Internet 225		
CurrentDownload	30720 KBs		
CurrentUpLoad	3072 KBs		

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

QOS not found



PCRF Main Package		ADSL Usage	
Main Package Data			
PackageName	Home Internet 160 (30 Mbps)		
CurrentDownload	0 KBs		
CurrentUpLoad	0 KBs		

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

Redirection Problem

RedirectionFlag1	REDIRECT_ACTIVATION
RedirectionFlag2	0
RedirectionFlag3	0

Script

تمام يا أستاذة/..... أنا سجلت الطلب وبستانذن حضرتك نسيب الراوتر متوصل وفي خلال الـ 24 ساعة اللي جاية هتكون الخدمة شغالة بصورة طبيعية وفي حالة ان حضرتك واجهت نفس المشكله بعد 24 ساعة ممكن تعاود الاتصال بينا مرة ثانية .

Siebel SR

Short Code	Type	Area	Product	Owner Group	SLA
37013	DSL Fault For VAS	Quality Of Service	ADSL	L3-DSL Fixed Technical Consumer Support	24 Hours

- In case of exceeding SLA with no feedback, agent should send email to "Egypt L3 technical consumer support <L3consumersupport-eg@orange.com>" and feedback will be recieved within 1 WD.

- Check customer's QOS Profile through PCRF and Connected with IP through IP tool

QOS Found

PCRF Main Package		ADSL Usage	
Main Package Data			
PackageName	Home Internet 225		
CurrentDownload	30720 KBs		
CurrentUpload	3072 KBs		

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

QOS not found

PCRF Main Package		ADSL Usage	
Main Package Data			
PackageName	Home Internet 160 (30 Mbps)		
CurrentDownload	0 KBs		
CurrentUpload	0 KBs		

Enter username :	
GET IP	
IPAddress	Logdate
45.243.140.179	6/17/2020 12:42:37 PM

Redirection Problem

RedirectionFlag1	REDIRECT_ACTIVATION
RedirectionFlag2	0
RedirectionFlag3	0



Redirection Page

RedirectionFlag1	REDIRECT_ACTIVATION
RedirectionFlag2	0
RedirectionFlag3	0

ErrorCode	er0000
ErrorMsg	Success
Status	1

RedirectionFlag1	0
RedirectionFlag2	0
RedirectionFlag3	0

ErrorCode	er0000
ErrorMsg	Success
Status	1

RedirectionFlag1	REDIRECT_NO_PAYMENT
RedirectionFlag2	0
RedirectionFlag3	0

ErrorCode	er0000
ErrorMsg	Success
Status	1

•List of redirections that the action will be taken through SRs:

- Redirection Activation: Related SR (3102)
- Redirection Suspension: Related SR (3104)
- Redirection No payment: Related SR (3100)
- Redirection Unknown : Related SR (3101)
- Redirection Cancelation: Related SR (3103)

•Important Notes:

- In case of Active Account: SR should be assigned to DSL CH VAS.
- In case of Candidate Account: SR should be assigned to DSL Installation Team as below 2 scenarios:
 - New activation.
 - Change user name or connectivity.

Redirect_Activation :

- Check if the customer has (New Activation order) , check if the self installation task is still pending , configure the CPE with customer and then activate the service via (aa.com) (172.217.23.110), or (74.125.133.113) by asking the customer to press on activate option and if he already configured his CPE proceed on activation step , finally recheck if self installation task is closed automatically or not , **call Assist Hunt to close** if customer did all these steps and Order is completed but still has redirect activation **Create** SR (3102)

■ Redirect Suspension :

- If the customer has Voluntary Suspension order >> Advise him how to reactivate the Service
- If the Customer has Modify Service order >> Check the pending Task and handle it
- If the Customer doesn't have Pending order , **Create** SR (3104)

■ Redirect No Payment :

- In case of receiving customer's complaint from "No browsing" issue and after checking agent found that account has due amount.
- Agent should check if the customer has due bill and exceeded the grace period or not.
- If yes, Advise the customer to pay his/her due amount and Create Release Line SR if eligible (promise to pay).
- If no, and still has redirect No Payment ,OR , if release line SR is submitted but still has redirect No payment create the below relevant SR "3100".

Redirect Cancellation :

- Check if the customer has "Deactivate Service Request", if yes, follow cancellation WF.
- If No, or there is "Deactivate Service Request" and its status is cancelled but customer still has redirect cancellation , create the below relevant SR "3103".

Redirect Unknown User :

Redirection Unknown User only happens in one of the below scenarios:

- New Activation request.
 - Change Username request.
-
- Accordingly, agent should ensure that customer is configured with the same username as Siebel (compare the username which exists on Octopus Log with
 -
 - Siebel Username) and if not modify it from router's page.
 - If username is correct , create the below relevant SR "3101".

Slow Download

How to open Slow Download WF

The screenshot displays the Orange website's user interface. At the top left is the Orange logo. A search bar labeled "Search Products" is positioned to the right of the logo. In the top right corner, the user's name "Sara Adel Mohamed Ab..." is shown next to a notification bell icon. Below the search bar is a horizontal navigation menu with the following items: "Products", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a downward arrow indicating a dropdown menu. Below the navigation menu, there are four product cards. The first card is titled "FREEMAX (OLD) ..." and contains the text "Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...". The second card is titled "WI-FI" and contains the text "Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...". The third card is titled "HOME DSL PACKA..." and contains the text "Home DSL Packages.". The fourth card is titled "DSL BACK OFFICE" and contains the text "DSL Back Office Workflows". An orange arrow points from the "Products" menu item to the first card. Another orange arrow points from the "Home Internet" section of the third card to the "HOME DSL PACKA..." card.

orange™

Search Products

Sara Adel Mohamed Ab...

Products Services Promotions Devices - test Global Scripts - Channels Internal Guideline Customer Support Tools Application Guides

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

Wi-Fi

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows

Find in page ▼ ▲ **Find**

ON THIS PAGE

Basic Information ?

Common Asked Questions

Plans

How to Pay ?

How to Manage My Account ?

How to Complain 

Siebel

Related Offers

Related VASs

Work Instructions

Related Links

 [Slow Upload](#)

 [No Browsing](#)

Billing

 [Bill Amount](#)

 [MSAN-Financial Adjustment](#)

 [Bad Debts](#)

 [Slow Browsing](#)

 [Wlan](#)

View All

 [Orange DSL FeedBack](#)

 [Money Transfer](#)

 [Customer Requests](#)

Technical

 [Technical Assign Visit](#)

 [TP-LINK Wi-Fi extender](#)

 [Voice Problems](#)

 [MSAN Scripts](#)

 [DSL - Slow Download](#)

 [Line Down](#)

View All



- Slow Download could be considered as Physical or network issue

***For MSAN (check from TE-Portal)**

Check first pervious SRs and related comments to avoid wrong SR .

Bad line in MSAN to considered bad if the MAX is less 36 maintaining that the port and router are VDSL.

Bad line is considered if line is less than 15 M for customers with ADSL port or ADSL router.

For Copper (check from Octopus)

Relative Occupation : < 85%

Noise Margin : > 60 dB

Signal Att : < 350 dB

Bitrate : < 85% from the Max rate

Max att : > 6144 kb/s

- It is considered as network issue if the parameters are good so if customer has problem in QOS , Bit rate , or if every thing is ok but he still has slow , it will be handled as network issue
- Physical issues requires to check , splitter wiring , internal wiring , Box and cabinet to be solved
- We must make sure that customer didn't consume all his Quota and his speed isn't downgraded to 256 K
- We must make sure that customer got right QOS matched with his speed

QoS

1. Check customer's quota consumption through Siebel PCRF as shown below if the package is fully consumed or not.
2. If not fully consumed, follow the below troubleshooting steps.
3. If fully consumed, offer upgrading the package/adding extension using the below script and create & close the below SR.

Normal QOS

PCRF Main Package ADSL Usage	
Main Package Data	
PackageName	Home Internet 420(30 Mbps)
CurrentDownload	30720 KBs
CurrentUpload	3072 KBs
CustomerQuota	300.0 GBs
CustomerQuota_expiryDate	2025-01-14T23:59:59Z
CustomerQuota_remainingPercentage	95.0%
CustomerQuota_startDate	2024-12-15T00:00:00Z
CustomerQuota_usagePercentage	5%
RemainingQuota	285.9 GBs

- Script:

Script	حضرتك إستخدمت الباقية بالكامل وميعاد تجديدها كل شهر يوم ممکن تشحن باقه اضافيه او تعلى الباقه لاستعاده السرعه الطبيعيه وتقدر تتابع إستهلاكك من خلال موقعنا Dsl.orange.eg أو تطبيق My Orange.
--------	--

- Siebel SR:

Short Code	Type	Area	Sub Area	Product
40014	DSL Fault For Connectivity	Slow Download	Solved Speed Downgraded	ADSL



Right QOS



Wrong QOS

Information

Username	0224316311-Shaymaa
Port Index	2287
Pop Name	Shoubra
Account Status	Enabled
Customer Type	Copper
Customer Details	Port Reset Details

Inspection

Port Status	Up	✓
Last Login	No log found for bras-dok and ae5:520-2433	⚠
QoS profile	Speed_4096	✓
IP Address	45.243.5.164	✓

Lock port

UnLock port

change profile speed



Solved



Not Solved



- Ask the customer to keep the router switched on and connected.

Script

تمام يا أستاذة/..... أنا سجلت الطلب ويستأذن حضرتك نسيب الراوتر متوصل وفي خلال الـ 48 ساعة اللي حاية هتكون الخدمة شغالة بصورة طبيعية وفي حالة ان حضرتك واجهت نفس المشكله بعد 48 ساعة ممكن تعاود الاتصال بينا مرة ثانية

- **Siebel SR:**

Short Code	Type	Area	Owner Group	SLA	Product
37013	Fault For VAS	Quality Of Service	L3-DSL Fixed Technical Consumer Support	48 Hrs	ADSL

- Check customer quota consumption and make sure that he didn't consume all his Quota

PCRF Main Package ADSL Usage	
Main Package Data	
PackageName	Home Internet 420(30 Mbps)
CurrentDownload	30720 KBs
CurrentUpload	3072 KBs
CustomerQuota	300.0 GBs
CustomerQuota_expiryDate	2025-01-14T23:59:59Z
CustomerQuota_remainingPercentage	95.0%
CustomerQuota_startDate	2024-12-15T00:00:00Z
CustomerQuota_usagePercentage	5%
RemainingQuota	285.9 GBs



Right QOS




Wrong QOS

- Check line parameters to determine if they are good or not
- For copper we will check parameters through OCTOPUS

• For Copper through Octopus:

Parameter	Accepted Rate
Relative Occupation	Less than 85%
Noise Margin	Greater than 60 dB
Signal Attenuation	Less than 350 dB
Bitrate	Less than 85% from the Max rate
Max Attainable Rate	Greater than 6144 kb/s

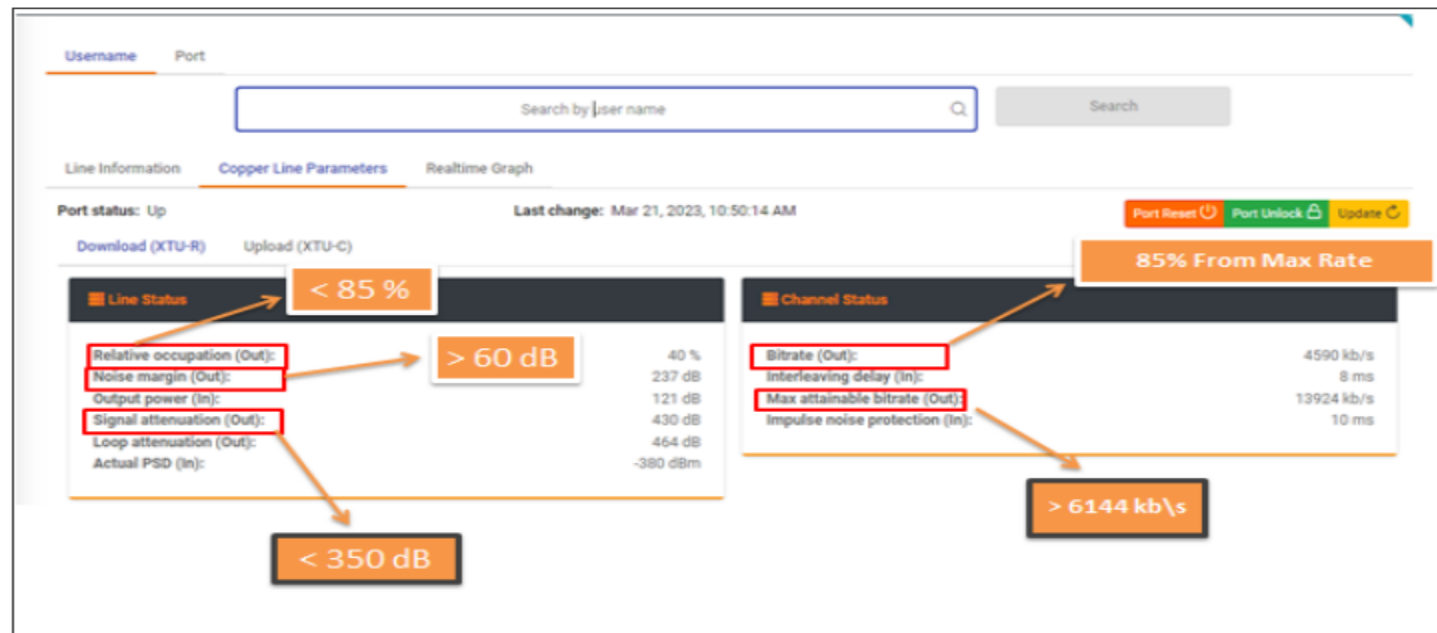

For MSAN through FTTH Tool

- In case no line parameters found on TE Portal, agent should check the line parameters in TR069 tool.
- In case no profile in TR069 tool, agent should handle according to customer and mentions that in the relevant SR.

Parameter	Accepted Rate
Relative Occupation	From 80% to 85%
Noise Margin	Greater than 60 dB
Bitrate	From 80% to 85% from the max
Accepted Max Attainable Rate	
For Up to 30 Mbps speed	Not less than 36 Mbps (Both Port & Router should be VDSL)
	Not less than 15 Mbps (Port or Router is ADSL)
For Up to 70 Mbps speed	Not less than 55 Mbps
For Up to 100 & 200 Mbps speed	Not less than 85 Mbps



getConfiguredSpeed

Dec 28, 2024, 2:07:23 PM

```
download speed(kbps): 30720, upload speed(kbps): 3072
```

GetPortParameters

Dec 28, 2024, 2:07:27 PM

```
adminStatus: up,  
operStatus: up,  
speedUP: 3071,  
speedDown: 30719,  
SNR UP: 206,  
SNR Down: 76,  
TX power UP: 84,  
TX power Down: 144,  
Attainable Rate UP: 23161,  
Attainable Rate Down: 70894,
```

**Accepted****Not Accepted**


- In case of Bad Line Parameters for Copper lines [Press Here](#).
- In case of Bad Line Parameters for MSAN, Check speed profile through TE Portal.



* For Copper



*For MSAN

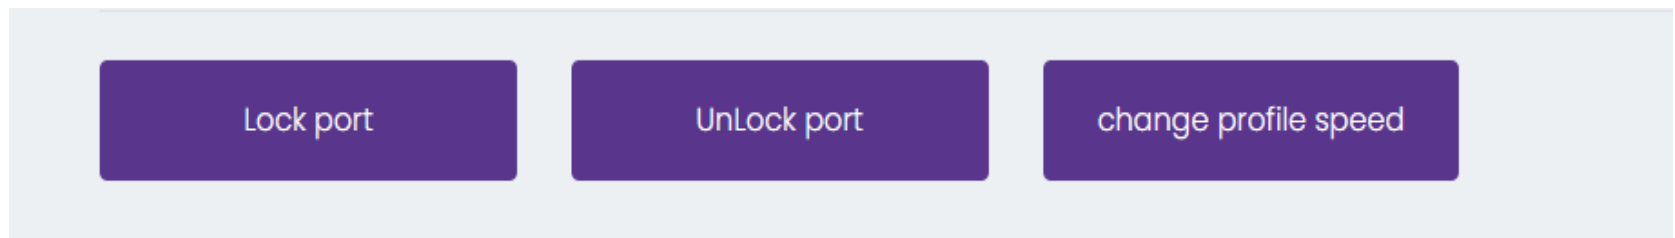





Solved



Not Solved




- If the customer is calling from any mobile or any number rather than the DSL Service number:
 - Ask the customer to connect without splitter .
- If the customer is calling from the DSL service number:
 - Ask the customer for his/her mobile number.
 - Ask the customer to end the call and answer the incoming call on his/her mobile.
 - Put Not Ready.
 - Call the customer.
 - Connect with him/her without splitter.

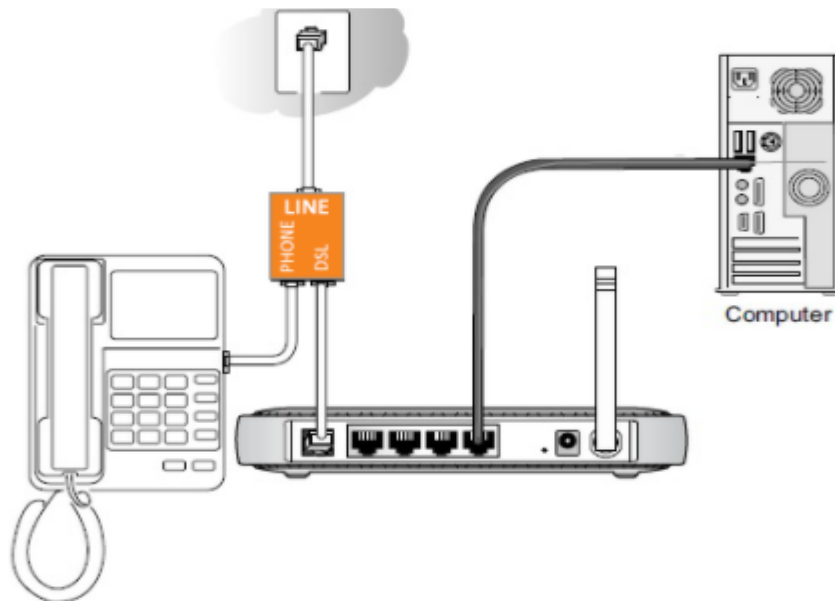

Solved



Not Solved



Open SR

تمام يا أستاذة..... أنا سجلت طلب حضرتك وفي حد من الدعم الفني هيتابع الشكوى، بستأذن حضرتك نسيب الراوتر متوصل، ولو مفيش أي تأخير من المصرية للاتصالات في خلال **48** ساعة عمل هتكون الخدمة شغاله بصورة طبيعية عند حضرتك

Sort code	39013
Type	DSL Fault For Physical
Area	Bad Line
Product	ADSL
Smart Script	Yes
Owner Group	Data Tech Con Support-Physical
Sub Area	Empty
Status	Open
SLA	48 WH

SR #	Short Code	Type	Area	Product	Sub Area	Status
1-981525762288	39013	DSL Fault For Physical	Bad Line	ADSL		Opened

- To determine if customer has bitrate Mismatch or not check the following :
- Relative Occupation should be less than 85% ($\text{Relative Occupation} = \text{Current Rate} / \text{Max attainable Rate}$)

Example 1 :

If the Max Attainable Rate is 20480 , the Bitrate should be less than 85% from 20480 (Current Rate 16384)

We will divide Current Rate / Max Attainable Rate) $16384/20480 = 80\%$ >>> **doesn't have Bit rate Mismatch**

Example 2:

If the Max Attainable Rate is 20480 , the Bitrate should be less than 85% from 20480 (Current Rate 10240)

We will divide Current Rate / Max Attainable Rate) $10240/20480 = 50\%$
>>> **has Bit rate Mismatch**

If parameters are good , Check Bit Rate on OCTOPUS for copper or FTTH Tool for MSAN

Channel Status

Bitrate (Out):	13312 kb/s
Interleaving delay (In):	8 ms
Max attainable bitrate (Out):	17528 kb/s
Impulse noise protection (In):	25 ms

getConfiguredSpeed

Dec 28, 2024, 2:07:23 PM

```
download speed(kbps): 30720, upload speed(kbps): 3072
```

GetPortParameters

Dec 28, 2024, 2:07:27 PM

```
adminStatus: up,  
operStatus: up,  
speedUP: 3071,  
speedDown: 30719,  
SNR UP: 206,  
SNR Down: 76,  
TX power UP: 84,  
TX power Down: 144,  
Attainable Rate UP: 23161,  
Attainable Rate Down: 70894,
```



Has Bit Rate Mismatch




Doesn't have Bit rate mismatch

For Copper :




For MSAN :

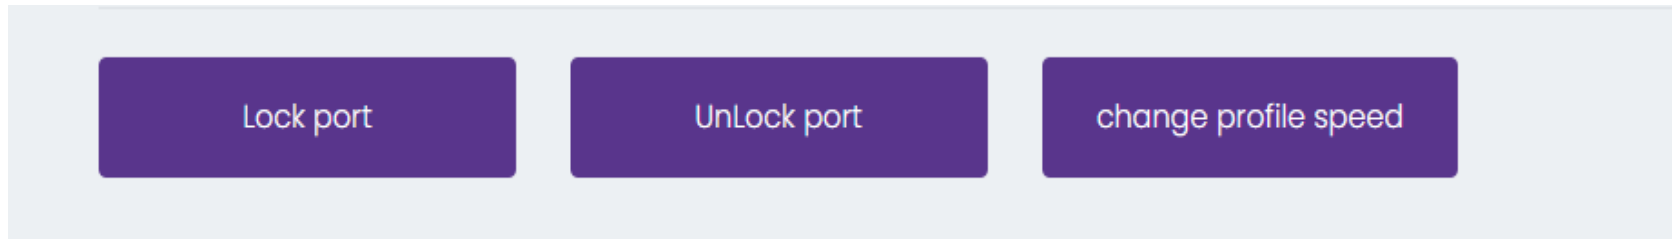

Solved



Not Solved



- For **Copper** lines, Create the following Siebel SR:

Short Code	Type	Area	Owner Group	SLA	Product
40010	Fault For Connectivity	Bit Rate MisMatch Copper	L3-DSL Fixed Technical Consumer Support	24 Hrs	ADSL

- For **MSAN** lines with Up to **30** Mbps, agent should adjust the profile speed through TE Portal and create & close the following Siebel SR:

Short Code	Type	Area	Sub Area	Product
40026	Fault For Connectivity	Bit Rate MisMatch MSAN	Solved	ADSL

- For **MSAN** lines with Up to **70,100,200** Mbps, agent should create the following Siebel SR:

Short Code	Type	Area	Product	Owner Group	SLA
40026	Fault For Connectivity	Bit Rate MisMatch MSAN	- Home Internet 400 - Home Internet 540 - Home Internet 675 - Home Internet 950 - Home Internet 1350 - Home Internet 800 (Up To 70 Mbps) - Home Internet 1200	L3-DSL Fixed Technical Consumer Support	24 Hrs

- Script:**

Script	تمام يا أستاذة/..... أنا سجلت الطلب وبستان حضرتك نسيب الراوتر متوصل وفي خلال الـ 24 ساعة اللي جاية في حد هيتواصل مع حضرتك من جانبنا لحل المشكلة
---------------	---

Check Bit Rate on OTCCT for copper or FTTH Tool for MSAN

Channel Status

Bitrate (Out):	13312 kb/s
Interleaving delay (In):	8 ms
Max attainable bitrate (Out):	17528 kb/s
Impulse noise protection (In):	25 ms

getConfiguredSpeed

Dec 28, 2024, 2:07:23 PM

```
download speed(kbps): 30720, upload speed(kbps): 3072
```

GetPortParameters

Dec 28, 2024, 2:07:27 PM

```
adminStatus: up,  
operStatus: up,  
speedUP: 3071,  
speedDown: 30719,  
SNR UP: 206,  
SNR Down: 76,  
TX power UP: 84,  
TX power Down: 144,  
Attainable Rate UP: 23161,  
Attainable Rate Down: 70894,
```



Has Bit Rate Mismatch



Doesn't have Bit rate mismatch

- Check if POP is congested or not

- this step is checked for copper only and if line is MSAN select not congested option
 - Accepted Download Rate is not less than 45% of customer's speed for Copper.
 - Agent should check Octopus tool in order to determine if customer has congested POP or congested MSAN cabinet.



Congested



Not Congested

• Script:

Script	الاستئصال بتاع حضرتك فى تحديثات يافندم، احنا لسا معندناش وقت معين بس عايزين حضرتك تعرف احنا بنشتغل بأقصى سرعه عشان نقدم ل حضرتك أحسن خدمة و حضرتك ممكن تتابع معنا فى أى وقت لحد المشكله ما تخلص على 16333
--------	--

• Siebel SR:

Short Code	Type	Area	Sub Area	Product
40014	Fault For Connectivity	Slow Download	Not Solved-Congested POP	ADSL

- Check if POP is congested or not

- this step is checked for copper only and if line is MSAN select not congested option



Congested



Not Congested



* For all MSAN customers , **Press Here**

* For Copper POPs , **Press Here**



- In case customer is facing a slowness for any gaming consoles, agent should follow [Online Gaming Handling](#).

In case customer is facing a slowness related to (computers & mobiles) devices, we will follow the below handling:

Agent will guide the customer to open <http://www.speedtest.net/>.

Ask customer to connect the device with LAN if available.

If not, ask customer to connect through Wi-Fi with 1 device only and disconnect all the others .

Check speed test result and compare it with customer's speed with minimum accepted download speed.



- Minimum download speed:

Profile Speed (Mbps)	Maximum Rate (KB/Sec)	Minimum Accepted Rate = 45% for Copper Pops		Minimum Accepted Rate = 65% for MSAN Pops	
		Speed Test (Mbps)	Accepted Rate (KB/Sec)	Speed Test (Mbps)	Accepted Rate (KB/Sec)
1	128	0.45	57.6	0.65	83.2
2	256	0.9	115.2	1.3	166.4
4	512	1.8	230.4	2.6	332.8
6	768	2.7	345.6	3.9	499.2
8	1024	3.6	460.8	5.2	665.6
10	1280	4.5	576	6.5	823
12	1536	5.4	691.2	7.8	998.4
14	1792	6.3	806.4	9.1	1164.8
16	2048	7.2	921.6	10.4	1331.2
18	2304	8.1	1036.8	11.7	1497.6
20	2560	9	1152	13	1664
22	2816	9.9	1267.2	14.3	1830.4
24	3072	10.8	1382.4	15.6	1996.8
25	3200	11.3	1440	16.2	2080
27	3456	12.2	1555.2	17.5	2246.6
30	3840	13.5	1728	19.5	2496
40	5120	--	--	26	3328
50	6400	--	--	32.5	4160
60	7680	--	--	39	4992
70	8960	--	--	45.5	5824
100	12800	--	--	65	8320
200	25600	--	--	130	16640

- In case both minimum speed download rate and speed test results are matched:
 - Agent will inform the customer that no problem found.
- In case speed download rate is not matched with speed test results:
 - A complaint will be submitted.
- In case customer refused the Speed Test troubleshooting or wasn't convinced with the Speed Test result:
 - Agent will follow the normal handling "trusted sites" to test the download rate by informing the customer to download files from trusted sites therefore s/he can compare his/her download rate with the speed test rate.

• **Example:**

- If the customer's line profile through TE Portal is 16 Mbps, make a speed test and get the accepted rate by applying the below calculation:
(16384x0.65=10.4)
- If customer refused the speed test troubleshooting or wasn't convinced with the speed test result, agent will follow the normal handling "trusted sites" to test the download rate by (16384x0.65/8).
- If the result is 1331.2 KB/Sec, then it's accepted.
- If the result is less than 1331.2 KB/Sec, then it's not accepted.



Accepted Rate



Not Accepted Rate

- Change the MTU on the customer's router to 1420.
- If not solved, agent can try 1300 or 1380 (As an extra mile and not a mandatory step).
- Check download again.



Accepted



Not Accepted

- If our customer connected to MSAN and using mobile, advise the customer to continue the troubleshooting using PC or Laptop if available

- Check if customer connect using Ethernet or WLAN?




Ethernet



WLAN

- In case receiving customer complaining from slow download while using Wi-Fi only , Change Wi-Fi password and the Wi-Fi channel by following the below steps:
- In case agent found the customer is connected to only 1 device though TR069, no need to change the Wi-Fi password.
 - From the wireless section in the router interface look for channel.
 - If the channel is set to auto, agent should set it to manual channel and choose one of these channels. (Channel 1, Channel 6 or Channel 11).
 - If the customer is using one of the above mentioned 3 channels, s/he can choose another 1 from them.
 - The following screenshot is an example for TP-Link W8910G.
 - Agent should create the following SR and close it.

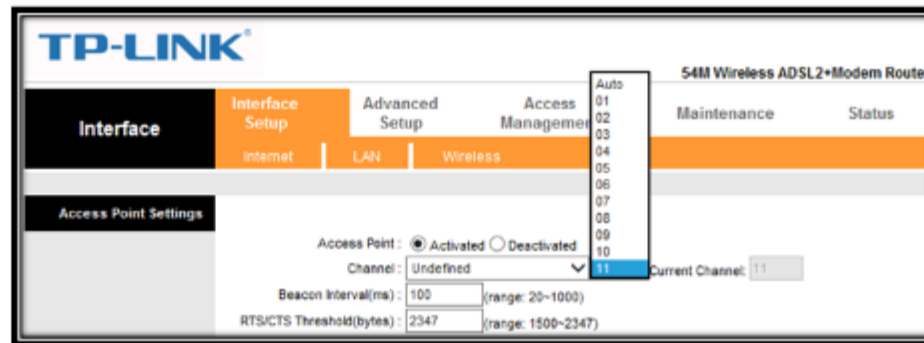

- [Then check Download?](#)
- To know how to change Wi-Fi password & channel [Click Here](#)



Accepted



Not accepted



- Create SR (SLA 24 H)

- Ask the customer to keep the router switched on and connected.

Script	تمام يا استاذة..... أنا سجلت الطلب ويستأذن حضرتك نسيب الراوتر متوصل وفي خلال الـ 24 ساعة اللي جاية في حد هيتواصل مع حضرتك من جانبنا لحل المشكلة
--------	---

- Create the following Siebel SR:

Short Code	Type	Area	Product	Owner Group	SLA
40014	Fault For Connectivity	Slow Download	ADSL	Data Tech Con Support -Network	24 Hrs

- Escalation matrix:
 - In case the customer called and there are no updates on SR and the above estimated time exceeded:
 - Send email to Consumer Support DSL-Network team to speed up the resolution and a feedback will be recieved within same working day except Friday & Saturday.

* For all MSAN customers , **Press Here**

* For Copper POPs , **Press Here**



- In case customer is facing a slowness for any gaming consoles, agent should follow [Online Gaming Handling](#).

In case customer is facing a slowness related to (computers & mobiles) devices, we will follow the below handling:

Agent will guide the customer to open <http://www.speedtest.net/>.

Ask customer to connect the device with LAN if available.

If not, ask customer to connect through Wi-Fi with 1 device only and disconnect all the others

Check speed test result and compare it with customer's speed with minimum accepted download speed.



- Minimum download speed:

Profile Speed (Mbps)	Maximum Rate (KB/Sec)	Minimum Accepted Rate = 45% for Copper Pops		Minimum Accepted Rate = 65% for MSAN Pops	
		Speed Test (Mbps)	Accepted Rate (KB/Sec)	Speed Test (Mbps)	Accepted Rate (KB/Sec)
1	128	0.45	57.6	0.65	83.2
2	256	0.9	115.2	1.3	166.4
4	512	1.8	230.4	2.6	332.8
6	768	2.7	345.6	3.9	499.2
8	1024	3.6	460.8	5.2	665.6
10	1280	4.5	576	6.5	823
12	1536	5.4	691.2	7.8	998.4
14	1792	6.3	806.4	9.1	1164.8
16	2048	7.2	921.6	10.4	1331.2
18	2304	8.1	1036.8	11.7	1497.6
20	2560	9	1152	13	1664
22	2816	9.9	1267.2	14.3	1830.4
24	3072	10.8	1382.4	15.6	1996.8
25	3200	11.3	1440	16.2	2080
27	3456	12.2	1555.2	17.5	2246.6
30	3840	13.5	1728	19.5	2496
40	5120	--	--	26	3328
50	6400	--	--	32.5	4160
60	7680	--	--	39	4992
70	8960	--	--	45.5	5824
100	12800	--	--	65	8320
200	25600	--	--	130	16640

- In case both minimum speed download rate and speed test results are matched:
 - Agent will inform the customer that no problem found.
- In case speed download rate is not matched with speed test results:
 - A complaint will be submitted.
- In case customer refused the Speed Test troubleshooting or wasn't convinced with the Speed Test result:
 - Agent will follow the normal handling "trusted sites" to test the download rate by informing the customer to download files from trusted sites therefore s/he can compare his/her download rate with the speed test rate.

• **Example:**

- If the customer's line profile through TE Portal is 16 Mbps, make a speed test and get the accepted rate by applying the below calculation:
- $(16384 \times 0.65 = 10.4)$
- If customer refused the speed test troubleshooting or wasn't convinced with the speed test result, agent will follow the normal handling "trusted sites" to test the download rate by $(16384 \times 0.65 / 8)$.
- If the result is 1331.2 KB/Sec, then it's accepted.
- If the result is less than 1331.2 KB/Sec, then it's not accepted.




Accepted Rate



Not Accepted Rate

- In case receiving customer complaining from slow download while using Wi-Fi only , Change Wi-Fi password and the Wi-Fi channel by following the below steps:
- In case agent found the customer is connected to only 1 device though TR069, no need to change the Wi-Fi password.
 - From the wireless section in the router interface look for channel.
 - If the channel is set to auto, agent should set it to manual channel and choose one of these channels. (Channel 1, Channel 6 or Channel 11).
 - If the customer is using one of the above mentioned 3 channels, s/he can choose another 1 from them.
 - The following screenshot is an example for TP-Link W8910G.
 - Agent should create the following SR and close it.

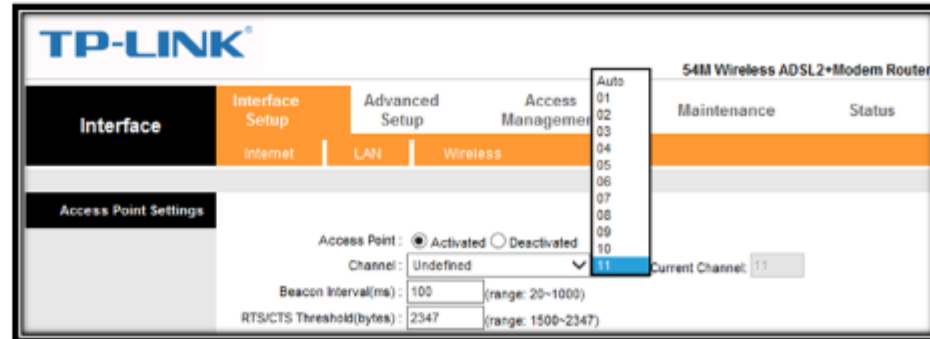

- **Then check Download?**
- To know how to change Wi-Fi password & channel [Click Here](#)



Accepted



Not accepted



- Create SR (SLA 24 H)

- Ask the customer to keep the router switched on and connected.

Script	تمام يا أستاذة/..... أنا سجلت الطلب ويستأذن حضرتك نسيب الراوتر متوصل وفي خلال الـ 24 ساعة اللي جاية في حد هيتواصل مع حضرتك من جانبنا لحل المشكلة
--------	--

- Create the following Siebel SR:

Short Code	Type	Area	Product	Owner Group	SLA
40014	Fault For Connectivity	Slow Download	ADSL	Data Tech Con Support -Network	24 Hrs

- Escalation matrix:
 - In case the customer called and there are no updates on SR and the above estimated time exceeded:
 - Send email to Consumer Support DSL-Network team to speed up the resolution and a feedback will be received within same working day except Friday & Saturday.

Slow Upload

- Slow Upload could be considered as Physical or network issue.

How to Open Slow Upload WF

The screenshot displays the Orange network portal interface. At the top, there is an orange logo on the left, a search bar labeled "Search Products" in the center, and a user profile "Sara Adel Mohamed Ab..." with a notification bell icon on the right. Below the header is a navigation menu with the following items: Products, Services, Promotions, Devices - test, Global Scripts - Channels, Internal Guideline, Customer Support Tools, and Application Guides. Each item has a dropdown arrow. Below the navigation menu, there are four product tiles. The first tile is titled "FREEMAX (OLD) ..." and contains the text "Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...". The second tile is titled "WI-FI" and contains the text "Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...". The third tile is titled "HOME DSL PACKA..." and contains the text "Home DSL Packages.". The fourth tile is titled "DSL BACK OFFICE" and contains the text "DSL Back Office Workflows". An orange arrow points from the "Products" menu item to the "FREEMAX (OLD) ..." tile. Another orange arrow points from the "Internal Guideline" menu item to the "HOME DSL PACKA..." tile.

orange™

Search Products

Sara Adel Mohamed Ab...

Products Services Promotions Devices - test Global Scripts - Channels Internal Guideline Customer Support Tools Application Guides

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows

Find in page



Find

ON THIS PAGE

Basic Information

Common Asked Questions

Plans

How to Pay

How to Manage My Account

How to Complain

Siebel

Related Offers

Related VASs

Work Instructions

Related Links



1



How to Complain

Network

View All

 [Transfer from Reseller to another Reseller](#)

 [Slow Upload](#)

 [No Browsing](#)

 [Quota Consumption Issues](#)

 [Slow Browsing](#)

 [Wlan](#)



2

Billing

View All

 [Bill Amount](#)

 [MSAN-Financial Adjustment](#)

 [Bad Debts](#)

 [Orange DSL FeedBack](#)

 [Money Transfer](#)

 [Customer Requests](#)

- Open customer's account on PCRF.
- Confirm that the package is not fully consumed.
- If yes, advise the customer to add extra quota or upgrade the package by following "[FBB Upselling Offers](#)".
- If no, check the physical line parameters and maximum attainable bit rate through Octopus for Copper or Bit Stream for MSAN as below:

Speed & Port	Max Attainable Bit Rate	Noise Margin
30 Mbps MSAN	3.6 Mbps	Not less than 6 dB
70 Mbps MSAN	8.4 Mbps	
100 Mbps MSAN	12 Mbps	
200 Mbps MSAN	24 Mbps	
Copper & ADSL Port / Router	1.2 Mbps	

- Check Physical Line parameters from OCTOPUS for copper

Download (XTU-R)

Upload (XTU-C)

Line Status

Relative occupation (In):	93 %
Noise margin (In):	95 dB
Output power (Out):	189 dB
Signal attenuation (In):	68 dB
Loop attenuation (In):	73 dB
Actual PSD (Out):	-442 dBm

Channel Status

Bitrate (In):	1017 kb/s
Interleaving delay (Out):	5 ms
Max attainable bitrate (In):	1169 kb/s
Impulse noise protection (Out):	5 ms

- Check Physical Line parameters from FTTH Tool for MSAN
- We should check Maximum attainable Rate US

GetPortParameters

Dec 18, 2024, 9:15:43 AM

True

```
Standard in port training: G.993.2-Annex B,  
Current power management state: Full-on state,  
Result of the last full initialization: No failure,  
G.998.4 retransmission used downstream: In use,  
G.998.4 retransmission used upstream: In use,  
Signal attenuation downstream(dB): 7.4,  
Signal attenuation upstream(dB): 0.0,  
Line attenuation downstream(dB): 7.4,  
Line attenuation upstream(dB): 0.0,  
Maximum attainable rate downstream(Kbps): 78927,  
Maximum attainable rate upstream(Kbps): 25715,  
Actual line rate downstream(Kbps): 43972,  
Actual line rate upstream(Kbps): 3872,  
Line SNR margin downstream(dB): 13.7,  
Line SNR margin upstream(dB): 21.0,  
VDSL2 PSD class mask: B998M2x,  
Highest frequency downstream(kHz): 17590.69,  
Lowest frequency downstream(kHz): 142.31,
```

getConfiguredSpeed

Dec 18, 2024, 9:15:44 AM

True

```
download speed(kbps): 35840, upload speed(kbps): 2560
```



Accepted Line Parameters



Not Accepted Line Parameters

For Copper :



For MSAN :

Lock port

UnLock port

change profile speed



Solved



Not solved



Short Code	Type	Area	Sub Area	Product	Owner Group	SLA
39003	DSL Fault For Physical	Slow Upload	Solved Port Reset	ADSL	Data Tech Con Support-Physical	48 Whrs

Script:

Script

تمام يا أستاذة/..... أنا سجلت طلب حضرتك وفي حد من الدعم الفني هيتابع الشكوى، بستأذن حضرتك نسيب الراوتر متوصل، ولو مغيش أي تأخير من المصرية للاتصالات في خلال 48 ساعة عمل هتكون الخدمة شغاله بصورة طبيعية عند حضرتك

```
Standard in port training: G.993.2-Annex B,  
Current power management state: Full-on state,  
Result of the last full initialization: No failure,  
G.998.4 retransmission used downstream: In use,  
G.998.4 retransmission used upstream: In use,  
Signal attenuation downstream(dB): 7.4,  
Signal attenuation upstream(dB): 0.0,  
Line attenuation downstream(dB): 7.4,  
Line attenuation upstream(dB): 0.0,  
Maximum attainable rate downstream(Kbps): 78927,  
Maximum attainable rate upstream(Kbps): 25715,  
Actual line rate downstream(Kbps): 43972,  
Actual line rate upstream(Kbps): 3872,  
Line SNR margin downstream(dB): 13.7,  
Line SNR margin upstream(dB): 21.0,  
VDSL2 PSD class mask: B998M2x,  
Highest frequency downstream(kHz): 17590.69,  
Lowest frequency downstream(kHz): 142.31,
```

Port status: Up

Last change: Nov 29, 2022, 3:55:37 PM

Port Reset  Port Unlock  Update 

Download (XTU-R)

Upload (XTU-C)

Line Status	
Relative occupation (Out):	69 %
Noise margin (Out):	123 dB
Output power (In):	121 dB
Signal attenuation (Out):	370 dB
Loop attenuation (Out):	373 dB
Actual PSD (In):	-382 dBm

Channel Status	
Bitrate (Out):	12288 kb/s
Interleaving delay (In):	8 ms
Max attainable bitrate (Out):	17788 kb/s
Impulse noise protection (In):	15 ms



- Check upload Bitrate on Octopus or Bit Stream

Speed & Port	Max Attainable Bit Rate	Current Rate/Bit Rate/Line Profile
30 Mbps MSAN	3.6 Mbps	85% of the customer's max attainable bit rate
70 Mbps MSAN	8.4 Mbps	
100 Mbps MSAN	12 Mbps	
200 Mbps MSAN	24 Mbps	
Copper & ADSL Port / Router	1.2 Mbps	

Channel Status

Bitrate (In):	1017 kb/s
Interleaving delay (Out):	5 ms
Max attainable bitrate (In):	1169 kb/s
Impulse noise protection (Out):	5 ms

GetPortParameters

Dec 18, 2024, 9:15:43 AM

True

```
Standard in port training: G.993.2-Annex B,  
Current power management state: Full-on state,  
Result of the last full initialization: No failure,  
G.998.4 retransmission used downstream: In use,  
G.998.4 retransmission used upstream: In use,  
Signal attenuation downstream(dB): 7.4,  
Signal attenuation upstream(dB): 0.0,  
Line attenuation downstream(dB): 7.4,  
Line attenuation upstream(dB): 0.0,  
Maximum attainable rate downstream(Kbps): 78927,  
Maximum attainable rate upstream(Kbps): 25715,  
Actual line rate downstream(Kbps): 43972,  
Actual line rate upstream(Kbps): 3872,  
Line SNR margin downstream(dB): 13.7,  
Line SNR margin upstream(dB): 21.0,  
VDSL2 PSD class mask: B998M2x,  
Highest frequency downstream(kHz): 17590.69,  
Lowest frequency downstream(kHz): 142.31,
```



Has Bit Rate Mismatch




Doesn't have Bit Rate Mismatch

For Copper :




For MSAN :

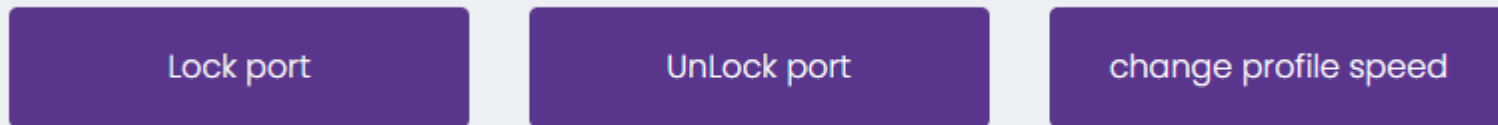

Solved



Not solved

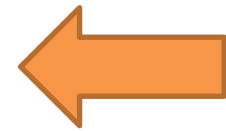

Open SR

Script

تمام يااستاذة انا قدمت لحضرتك طلب والمشكلة هتكون اتحلت خلال ال 24 ساعه القادمة محتاج حضرتك تسبب الراوتر شغال ولو بعد 24 ساعه المشكلة لسه موجوده ممكن حضرتك تشرفنا بالاتصال مره ثانيه

Create the below SR & Clarify in SR Note that customer has bit rate mismatch regarding upload speed

Short Code	Type	Area	Sub Area	Product	Owner Group	SLA
39003	DSL Fault For Physical	Slow Upload	Solved Port Reset	ADSL	Data Tech Con Support-Physical	48 Whrs

Script:

Script

تمام يا أستاذة..... أنا سجلت طلب حضرتك وفي حد من الدعم الفني هيتابع الشكوى، بستأذن حضرتك نسيب الراوتر متوصل، ولو مفيش أي تأخير من المصرية للاتصالات في خلال 48 ساعه عمل هتكون الخدمة شغاله بصورة طبيعية عند حضرتك

Channel Status

Bitrate (In):	1017 kb/s
Interleaving delay (Out):	5 ms
Max attainable bitrate (In):	1169 kb/s
Impulse noise protection (Out):	5 ms

GetPortParameters

Dec 18, 2024, 9:15:43 AM

True

```
Standard in port training: G.993.2-Annex B,  
Current power management state: Full-on state,  
Result of the last full initialization: No failure,  
G.998.4 retransmission used downstream: In use,  
G.998.4 retransmission used upstream: In use,  
Signal attenuation downstream(dB): 7.4,  
Signal attenuation upstream(dB): 0.0,  
Line attenuation downstream(dB): 7.4,  
Line attenuation upstream(dB): 0.0,  
Maximum attainable rate downstream(Kbps): 78927,  
Maximum attainable rate upstream(Kbps): 25715,  
Actual line rate downstream(Kbps): 43972,  
Actual line rate upstream(Kbps): 3872,  
Line SNR margin downstream(dB): 13.7,  
Line SNR margin upstream(dB): 21.0,  
VDSL2 PSD class mask: B998M2x,  
Highest frequency downstream(kHz): 17590.69,  
Lowest frequency downstream(kHz): 142.31,
```



Has Bit Rate Mismatch



Doesn't have Bit Rate Mismatch



- Check customer's package and calculate the accepted upload rate which should be 65% of the current rate.

- Incase receiving customers subscribed on Up to 30 packages and complaining from his/her upload speed and the reason to be 1 Mbps and instead of 3 Mbps , use the below Script.

Script

حضرتك تقدر تشتري راوتر السرعات الفائقة والذي هيووفر لحضرتك سرعة ابلود اوتحميل اعلي من الموجودة على خطك حاليا... تحب اوضحلك تفاصيل عن الراوتر وسعره؟	في حالة ان العميل عنده VDSL Port بـ ADSL راوتر : الموظف يجب عليه upsell high end router using the script
للاسف بافندم سرعة التحميل الموجودة على خطك دى اقصى سرعة البورت الخاص بحضرتك بقدر يتحملها	في حالة ان العميل عنده ADSL port

- Check upload rate through speed test.



Open SR

Script

تمام يااستاذنا ة انا قدمت لحضرتك طلب والمشكلة هتكون اتحلت خلال ال 24 ساعه القادمة محتاج حضرتك تسيب الراوتر شغال ولو بعد 24 ساعه المشكلة لسه موجوده ممكن حضرتك تشرفنا بالاتصال مره ثانيه

Short Code	Type	Area	Product	Owner Group	SLA
40015	DSL Fault FOR Connectivity	Slow Upload	ADSL	L3-DSL Fixed Technical Consumer Support	24 Hours

Slow Browsing

Please check customer quota consumption and make sure that he didn't consume all his usage first before handle slow workflow

Slow browsing could be considered as Physical or network issue.

How to Open Slow Browsing WF

The screenshot displays the Orange website's navigation bar and a grid of product cards. The navigation bar includes the Orange logo, a search bar, a user profile, and a list of menu items: Products, Services, Promotions, Devices - test, Global Scripts - Channels, Internal Guideline, Customer Support Tools, and Application Guides. Below the navigation bar, there are four preview cards for various services. An orange arrow points from the 'Products' menu item to the 'FREEMAX (OLD) ...' card. Another orange arrow points from the 'Home Internet' card to the 'HOME DSL PACKA...' card.

Products ▾ **Services** ▾ **Promotions** ▾ **Devices - test** ▾ **Global Scripts - Channels** ▾ **Internal Guideline** ▾ **Customer Support Tools** ▾ **Application Guides** ▾

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows

ON THIS PAGE

- Basic Information ?
- Common Asked Questions
- Plans
- How to Pay ?
- How to Manage My Account ?
- How to Complain**
- Siebel
- Related Offers
- Related VASs
- Work Instructions
- Related Links

How to Complain

Network

View All

- Transfer from Reseller to another Reseller
- Slow Upload
- No Browsing

- Quota Consumption Issues
- Slow Browsing
- Wlan

Billing

View All

- Bill Amount
- MSAN-Financial Adjustment
- Bad Debts
- Orange DSL FeedBack
- Money Transfer
- Customer Requests

- Ask the customer if the download rate is accepted or not.
- Minimum download speed:

Profile Speed (Mbps)	Maximum Rate (KB/Sec)	Minimum Accepted Rate = 45% for Copper Pops		Minimum Accepted Rate = 65% for MSAN Pops	
		Speed Test (Mbps)	Accepted Rate (KB/Sec)	Speed Test (Mbps)	Accepted Rate (KB/Sec)
1	128	0.45	57.6	0.65	83.2
2	256	0.9	115.2	1.3	166.4
4	512	1.8	230.4	2.6	332.8
6	768	2.7	345.6	3.9	499.2
8	1024	3.6	460.8	5.2	665.6
10	1280	4.5	576	6.5	823
12	1536	5.4	691.2	7.8	998.4
14	1792	6.3	806.4	9.1	1164.8
16	2048	7.2	921.6	10.4	1331.2
18	2304	8.1	1036.8	11.7	1497.6
20	2560	9	1152	13	1664
22	2816	9.9	1267.2	14.3	1830.4
24	3072	10.8	1382.4	15.6	1996.8
25	3200	11.3	1440	16.2	2080
27	3456	12.2	1555.2	17.5	2246.6
30	3840	13.5	1728	19.5	2496
40	5120	--	--	26	3328
50	6400	--	--	32.5	4160
60	7680	--	--	39	4992
70	8960	--	--	45.5	5824
100	12800	--	--	65	8320
200	25600	--	--	130	16640

- Before checking Slow browsing we should make sure download rate is accepted

- Ask customer about download rate



- Use Slow Download Work Flow in case download rate is not accepted .

Please check customer quota consumption and make sure that he didn't consume all his usage first before handle slow workflow.

Check Physical Line parameters from Octopus for copper.

- Ask customer about download rate



Accepted Rate



Not Accepted Rate

Port status: Up

Last change: Nov 29, 2022, 3:55:37 PM

Port Reset 

Port Unlock 

Update 

Download (XTU-R)

Upload (XTU-C)

Line Status	
Relative occupation (Out):	69 %
Noise margin (Out):	123 dB
Output power (In):	121 dB
Signal attenuation (Out):	370 dB
Loop attenuation (Out):	373 dB
Actual PSD (In):	-382 dBm

Channel Status	
Bitrate (Out):	12288 kb/s
Interleaving delay (In):	8 ms
Max attainable bitrate (Out):	17788 kb/s
Impulse noise protection (In):	15 ms

Standard in port training: G.993.2-Annex B,
Current power management state: Full-on state,
Result of the last full initialization: No failure,
G.998.4 retransmission used downstream: In use,
G.998.4 retransmission used upstream: In use,
Signal attenuation downstream(dB): 7.4,
Signal attenuation upstream(dB): 0.0,
Line attenuation downstream(dB): 7.4,
Line attenuation upstream(dB): 0.0,

Maximum attainable rate downstream(Kbps): 78927,

Maximum attainable rate upstream(Kbps): 25715,

Actual line rate downstream(Kbps): 43972,

Actual line rate upstream(Kbps): 3872,

Line SNR margin downstream(dB): 13.7,

Line SNR margin upstream(dB): 21.0,

VDSL2 PSD class mask: B998M2x,

Highest frequency downstream(kHz): 17590.69,

Lowest frequency downstream(kHz): 142.31,



Accepted



Not Accepted

- Reset browser settings to default

 Internet Explorer	 Google Chrome	 microsoft edge
 Firefox	 Opera	 Safari

Reset the customer's Browser and check the browsing again, steps will be according to browser type

- Click the Tools "menu".
- Select Options.
- Click the Under the Hood tab then click on "Clear browsing data" button
- Select "the beginning of time" , Mark the needed checkboxes and click "Clear browsing data" button
- Click on "Under the Hood" again then click on "Change proxy settings" button
- Select Connections tab and make sure the Dial-up Box is Empty then click "LAN settings" button then click "OK" button
- Make sure to clear check boxes then click ok



Solved



Not Solved



- If our customer has slow download problem make sure that the customer connected with one device via Ethernet cable connection (PC or laptop) or via Wi-Fi Connection (Laptop Or any smart phone) and download from Microsoft.com and check the download rate.
- If our customer is using a smart phone let him/her start any download session and check the speed via speed test application
- For Windows 10 customers ensure to disable windows update before any troubleshooting.



Copper



MSAN




- Change the MTU on the customer Modem to 1420
- If not solved, agent can try 1300 or 1380 (As an extra mile and not a mandatory step).
- Check Browsing Speed again.



Accepted



Not Accepted

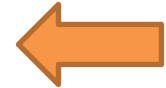

Check if customer connect using Ethernet or WLAN?



Ethernet



WLAN




Change Wi-Fi password, then check Browsing?



Accepted



Not Accepted



Open SR

- In case customer using smart phone, open case with the below details and inform him/her to prepare a device connected with cable or WiFi if possible for follow up call.
- Inform the customer to keep the CPE connected during the next 24 Hrs.

Script

تمام يا أستاذة..... أنا سجلت الطلب وبستأذن حضرتك نسيب الراوتر متوصل وفي خلال الـ 24 ساعه اللي جاية هتكون الخدمة شغالة بصورة طبيعية وفى حاله ان حضرتك واجهت نفس المشكله بعد 24 ساعه ممكن تعاود الاتصال بينا مرة ثانية

- In case of exceeding the SLA:

•هقدم لحضرتك طلب استعجال وهيثم الرد في اسرع وقت ممكن.. شكرا لتفهمك

Short Code	Type	Area	Product	Owner Group	Sub Area	Status	Smart Script	SLA
40020	DSL Fault For Connectivity	Slow Browsing	ADSL	Data Tech Con Support-Network	Empty	Open	No	24 Hrs

Standard in port training: G.993.2-Annex B,
Current power management state: Full-on state,
Result of the last full initialization: No failure,
G.998.4 retransmission used downstream: In use,
G.998.4 retransmission used upstream: In use,
Signal attenuation downstream(dB): 7.4,
Signal attenuation upstream(dB): 0.0,
Line attenuation downstream(dB): 7.4,
Line attenuation upstream(dB): 0.0,
Maximum attainable rate downstream(Kbps): 78927,
Maximum attainable rate upstream(Kbps): 25715,
Actual line rate downstream(Kbps): 43972,
Actual line rate upstream(Kbps): 3872,
Line SNR margin downstream(dB): 13.7,
Line SNR margin upstream(dB): 21.0,
VDSL2 PSD class mask: B998M2x,
Highest frequency downstream(kHz): 17590.69,
Lowest frequency downstream(kHz): 142.31,



Accepted




Not Accepted



* For Copper




* For MSAN

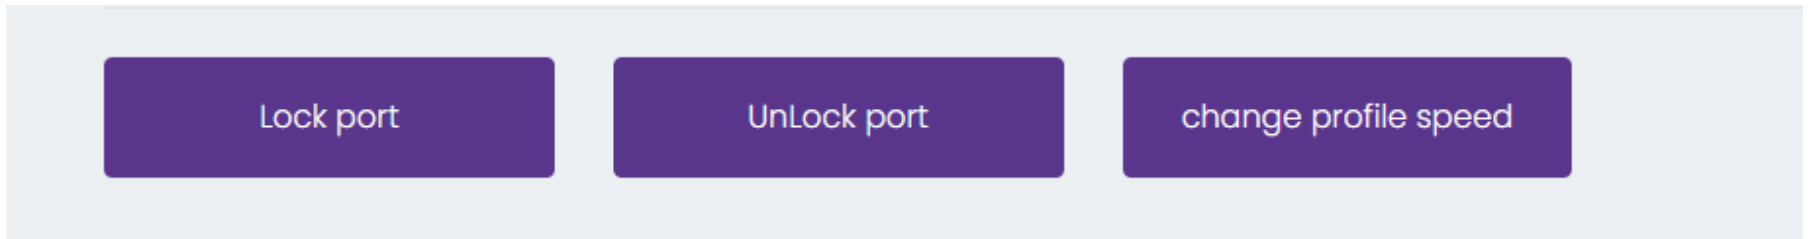

Solved




Not Solved



- If the customer is calling from DSL service number:


- Ask the customer for his/her mobile number
- Ask customer to end call with you and ask him to answer the call on his/her mobile.
- Put Not Ready
- Call the customer
- Connect with him/her without splitter

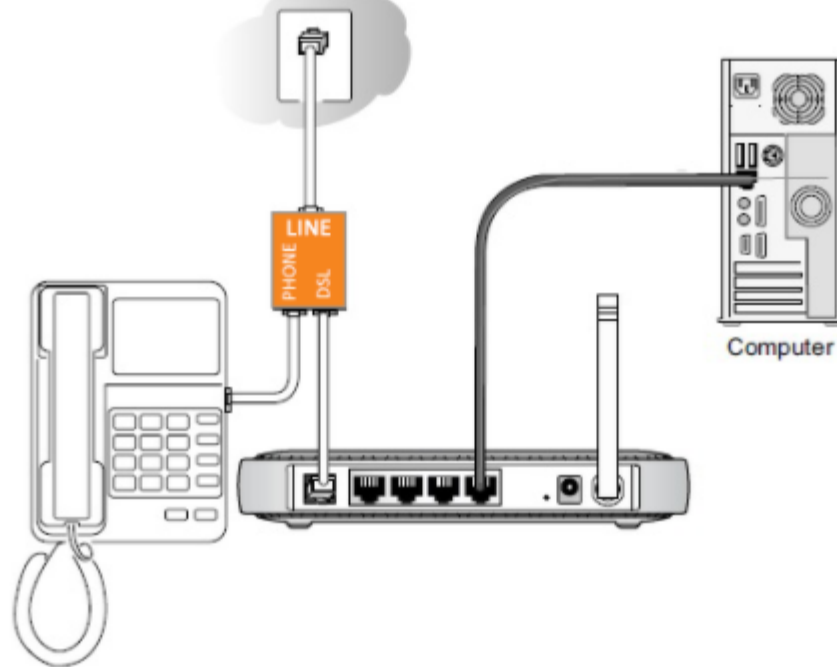

Solved



Not Solved



Open SR

تمام يا أستاذة..... أنا سجلت طلب حضرتك وفي حد من الدعم الفني هيتابع الشكوى، بستأذن حضرتك نسيب الراوتر متوصل، ولو مفيش أي تأخير من المصرية للاتصالات في خلال **48** ساعة عمل هتكون الخدمة شغاله بصورة طبيعية عند حضرتك

Short Code	Type	Area	Product	Owner Group	Sub Area	Status	Smart Script	SLA
39013	Fault For Physical	Bad Line	ADSL	Data Tech Con Support Physical	Empty	Open	Yes	48 Whr

SR #	Short Code	Type	Area	Product	Sub Area	Status
1-981525762288	39013	DSL Fault For Physical	Bad Line	ADSL		Opened

Connection Unstable

Not matched physical with logical up time on FTTH Tool & IP Tool

How to Open Connection unstable WF

The screenshot displays the Orange website's product catalog. At the top, there is an orange logo on the left, a search bar labeled "Search Products" in the center, and a user profile "Sara Adel Mohamed Ab..." with a notification bell on the right. Below the header is a navigation bar with several menu items: "Products", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a downward arrow indicating a dropdown menu. Below the navigation bar, there are four product cards. The first card, "FREEMAX (OLD) ...", has an orange arrow pointing up to it from below. The second card, "WI-FI", features a smartphone icon. The third card, "HOME DSL PACKA...", has an orange arrow pointing down to it from above and features a photo of a white DSL router. The fourth card, "DSL BACK OFFICE", features a technical drawing icon with a wrench and pencil. Each card includes a title, a brief description, and a three-dot menu icon in the top right corner.

orange™

Search Products

Sara Adel Mohamed Ab...

Products ▾ Services ▾ Promotions ▾ Devices - test ▾ Global Scripts - Channels ▾ Internal Guideline ▾ Customer Support Tools ▾ Application Guides ▾

... portfolio introducing new, ...
... and attractiv...

Name is EF-Primo C&C line valid for 1
year for on...

attractive tariffs plans "Dolphin" to
meet all of...

... promises to expand the
choosing base & to...

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for
control share and 4 tariffs for control
plus, change...

WI-FI

Wi-Fi technology is rapidly gaining
acceptance as an alternative to a
wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows



Connection Unstable



Wi-Fi Instability

1.Open FTTH Tool and check the Port Up time.

getPortUpTime

Dec 18, 2024, 12:22:11 PM

True

2024-12-18 07:00:50+02:00

2.Open IP Tool and check the login date.

IPAddress	Logdate
197.166.128.232	11/30/2022 7:49:34 AM



Matched



Not Matched



3. If both not matched (the time between port up time & IP and found more than 5 minutes) will assign "40012" Siebel SR to L3 --> Agent shouldn't do port reset or restart the router.

Siebel SR

Short Code	Type	Area	Product	Owner Group	SLA
40012	D8L Fault For Connectivity	Connection Unstable	ADSL	L3-D8L Fixed Technical Consumer Support	24 Hours

For Copper

Username

Port

0553223728

Q

Line Information

Copper Line Parameters

Traffic

Port status: Down

Last change: Dec 2, 2022, 9:39:29 AM



IP Tool

IPAddress	Logdate
45.246.216.133	1/26/2020 12:59:34 PM



Matched

Not Matched

3. If both not matched (the time between port up time & IP and found more than 5 minutes) will assign "40012" Siebel SR to L3 --> Agent shouldn't do port reset or restart the router.

Open SR

Siebel SR

Short Code	Type	Area	Product	Owner Group	SLA
40012	DSL Fault For Connectivity	Connection Unstable	ADSL	L3-DSL Fixed Technical Consumer Support	24 Hours

.

Addresses

Assets

Contacts

Rate Plan History

Service Requests

Activities

360° View

Attachments

Service Requests

Record Count

Smart Script



Short Code

Type

Area

Sub Area

Product

Status

40012

DSL Fault For Connectivity

Connection Unstable

ADSL



Opened

Browsing Sites Problem

In case receiving customer complaining from sites problem.

- Customer should have a PC/Laptop in order to follow this handling.
- If no and customer only has a mobile, accordingly agent should make sure that the customer is connected (Authenticated and has IP) and date & time is updated.
- Agent should create & close the below SR:

Short Code	Type	Area	Sub Area	Product	Owner Group
40009	DSL Fault For Connectivity	Browsing Sites Problem	Not Solved Customer Side Issue	ADSL	DSL Call Center

Enter username :

GET IP

IPAddress	Logdate
197.162.86.124	12/18/2024 7:00:53 AM

PCRF Main Package ADSL Usage

Main Package Data

PackageName	Home Internet 420(30 Mbps)
CurrentDownload	30720 KBs
CurrentUpload	3072 KBs
CustomerQuota	300.0 GBs
CustomerQuota_expiryDate	2025-01-14T23:59:59Z
CustomerQuota_remainingPercentage	95.0%
CustomerQuota_startDate	2024-12-15T00:00:00Z
CustomerQuota_usagePercentage	5%
RemainingQuota	285.9 GBs

- Ask the customer if s/he can browse other websites or not.




In case can browse other websites, agent should ask the customer If s/he installed a firewall/ ISA server.

If Yes, ask the customer to connect back to back and make sure the default GW for his/her PC/Laptop is router IP (not ISA server IP).

If No, follow the below:

- Let customer try to open the web site



Can Browse this site



Can't Browse this site

- Check Date and Time on customer's PC.



- Let customer try to open the web site.



Can Browse this site



Can't Browse this site



- Reset browser settings to default



- Let Customer try to open the web site



Can Browse web sites






Can't Browse web sites






- Check DNS , on TCP/IP Setting

- Preferred DNS 41.128.225.225

- Alternate DNS 41.128.225.226

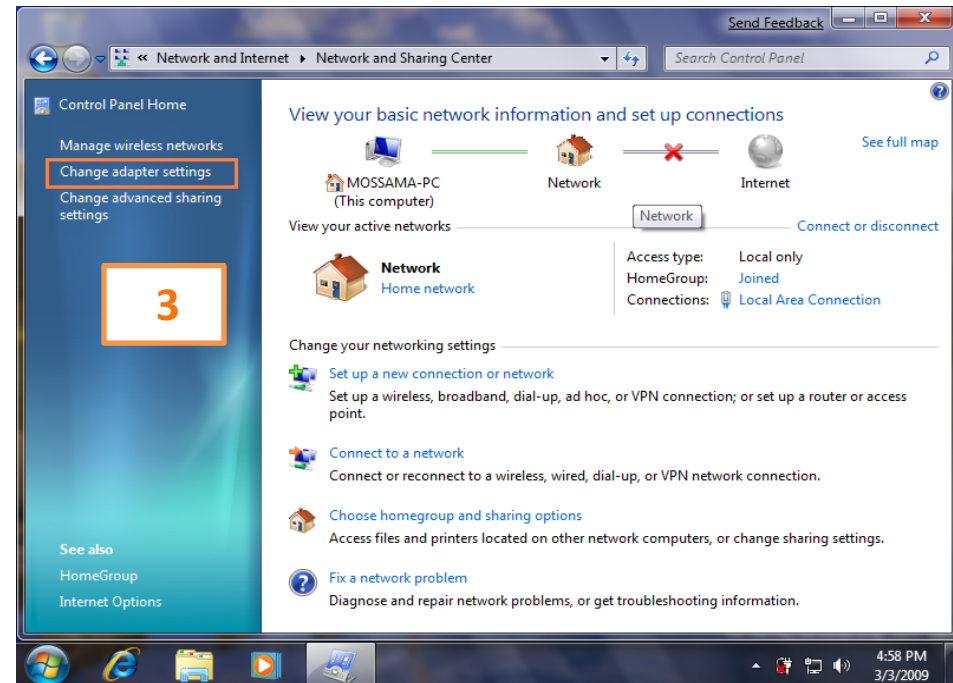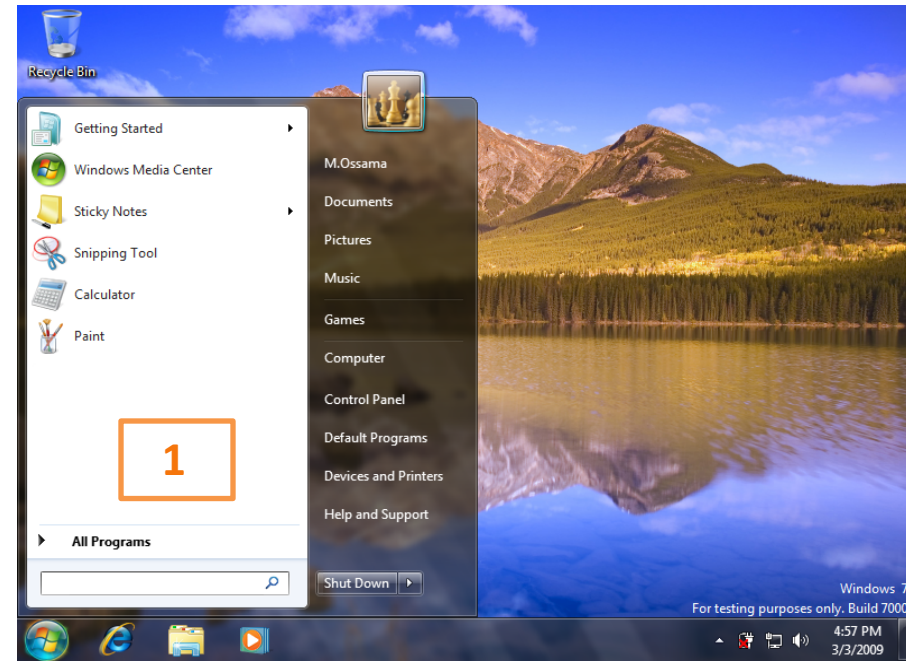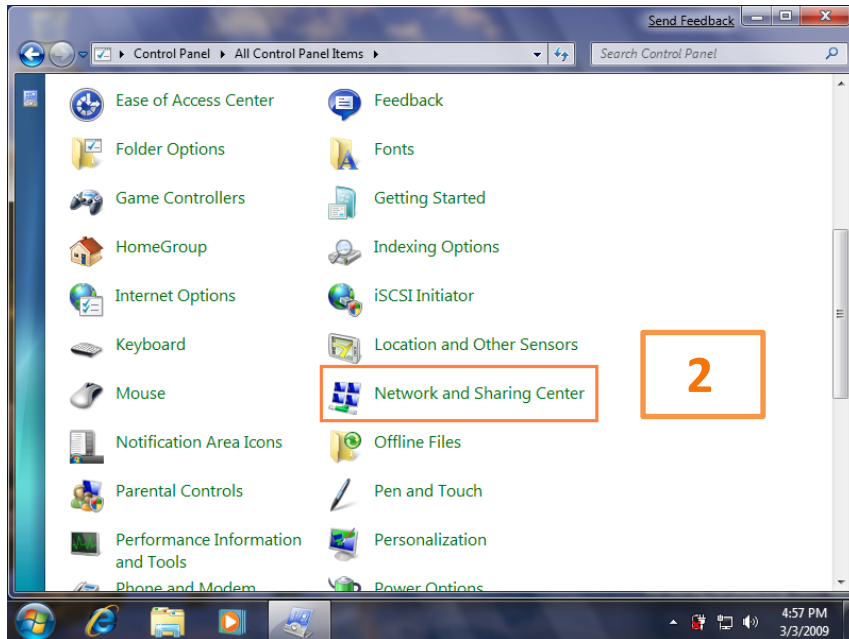

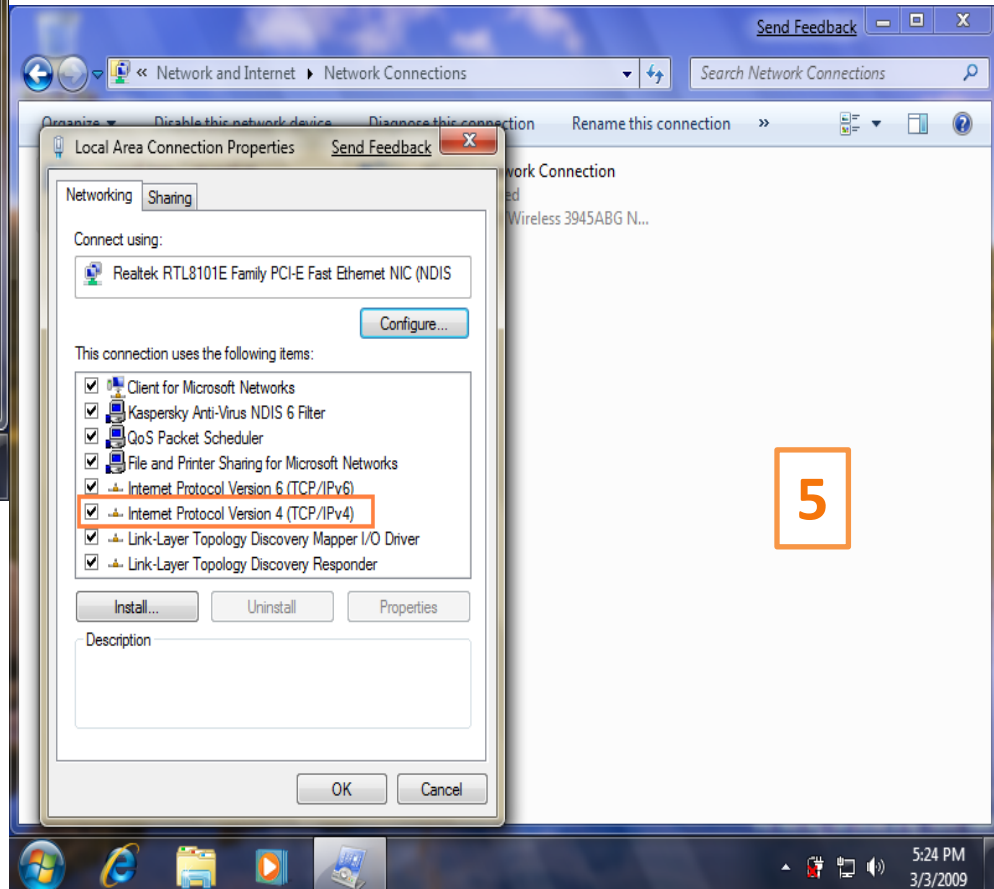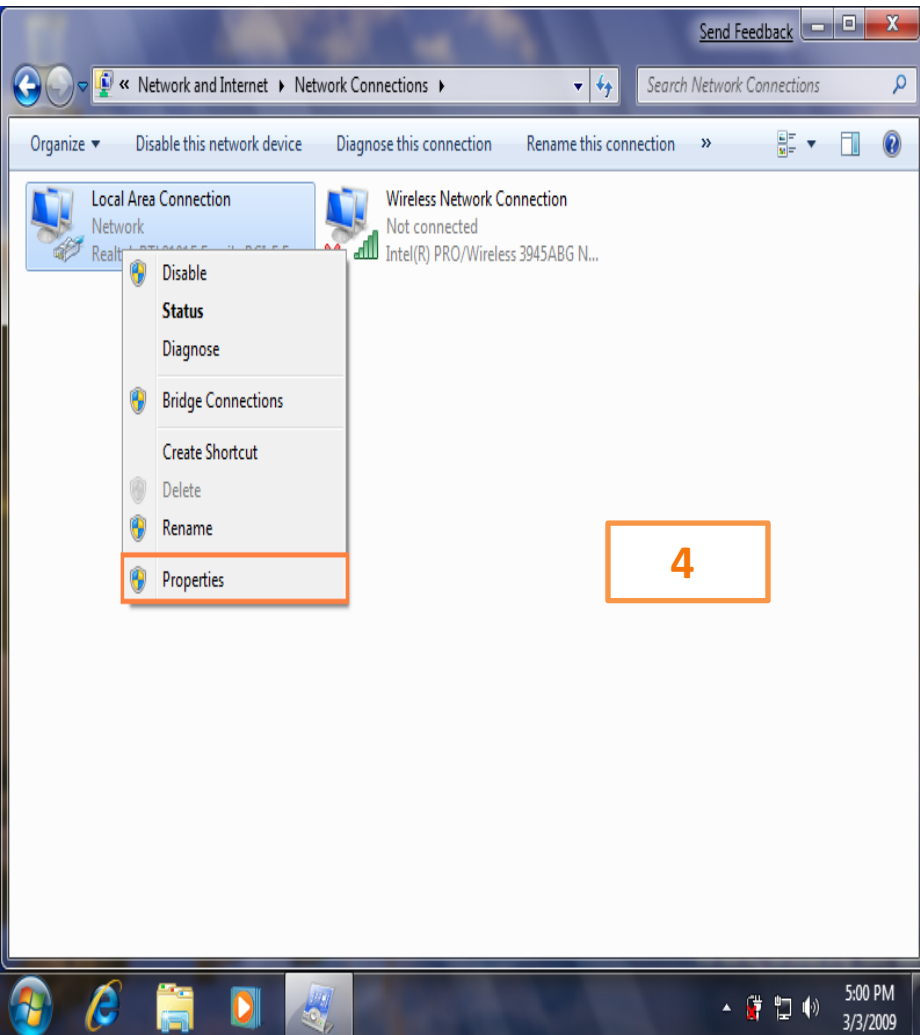

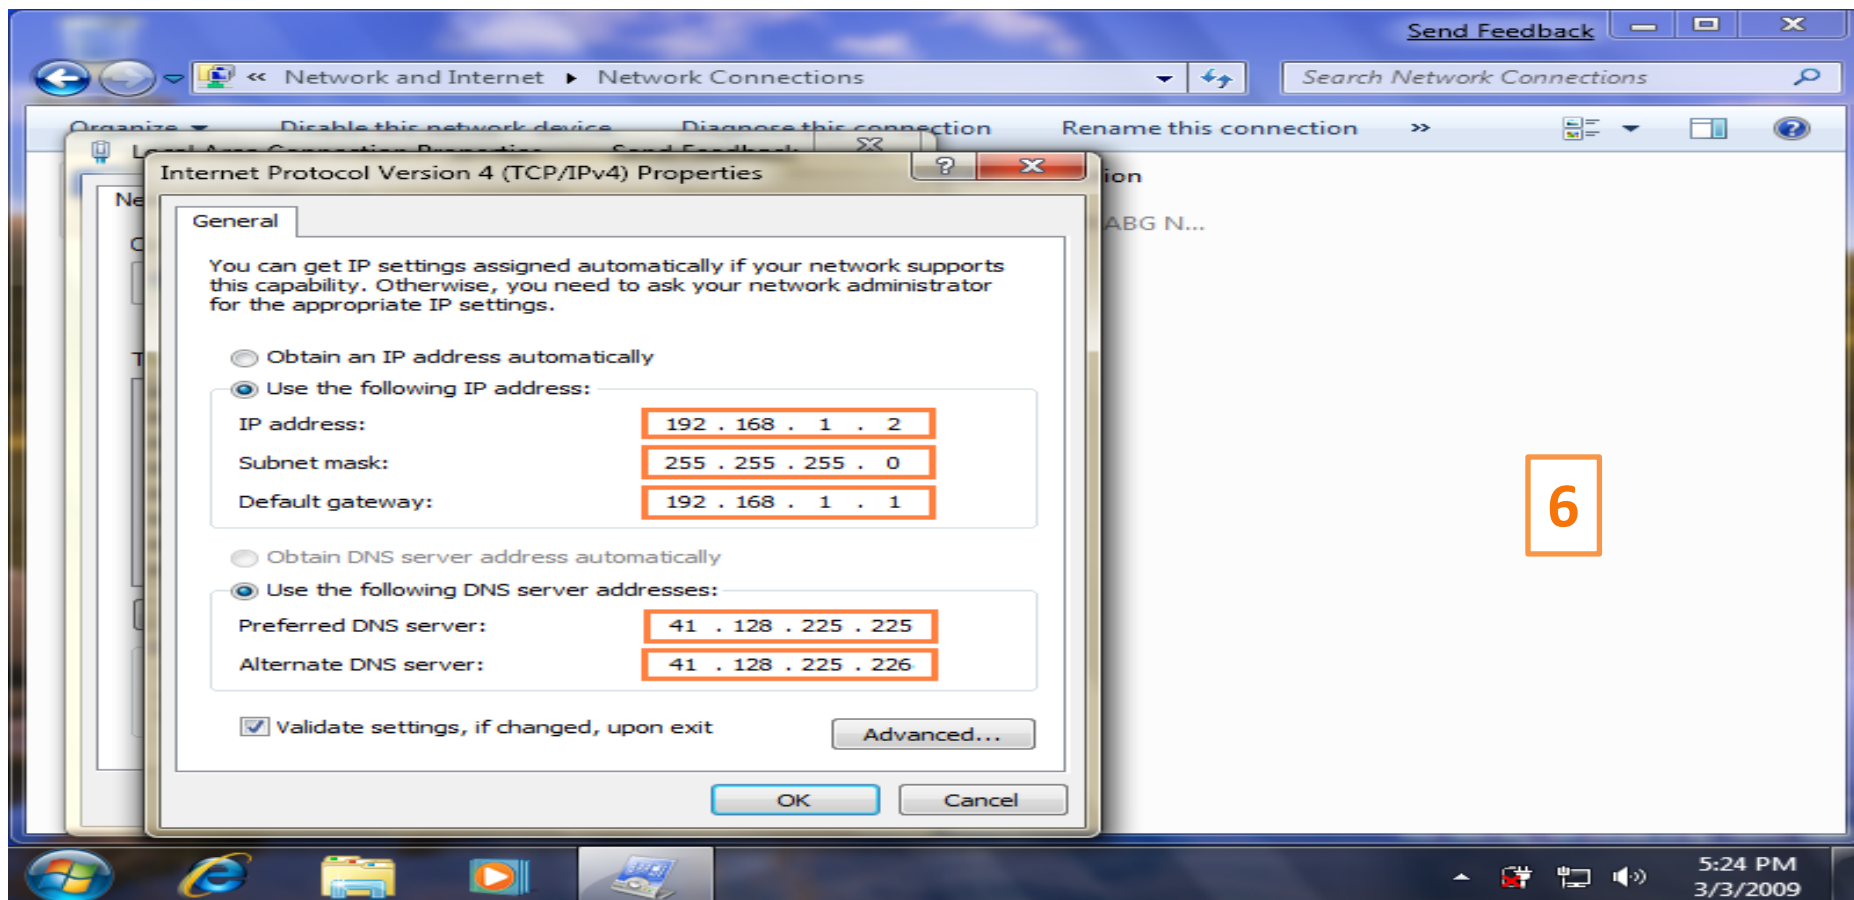

Let customer try to open the web site



Ask our customer to open famous sites www.hotmail.com Or www.msn.com



Yes

No

-change the MTU to 1420.



Yes

No

Get tracert from customer side.

Attached the image with ticket and open case to [Consumer Support](#) with source [Browsing sites Problem- K](#)

Use the following steps to know how to Trace any website (type tracert and the name of the web site you want to trace), then click "Enter" button.

```
C:\WINDOWS\system32\cmd.exe - tracert www.yahoo.com

C:\Documents and Settings\nohaned.sosman>tracert www.yahoo.com

Tracing route to www.yahoo-ht3.akadns.net [69.147.76.15]
over a maximum of 30 hops:

  0  <1 ms    <1 ms    <1 ms    10.6.38.1
  1  1 ms     <1 ms    <1 ms    host-41-196-1-1.static.link.com.eg [41.196.1.1]

  2  229 ms   191 ms   154 ms   10.181.2.193
  3  129 ms   87 ms    74 ms    172.18.2.189
  4  36 ms    7 ms     21 ms    172.20.1.242
  5  116 ms   204 ms   93 ms    80.77.0.189
  6  197 ms   247 ms   325 ms   te2-4-10ge-ar3.dca3.gblx.net [67.16.160.210]
  7  179 ms   177 ms   101 ms   ge-3-0-0.0.cjr03.ldn004.flagtel.com [62.216.129.66]
  8  307 ms   171 ms   201 ms   ae-92-92.csw4.washington1.level3.net [4.69.134.158]
```

Script

تمام يا أستاذة..... أنا سجلت الطلب لحضرتك وفي خلال الـ 24 ساعة اللي جاية فيه حد هيتواصل مع حضرتك من . جانبنا لحل المشكلة ونستأذنك تسبب الراوتر شغال

- **Siebel SR:**

Code	Type	Area	Product	Smart Script	Owner Group	SLA
40009	DSL Fault For Connectivity	Browsing Sites Problem	ADSL	Yes	L3-DSL Fixed Technical Consumer Support	24 Hrs

- In case of eceeding SLA, send mail to Egypt L3 technical consumer support L3consumersupport-eg@orange.com

Addresses Assets Contacts Rate Plan History **Service Requests** Activities 360° View Attachments

Service Requests

Record Count

Smart Script



Short Code

Type

Area

Sub Area

Product

Status

40009

DSL Fault For Connectivity

Browsing Sites Problem

ADSL



Opened

WLAN

Wireless LAN that uses to link more devices using wireless communication from a local area network within limited area.

How to Open WLAN WF

The screenshot displays the Orange website's navigation and product sections. At the top left is the Orange logo. A search bar labeled "Search Products" is positioned to the right of the logo. In the top right corner, the user's name "Sara Adel Mohamed Ab..." and a notification bell icon are visible. Below the search bar is a horizontal navigation menu with the following items: "Products", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a downward arrow indicating a dropdown menu. Below the navigation menu, there are four product cards. The first card is titled "FREEMAX (OLD) ..." and contains the text "Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...". The second card is titled "WI-FI" and contains the text "Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...". The third card is titled "HOME DSL PACKA..." and contains the text "Home DSL Packages.". The fourth card is titled "DSL BACK OFFICE" and contains the text "DSL Back Office Workflows". An orange arrow points from the "Products" menu item to the "FREEMAX (OLD) ..." card. Another orange arrow points from the "Internal Guideline" menu item to the "HOME DSL PACKA..." card.

orange™

Search Products

Sara Adel Mohamed Ab...

Products Services Promotions Devices - test Global Scripts - Channels Internal Guideline Customer Support Tools Application Guides

expand portfolio introducing new, simple and attractiv...

Name is E-Primo C&C line valid for 1 year for on...

attractive tariffs plans "Dolphin" to meet all of...

Monthly profiles to expand the choosing base & to...

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

Technical

DSL BACK OFFICE

DSL Back Office Workflows

ON THIS PAGE

Basic Information

Common Asked Questions

Plans

How to Pay

How to Manage My Account

How to Complain

Siebel

Related Offers

Related VASs

Work Instructions

Related Links

How to Complain

Network

View All

 [Transfer from Reseller to another Reseller](#)

 [Quota Consumption Issues](#)

1

 [Slow Upload](#)

2

 [Slow Browsing](#)

 [No Browsing](#)

 [Wlan](#)

Billing

View All

 [Bill Amount](#)

 [Orange DSL FeedBack](#)

 [MSAN-Financial Adjustment](#)

 [Money Transfer](#)

 [Bad Debts](#)

 [Customer Requests](#)

 Wi-Fi Password	  No Browsing
 Wlan Issues	 Changing WIFI Channel



Windows Seven



Windows 8 & 10



MAC


• **How to check if Wireless Installed driver card is installed on windows 10:**

- Start button
- Settings
- Network & Internet
- Status
- Network and Sharing Center
- Click on change adapter settings it'll direct you to network connections.
- You notice Wi-Fi icon, if not found that means Wireless network adapter is not installed.


• **How to check if Wireless Installed driver card is installed on windows 8:**

- From the start menu click on "Desktop" icon


- From the start menu click on "Desktop" icon

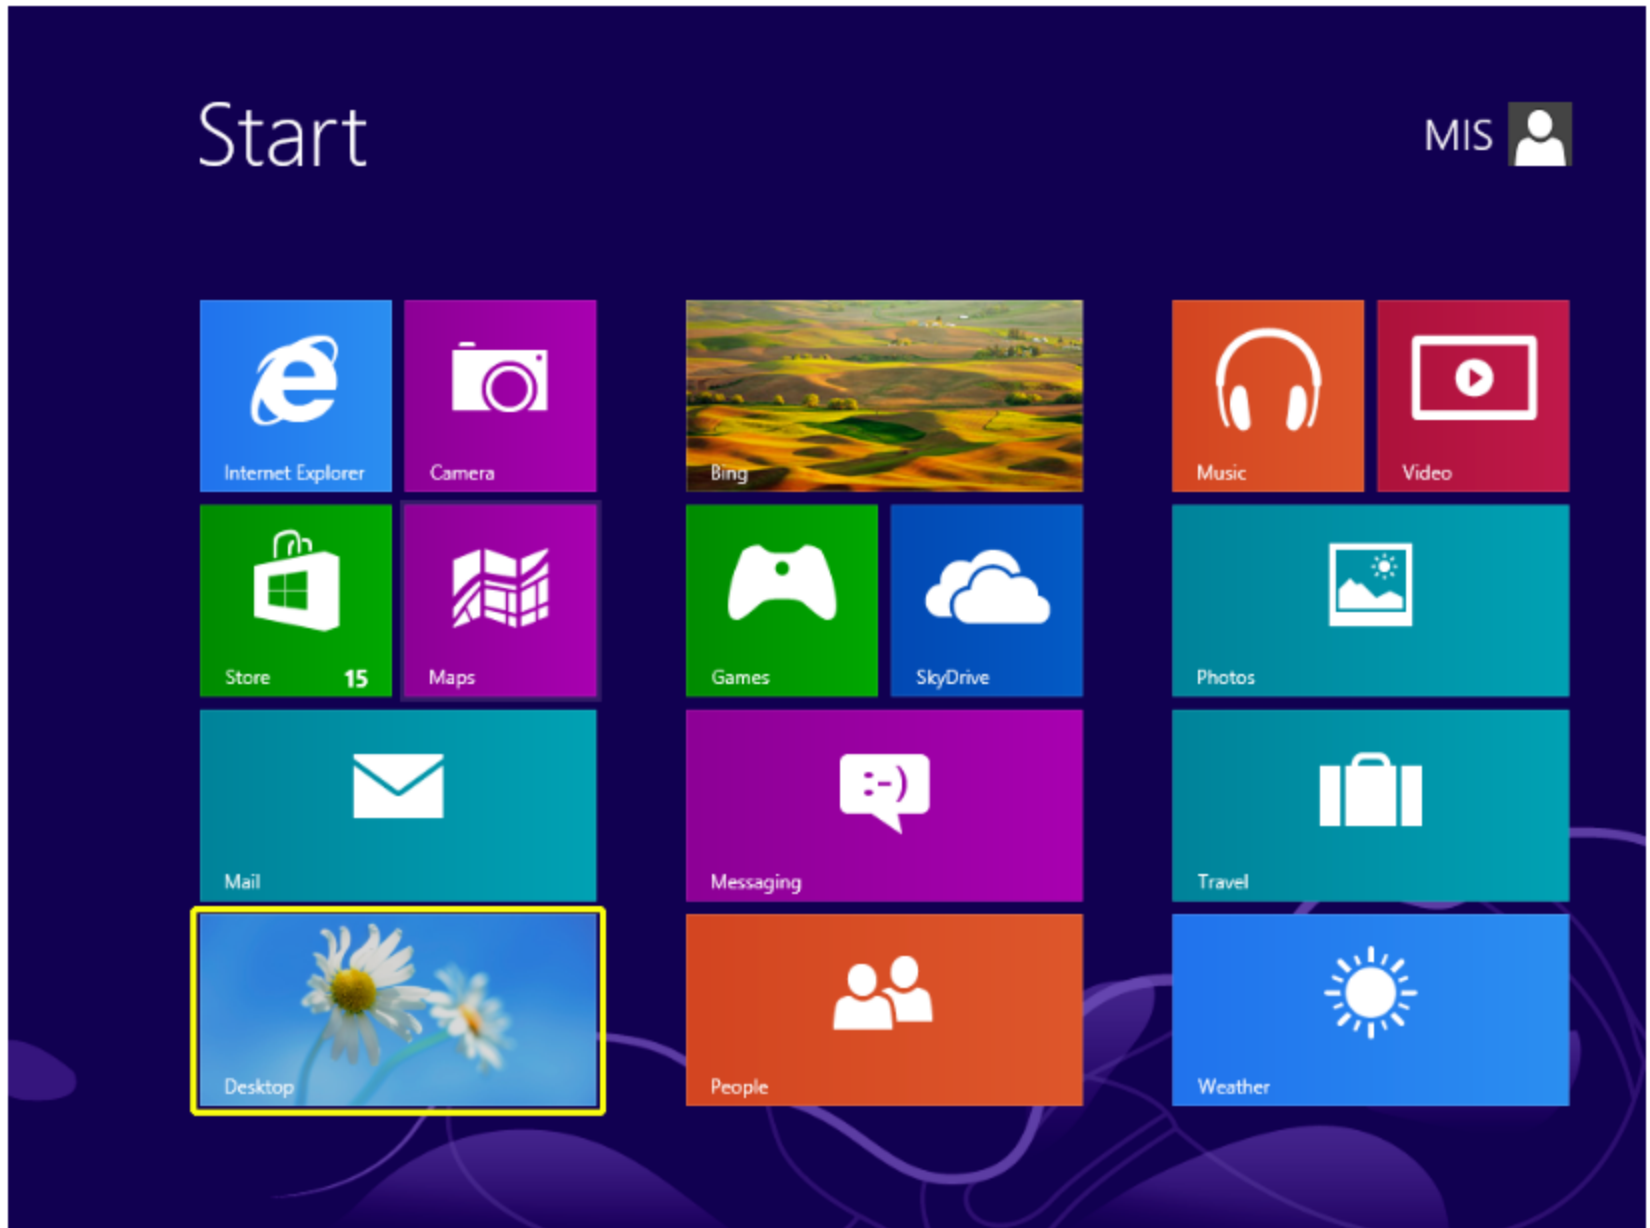


- On the notification right click on the network Icon Select Open Network and Sharing Center.

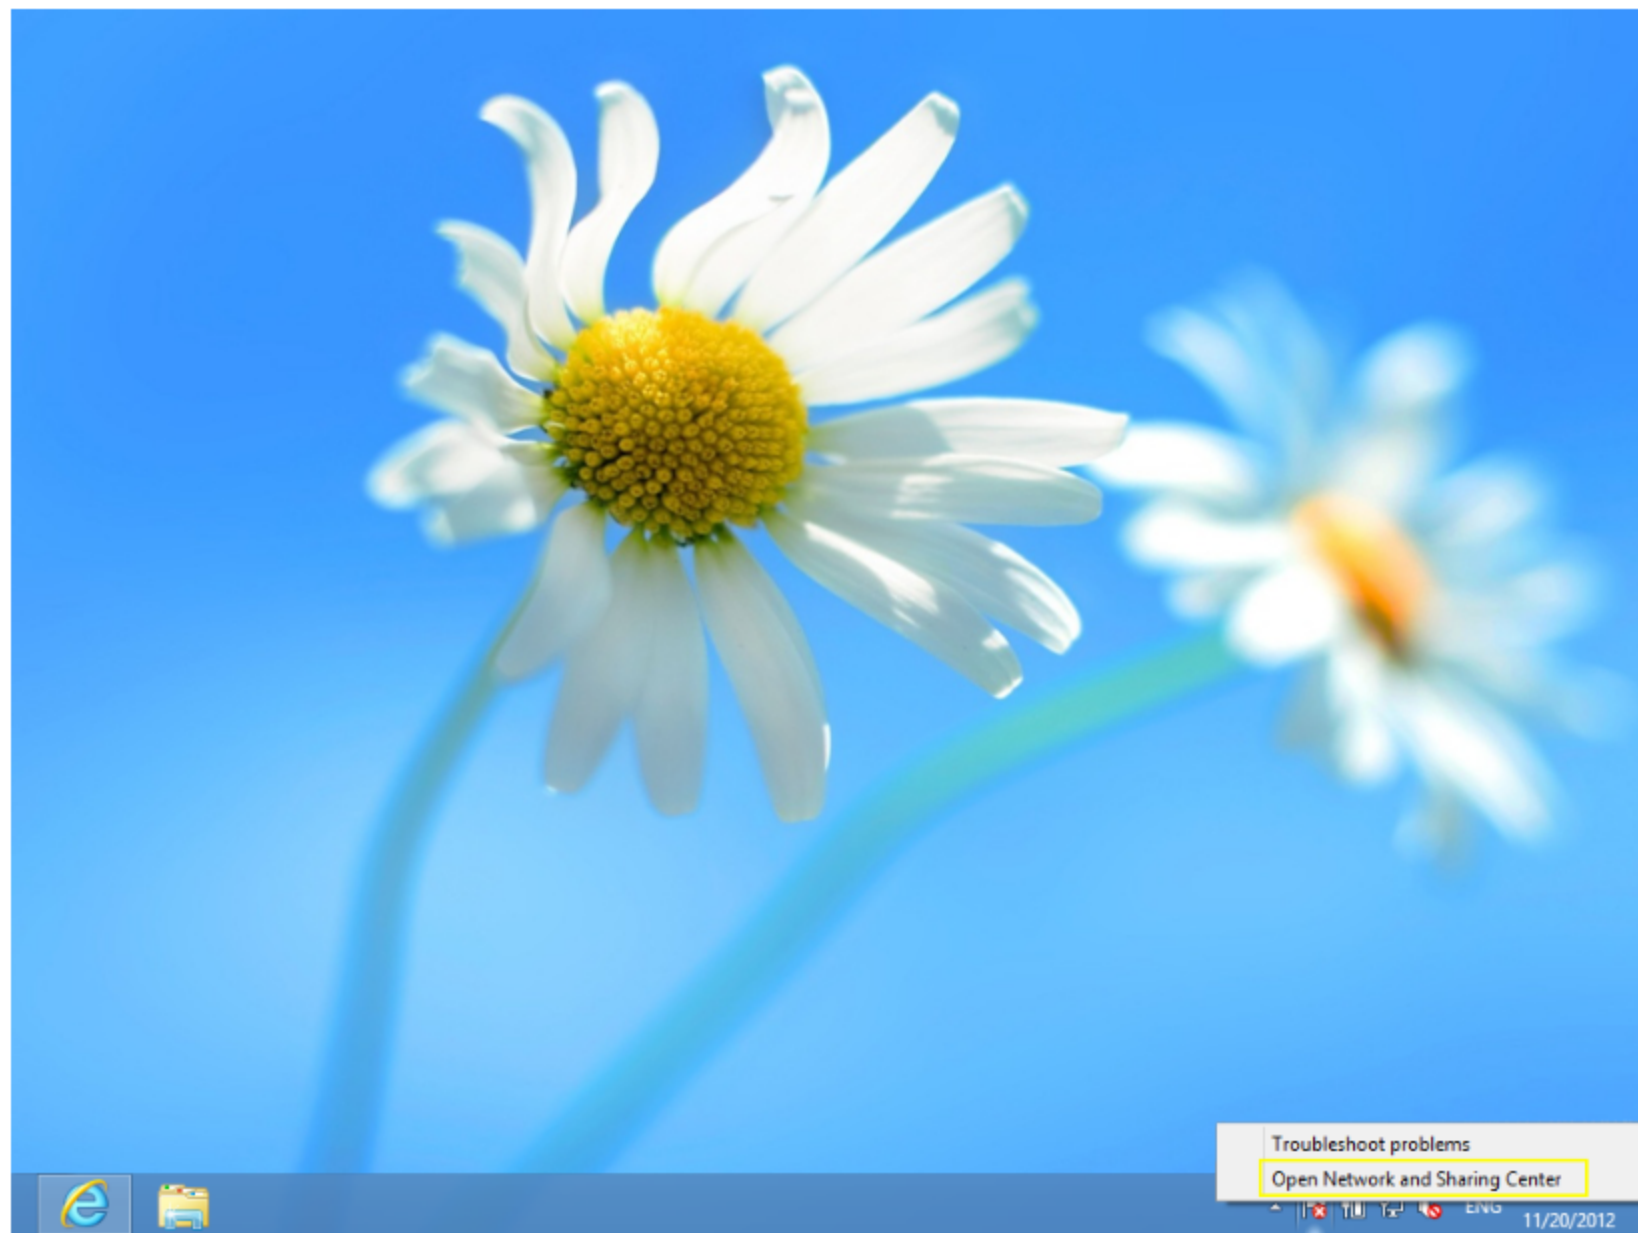

- Click on change adapter settings it'll direct you to network connections.

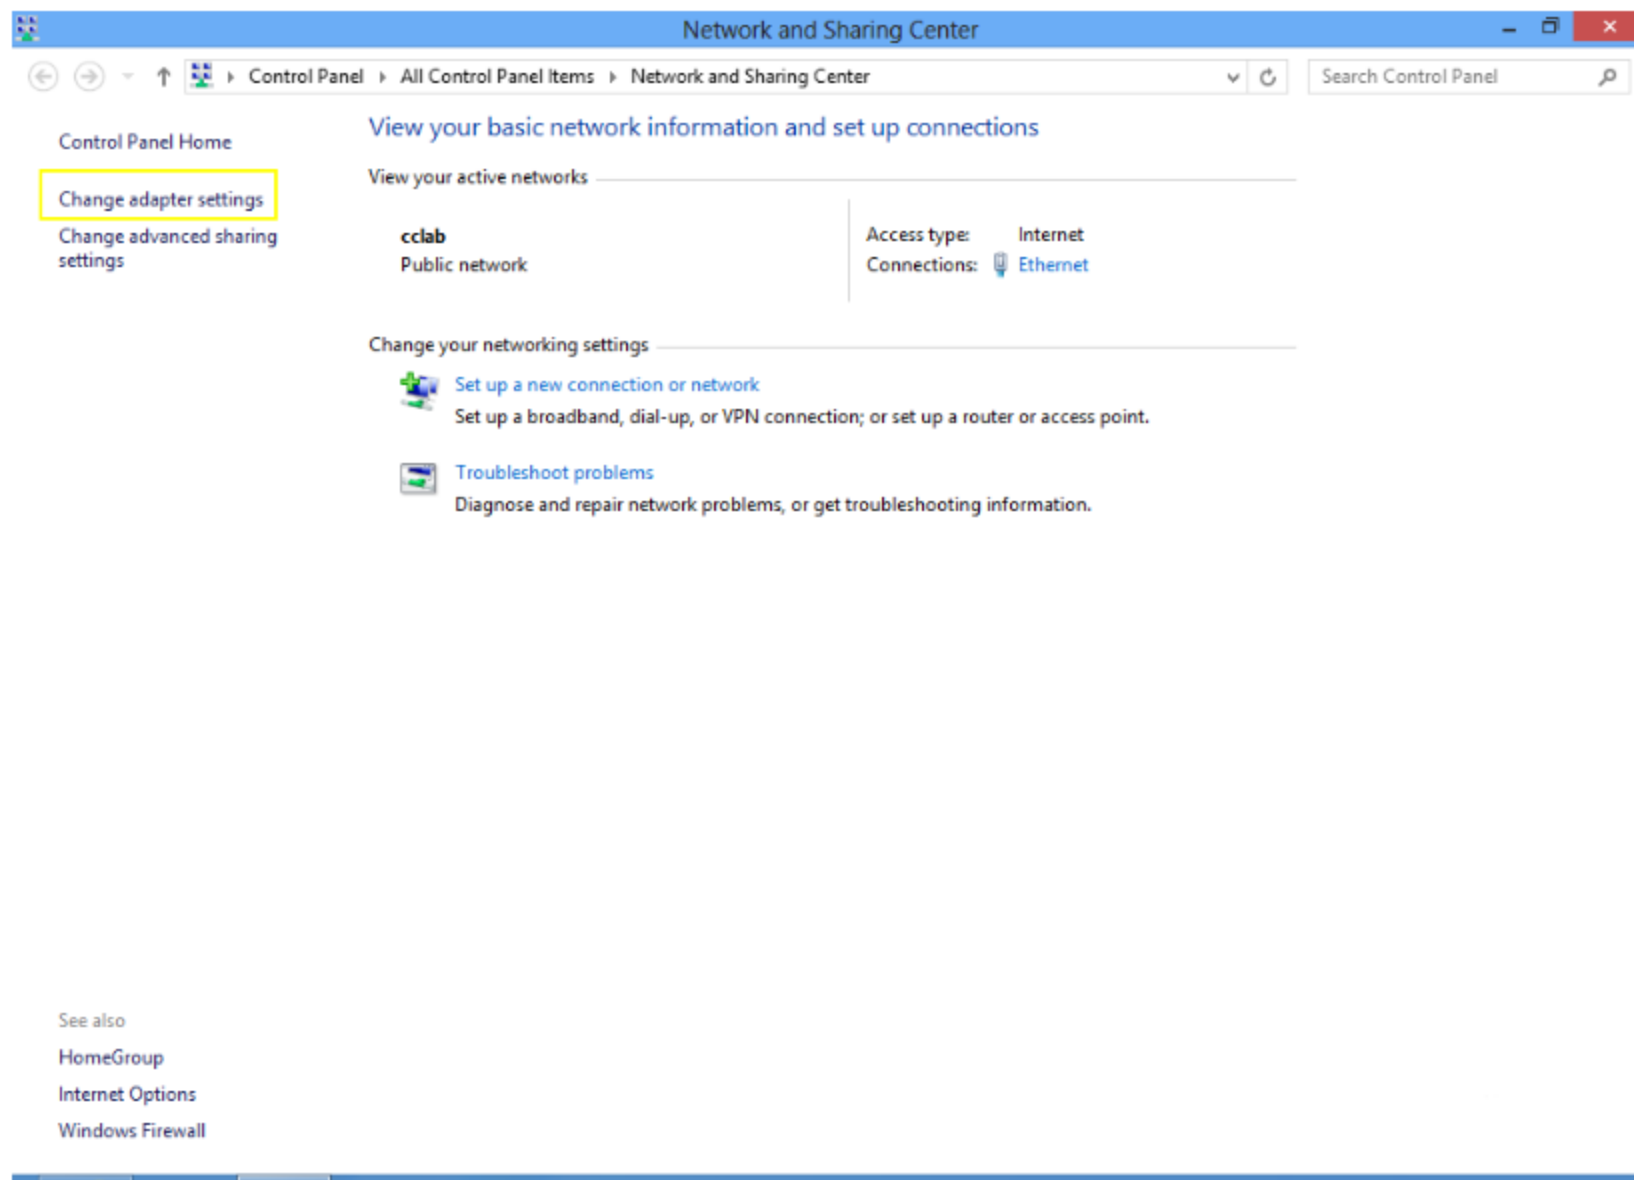

- You notice Wi-Fi icon, if not found that means Wireless network adapter is not installed

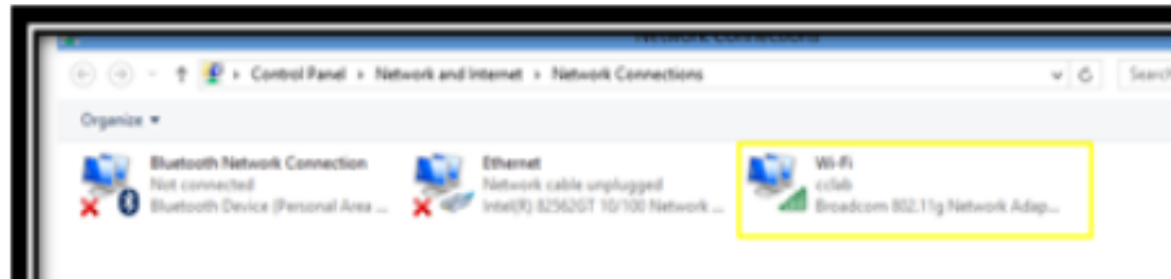

Installed




Not Installed



Short Code	Type	Area	Sub Area	Product
40029	DSL Fault For Connectivity	WLAN No Browsing	Not Solved internal network	ADSL

Wireless Network Card not installed

Installed



Not Installed



- If the router has a **Wireless Button**, check if it is On or Off.
- Check wireless LED in the customer router.



Wireless ON



Wireless OFF

- If the router has a Wireless Button, check if it is On or Off.
- Ask customer to press and hold on WLAN button till WLAN led become up, to switch on WLAN in the router.
- If WLAN button not working, DSL agent should check with cable to open WLAN from router page.



Wireless led is on



Wireless led is off

- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



Router From Orange



Router Not From Orange

- In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:
- In case the router is not from Orange, agent should upsell the new High-End router to the customer.
 - If the customer accepts; providing the nearest shop and working hours.
 - If the customer rejects; informing her/him the vendor's details (Name, Address, and Contact).

Siebel SR

Short Code	Type	Area	Sub Area	Product
40029	DSL Fault For Connectivity	WLAN No Browsing	Not Solved CPE Problem	ADSL



Router From Orange



Router Not From Orange

In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario

- If the router has a **Wireless Button**, check if it is On or Off.
- Check wireless LED in the customer router.





Wireless ON




Wireless OFF


- Let customer search for available wireless networks

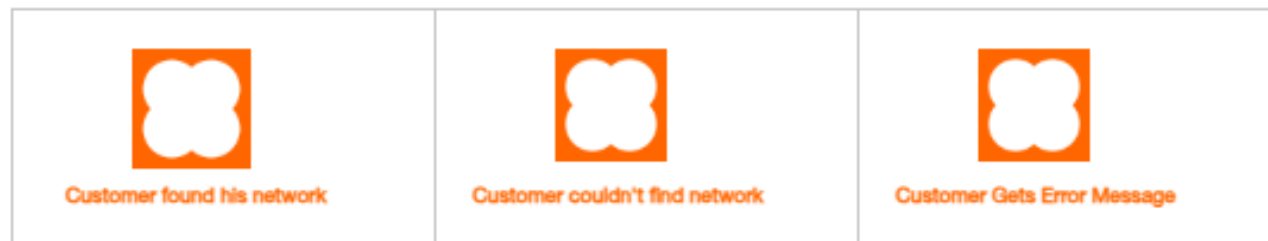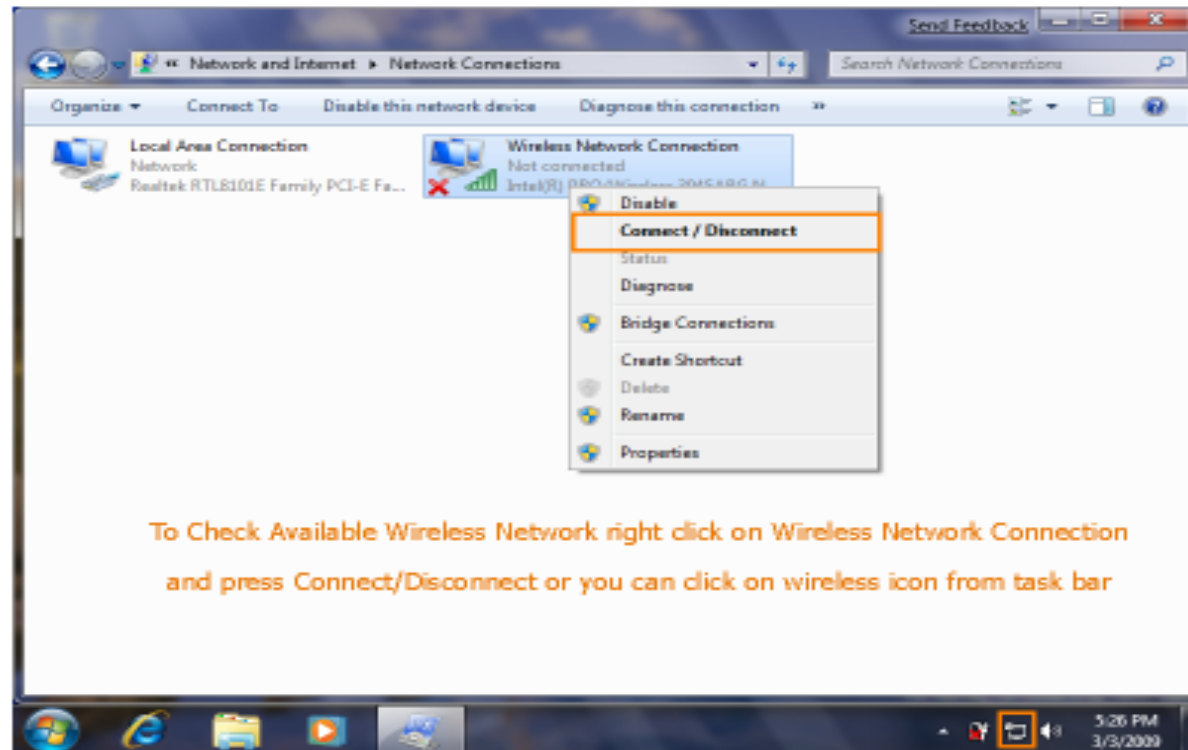

- Let customer choose his wireless network and press connect

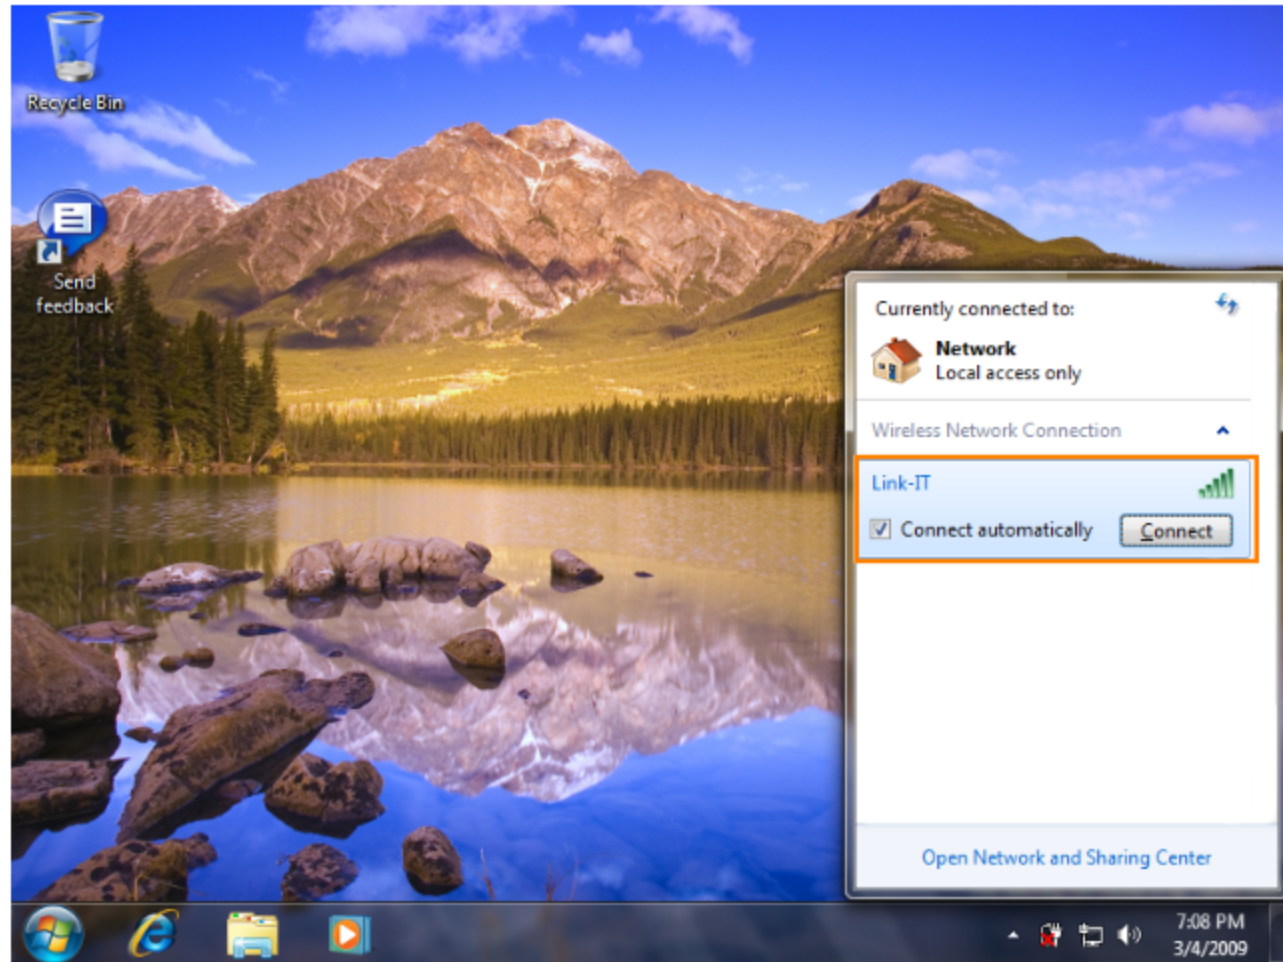

- If he connected to secured network, customer will be prompted to enter his password

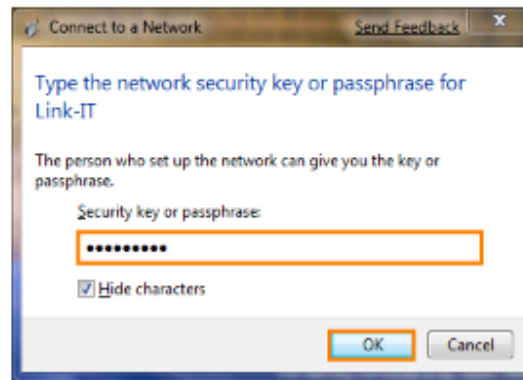

Connected Successfully




Couldn't Connect




- Let customer Delete Preferred network List then restart his PC

1- Click Start Menu, Select Control Panel then choose Network and Sharing Center

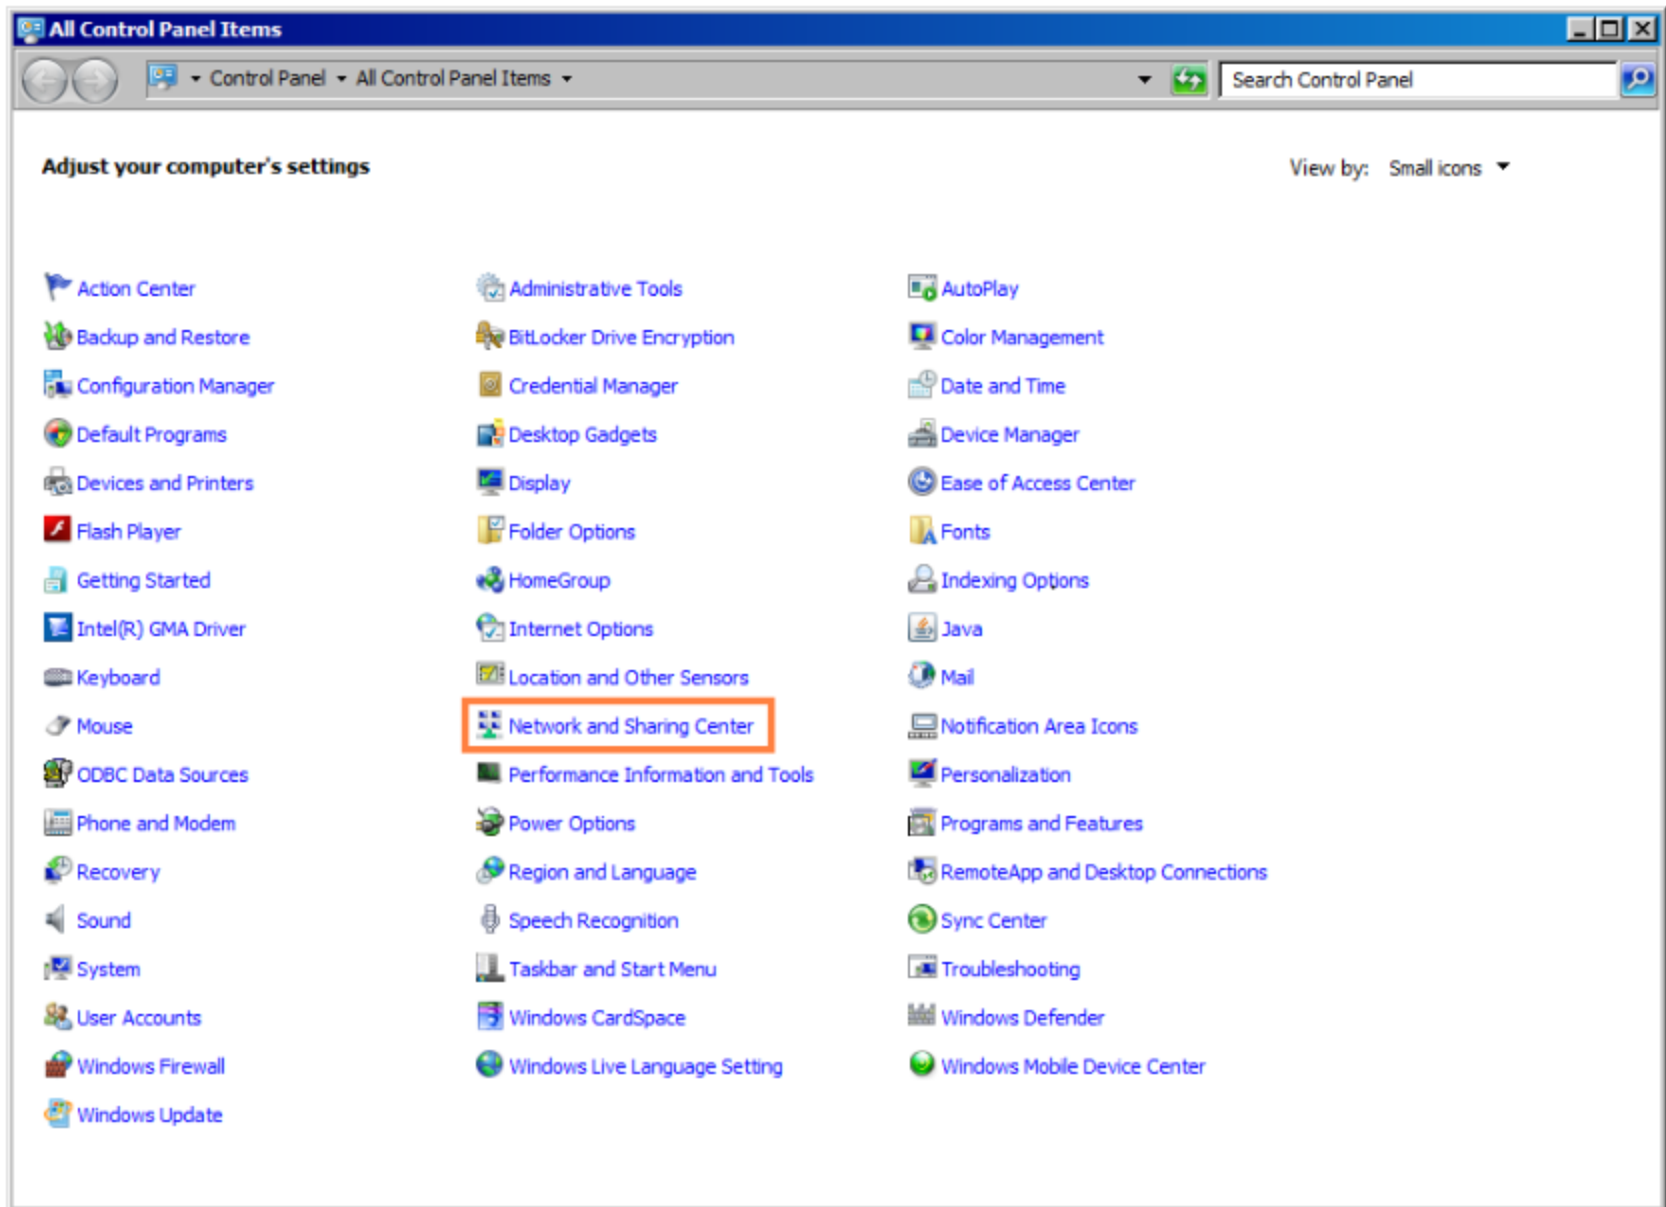


2- From Left menu click on **Manage wireless networks**

***if you not found Mange wireless networks click her to know how to show it**

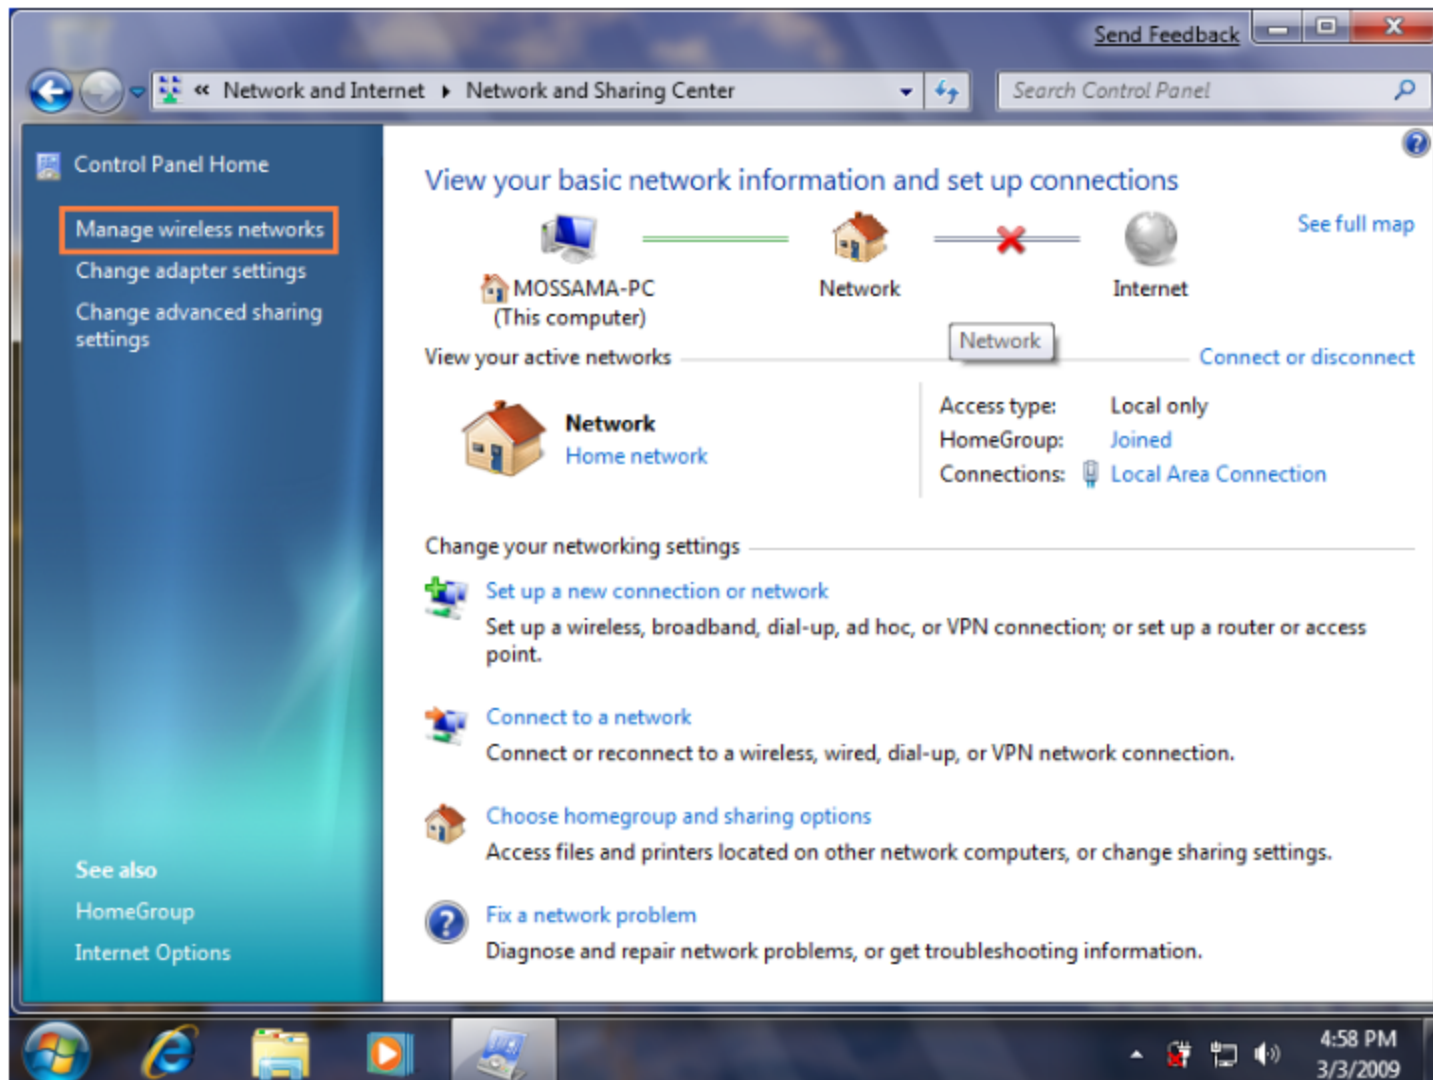

- Select wireless network then click **Remove** button

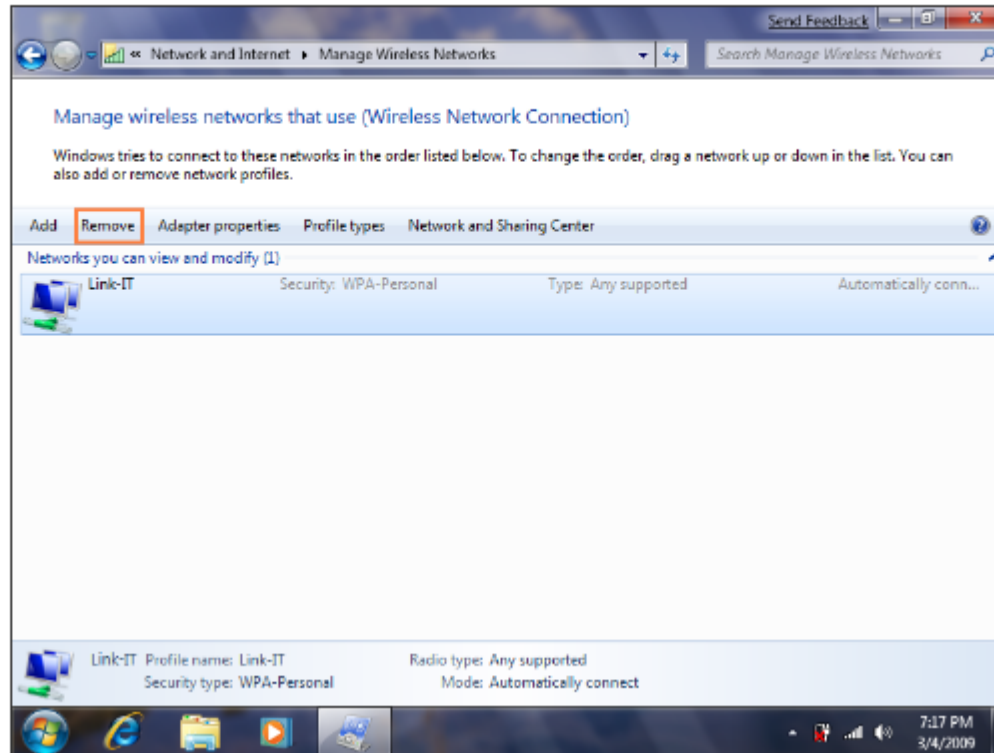

- Let customer connect again by wireless to his router



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario


- Let customer connect again by wireless to his router




- Let customer try to check browsing.
- In case customer faced this error message "you need to check your connection with your ISP", We have to Restart the CPE first.




- Press right click on whatever the Local Area Connection or the Wireless Network Connection and choose Properties.

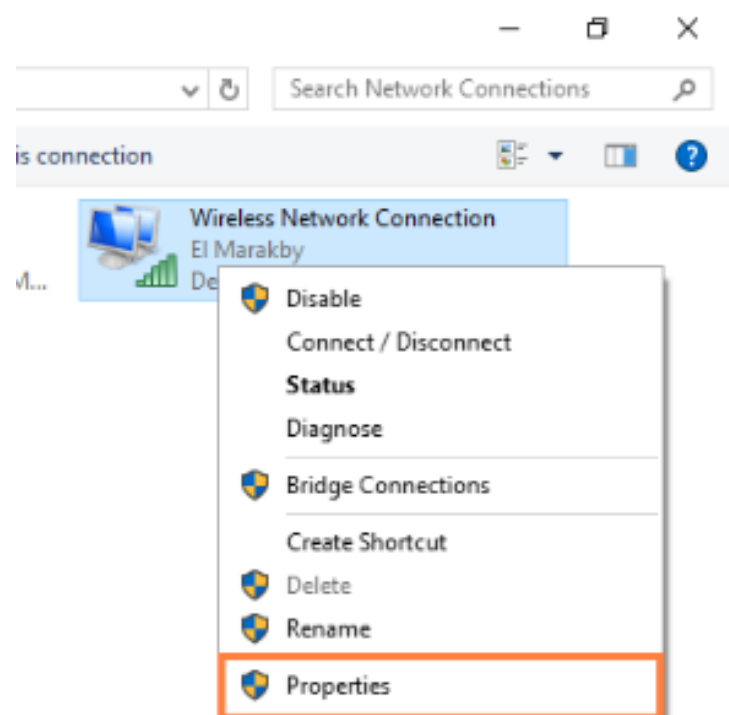

- Double Click on Internet Protocol Version 4 (TCP/IPv4).

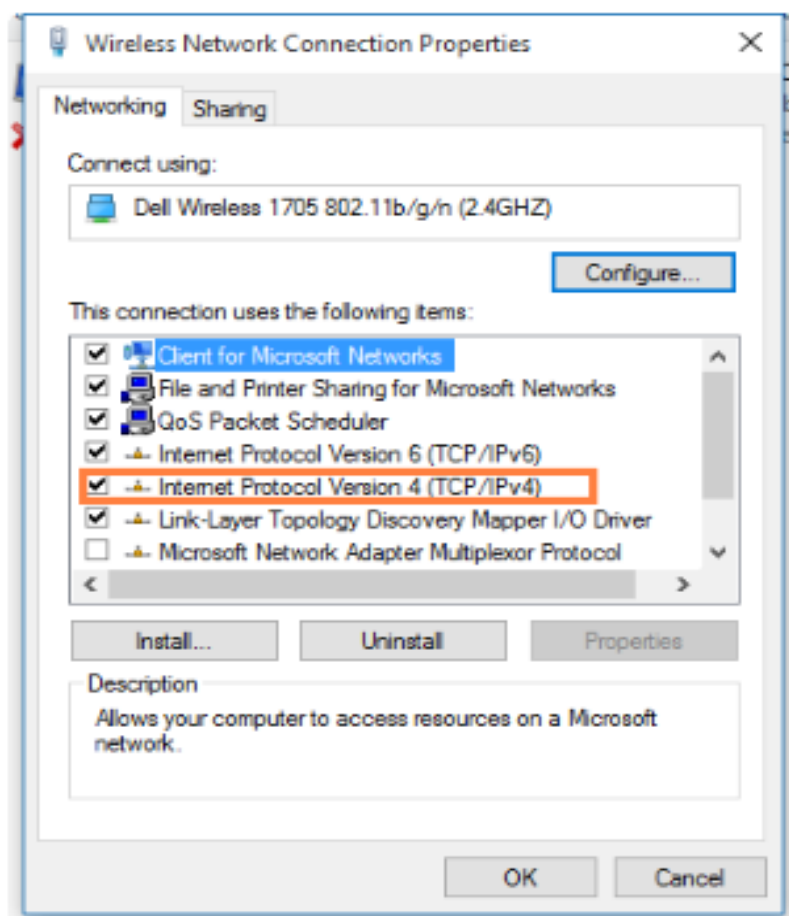

- Chose Use the following IP address , add the IPs , DNS and click OK.

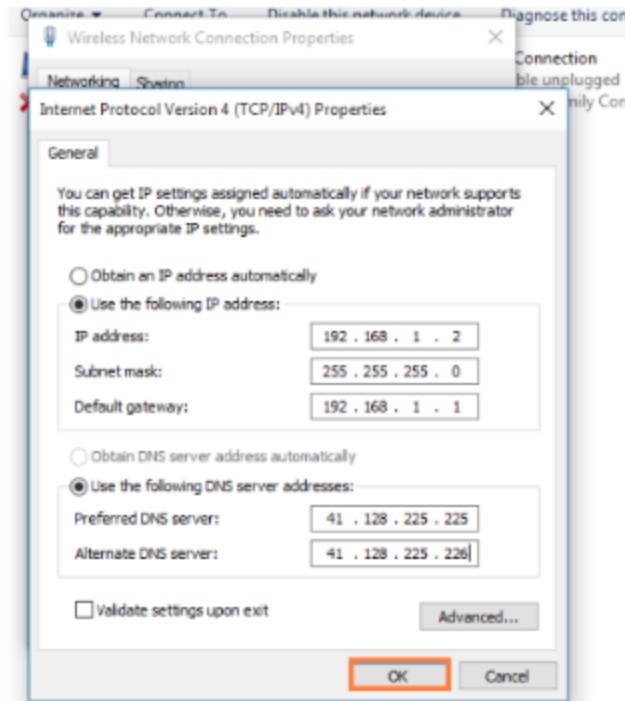

- Let customer to check with cable



- Check No Browsing Workflow



- Let customer to check with cable



- Ask the customer to check with another wireless device if possible



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.


Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario


- Let customer try to check browsing.
- In case customer faced this error message "you need to check your connection with your ISP", We have to Restart the CPE first.




- Press right click on whatever the Local Area Connection or the Wireless Network Connection and choose Properties.

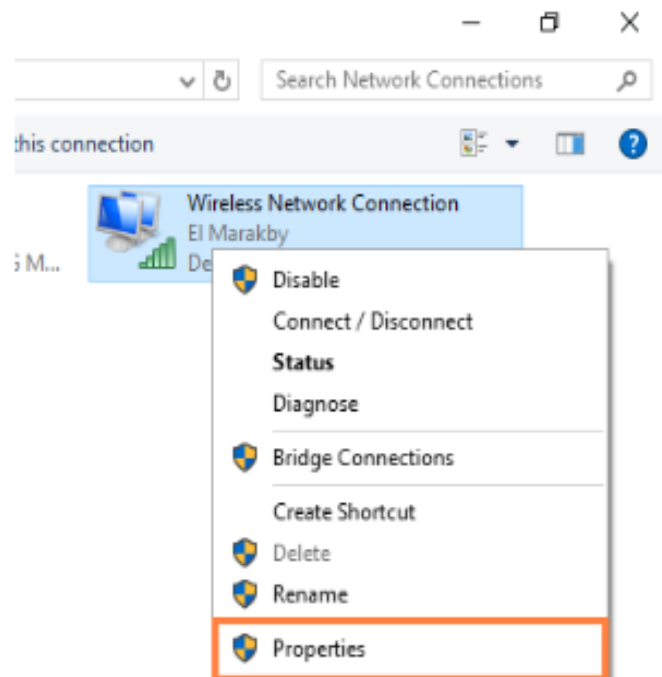

- Double Click on Internet Protocol Version 4 (TCP/IPv4).

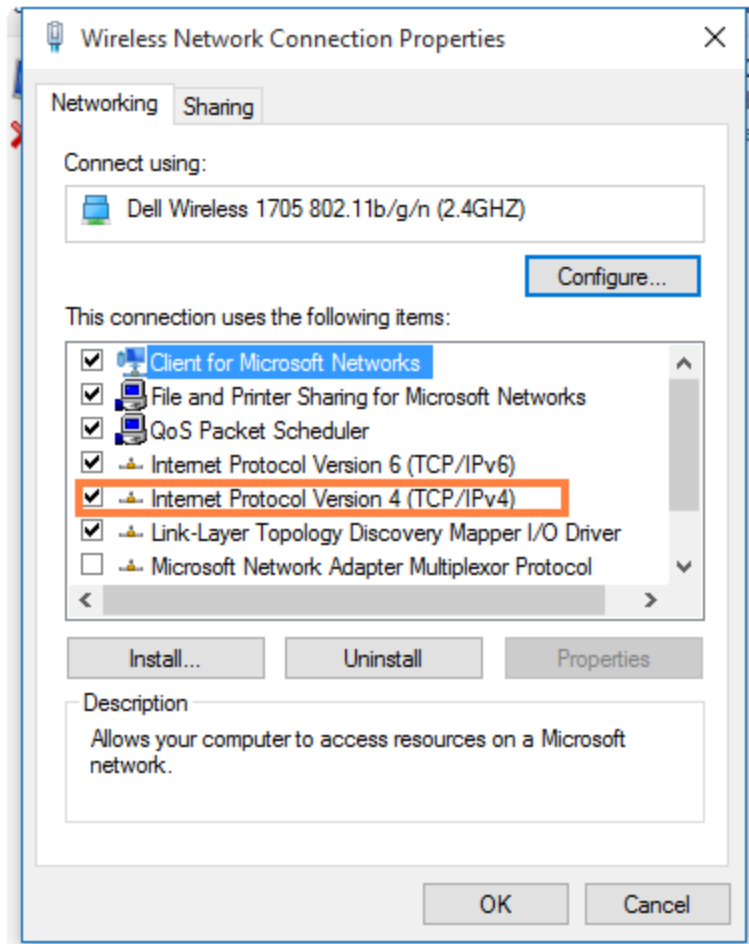

- Chose Use the following IP address , add the IPs , DNS and click OK.

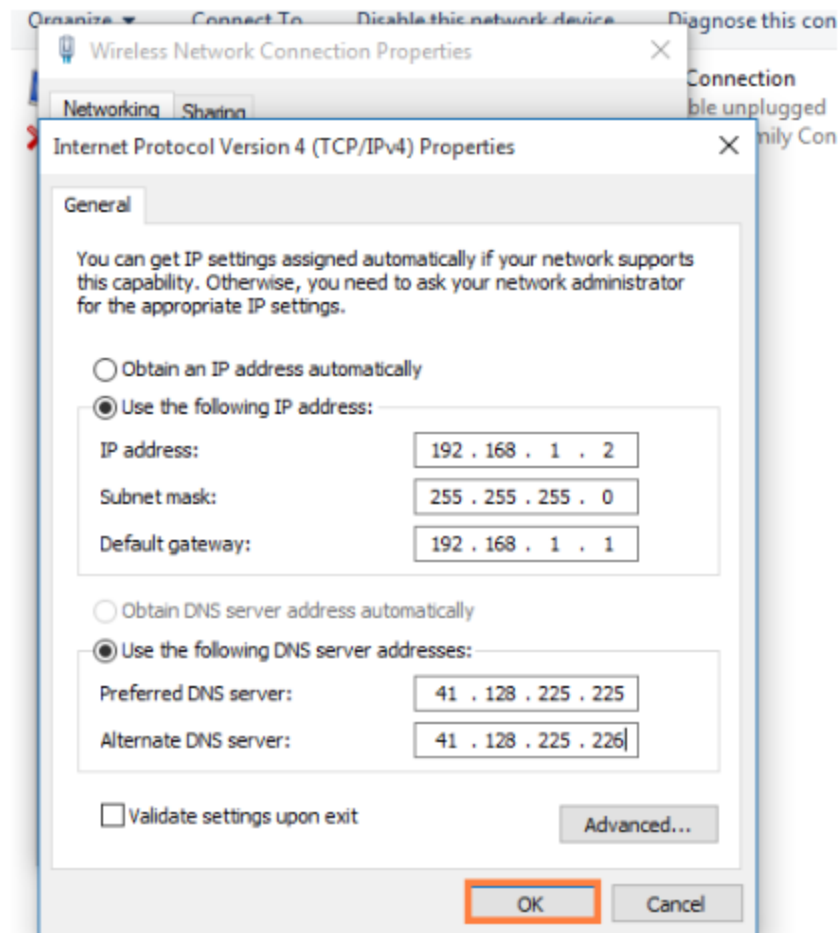

- Let customer to check with cable



- Check No Browsing Workflow



- Let customer to check with cable



- Ask the customer to check with another wireless device if possible



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR


Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario




- Let customer try to check browsing.
- In case customer faced this error message "you need to check your connection with your ISP", We have to Restart the CPE first.




- Press right click on whatever the Local Area Connection or the Wireless Network Connection and choose Properties.

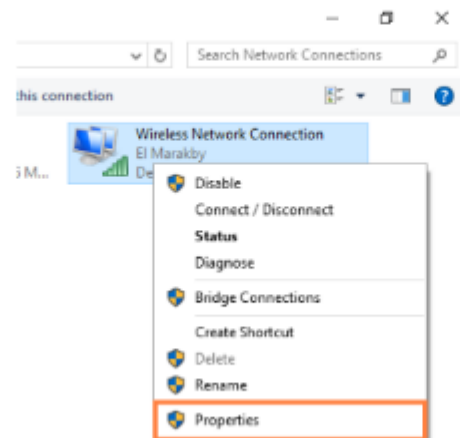

- Double Click on Internet Protocol Version 4 (TCP/IPv4).

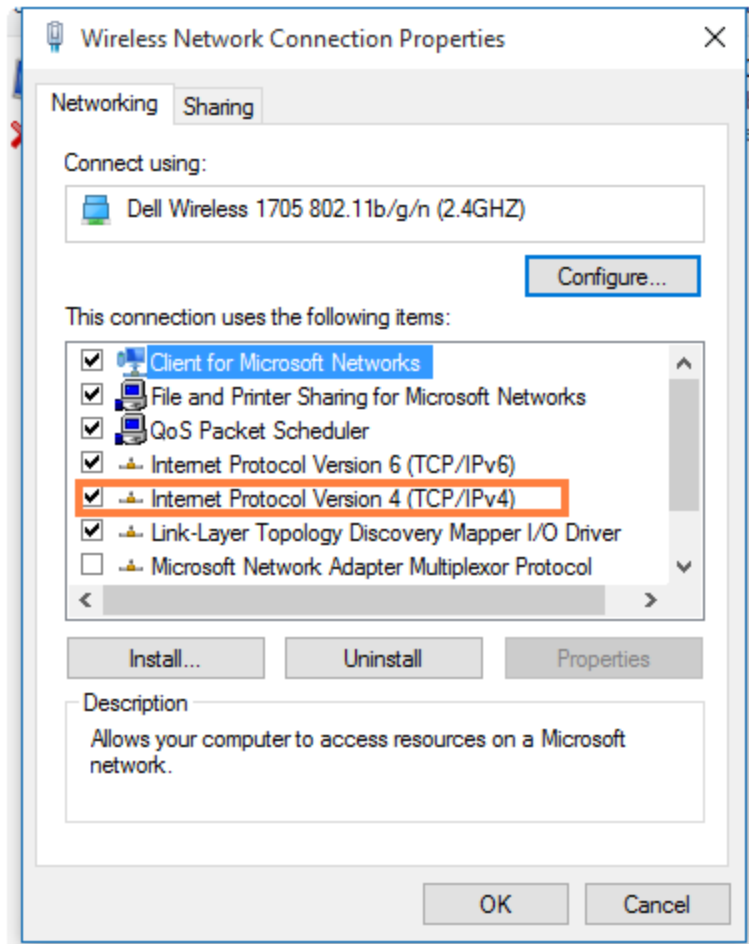

- Chose Use the following IP address , add the IPs , DNS and click OK.

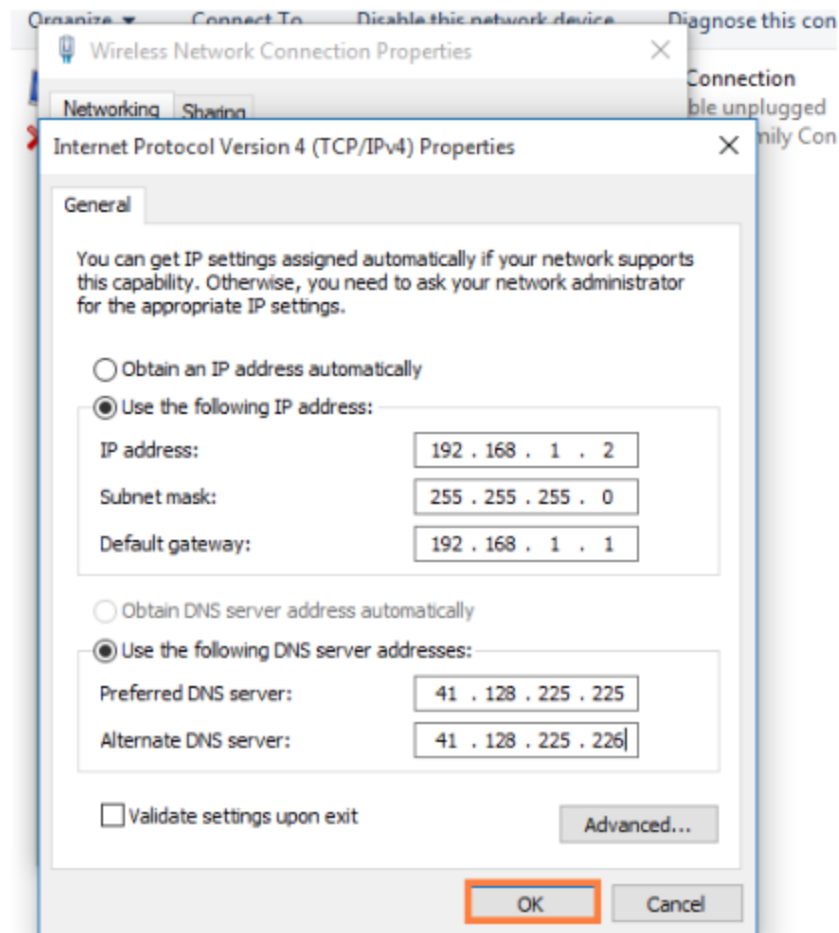

- Let customer to check with cable



- Check No Browsing Workflow



- Let customer to check with cable



Customer Can browse



Customer Can't browse

-Ask the customer to check with another wireless device if possible



Customer Can browse



Customer Can't browse



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario



Customer found his network




Customer couldn't find network



Customer Gets Error Message



Customer couldn't find his network

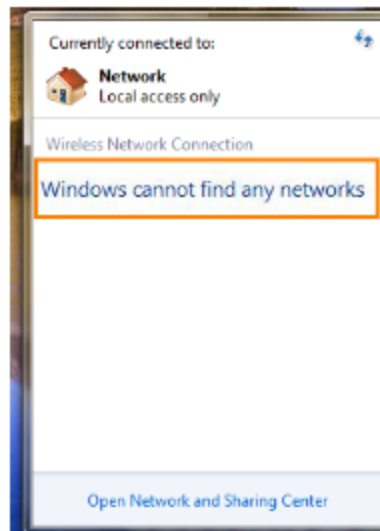

- Make sure that customer enable his wireless on Laptop



Or from Keyboard Click



button plus the wireless button



- Noting that Some laptops or PCs has only one button for wireless without "Fn" button.
- Agent should ask the customer to check with another wireless device if possible...if can browse so it will be device issue and if cannot browse "Customer cannot find the network" handling should be followed.

Let customer search now




Customer found the network




Customer not found the network



- Let customer choose his wireless network and press connect

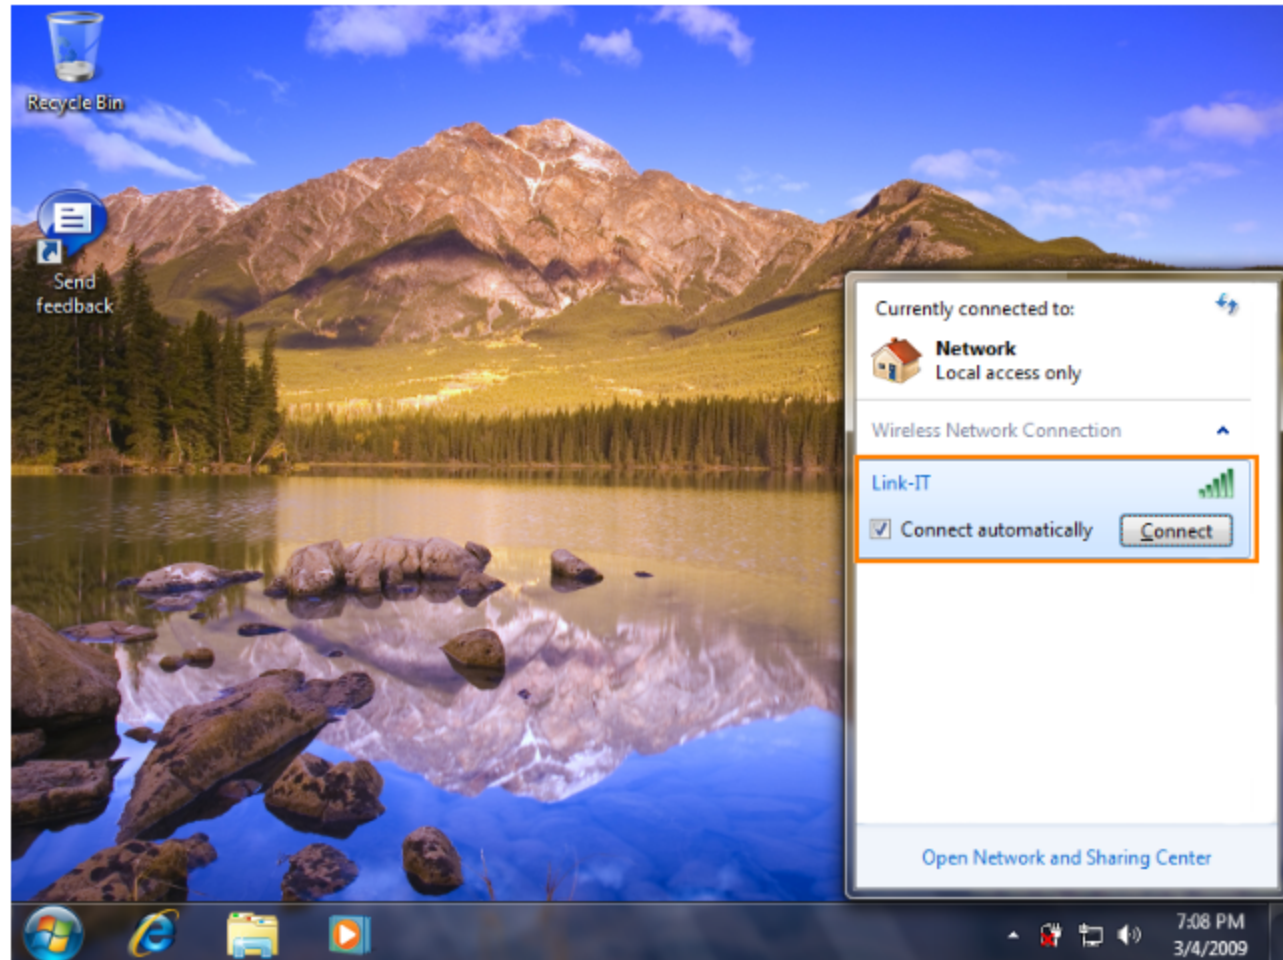


- If he connected to secured network, customer will be prompted to enter his password

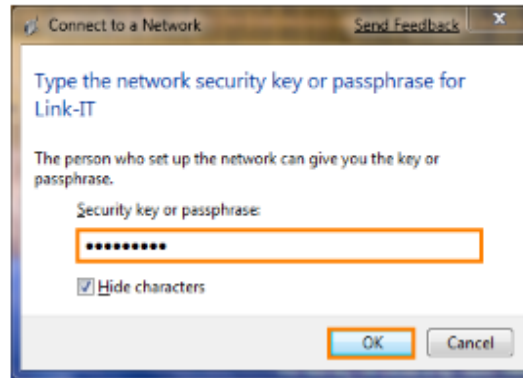


(Customer couldn't find network The same steps Follow WF customer found his network



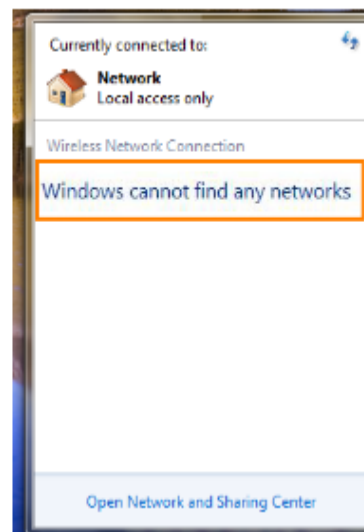



Check Wireless Zero Configuration Service

Click **Start Menu** , Select **Control Panel** then choose System and Security and click on **Administrative Tools Icon**

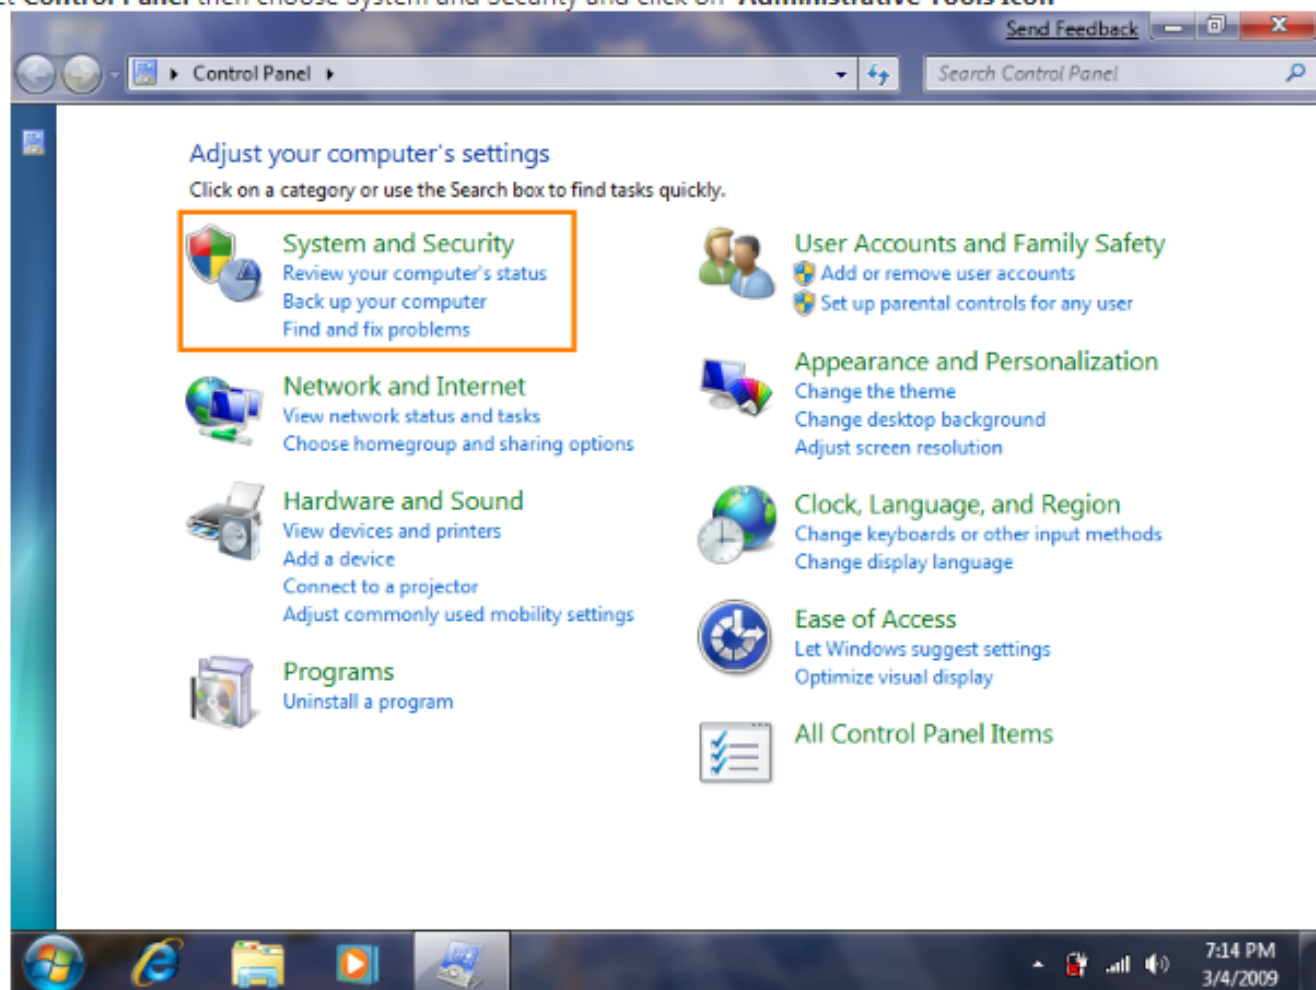


Or you can click on ALL Control Panel Items then click on Administrative Tools Icon

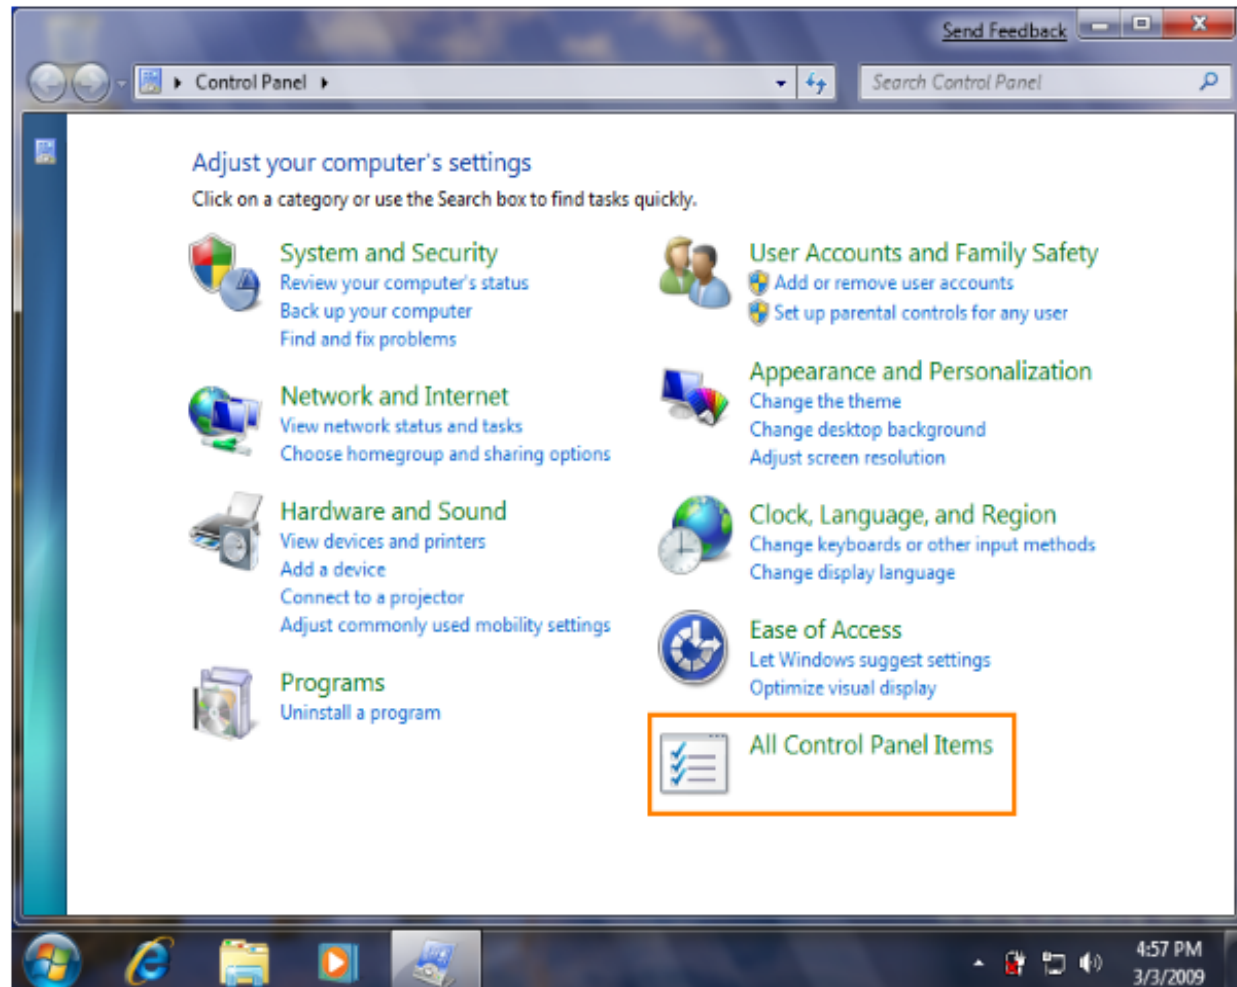


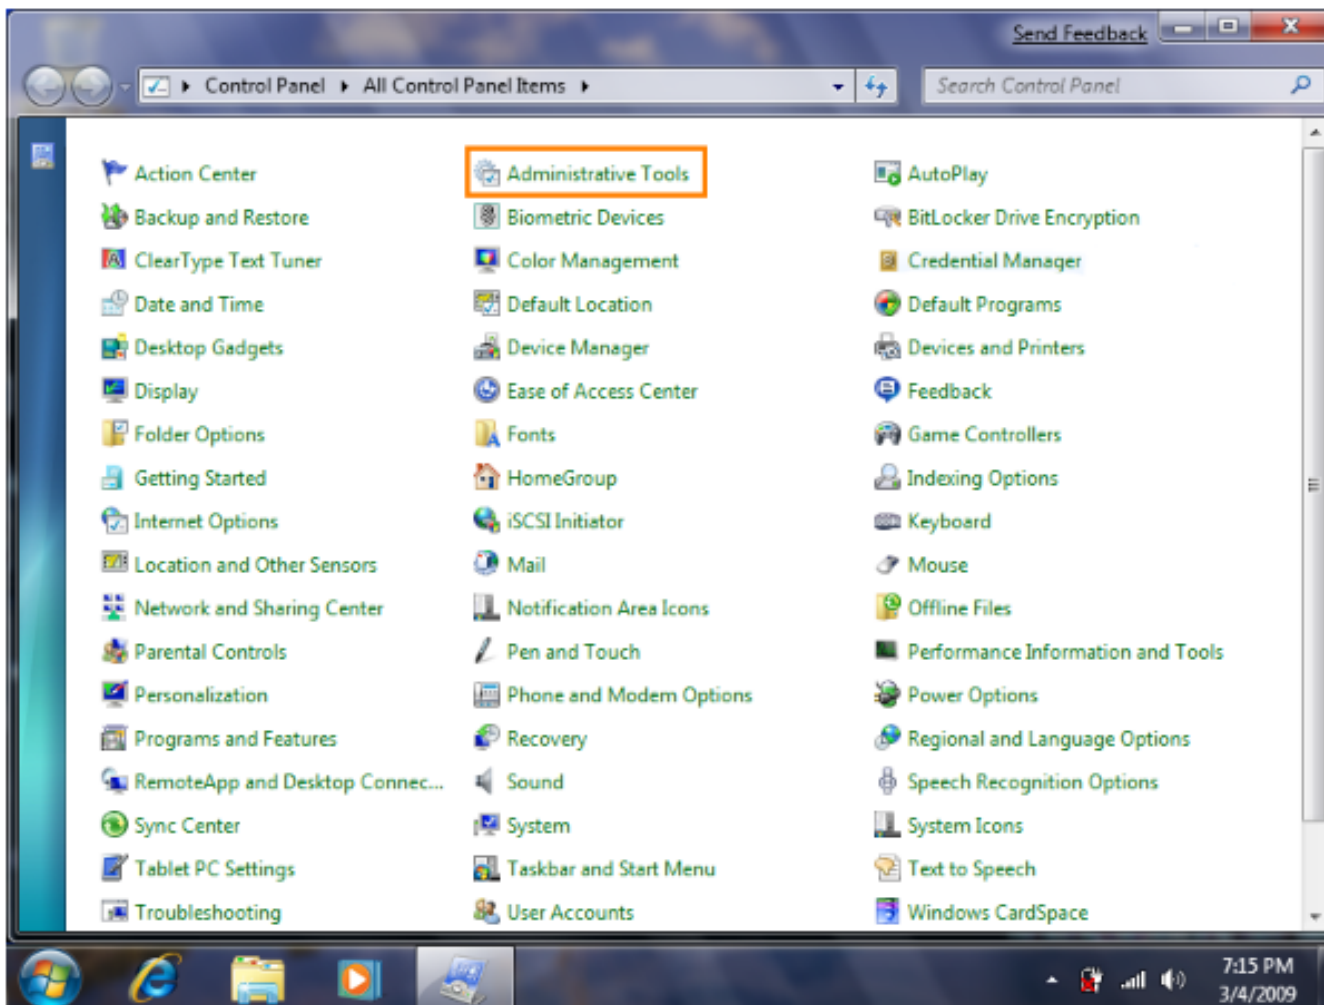


- Click "Services"

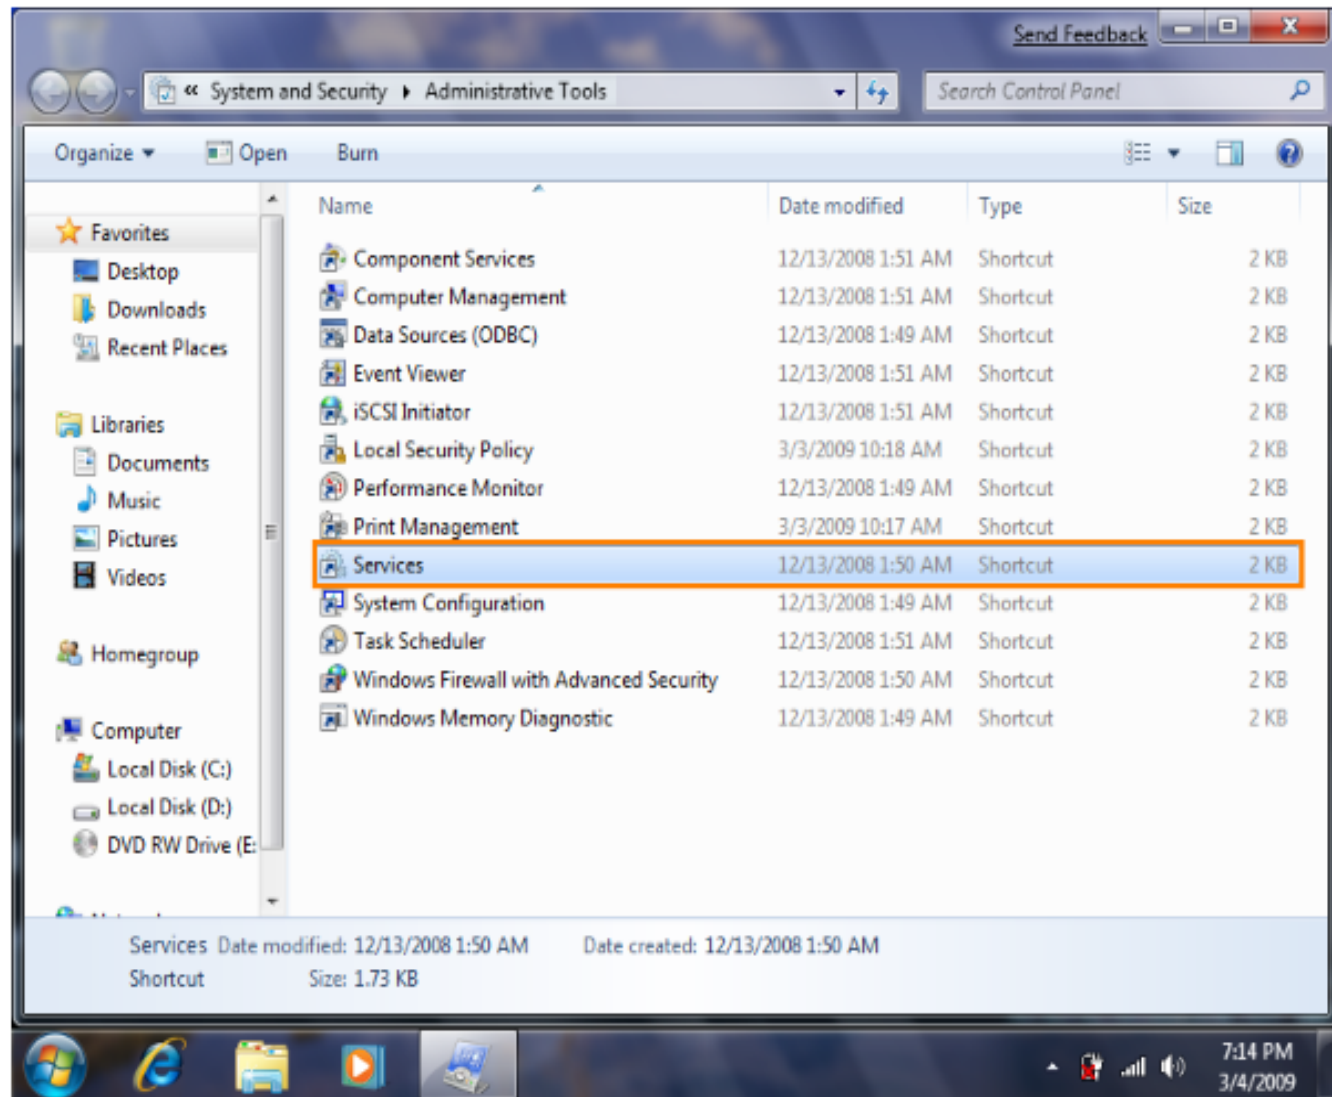

- Double click on "WLAN Auto Configuration"

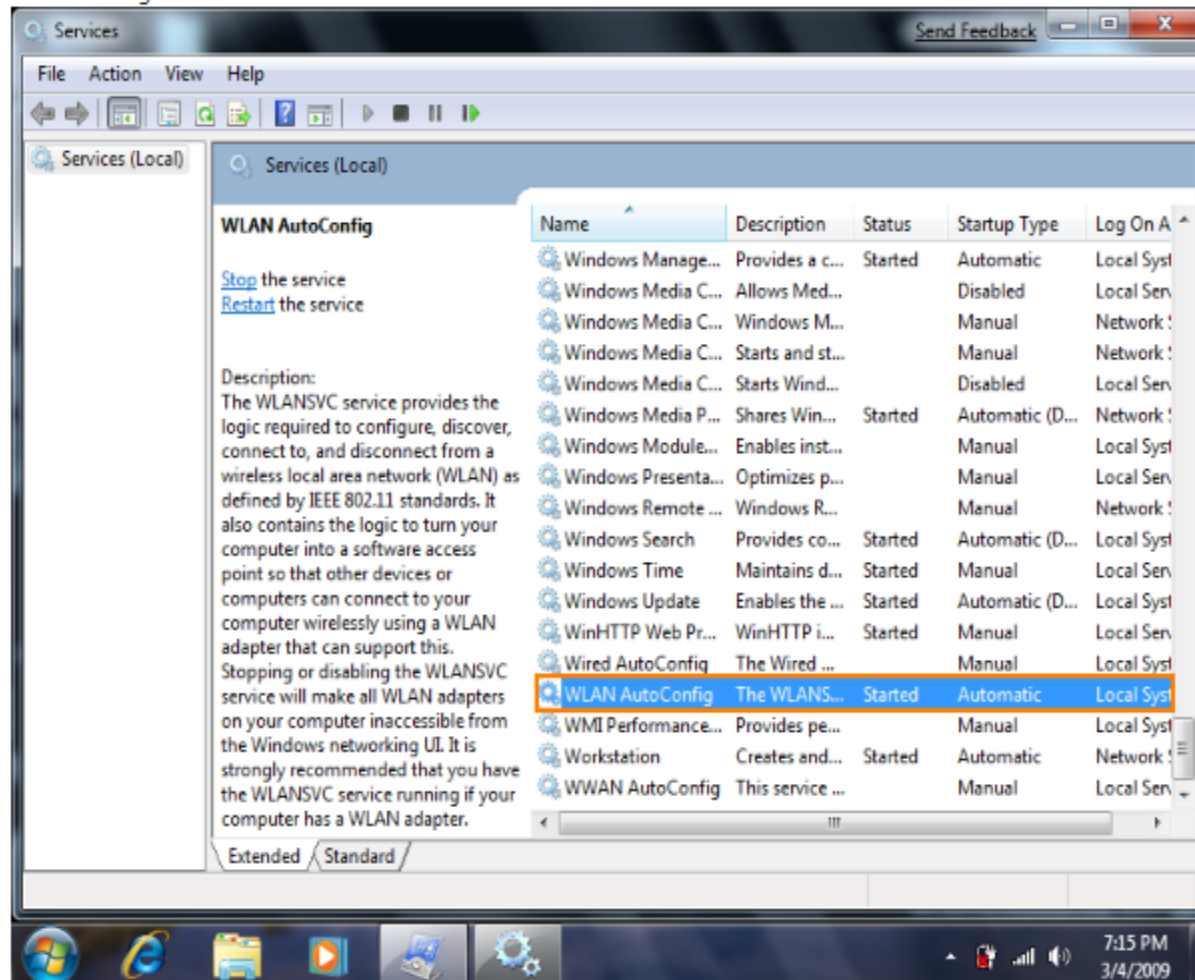

- Click Stop then Start , If status started make it stop then start again

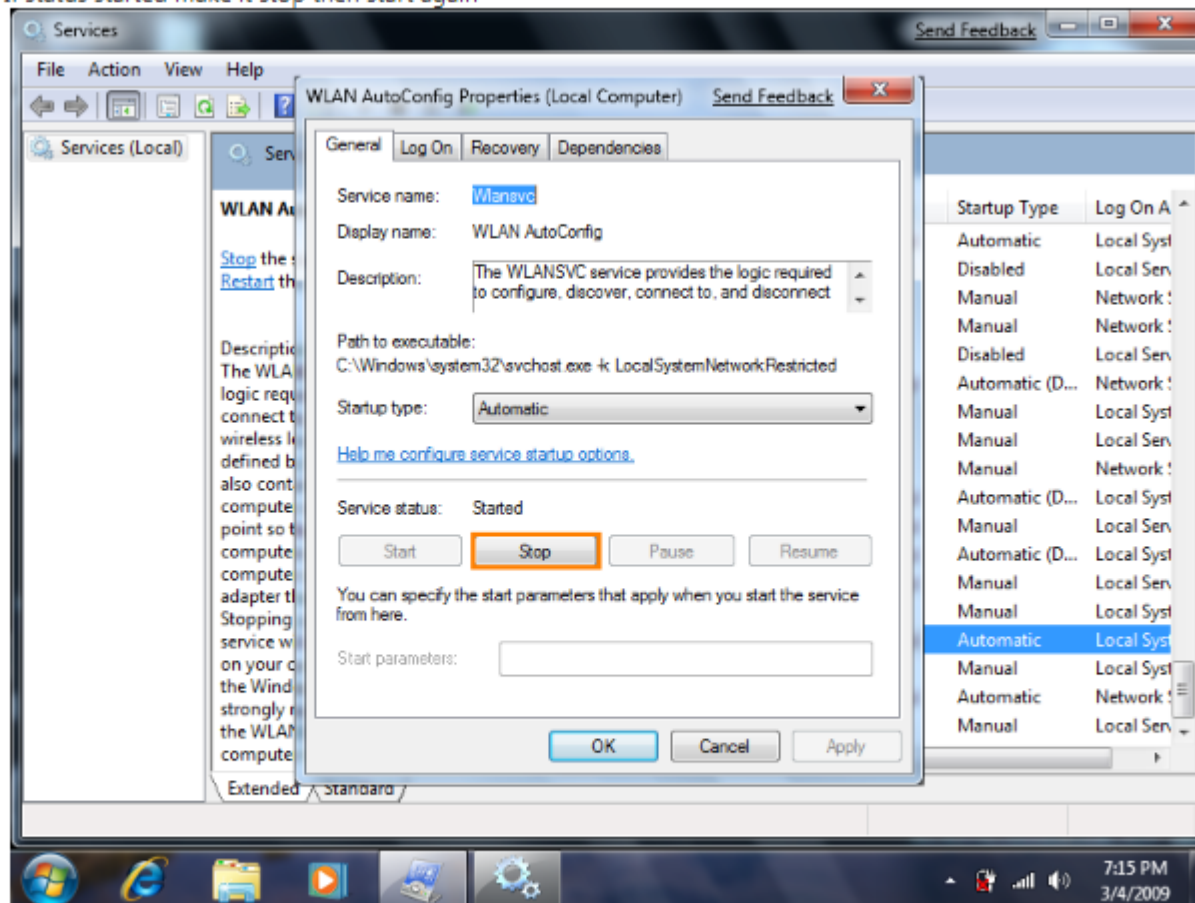


- Let customer to search




Customer found his wireless network

- Let customer choose his wireless network and press connect

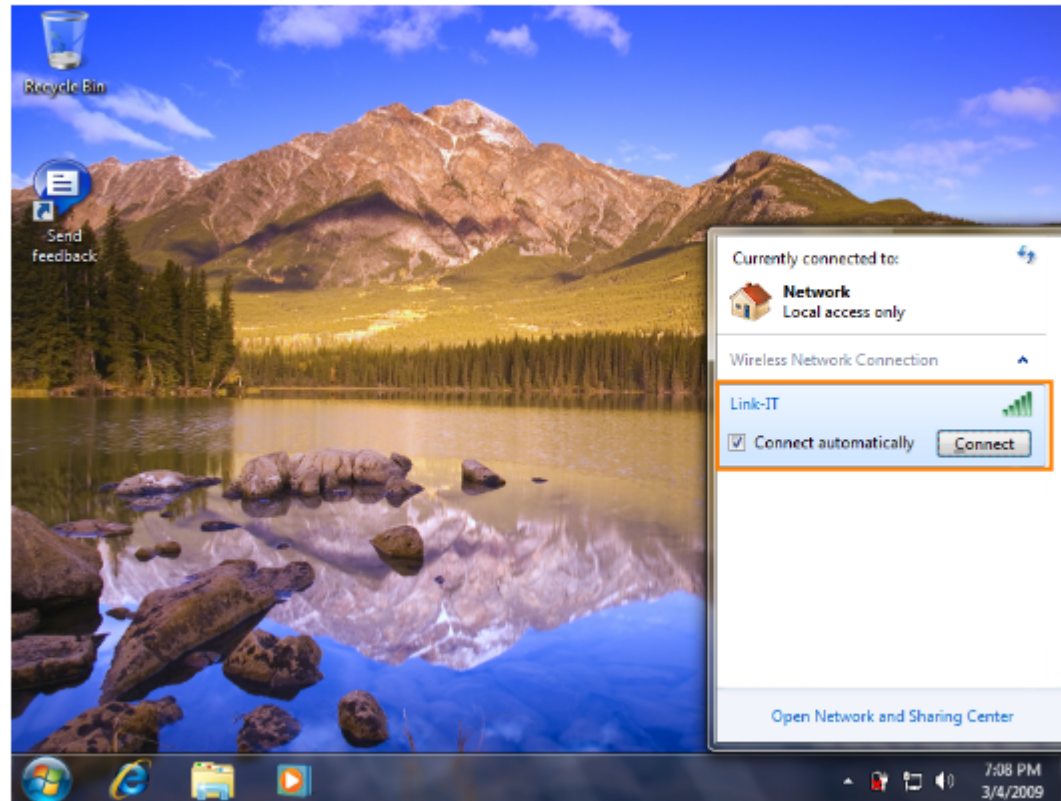

- If he connected to secured network, customer will be prompted to enter his password

- If he connected to secured network, customer will be prompted to enter his password

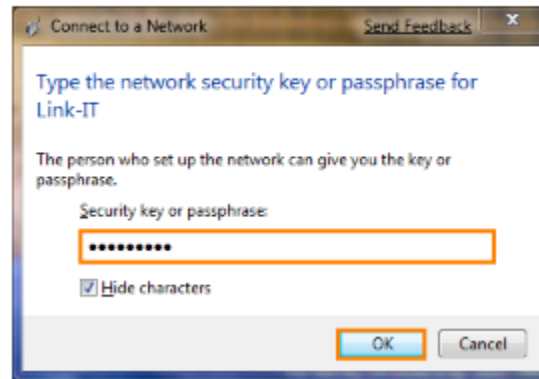

Connected Successfully




Couldn't Connect




- Let customer Delete Preferred network List then restart his PC

1- Click Start Menu, Select Control Panel then choose Network and Sharing Center

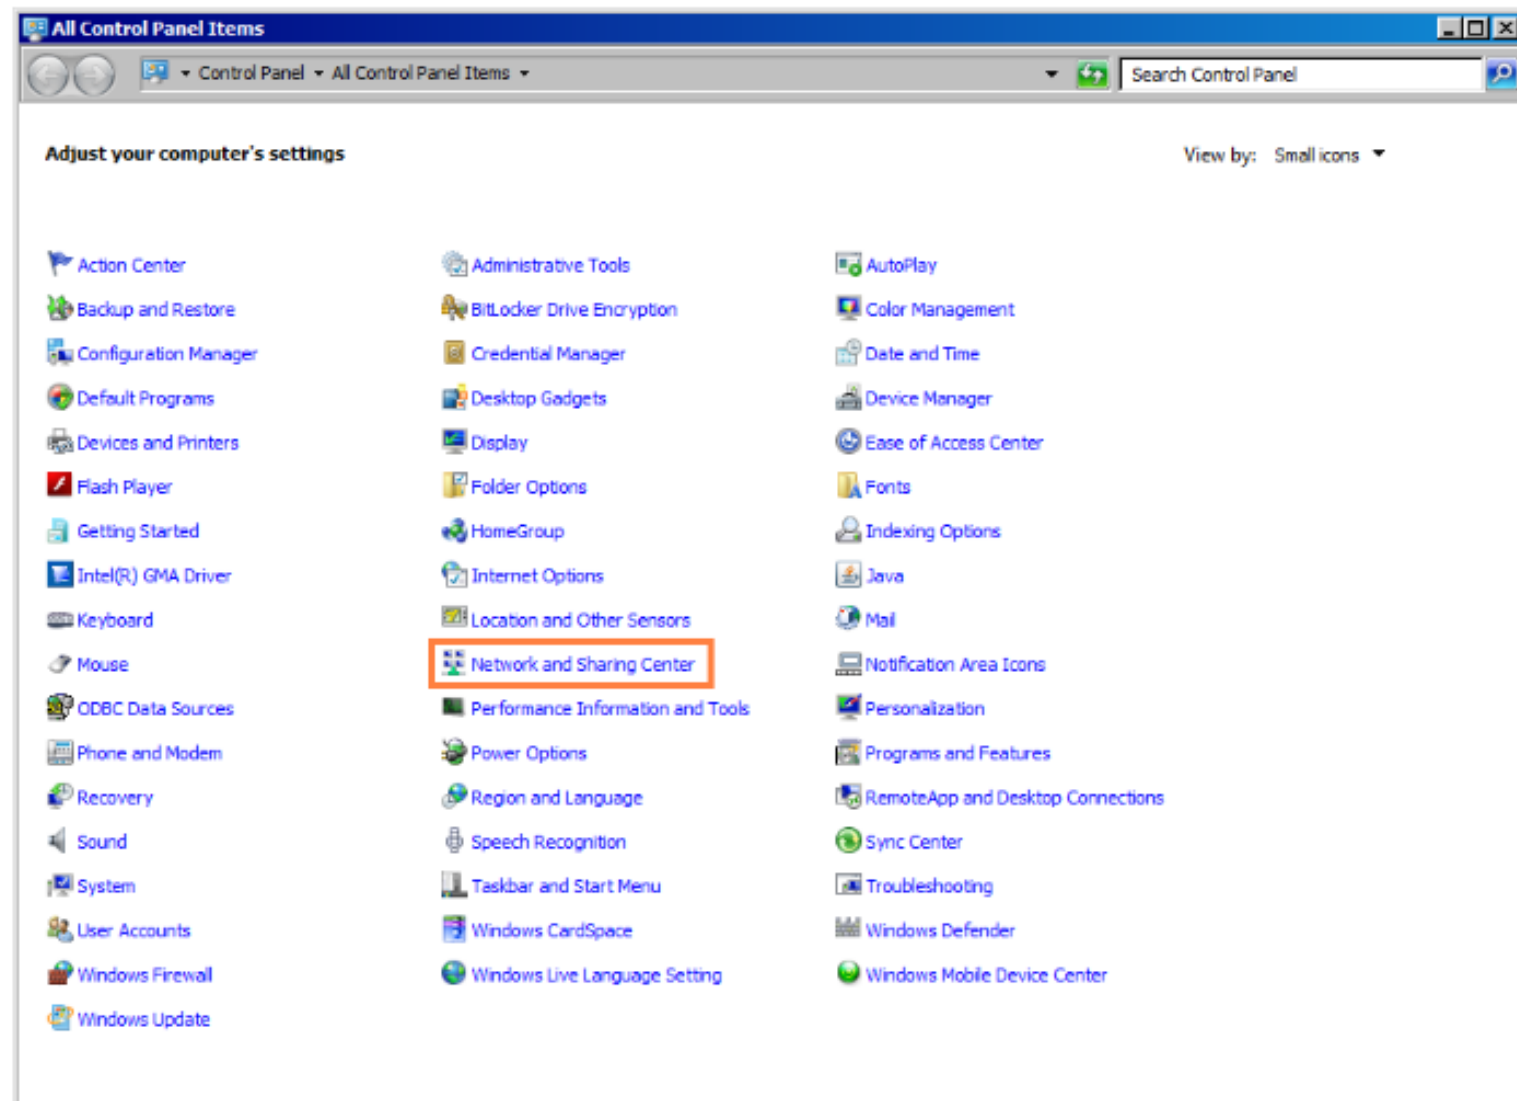


2- From Left menu click on **Manage wireless networks**

*if you not found Mange wireless networks click her to know how to show it

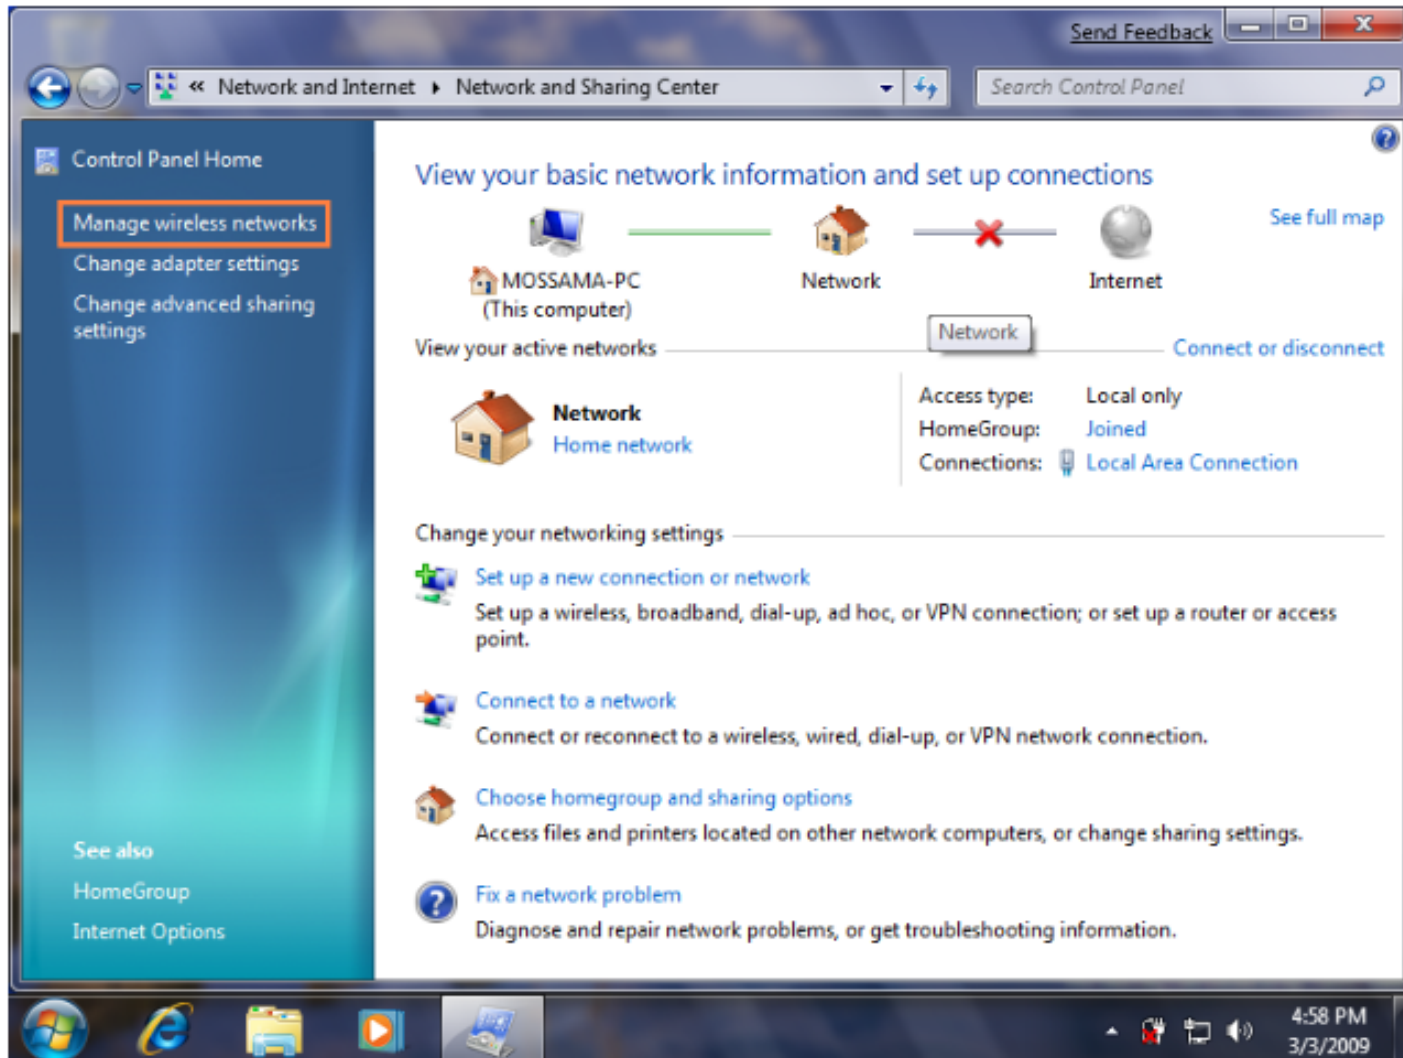

- Select wireless network then click **Remove** button

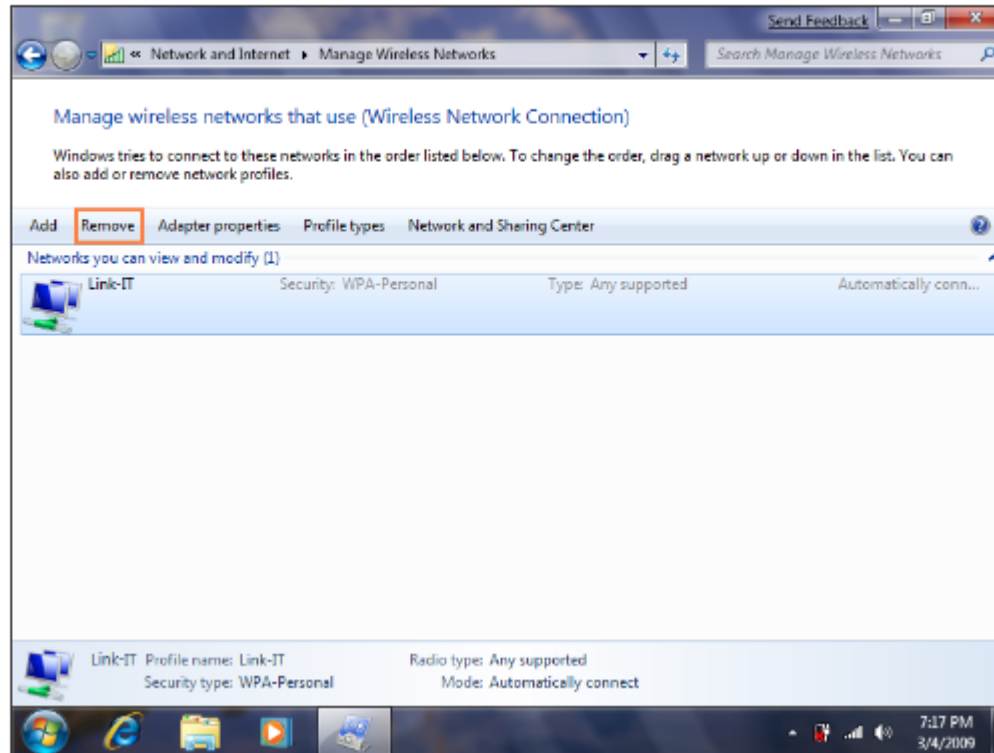

- Let customer connect again by wireless to his router



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario


- Let customer connect again by wireless to his router




- Let customer try to check browsing.
- In case customer faced this error message "you need to check your connection with your ISP", We have to Restart the CPE first.




- Press right click on whatever the Local Area Connection or the Wireless Network Connection and choose Properties.

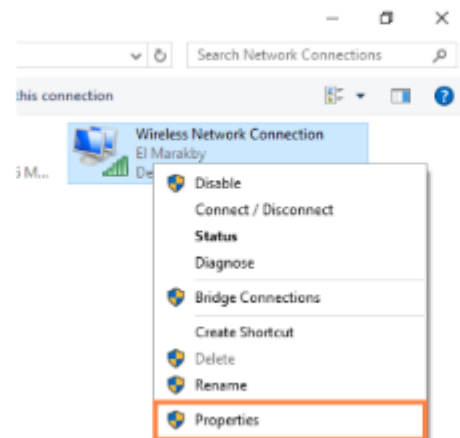

- Double Click on Internet Protocol Version 4 (TCP/IPv4).

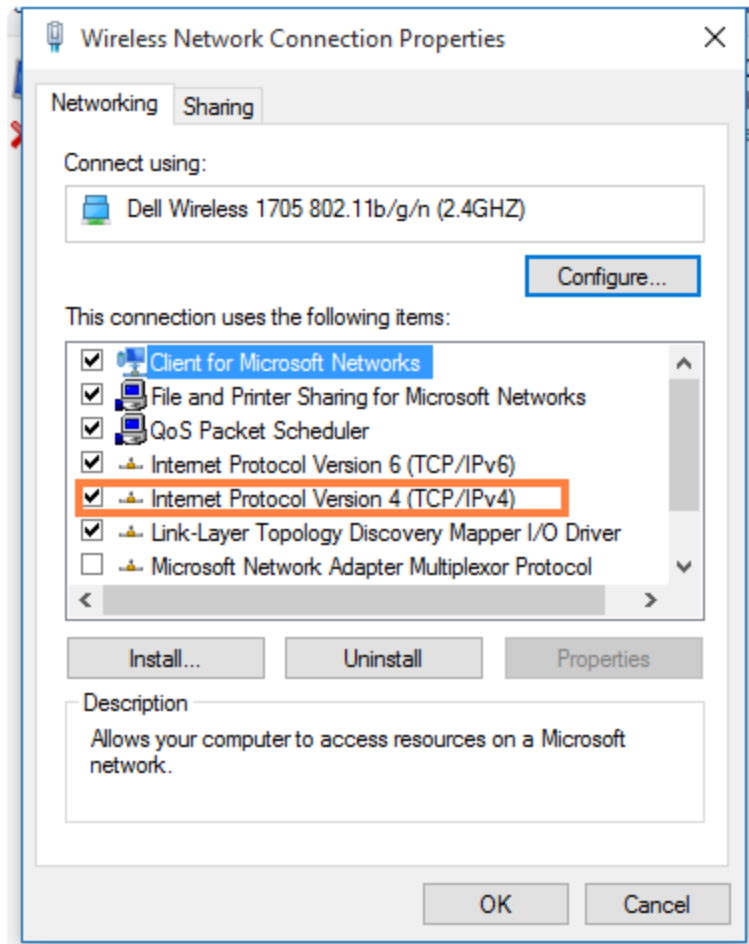

- Chose Use the following IP address , add the IPs , DNS and click OK.

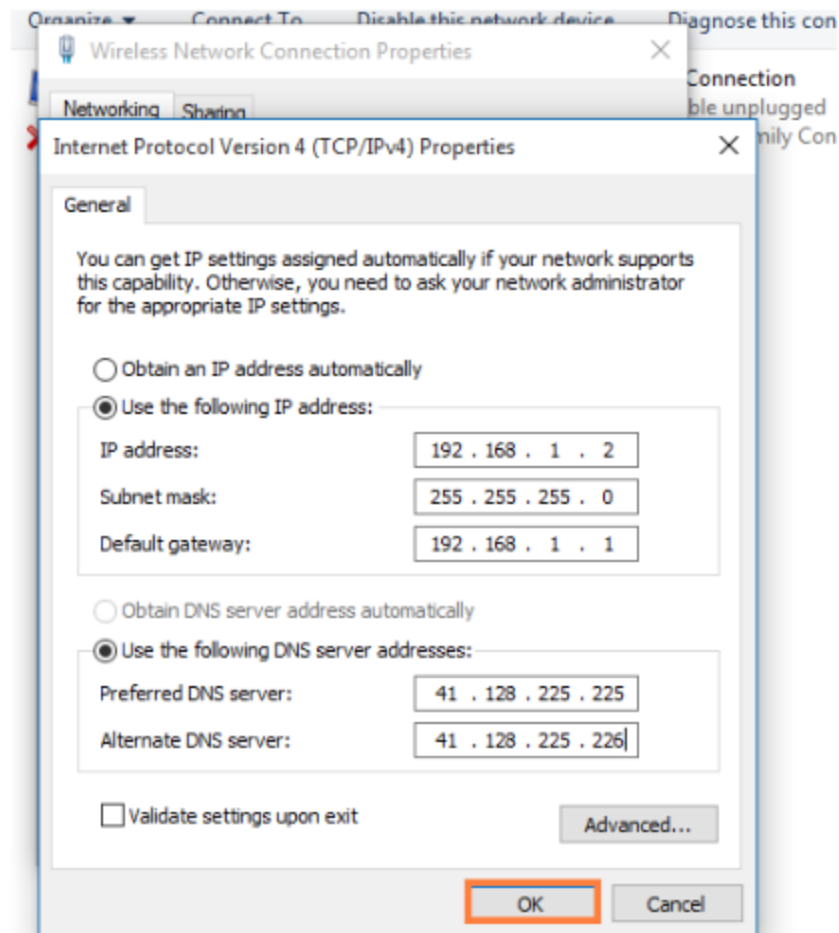

- Let customer to check with cable



Customer Can browse



Customer Can't browse

-Ask the customer to check with another wireless device if possible



Customer Can browse



Customer Can't browse



- Agent should ask the customer if the router is from Orange or not.
- In case problem is not solved yet, agent should create below Wlan no browsing SR to be assigned to FBB Technical Consumer Support team.

Siebel SR

Short Code	Type	Area	Owner Group	SLA
40029	DSL Fault For Connectivity	WLAN No Browsing	Data Tech Con Support-Network	24 Hours



In case receiving feedback from Technical team that the router is faulty, Inform the customer that there's fault in his/her router and follow the below:

In case the router is from Orange and in warranty period: customer will have the option to replace it

- In case the router is from Orange and in warranty period: customer will have the option to replace it
- All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

In case the router is from Orange and out of warranty period: customer will have below two options.

- Buy the new High-End router, If the customer accepts, providing the nearest shop and working hours.
- If the customer rejects, informing her/him the vendor's details (Name, Address, and Contact).

All router's faulty issues should be updated with a written & stamped report from our technician by visit to be able to replace it from the shop.

Siebel SR

Short Code	Type	Area	Product	Comment
40029	DSL Fault For Connectivity	WLAN No Browsing	ADSL	Sub area will be Chosen depending on the case scenario

Quota Problems

Main Package Data

PackageName	Home Internet 420(30 Mbps)
CurrentDownload	30720 KBs
CurrentUpload	3072 KBs
CustomerQuota	300.0 GBs
CustomerQuota_expiryDate	2025-01-14T23:59:59Z
CustomerQuota_remainingPercentage	95.0%
CustomerQuota_startDate	2024-12-15T00:00:00Z
CustomerQuota_usagePercentage	5%
RemainingQuota	285.9 GBs

ADSL Usage



1 - 10 of 1

Username	Consumption	Consumption Da	Error Code	Error Description
0227877227	13,908 MB	19 September ...		
0227877227	17,812 MB	20 September ...		
0227877227	17,814 MB	21 September ...		
0227877227	21,499 MB	22 September ...		
0227877227	16,409 MB	23 September ...		
0227877227	17,331 MB	24 September ...		
0227877227	18,052 MB	25 September ...		
0227877227	16,659 MB	26 September ...		
0227877227	17,630 MB	27 September ...		
0227877227	19,692 MB	28 September ...		

How to Open Quota Consumption Issues WF

The screenshot displays the Orange portal interface. At the top left is the Orange logo. A search bar labeled "Search Products" is located at the top center. On the top right, the user's name "Sara Adel Mohamed Ab..." and a notification bell icon are visible. Below the search bar is a horizontal navigation menu with the following items: "Products—", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a dropdown arrow. Below the navigation menu, there are four product cards. The first card is titled "FREEMAX (OLD) ..." and contains the text "Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...". The second card is titled "WI-FI" and contains the text "Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...". The third card is titled "HOME DSL PACKA..." and contains the text "Home DSL Packages.". The fourth card is titled "DSL BACK OFFICE" and contains the text "DSL Back Office Workflows". An orange arrow points from the "Products—" menu item to the first card. Another orange arrow points from the "Internal Guideline" menu item to the third card.

orange™

Search Products

Sara Adel Mohamed Ab...

Products— Services Promotions Devices - test Global Scripts - Channels Internal Guideline Customer Support Tools Application Guides

and portfolio introducing new, ple and attractiv...

Name is EF-Primo card line valid for 1 year for on...

attractive tariffs meets "Dolphin" to meet all of...

Monthly promises to expand the choosing base & to...

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows

Basic Information

Common Asked Questions

Plans

How to Pay

How to Manage My Account

How to Complain

Siebel

Related Offers

Related VASs

Work Instructions

Related Links

4,112Visits - Last Update 11/30/2022 2:52 PM

Basic Information

Network

View All



Wlan2



Quota Consumption Issues



Slow Browsing



Transfer from Reseller to another Reseller



Slow Upload



No Browsing

- No limitation for recharging quota, Our customer can recharge unlimited count of quota.
- Extra validity is 1 month.
- Recharge options are (16333 & shops & portal) available for all customer base including GOV customer.



Monthly Quota Not Update or Updated Wrongly



Extra Quota Not Updated After Recharge



Quota Consumption Problem

- Check customer balance and his renewal date for his quota (Quota Renewal date = Due Date for invoices)

PCRF Main Package ADSL Usage	
Main Package Data	
PackageName	Home Internet 420(30 Mbps)
CurrentDownload	256 KBs
CurrentUpload	32 KBs
CustomerQuota	300.0 GBs
CustomerQuota_expiryDate	2024-12-22T23:59:59Z
CustomerQuota_remainingPercentage	0.0%
CustomerQuota_startDate	2024-11-23T00:00:00Z
CustomerQuota_usagePercentage	100%
RemainingQuota	0.0 GBs

-Renewal takes place from 12:00 AM till 3:00AM , accordingly no need for escalation during this time.



Quota Updated



Quota Not Updated



Quota compensation for Quota Renewal complaint

- 10 GBs from Home internet 210 up to 420.
- 20 GBs from Home Internet 680 up to 1230.
- 30 GBs for Home Internet 1760.

Scenario	Script
In case of complaint after 03:00 AM	تماما يا أستاذة..... أنا سجلت الطلب لحضرتك وفي خلال الـ 48 ساعة عمل التي جاية هنقوم بحل مشكلة حضرتك، وفي حالة ان حضرتك واجهت نفس المشكلة ممكن تعاود الاتصال بينا مرة ثانية
In case of complaint from 12:00 AM till 3:00 AM	يتم تجديد الباقية الشهرية ما بين 12 صباحا و 3 صباحا

Short Code	Type	Area	Product	Owner Group	SLA	SS	Description
37014	Fault For VAS	Quota Renewal Problem	ADSL	DSL CH VAS	48 Whrs	Yes	SR should be created in case main package quota wasn't renewed after 03:00 AM
5001	DSL Service-Acc Administration	Compensation Quota	--	--	--	--	SR is created & closed automatically upon compensating the customer with free GBs
16819	DSL Acc Mod For Line Mod	Quota Compensation	ADSL	--	--	--	SR should be created manually & closed by agent after adding the GBs explaining the reason for compensation

- In case of exceeding SLA, agent should send mail to Egypt DSL VAS.

Service Requests

Record Count	Smart Script					
Short Code	Type	Area	Sub Area	Product	Status	
37014	DSL Fault For VAS	Quota Renewal Problem		ADSL	Opened	

Main Package Data

PackageName	Home Internet 360 (30 Mbps)	
CurrentDownload	30720 KBs	
CurrentUpLoad	3072 KBs	Extr.
CustomerQuota	250.0 GBs	
CustomerQuota_expiryDate	2025-01-09T23:59:59Z	
CustomerQuota_remainingPercentage	58.0%	
CustomerQuota_startDate	2024-12-10T00:00:00Z	
CustomerQuota_usagePercentage	42%	
RemainingQuota	144.85 GBs	



Quota Updated



Quota Not Updated

- Check if it updated correctly



Updated Correctly



Updated Incorrectly



Open SR

تمام يا أستاذة..... أنا سجلت الطلب لحضرتك وفي خلال الـ 48 ساعة اللي جاية هنقوم بحل مشكلة حضرتك، وفي حالة ان حضرتك واجهت نفس المشكلة بعد 48 ساعه ممكن تعاود الاتصال بينا مرة ثانية

Short Code	37014
Type	Fault For VAS
Area	Quota Renewal Problem
Product	ADSL
Owner Group	DSL CH VAS
Sub Area	Empty
Status	Open
Smart Script	Yes



Monthly Quota Not Update or Updated Wrongly



Extra Quota Not Updated After Recharge



Quota Consumption Problem



- Customer complains that he charged (Online or shop or 16333) but he didn't get extra quota for charging Extra Quota problems through 16333 for charging Extra Quota problems through 16333 [Click here](#)



- Check on PGW (Payment Gateway) if transaction done successfully.

If the action already done from our side, but the Extra GBs still not reflected on PCRf, create the below SR to be handled from billing team

The below SR to be used only in case customer has missing purchased quota, taking into consideration that in case customer purchased the extra quota from shop, the payment receipt should be attached

Script :

تمام يا أستاذة/..... أنا سجلت الطلب لحضرتك وفي خلال الـ 48 ساعة التي جاية هنقوم بحل مشكلة حضرتك، وفي حالة إن حضرتك واجهت نفس المشكلة ممكن تعاود الاتصال بينا مرة تانية.

SLA : 48 HRs

Short Code	37021
Type	Fault For VAS
Area	Extra Quota Dispute
Product	ADSL
Owner Group	DSL CH Billing / SLA 48 hours
Sub Area	Empty
Status	Open
Smart Script	Yes

- Customer complains that he charged (Online or shop or 16333) but he didn't get extra quota
- - Check on PGW (Payment Gateway) if transaction done successfully

Extension Data										1 - 1 of 1
rechargeQuota	Recharge Usage Percentage	Recharge Remaining Quota	purchaseReceiptId	rechargePurchaseDate	rechargeQuotaExpiry	Recharge Remaining Per	ErrorCode	ErrorMessage	Status	
							er2056	No Extension Q...	2	



Transaction Failed



Transaction Done Successfully



(Transaction Done Successfully)

- Transaction done successfully on PGW (Payment Gateway), Check Quota on PCRF.



- If Transaction done successfully on PGW (Payment Gateway and Pay Station), Check Quota on PCRF, if still not updated:
- In case customer added extra quota through IVR/Portal/My Orange App but it's duplicated in PCRF Or:
- In case customer added 1 or more extra quota by mistake and complained from non-usage due to the new validity or any other reason:
 - Agent should validate and confirm customer 0 consumption of the claimed extra quota through PCRF.
 - Agent should create "37021" SR to be assigned to CH Billing in order to assign the SR to IT DSL team to remove the extra added Quota from PCRF.
 - Then CH Billing agent should adjust the customer's balance accordingly including the VAT.

- **Script :**

تمام يا أستاذة/..... أنا سجلت الطلب لحضرتك وفي خلال الـ 48 ساعة عمل اللي جاية هنقوم بحل مشكلة حضرتك، وفي حالة ان حضرتك واجهت نفس المشكلة ممكن تعاود الاتصال بينا مرة ثانية.

- Create the below SR :

Short Code	37021
Type	DSL Fault For VAS
Area	Extra Quota Dispute
Product	ADSL
Smart Script	Extra Quota Dispute
SLA	48 Whrs

In case of exceeding SLA, agent should send mail to Egypt DSL VAS.

Make sure to fill the below data in the Smart Script:

- Last 4 digits from credit card
- Amount
- Transaction date
- Channel (my orange App or through portal)
- Add note: it is for bill payment or purchasing extra quota
- Number used for access the application
- Contact number

Note : Don't forget to attach the reference from PGW in the SR .


- Don't open the SR before passing 24 hours from extra quota purchasing date.
- Taking into consideration that in case customer purchased the extra quota from shop, the payment receipt should be attached.
- Make sure to mention all the payment details within the Smart script.



Monthly Quota Not Update or Updated Wrongly



Extra Quota Not Updated After Recharge

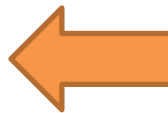

Quota Consumption Problem



Quota doesn't Count



Quota Consumption Error

- -This Scenario occurs when quota consumption doesn't count (consumption not updated)
- - **Check PCRF and verify**
we Will notice that there is normal usage appears in the daily usage on PCRF while remaining quota isn't decreased



Error Found



Error Not Found

Open SR

تمام يا أستاذة..... أنا سجلت الطلب لحضرتك وفي خلال الـ 48 ساعة اللي جاية هنقوم بحل مشكلة حضرتك، وفي حالة ان حضرتك واجهت نفس المشكلة بعد 48 ساعه ممكن تعاود الاتصال بينا مرة ثانية

Short Code	37004
Type	Fault For VAS
Area	Quota Dispute
Product	Choose Customer's package
Owner Group	DSL CH VAS
Sub Area	Empty
Status	Open
Smart Script	Yes

-This Scenario occurs when quota consumption doesn't count (**consumption not updated**)

- Check **PCRF** and verify, if the **error found**:

Short Code	Type	Area	Product	Sub Area	Status
37004	DSL Fault For VAS	Quota Dispute	Home DSL 700		Opened


(Quota Consumption Problem)



Quota doesn't Count



Quota Consumption Error



-This Scenario occurs when quota consumption doesn't count (consumption not updated)

- Check **PCRF** and verify, if there's no error close the below SR .

Short Code	37004
Type	Fault For VAS
Area	Quota Dispute
Product	Choose Customer's package
Owner Group	DSL Call Center
Sub Area	No Problem Found
Status	Closed
Smart Script	No

Online Gaming support

Could be considered as Physical or network issue.

How to Open Quota Consumption Issues WF

The screenshot displays the Orange portal interface. At the top left is the Orange logo. A search bar labeled "Search Products" is positioned next to it. On the top right, the user's name "Sara Adel Mohamed Ab..." and a notification bell icon are visible. Below the search bar is a horizontal navigation menu with the following items: "Products—", "Services", "Promotions", "Devices - test", "Global Scripts - Channels", "Internal Guideline", "Customer Support Tools", and "Application Guides". Each item has a downward arrow indicating a dropdown menu. Below the navigation menu, there are four product cards. The first card is titled "FREEMAX (OLD) ..." and contains the text "Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...". The second card is titled "WI-FI" and contains the text "Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...". The third card is titled "HOME DSL PACKA..." and contains the text "Home DSL Packages.". The fourth card is titled "DSL BACK OFFICE" and contains the text "DSL Back Office Workflows". An orange arrow points from the "Products—" menu item to the first card. Another orange arrow points from the "Internal Guideline" menu item to the third card.

orange™

Search Products

Sara Adel Mohamed Ab...

Products— Services Promotions Devices - test Global Scripts - Channels Internal Guideline Customer Support Tools Application Guides

and portfolio introducing new, ple and attractiv...

Name is EF-Primo card line valid for 1 year for on...

attractive tariffs meets "Dolphin" to meet all of...

Monthly promises to expand the choosing base & to...

FREEMAX (OLD) ...

Orange is rebranding 7 tariffs for control share and 4 tariffs for control plus, change...

WI-FI

Wi-Fi technology is rapidly gaining acceptance as an alternative to a wired local area ...

Home Internet

HOME DSL PACKA...

Home DSL Packages.

DSL BACK OFFICE

DSL Back Office Workflows



Search Products

Randa Ahmed Abdelmoa...



Products-- ▾ Services ▾ Promotions ▾ Devices - test ▾ Global Scripts - Channels ▾ Internal Guideline ▾ Customer Support Tools ▾ Application Guides ▾

Find in page ▾ ^

Find

ON THIS PAGE

Basic Information ?

Common Asked Questions

Plans

How to Pay ?

How to Manage My Account ?

How to Complain ←

Siebel

Related Offers

Related VASs

Work Instructions

Related Links

Wrong Action

Attitude Complaints

Network

Mobile Apps Complaints

Quota Consumption Issues

Slow Browaing

Wrong Info

Premier Customer Bundling with DSL WF

WLAN

Slow Upload

No Browaing



View All

Billing

Candidate Payment Dispute

Bill Not Issued On Time

Customer Paid With Wrong Land Line Number

Active Payment Dispute

Drop Amount

Wrong Contract Entry

View All

Home DSL Packages ▾

Network ▾

Active ▾



Authentication Problem

Mobile Apps Complaints

Quota Consumption Issues

WLAN

Browsing Sites Problems

No Browsing

Slow Browsing

Connection Unstable

Online Gaming

Slow Upload

What is Ping or Lag in gaming?

In gaming ping is used to describe the delay between a player's input and the server's response to those inputs. Lag is a spike in the time it takes for an action from your game to reach the game server and be registered, or for a message from the game server to be registered on your device. This delay is called ping and a lower ping is better as this means less delay and a smoother gameplay experience.

Ping is measured in milliseconds, which is shortened to ms. A ping of 15ms or less is generally considered excellent, between 15 and 45ms is great and 45 to 100ms is somewhat acceptable. A ping more than 100 to 250ms can be barely playable while anything above 250ms is often unplayable.

بإختصار شديد هو وحدة قياس تقيس مدة اتصال جهاز الكمبيوتر الخاص بك بسيرفر معين وبناء على الأمر الذي قمت بإعطائه داخل لعبتك يتم إرساله إلى السيرفر لتنفيذه. فكلما كانت سرعة البينج لديك أقل كلما كان تنفيذ الأمر بداخل لعبتك سريع جدا ويقاس بوحدة الملي ثانية ms الملي سكند

العمل لما هيكلكمك هييقول البينج عالى او الجيم بيقطع او فى لاج فى الجيم

البينج فوق الممتاز بيكون من 15 ملي سكند فى أقل

من 15 لـ 45 بيكون كويس جدا جدا

من 45 لـ 100 بيكون من كويس لـ مقبول

من 100 لـ 250 بيكون أقل من المقبول

Description	Troubleshooting Steps	Results	Needed Action
Check the line physically	- Physical Parameters should be accepted. - MSAN line max bitrate shouldn't be less than 40 Mbps. - Port and Router types should be VDSL. - Noise shouldn't be less than 100.	If any is not accepted	Follow Bad Line WF and add in the SR note "Online Gaming"
		If all are accepted	Ask the customer to make a speed test (For more details press here).
Check the connectivity	Change the MTU on the customer's router to 1420	If solved	Create & Close the below SR with the relevant Sub Area
		If not solved	Try 1300 or 1380 as an extra mile and not a mandatory step
	Check the download again	If solved	Create & Close the below SR with the relevant Sub Area
		If not solved	Check if customer is connected using Ethernet or WLAN
	Ethernet	Create the below SR to be auto-assigned to the concerned team	
	<u>Wi-Fi:</u> - Change Wi-Fi Channel & Password (For more details press here)	If solved	Create & Close the below SR with the relevant Sub Area
		If not solved	Create the below SR to be auto-assigned to the concerned team

Scenario	Script
In case problem is not solved after troubleshooting and agent will create the below SR	"انا قدمت طلب يا فندم و هيتيم التواصل مع حضرتك خلال ساعتين عمل."
In case customer is having VDSL port and ADSL router, agent should handle the customer with best efforts and upsell the VDSL high end router	"حابب أكد لحضرتك يا فندم انك لو اشتريت روتر High End VDSL هيجسن الخدمة مع حضرتك بشكل ملحوظ و هيقبل البينج , الروتر حاليا عليه عرض 50% خصم لعملاء اورنج يعنى سعره 855 جنيه شامل الضريبة. اوضح لحضرتك اقرب فرع ومواعيد عمله؟"
Copper lines' customers will be handled with best efforts, however the results are not guaranteed	"حابب أكد لحضرتك يا فندم ان الخط كفايته مش هتكون بالشكل المطلوب عشان الاسلاك نحاس وده مش بيضمن احسن خدمة وسرعة للانترنت"
Generic script	"لو حضرتك بتواجه تقطيع في اللعبة او بطئ او البينج عالى ,, احنا في خدمة حضرتك 24 ساعة طوال ايام الاسبوع شرفنا اى وقت هنعمل بعض الخطوات لحل المشكلة"

- Customer will be contacted within 2 hours and problem resolution SLA is 24 hours.

Short Code	Type	Area	Sub Area	Product	SS	Team
40032	DSL Fault For Connectivity	Online Gaming Support	- CC-Solved MTU 1420 - CC-Solved MTU 1300 - CC-Solved MTU 1380 - CC-Solved Wi-Fi Channel - CC-Solved Wi-Fi Password	ADSL/FTTH	Yes	Call Center
			--			Data Tech Con Support-Network

- In case of exceeding the SLA, send mail to [Egypt Back office technical](#)

Thank you

