

From: "assignments@hvacinvestigators.com" <assignments@hvaci.com>
Sent: Wed, 18 Mar 2026 02:51:32 +0000 (GMT)
To: "imaging@libertymutual.com" <imaging@libertymutual.com>
Subject: {EXTERNAL} View HVACi Final Report for Claim #061004792
Attachments: HVACi Final Report-26-03689365-Jeff Stamm-061004792.pdf



Claim #: 061004792
HVACi File #26-03689365

Your Final Report for Claim #061004792 Is Ready

Your Final Report Is Ready!

Claim Assignment #26-03689365



View Your Final Report

Your final report and invoice are attached to this email.



Rate Your Experience

Take our adjuster survey to share your feedback with us.

[Adjuster Survey](#)



Have A Question?

If you have questions, [click here](#) or call **888-407-5224**.



Next Steps

Have another claim? [Submit it here](#). Looking to enhance your HVAC claim knowledge? Check out our [resource library](#).

Thank you for trusting us with your claim, and we look forward to working with you again soon.

HVACi Operations Team

888-407-5224

HVACi Website

Alpine Intel Website

Submit A Claim



ON-SITE ASSESSMENT REPORT

888.407.5224
hvaci.com
assignments@hvaci.com

ON-SITE ASSESSMENT REPORT



03/17/2026

HVACi Assessment # 26-03689365

Liberty Mutual

Attention: Bedria Purifoy
Report Submitted VIA: bedria.purifoy@libertymutual.com

Claim # 061004792
Date of Loss: 02/26/2026
Insured: Jeff Stamm
Loss Address: 899 Virginia Park St
Detroit, MI 48202
Phone: 9545474939

Evaluation Summary

HVACi Evaluation Findings:	1 System Damaged
Recommendation:	Replace 1 System
Cause of Loss:	Freezing Conditions
Repair Cost for Systems Requiring Repairs:	\$0.00
Estimated Timeframe to Repair:	N/A
Replacement Cost for Systems Requiring Replacements:	\$30,875.41
Estimated Timeframe to Replace:	1-2 Days

HVACi Recommended Cost (Including Sales Tax)	\$30,875.41
HVACi Applied Depreciation	\$2,946.72
HVACi Recommended ACV (Including Sales Tax)	\$27,928.69

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Cause Of Loss

Equipment Information

The subject system is composed of a natural gas-fired, hot water boiler and the associated radiant heating equipment. Water is heated within the boiler by way of its internal heat exchanger and is circulated throughout the residence to the radiant heating equipment, which transfers heat to the conditioned spaces. Available demographic information for the subject system indicates that it was manufactured by Bryant and is approximately 3 years old.

Observations and Conclusions

The findings of our on-site inspection indicate that the boiler's heat exchanger have failed as a result of freezing. The boiler was exposed to freezing temperatures and water within the system has frozen and expanded. Additionally, the radiators have been exposed to freezing temperatures, and water within the piping has frozen and expanded. No other components were affected by the event.

Based on the information collected during our onsite investigation, it is the opinion of HVACi that **the cause of loss to the Boiler is Freezing Conditions.**

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Recommendation

If coverage is afforded, **HVACi recommends that the HVAC system be replaced.** Our findings indicate that a full replacement of the damaged HVAC system is required to restore the insured to pre-loss condition.

- Due to the extent of the failures, it is our recommendation to replace the boiler and affected radiators.

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Determinations

HVACi's on-site investigation indicates that the following line items are required to restore pre-loss condition:

- Burnham, 210k BTU, 80% AFUE, Natural Gas, Hot Water Boiler
- Drain Water from Existing System
- Pipe and Water Connections
- Automatic Water Feeder
- Removal and Disposal of Existing Boiler
- Expansion Tank with Air Purger and Float
- Install Boiler Relief Valve and Discharge Piping
- Install Check Valve and Isolation Valves in Piping
- Install Combustion Air Piping
- Install Supply and Return Piping Manifolds
- Install Primary Circulator Pump in Supply Piping
- Install Main System Air Eliminator / Air Bleeder Valve
- Low Water Cut-Off
- Electrical / Gas Connections
- Miscellaneous Materials
- Thermostat
- System Purge
- Radiator Replacement
- System Start-Up and Operational Testing
- Professional Labor for Installation

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Existing HVAC Equipment Demographic Information

#	BRAND	MODEL #	SERIAL #	CAUSE OF LOSS	AGE	TON / BTU	SYSTEM TYPE	RECOMMENDATION
001	Bryant	BM2AAN000210 ABAA	0901V02318	Freezing Conditions	2023	210k	Boiler	Replace

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365



Recommended Cost Breakdown

The following section provides a breakdown of our recommended cost by individual system. The actions listed below will restore your insured to repaired condition:

Replacement Costs

System #: 001 Brand: Bryant Model #: BM2AAN000210ABAA Ton/BTU: 210k Age: 2023

DESCRIPTION	PARTS COST INCLUDING TAX	LABOR HOURS	LABOR COST	LINE ITEM TOTAL INCLUDING TAX
Burnham, 210k BTU, 80% AFUE, Natural Gas, Hot Water Boiler	\$7,829.22	4	\$600.00	\$8,429.22
Drain Water from Existing System	\$106.00	1	\$150.00	\$256.00
Pipe and Water Connections	\$106.00	1	\$150.00	\$256.00
Automatic Water Feeder	\$354.50	1	\$150.00	\$504.50
Removal and Disposal of Existing Boiler	\$159.00	8	\$1,200.00	\$1,359.00
Expansion Tank with Air Purger and Float	\$139.94	0.5	\$75.00	\$214.94
Install Boiler Relief Valve and Discharge Piping	\$159.00	2	\$300.00	\$459.00
Install Check Valve and Isolation Valves in Piping	\$95.40	2	\$300.00	\$395.40
Install Combustion Air Piping	\$106.00	2	\$300.00	\$406.00
Install Supply and Return Piping Manifolds	\$106.00	2	\$300.00	\$406.00
Install Primary Circulator Pump in Supply Piping	\$291.50	1	\$150.00	\$441.50
Install Main System Air Eliminator / Air Bleeder Valve	\$47.70	2	\$300.00	\$347.70
Low Water Cut-Off	\$146.21	1	\$150.00	\$296.21
Electrical / Gas Connections	\$106.00	1	\$150.00	\$256.00
Miscellaneous Materials	\$265.00	1	\$150.00	\$415.00
Thermostat	\$104.94	0.5	\$75.00	\$179.94
System Purge	\$106.00	2	\$300.00	\$406.00
Radiator Replacement	\$11,872.00	24	\$3,600.00	\$15,472.00
System Start-Up and Operational Testing	\$0.00	2.5	\$375.00	\$375.00
System Total w/Tax:	\$22,100.41	58.50	\$8,775.00	\$30,875.41

Parts Sub Total w/o Tax: \$20,849.44
Labor Sub Total w/o Tax: \$8,775.00
Sales Tax: \$1,250.97
Total Recommended Cost: \$30,875.41

State Sales Tax Rate: 6.00%

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Technician Rate Per Hour: \$150.00

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

LKQ Replacement Cost Reference

The following section provides an estimate for a suitable LKQ replacement of the existing HVAC system, should this information be useful. This LKQ replacement cost estimate is not associated with our recommendation and is provided only for reference purposes.

System #: 001

DESCRIPTION	PARTS COST INCLUDING TAX	LABOR HOURS	LABOR COST	LINE ITEM TOTAL INCLUDING TAX
Burnham, 210k BTU, 80% AFUE, Natural Gas, Hot Water Boiler	\$7,829.22	4	\$600.00	\$8,429.22
Drain Water from Existing System	\$106.00	1	\$150.00	\$256.00
Pipe and Water Connections	\$106.00	1	\$150.00	\$256.00
Automatic Water Feeder	\$354.50	1	\$150.00	\$504.50
Removal and Disposal of Existing Boiler	\$159.00	8	\$1,200.00	\$1,359.00
Expansion Tank with Air Purger and Float	\$139.94	0.5	\$75.00	\$214.94
Install Boiler Relief Valve and Discharge Piping	\$159.00	2	\$300.00	\$459.00
Install Check Valve and Isolation Valves in Piping	\$95.40	2	\$300.00	\$395.40
Install Combustion Air Piping	\$106.00	2	\$300.00	\$406.00
Install Supply and Return Piping Manifolds	\$106.00	2	\$300.00	\$406.00
Install Primary Circulator Pump in Supply Piping	\$291.50	1	\$150.00	\$441.50
Install Main System Air Eliminator / Air Bleeder Valve	\$47.70	2	\$300.00	\$347.70
Low Water Cut-Off	\$146.21	1	\$150.00	\$296.21
Electrical / Gas Connections	\$106.00	1	\$150.00	\$256.00
Miscellaneous Materials	\$265.00	1	\$150.00	\$415.00
Thermostat	\$104.94	0.5	\$75.00	\$179.94
System Purge	\$106.00	2	\$300.00	\$406.00
Radiator Replacement	\$11,872.00	24	\$3,600.00	\$15,472.00
System Start-Up and Operational Testing	\$0.00	2.5	\$375.00	\$375.00
System Total W/Tax:	\$22,100.41	58.50	\$8,775.00	\$30,875.41

Parts Sub Total w/o Tax: \$20,849.44
Labor Sub Total w/o Tax: \$8,775.00
Sales Tax: \$1,250.97
Total Replacement Cost: \$30,875.41

State Sales Tax Rate: 6.00%
Technician Rate Per Hour: \$150.00

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Depreciation Schedule

The industry accepted useful life for HVAC equipment is 15 years. HVACi applies 6.67% depreciation per year of service to determine Actual Cash Value. A 25% residual value "cap" is applied to systems whose calculated depreciation is greater than 75%. Labor is not depreciated in ACV calculations.

Depreciation is calculated based on the useful life of the equipment and its general condition without reference to legal requirements of the local jurisdiction. Please refer to the requirements of the loss location jurisdiction and your company guidelines in applying depreciation.

SYSTEM #	DOM	AGE	DEPRECIATION RATE	RECOMMENDED COSTS INCLUDING TAX	APPLIED DEPRECIATION	ACV	25% CAP VALUE
001	2023	3	6.67%	\$30,875.41	\$2,946.72	\$27,928.69	\$14,300.10

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Photographs

System #: 001 Loss Location



System #: 001 Thermostat



ON-SITE ASSESSMENT REPORT




Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

System #: 001 Radiator



System #: 001 Radiator

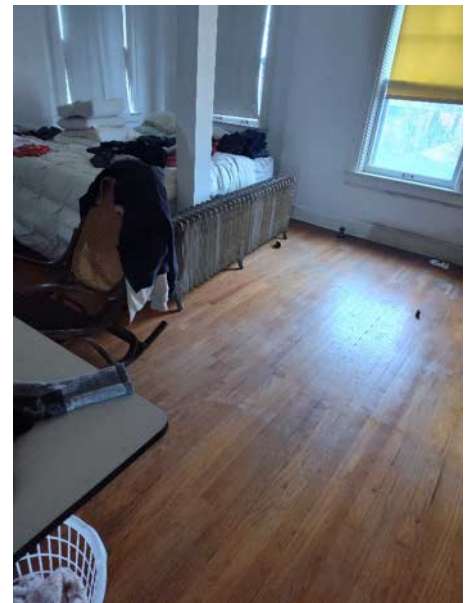

ON-SITE ASSESSMENT REPORT




Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

System #: 001 Radiator



System #: 001 Radiator

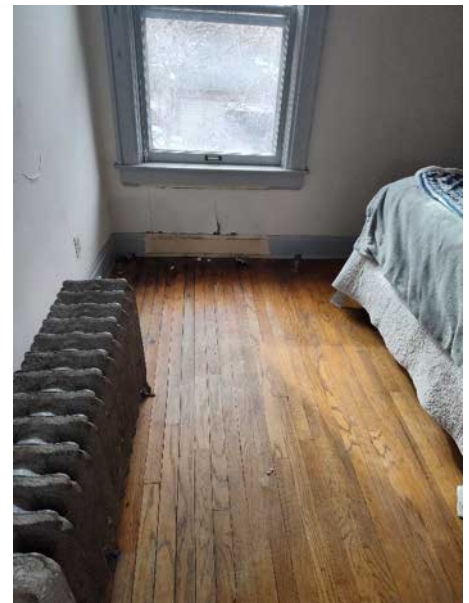

ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

System #: 001 Heat Exchanger



System #: 001 Tridicator



ON-SITE ASSESSMENT REPORT



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

System #: 001 Data Plate



System #: 001 Boiler





ON-SITE ASSESSMENT REPORT

POLICYHOLDER COPY

888.407.5224
hvaci.com
assignments@hvaci.com

ON-SITE ASSESSMENT REPORT

Policyholder Copy



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

03/17/2026

HVACi Assessment # 26-03689365

Liberty Mutual

Attention: Bedria Purifoy
Report Submitted VIA: bedria.purifoy@libertymutual.com

Claim # 061004792
Date of Loss: 02/26/2026
Insured: Jeff Stamm
Loss Address: 899 Virginia Park St
Detroit, MI 48202
Phone: 9545474939

Evaluation Summary

HVACi Evaluation Findings:

1 System Damaged

Recommendation:

Replace 1 System

Cause of Loss:

Freezing Conditions

Recommended Cost (Including Sales Tax)	\$30,875.41
Applied Depreciation	\$2,946.72
Recommended ACV (Including Sales Tax)	\$27,928.69

ON-SITE ASSESSMENT REPORT

Policyholder Copy

Report Date:

03/17/2026

Claim #

061004792

HVACi File #

26-03689365



Cause Of Loss

Equipment Information

The subject system is composed of a natural gas-fired, hot water boiler and the associated radiant heating equipment. Water is heated within the boiler by way of its internal heat exchanger and is circulated throughout the residence to the radiant heating equipment, which transfers heat to the conditioned spaces. Available demographic information for the subject system indicates that it was manufactured by Bryant and is approximately 3 years old.

Observations and Conclusions

The findings of our on-site inspection indicate that the boiler's heat exchanger have failed as a result of freezing. The boiler was exposed to freezing temperatures and water within the system has frozen and expanded. Additionally, the radiators have been exposed to freezing temperatures, and water within the piping has frozen and expanded. No other components were affected by the event.

Based on the information collected during our onsite investigation, it is the opinion of HVACi that **the cause of loss to the Boiler is Freezing Conditions.**

ON-SITE ASSESSMENT REPORT

Policyholder Copy



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Determinations

HVACi's on-site investigation indicates that the following line items are required to restore pre-loss condition:

- Burnham, 210k BTU, 80% AFUE, Natural Gas, Hot Water Boiler
- Drain Water from Existing System
- Pipe and Water Connections
- Automatic Water Feeder
- Removal and Disposal of Existing Boiler
- Expansion Tank with Air Purger and Float
- Install Boiler Relief Valve and Discharge Piping
- Install Check Valve and Isolation Valves in Piping
- Install Combustion Air Piping
- Install Supply and Return Piping Manifolds
- Install Primary Circulator Pump in Supply Piping
- Install Main System Air Eliminator / Air Bleeder Valve
- Low Water Cut-Off
- Electrical / Gas Connections
- Miscellaneous Materials
- Thermostat
- System Purge
- Radiator Replacement
- System Start-Up and Operational Testing
- Professional Labor for Installation

ON-SITE ASSESSMENT REPORT

Policyholder Copy



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Existing HVAC Equipment Demographic Information

#	BRAND	MODEL #	SERIAL #	CAUSE OF LOSS	AGE	TON / BTU	SYSTEM TYPE
001	Bryant	BM2AAN000210 ABAA	0901V02318	Freezing Conditions	2023	210k	Boiler

POLICYHOLDER COPY

ON-SITE ASSESSMENT REPORT

Policyholder Copy

Report Date:

03/17/2026

Claim #

061004792

HVACi File #

26-03689365



Recommended Cost Breakdown

The following section provides a breakdown of our recommended cost by individual system. The actions listed below will restore your insured to repaired condition:

Replacement Costs

System #: 001

Brand: Bryant

Model #: BM2AAN000210ABAA

Ton/BTU: 210k

Age: 2023

DESCRIPTION	PARTS COST INCLUDING TAX	LABOR HOURS	LABOR COST	LINE ITEM TOTAL INCLUDING TAX
Burnham, 210k BTU, 80% AFUE, Natural Gas, Hot Water Boiler	\$7,829.22	4	\$600.00	\$8,429.22
Drain Water from Existing System	\$106.00	1	\$150.00	\$256.00
Pipe and Water Connections	\$106.00	1	\$150.00	\$256.00
Automatic Water Feeder	\$354.50	1	\$150.00	\$504.50
Removal and Disposal of Existing Boiler	\$159.00	8	\$1,200.00	\$1,359.00
Expansion Tank with Air Purger and Float	\$139.94	0.5	\$75.00	\$214.94
Install Boiler Relief Valve and Discharge Piping	\$159.00	2	\$300.00	\$459.00
Install Check Valve and Isolation Valves in Piping	\$95.40	2	\$300.00	\$395.40
Install Combustion Air Piping	\$106.00	2	\$300.00	\$406.00
Install Supply and Return Piping Manifolds	\$106.00	2	\$300.00	\$406.00
Install Primary Circulator Pump in Supply Piping	\$291.50	1	\$150.00	\$441.50
Install Main System Air Eliminator / Air Bleeder Valve	\$47.70	2	\$300.00	\$347.70
Low Water Cut-Off	\$146.21	1	\$150.00	\$296.21
Electrical / Gas Connections	\$106.00	1	\$150.00	\$256.00
Miscellaneous Materials	\$265.00	1	\$150.00	\$415.00
Thermostat	\$104.94	0.5	\$75.00	\$179.94
System Purge	\$106.00	2	\$300.00	\$406.00
Radiator Replacement	\$11,872.00	24	\$3,600.00	\$15,472.00
System Start-Up and Operational Testing	\$0.00	2.5	\$375.00	\$375.00
System Total w/Tax:	\$22,100.41	58.50	\$8,775.00	\$30,875.41

Parts Sub Total w/o Tax: \$20,849.44
Labor Sub Total w/o Tax: \$8,775.00
Sales Tax: \$1,250.97
Total Recommended Cost: \$30,875.41

State Sales Tax Rate: 6.00%

ON-SITE ASSESSMENT REPORT

Policyholder Copy



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Technician Rate Per Hour: \$150.00

POLICYHOLDER COPY

ON-SITE ASSESSMENT REPORT

Policyholder Copy



Report Date: 03/17/2026
Claim # 061004792
HVACi File # 26-03689365

Depreciation Schedule

The industry accepted useful life for HVAC equipment is 15 years. HVACi applies 6.67% depreciation per year of service to determine Actual Cash Value. A 25% residual value "cap" is applied to systems whose calculated depreciation is greater than 75%. Labor is not depreciated in ACV calculations.

Depreciation is calculated based on the useful life of the equipment and its general condition without reference to legal requirements of the local jurisdiction. Please refer to the requirements of the loss location jurisdiction and your company guidelines in applying depreciation.

SYSTEM #	DOM	AGE	DEPRECIATION RATE	RECOMMENDED COST INCLUDING TAX	APPLIED DEPRECIATION	ACV	25% CAP VALUE
001	2023	3	6.67%	\$ 30,875.41	\$ 2,946.72	\$ 27,928.69	\$ 14,300.10



HVAC Investigators, LLC
PO Box 74008991
Chicago, IL 60674

(888) 407-5224
hvacinvestigators.com
assignments@hvaci.com

Invoice

Date	Invoice #
03/17/2026	H26328970
Terms	Due Date
Net 30 Do Not Pay for USRM only	04/16/2026

Bill To

Liberty Mutual
Bedria Purifoy

Amount Due	Enclosed
\$540.00	

✂ Please detach top portion and return with your payment. ✂

Activity	Quantity	Rate	Amount
Acknowledgement of claim assignment with carrier, Coordination of appointment with insured and local technician, Discussion of claim assignment with technician Onsite evaluation of HVAC system, travel to and from loss location, technical diagnosis of equipment, collection of demographic information, photographs of equipment Review of field notes, repair/replacement parts research, communication with HVAC manufacturers to verify parts availability/current pricing, LKQ verification, applicable depreciation and tax rates, draft technical report Compose final report, technical review of findings, delivery of final report, adjuster follow up and report review when applicable	1	\$540.00	\$540.00
Total			\$540.00

HVACi File #: 26-03689365
Customer Claim #: 061004792
Insured: Jeff Stamm
HVAC Investigators Tax ID #: 45-2036084

Thank you for your business! We hope to work with you again soon.

Send payment to HVAC Investigators, LLC PO Box 74008991 Chicago, IL 60674