



Report on Phase II
Environmental Site Assessment

***37900 Mound Road Property
37900 Mound Road
Sterling Heights, Michigan***

Prepared for:

***RDB Industrial Drive, LLC and
S&S Holdings of Southwest Florida, LLC
Attn: Mr. John D. Gaber, Esq.
380 North Old Woodward Avenue, Suite 300
Birmingham, Michigan 48009***

**July 18, 2024
G2 Project No. 240506**



July 18, 2024

RDB Industrial Drive, LLC and
S&S Holdings of Southwest Florida, LLC
c/o Mr. John D. Gaber, Esq.
Williams, Williams, Ratner & Plunkett, P.C.
380 North Old Woodward Avenue, Suite 300
Birmingham, Michigan 48009

Re: Phase II Environmental Site Assessment
37900 Mound Road Property
37900 Mound Road, Sterling Heights, Michigan
G2 Project No. 240506

Dear Mr. Gaber:

We have completed the Phase II Environmental Site Assessment for the approximate 3.58-acre property located at 37900 Mound Road, Sterling Heights, Macomb County, Michigan (the "subject property"). Our Phase II Environmental Site Assessment (ESA) was performed to address recognized environmental conditions (RECs) identified within our previously prepared Phase I Environmental Site Assessment (dated July 3, 2024) for the subject property, as well as, to supplement a Baseline Environmental Assessment (BEA) for the subject property dated 2010.

The Phase II ESA was conducted to determine whether target analytes are present in environmental media at a property, mainly through chemical testing of samples of environmental media collected from locations where such target analytes are most likely to have been present, and if present, to gain sufficient information regarding the target analytes to meet the objectives of this assessment. This Phase II ESA Report has been prepared for the exclusive use of RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC whom may rely on the findings of this report as a current assessment of present risk.

As always, we appreciate the opportunity to be of service to you and look forward to discussing the information presented. In the meantime, if you have any questions regarding the report or any other matter pertaining to the project, please call us.

Sincerely,

G2 Consulting Group, LLC

Kyle J. Dymowski
Environmental Scientist

Thomas A. McDonald
Project Manager

KJD/TAM/crs
Enclosures

g2consultinggroup.com

Headquarters	1866 Woodslee St	Troy, MI 48083	P 248.680.0400	F 248.680.9745
Ann Arbor	1350 Eisenhower Pl	Ann Arbor, MI 48108	P 734.390.9330	F 734.390.9331
Chicagoland	1186 Heather Dr	Lake Zurich, IL 60047	P 847.353.8740	F 847.353.8742

TABLE OF CONTENTS

1.0	INTRODUCTION	1
2.0	SCOPE OF SERVICES	3
3.0	EXPLORATION & ANALYTICAL TESTING PROCEDURES	4
3.1	<i>Boring & Soil Sampling Procedures</i>	4
3.2	<i>Water Sampling Procedures</i>	6
3.3	<i>Soil Gas Screening/Sampling Procedures</i>	6
3.4	<i>Decontamination Procedures</i>	7
3.5	<i>Soil, Soil Gas, and Groundwater Analytical Testing</i>	7
4.0	GEOLOGIC SITE CHARACTERIZATION	8
4.1	<i>Encountered Subsurface Conditions</i>	8
5.0	ANALYTICAL TEST RESULTS	9
6.0	CONCLUSIONS & RECOMMENDATIONS	10
7.0	LIMITATIONS	12

APPENDIX

General Location Plan	Figure 1
General Site Plan	Figure 2
Soil Boring and Sample Location Plan	Figure 3
Boring Logs	Log Nos. 1 through 10
Laboratory Analytical Test Results Reports	
Cleanup Criteria Requirements for Response Activity (Formerly the Part 201 Generic Cleanup Criteria and Screening Levels) Tables	



1.0 INTRODUCTION

The subject property is comprised of a single, approximate 3.58-acre parcel of land [Property Identification Number (PIN): 10-10-21-301-006] and addressed as 37900 Mound Road. It is situated on the east side of Mound Road, north of Metropolitan Parkway, within Section 21 in Sterling Heights (T.2N. R.12E.), Macomb County, Michigan (42.572051°N, 83.048293°W). A General Location Map taken from the “Warren, Michigan” United States Geological Survey (USGS) Topographic Map is presented in Figure 1.

The subject property is currently comprised of developed land and is located in an area of Sterling Heights that is characterized by commercial and industrial operations, and surface roadways. It should be noted that the uses of the vicinity were gathered in the course of researching the subject property itself. A General Site Plan developed from our recent site inspection is presented as Figure 2.

The subject property is currently zoned M-1 (light industrial) and currently consists of an industrial manufacturing operation utilizing two structures, paved parking and driveway areas. Concrete-paved parking/drive aisles are located adjacent to the subject property building to the north and east. The western and southern portions of the subject property consist of landscaped areas and manicured grass. The subject property is accessed by one curb cut along Mound Road.

G2 Consulting Group, LLC (G2) was retained by RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC to perform a Phase II ESA to thoroughly address the recognized environmental conditions (RECs) within the subject property and presented in our previously prepared Phase I ESA Report, dated July 3, 2024. These RECs are identified as follows:

- A. The subject property has operated as a manufacturing facility since construction in 1974. A subsurface investigation conducted throughout the subject property in December 2009 identified metals in the soil and groundwater above the unrestricted residential use criteria. Based on the analytical results of the December 2009 investigation, the subject property is considered a “facility” under Part 201 of the Natural Resources and Environmental Protection Act (NREPA), Public Act 451 of 1994, as amended. It is G2’s professional opinion that the identified contamination on the subject property above the unrestricted residential use criteria represents a REC.
- B. The subject property had a drain that bisected the subject property from the northeast to the southwest prior to the construction of the current subject building. During construction, the drain was filled in with unknown fill soils. The December 2009 subsurface investigation advanced one soil boring in the area of the former drain. This boring was advanced within the southern interior of the subject building and metal contamination was identified in the soil and groundwater at this location above the unrestricted residential use criteria. Additionally, approximately 6-feet of fill material was identified beneath the building in this area. G2 notes that methane gas testing had not been part of the December 2009 investigation. Based on the identification of contamination in the soil and groundwater in the area of the former drain, and the presence of six feet of fill material, it is G2’s professional opinion that the filling on the subject property remains a REC and additional investigation is needed.
- C. The subject property has continued to operate with manufacturing and assembly operations for the past fifteen years after the December 2009 subsurface investigation. During G2’s recent site reconnaissance, staining was observed within the interior of the subject building. Hazardous materials and petroleum products were observed to be stored near these stained areas, and absorbent padding to clean up leaks were observed near some of the stained areas. Therefore, it is impossible to differentiate between “old” staining assessed as part of the December 2009 subsurface investigation, and “new” staining which occurred within the last 15 years. Additionally, areas of staining, not discussed in the 2009 investigation, were observed in 2024 on the exterior of the subject property and within the ancillary building interior. The December 2009 investigation addressed exterior material storage concerns along the southern adjoining property boundary; however, during the 2024 renaissance, G2 observed exterior material storage along the northern



adjoining property boundary. In G2's professional opinion, these new areas of observed staining and exterior material storage represent a REC.

- D. The adjoining property to the north appears to have been utilized for industrial operations since the early 1990s. This site has had several violations relating to the storage and handling of regulated hazardous waste generation. Additionally, G2 observed the storage of racks and other materials along the shared property boundary. It is G2's professional opinion that this site represents a REC to the subject property.

These RECs identified in the aforementioned Phase I ESA exhibited a potential for having an adverse environmental impact on the subject property; therefore, an additional investigation in the form of a Phase II ESA was deemed necessary.

This work is subject to terms and conditions of G2 Consulting Group, LLC proposal with RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC, and dated June 21, 2024.

RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC had the responsibility for obtaining/arranging the site access authorization of the subject property.

Field activities were performed on June 28, 2024, with the weather conditions documented as being clear and a high temperature of 80 degrees Fahrenheit. G2 notes that precipitation events occurred within a 48-hour period prior to field activities.



2.0 SCOPE OF SERVICES

The purpose of our Phase II ESA is to evaluate the RECs on the subject property and to supplement the data from the previously prepared BEA (BEA Submittal ID B201004357LV) dated January 28, 2010 for the subject property. This investigation was performed in general accordance with ASTM E1903-19 and our proposed scope of work for the Phase II ESA. Our Phase II ESA is not intended to identify or render an opinion regarding the presence of additional environmental contamination. A Project Manager developed the Phase II ESA, which included the following scope of services:

- An appropriate utilities search was performed by the local utility locating service provider (MISS DIG). The subject property owner also reviewed and approved soil boring locations.
- The performance of a subsurface investigation and the collection of soil and water samples (if encountered). A total of ten environmental soil borings were advanced within the subject property and identified as soil borings G2-1 through G2-10 and were advanced to a maximum depth of 16-feet below the ground surface (bgs).
- Representative samples were properly collected from soil borings G2-1 through G2-10. The samples were collected and submitted for the presence of analytical testing for presence of volatile organic compounds (VOCs); polynuclear aromatic hydrocarbons (PNAs), Eight Metals (As, Ba, Cd, Cr, Hg, Pb, Se, and Ag) and Hexavalent Chromium. These are target analytes for the aforementioned RECs.
- Since groundwater was not encountered, no groundwater sampling activities were performed.
- Each soil sample was visually assessed and screened in the field using the headspace method for the photoionization detector (PID) to determine the approximate concentration of total volatile organic compounds with a PID. The PID has a 10.6 electron volt ultraviolet probe that provides a wide range of sensitivity for volatile organic compounds. The PID was calibrated using an isobutylene reference gas canister. Isobutylene is a volatile organic compound which mimics the PID response to benzene.
- Ten temporary soil gas sampling points were installed at ten locations within the subject property (G2-1 through G2-10). These soil gas sampling points were sampled in the field using a calibrated direct reading methane gas meter. The meter readings did not yield readings above the detection limit. If the meter indicated detectable concentrations, then bottle-vac samples would have been submitted for chemical analysis. Additionally, every soil boring was also screened with the methane gas meter, with similar findings.
- Collected samples were placed in laboratory supplied sample containers and stored in an iced cooler until delivery to the analytical laboratory. The sample containers were of suitable capacity and material for the requested analysis, in accordance with USEPA SW-846. The sample containers were labeled with test boring and sample numbers, type of sample, required analysis, date, and time of collection, and sample collector's name. Chain-of-Custody procedures were utilized for the samples. Custody of the samples is the responsibility of G2 Consulting Group, LLC until delivery to the laboratory, at which time custody becomes the responsibility of the laboratory.
- Ten representative soil samples were sent to an independent laboratory for laboratory analyses using Michigan Department of Environment, Great Lakes & Energy (EGLE) and/or U.S. Environmental Protection Agency (EPA) approved analytical methods.
- The analytical results of the target analytes were compared to appropriate regulatory guidelines, background levels, and limits.



The following is the preparation of a formal report, which documents our field observations, procedures followed during the performance of the Phase II ESA, our interpretation of the analytical results, and our conclusions.

3.0 EXPLORATION & ANALYTICAL TESTING PROCEDURES

This assessment is consistent with scientific inquiry, as the work was formulated such that another Phase II ESA assessor would be able to reproduce the assessment and obtain consistent results.

G2 Consulting Group, LLC and TMH Environmental performed the Geoprobe® soil borings (G2-1 through G2-4 and G2-9 through G2-10) and hand auger soil borings (G2-5 through G2-8) identified as soil borings G2-1 through G2-10 at selected locations within the subject property. Lastly, temporary soil gas sampling points were also properly installed within the ten soil borings.

3.1 Boring & Soil Sampling Procedures

In determining the locations for subsurface sampling events, the Phase II ESA assessor determined how the target analytes likely would have entered the environment (i.e., first contacted environmental media). The Phase II ESA assessor exercised professional judgement based on knowledge of the types of activities, operations, and releases that are inherent to the past/current uses at or within the vicinity of the subject site.

G2 drew on knowledge of the characteristics of the engineered structures, features, containers/vessels present or known or inferred to have been present at or within proximity to the subject property, from which or through which the target analytes may been released or dispersed on the subject property. The following areas were deemed the locations currently most likely to have the highest concentrations of the target analytes given the possible mechanisms of first entry into the environment, the subject property physical conditions, and the behavior, fate and transport characteristics of the target analytes.

The data quality objective for this Phase II ESA was at a minimum, to achieve reproducible chemical testing results for target analytes in samples of environmental media collected from locations relevant to the objectives of this assessment. G2 exercised professional judgement based on knowledge of the manner in which releases commonly occur in connection with commercial or industrial activities and operations similar to those currently or historically conducted within the subject property.

A total of ten (10) Geoprobe® soil borings (G2-1 through G2-4 and G2-9 through G2-10) and hand auger soil borings (G2-5 through G2-8) identified as soil borings G2-1 through G2-10 were advanced using proper environmental sampling protocol. Additionally, temporary soil gas sampling points were properly installed within each of the ten soil borings.

The approximate locations of these soil borings are shown on the appended Soil Boring and Sample Location Plan, Figure 3. The following explains the rationale behind the boring placements.

RECs	Investigation Activity	Target Analytes
RECs A through D	Soil boring G2-1 was near the northeastern corner of the subject property. One soil sample (G2-1) was collected from the soil boring. Set temporary groundwater well, but it did not produce. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas

RECs	Investigation Activity	Target Analytes
RECs A through D	Soil boring G2-2 was in the eastern portion of the subject property, along the north exterior wall of the small ancillary building. One soil sample (G2-2) was collected from the soil boring. Set temporary groundwater well, but it did not produce. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-3 was in the southeastern portion of the subject property, within the landscaped area. One soil sample (G2-3) was collected from the soil boring. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-4 was in the southeastern portion of the subject property, within the landscaped area. One soil sample (G2-4) was collected from the soil boring. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-5 was an interior soil boring, within the small ancillary building. Collected one soil sample (G2-5) from the soil boring. Set temporary gas sample probe at 2.0-2.5-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-6 was an interior soil boring, within the small ancillary building. Collected one soil sample (G2-6) from the soil boring. Set temporary gas sample probe at 2.5-3.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-7 was inside the main building, in the eastern section. One soil sample (G2-7) was collected from the soil boring. Set temporary gas sample probe at 2.5-3.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-8 was inside the main building, in the eastern section of the compressor room. One soil sample (G2-8) was collected from the soil boring. Set temporary gas sample probe at 2.5-3.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-9 was along southern edge of pavement near the former storage area. One soil sample (G2-9) was collected from the soil boring. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas
RECs A through D	Soil boring G2-10 was east of the small ancillary building. One soil sample (G2-10) was collected from the soil boring. Set temporary gas sample probe at 4.5-5.0-feet bgs.	VOCs; PNAs; PCBs; the Eight RCRA Metals; hexavalent chromium and screened for methane gas

The Geoprobe® soil borings (G2-1 through G2-4 and G2-9 through G2-10) were advanced using a Geoprobe® machine. A Geoprobe® machine is a hydraulically powered percussion-probing machine that drives a sampling tool to obtain continuous soil cores or discrete soil samples. Samplers can also be driven



to collect vapors and/or water samples. Soil samples are typically 48-inches to 60-inches in length by 1.5-inches inside diameter with a non-reactive liner to retain the samples. Liners are available in clear plastic, brass, stainless steel, and PTFE (Teflon). The sampler and lining are pushed to the desired depth, the sampler and drive rods are removed from the hole, and then the soil and liner are extracted and capped.

The stainless steel hand auger set up consisted of pre-cleaned stainless steel bucket auger, connecting rods, and handle. The hand auger soil borings (G2-5 through G2-8) extended down to the desired depths and the resulting soils were brought to the surface for a thorough evaluation and sampling.

Sample collection was conducted according to standard procedures established in US EPA SW-846, 3rd Edition. Variations in subsoil conditions occurred throughout the subject site. Additionally, the stratigraphic lines represented the approximate boundary between soil types; however, the transition may be more gradual than what is shown. Encountered soils were screened with a PID and observed for olfactory (unusual odors) and visual indications (discolored soils) of potential concerns. The suspected layers were placed into laboratory prepared containers. If no suspect layers were identified within the liner, then representative samples were selected from the materials and placed into the laboratory prepared containers. Standard sample chain of custody protocol was followed for the transference of collected samples.

Soil gas screening events were performed during the advancement of each of the ten soil borings. Additionally, the screening events were performed after proper installation of each soil gas sampling point, set at depths ranging from 2.5-feet bgs to 5.0-feet bgs.

Upon completion of sampling events within each soil boring, they were properly backfilled with hydrated bentonite, spoils, and capped with appropriate material.

3.2 Water Sampling Procedures

As stated previously, the data quality objective for this Phase II ESA is to obtain information regarding the presence of target analytes at the subject property that is accurate and reproducible, consistent with proper scientific inquiry and the scientific method.

It should be noted G2 properly installed two temporary groundwater monitoring wells, one within soil boring G2-1 and one within soil boring G2-2. However, neither of the wells produced water. The remaining soil borings did not exhibit the potential for groundwater.

Significant quantities of groundwater (sufficient to properly collect samples) were not encountered within the soil borings; therefore, no groundwater sampling events were performed.

3.3 Soil Gas Screening/Sampling Procedures

Additionally, the ten soil gas sampling points/probes were each properly installed within the subject property at a maximum depth of 5-feet below the ground surface and above the groundwater table. A Geoprobe® unit or hand auger set up was utilized to assist in the installation of the soil gas probes. A temporary non-reactive (stainless steel or stone) probe was placed into the hole with an airtight seal created around the metal probe. After the proper installation of the temporary vapor probes/sampling points within the borings, an adequate time period was allowed for the sampling point to equilibrate prior to screening/sampling.

This methane gas evaluation was performed using a direct reading and portable instrument that measured the gas/atmosphere for the presence of methane gas concentrations. G2 utilized a calibrated GEM 5000 meter for the series of screening/sampling events within each soil boring. This unit measured methane, oxygen, carbon dioxide and balance gases. If the direct reading instrument yielded detectable readings of methane, bottle-vac sampling would have been performed with supplemental analytical testing.

However, all of the readings/screenings did not yield methane levels above the detection limit.

3.4 Decontamination Procedures

Equipment used during Geoprobe, as well as, hand auger sampling procedures were decontaminated prior to and between each use. Geoprobe® equipment (e.g., rods and probes) and hand auger equipment were cleaned using a high pressure, hot water power washer and clean water rinse. The sampling tools were also sequentially rinsed with a phosphate free detergent/water wash, clean water rinse, and deionized water final rinse.

Disposable powderless nitrile gloves were donned by field personnel between each sampling interval to reduce the potential for cross contamination.

3.5 Soil, Soil Gas, and Groundwater Analytical Testing

G2 collected soil samples according to USEPA Publication SW-846, *“Test Methods for Evaluating Solid Waste.”* Soil and groundwater samples (if any) were collected in laboratory-supplied containers, stored on ice or at approximately 4 degrees Celsius, and submitted under chain-of-custody documentation.

At least one soil sample was properly collected and submitted for analytical testing from each soil boring. Each soil boring and sample had the same name designation. For example, soil boring G2-1 had soil sample G2-1 collected from it and so forth.

G2 utilized a calibrated GEM 5000 meter for the series of screening/sampling events within each soil boring and subsequent soil gas vapor probe/soil gas sampling point. This unit measured methane, oxygen, carbon dioxide and balance gases. If the direct reading instrument yielded detectable readings of methane, bottle-vac sampling would have been performed with supplemental analytical testing.

Based on moist soils (not saturated), G2 properly set temporary groundwater monitoring wells within soil borings G2-1 and G2-2. These wells did not produce groundwater; therefore, no groundwater sampling events were performed. No saturated soils were observed within the remaining eight soil borings.

The following table presents a summary of sampling analyses:

Sample ID	Sample Depth (ft bgs)	Sample type	VOCs and PNAAs	8 RCRA Metals and Hexavalent chromium	Methane Screening
G2-1	2.5-3.0	Soil	☑	☑	
G2-2	0.5-1.0	Soil	☑	☑	
G2-3	5.0-5.5	Soil	☑	☑	
G2-4	3.0-3.5	Soil	☑	☑	
G2-5	1.0-1.5	Soil	☑	☑	
G2-6	0.75-1.25	Soil	☑	☑	
G2-7	2.5-3.0	Soil	☑	☑	
G2-8	1.5-2.0	Soil	☑	☑	
G2-9	1.0-1.5	Soil	☑	☑	
G2-10	1.75-2.25	Soil	☑	☑	
G2-1	4.5-5.0	Soil gas			☑
G2-2	4.5-5.0	Soil gas			☑
G2-3	4.5-5.0	Soil gas			☑
G2-4	4.5-5.0	Soil gas			☑

Sample ID	Sample Depth (ft bgs)	Sample type	VOCs and PNAS	8 RCRA Metals and Hexavalent chromium	Methane Screening
G2-5	2.0-2.5	Soil gas			☒
G2-6	2.5-3.0	Soil gas			☒
G2-7	2.5-3.0	Soil gas			☒
G2-8	2.5-3.0	Soil gas			☒
G2-9	4.5-5.0	Soil gas			☒
G2-10	4.5-5.0	Soil gas			☒

The sample sets were placed into an iced cooler in the field, maintained at 4 degrees Celsius at the analytical laboratory prior to analysis, and managed under strict chain-of-custody protocols.

There were no physical samples of soil gas, as soil gas was screened in the field, with a calibrated direct reading instrument.

4.0 GEOLOGIC SITE CHARACTERIZATION

Topographical information of the subject property and the surrounding area was obtained and reviewed from the USGS, "Warren, Michigan" Quadrangle, 7.5-Minute Series Topographic Map. This map is included as Figure 1. The surface of the subject property exhibits a relatively flat topography. The approximate USGS elevation of the subject property is approximately 625-feet above mean sea level.

According to readily available published sources of generalized subsurface information, the geology of the general area is characterized by Lacustrine clay and silt. Lacustrine clay and silt soils have been deposited in the still, fresh water of historic lakes. Underlying these deposits is Devonian-aged Berea sandstone and Bedford shale bedrock formation. The surficial soils at the subject property are identified by the Macomb County Soil Survey as Pipestone sand, loamy substratum with 0 to 6 percent slopes and Udorthents and Udipsamments, nearly level to hilly. Pipestone sands are somewhat poorly drained and primarily located on strand plains on till-floored lake plains with depth to water table of 6-inches. Udorthents and Udipsamments are well-drained and primarily located on ground moraines with a depth to the water table generally greater than 80-inches.

No site-specific groundwater information was available for the subject property, therefore major hydrogeologic features and surface topography information were reviewed to determine the probable groundwater flow direction of the subject property. The available hydrogeologic information indicates that the presumed local groundwater flow direction is to the northeast. It should be noted that local geologic features may cause local groundwater flow direction to differ from the regional flow direction. Local hydraulic gradient at the subject property was interpreted based on a review of the "Warren, Michigan" USGS Topographic Map. Therefore, in assessing potential external environmental impact, properties located directly southwest (presumed up gradient) of the subject property are of primary concern. A complete hydrogeologic investigation would be necessary to determine site-specific groundwater flow direction. Estimated groundwater levels and/or flow direction(s) may vary due to seasonal fluctuations in precipitation, local usage demands, geology, underground structures, or dewatering operations.

4.1 Encountered Subsurface Conditions

In summary, the surface soils consist of fill soils of brown silty sand or brown silty clay which extends down to depths of up to 6-feet below the ground surface (bgs). Debris consisting of wood, concrete and brick were observed in several of the soil borings within the fill soils. Underlying the fill soils was brown/gray silty clay and gray silty clay to the terminal depths of up to 16-feet bgs. No apparent olfactory indications of the presence of strong unusual odors were noted within the explored areas. No significantly elevated PID readings were noted within the screened soils. Groundwater was not encountered within the



explored areas.

Previously prepared environmental investigations identified similar encountered soil conditions.

Boring Logs of Geoprobe® and hand auger soil borings are included in the Appendix of this report. The stratification depths shown on these boring logs represent soil conditions at each boring location. Variations may occur between and away from the borings. Additionally, the stratigraphic lines represent the approximate boundary between soil types; the transition may be more gradual than what is shown. We have prepared the boring logs on the basis of field logs of the soils encountered and were not supplemented by laboratory classification and testing.

5.0 ANALYTICAL TEST RESULTS

Documentation of the analytical test procedures and a list of the analyzed samples are presented in the Soil and Groundwater Sample Analytical Testing sections of this report. As stated throughout this text, the data quality objective for this Phase II ESA is to obtain information regarding the presence of target analytes at the subject site that is accurate and reproducible, consistent with proper scientific inquiry and the scientific method. The complete analytical test results and comparison tables are included in the Appendix.

The above referenced soil samples were selected for chemical analysis based on the previously mentioned criteria detailed in the Soil Sampling Procedures section in this report. For additional information refer to the appended Boring Logs and the appended Merit Laboratories, Inc. Analytical Report dated July 12, 2024.

Analytical results obtained from Merit Laboratories, Inc. were compared to the Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) detailed within Operational Memorandum No. 1 and dated December 30, 2013, and revised June 25, 2018, December 21, 2020, as well as, October 12, 2023. The land use criteria applied for reference is Residential, which is the most restrictive. These values will be referenced as the cleanup criteria throughout the text of this document.

The ten submitted soil sample sets, identified as G2-1 through G2-10 were analyzed for the presence of volatile organic compounds (VOCs-USEPA Method 8260 and 5035); polynuclear aromatic hydrocarbons (PNAs-USEPA Method 8270), Eight Metals (As, Ba, Cd, Cr, Hg, Pb, Se, and Ag-USEPA Method 6020 and 7471) and Hexavalent Chromium (USEPA Method 7196). These are target analytes for the aforementioned RECs and also supplemented previously prepared data presented in a previously prepared BEA (BEA Submittal ID B201004357LV) dated January 28, 2010 for the subject property.

The analytical data for the ten soil samples indicate results below the method detection limit (i.e., non-detect) for VOCs and PNAs.

The analytical data for the ten soil samples indicate results for hexavalent chromium (chromium VI), selenium, and mercury are below the method detection limit (i.e., non-detect).

The analytical data for the ten soil samples indicate only one soil sample, G2-5, had detectable concentration of silver. This silver level is below the Statewide Default Background Value and well below the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for silver.

The analytical data for the ten soil samples indicate detectable concentrations of cadmium within the majority of the soil samples. These cadmium concentrations ranged non-detect to 1,080 ug/kg, which are below the Statewide Default Background Value and well below the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for cadmium.



The analytical data for the ten soil samples indicate detectable concentrations of barium, within each of the soil samples. These barium concentrations ranged from 15,300 ug/kg to 54,900ug/kg, which are below the Statewide Default Background Value and well below the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for barium.

The analytical data for the ten soil samples indicate detectable concentrations of lead, within each of the soil samples. These lead concentrations ranged from 3,400 ug/kg to 17,600 ug/kg, which are below the Statewide Default Background Value and well below the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for lead.

The analytical data for the ten soil samples indicate detectable concentrations of arsenic within each of the soil samples. These arsenic concentrations ranged from 2,700 ug/kg to 11,700 ug/kg. Three soil samples (G2-4, G2-6, and G2-9) are above the Statewide Default Background Value and also above the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for arsenic. Specifically, the three elevated soil samples are above the Drinking Water Protection Criteria (DWPC) as well as the Groundwater Surface Water Interface Protection Criteria (GSIPIC) for arsenic. Additionally, soil sample G2-9 is also above the Direct Contract Criteria (DCC) for arsenic.

The analytical data for the ten soil samples indicate detectable concentrations of total chromium within each of the soil samples. These total chromium concentrations ranged from 4,500 ug/kg to 33,400 ug/kg, which three soil samples, G2-4, G2-5, and G2-6 are above the Statewide Default Background Value for total chromium. As stated previously within this text, these samples were also speciated and analytical data indicated hexavalent chromium (chromium VI) was non-detect for all ten soil samples. Therefore, the ten soil samples submitted for total chromium are below the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels).

The ten soil gas sampling points identified as G2-1 through G2-10 were properly screened/sampled with a calibrated direct reading methane gas instrument (GEM 5000). These ten soil gas sampling events did not yield detectable concentrations of methane; therefore, no further bottle-vac sampling with subsequent analytical testing was deemed necessary. Furthermore, each of the soil borings were screened during advancement of the borings with the methane gas meter and none of the soil borings exhibited detectable concentrations of methane gas during this process.

Refer to the Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) Cleanup Criteria Comparison Tables in the Appendix for additional information.

6.0 CONCLUSIONS & RECOMMENDATIONS

G2 performed this Phase II ESA at the approximate 3.58-acre property located at 37900 Mound Road, Sterling Heights, Macomb County, Michigan to thoroughly address the RECs identified within the subject property as identified in the July 3, 2024 Phase I ESA. This Phase II ESA also provided supplemental data to the previously prepared BEA (BEA Submittal ID B201004357LV) dated January 28, 2010 for the subject property. G2 performed this Phase II ESA in general conformance with the scope and limitations of ASTM Practice E 1903-19, and following the stated objectives of the Scope of Work document (proposal) dated June 21, 2024. Following our performance of the Phase II ESA, G2 offers the following summary of evaluations and conclusions for the subject property.

Ten (10) total soil borings comprising of six (6) Geoprobe® soil borings identified as soil borings G2-1 through G2-4 and G2-9 and G2-10, as well as four (4) hand auger soil borings identified as soil borings G2-5 through G2-8, were properly placed within the subject property to thoroughly evaluate the areas for the aforementioned RECs. The maximum depth of the soil borings was 16-feet below the ground surface (bgs).



Ten temporary soil gas sampling points were properly installed at ten locations within the subject property (G2-1 through G2-10).

During the current field investigation, apparent visual indications of fill soils containing debris was observed. The debris consisted of brick, concrete, and wood. No apparent olfactory indications of the presence of strong unusual odors were noted within the explored areas. No significantly elevated PID readings were noted within the screened soils. Groundwater was not encountered within the explored areas.

The ten submitted soil sample sets, identified as G2-1 through G2-10 were analyzed for the presence of volatile organic compounds (VOCs-USEPA Method 8260 and 5035); polynuclear aromatic hydrocarbons (PNAs-USEPA Method 8270), Eight Metals (As, Ba, Cd, Cr, Hg, Pb, Se, and Ag-USEPA Method 6020 and 7471) and Hexavalent Chromium (USEPA Method 7196). These are target analytes for the aforementioned RECS and also supplemented previously prepared data presented in the BEA for the subject property dated 2010.

The analytical data for the ten soil samples indicate results below the method detection limit (i.e., non-detect) for VOCs, PNAs, hexavalent chromium (chromium VI), selenium, and mercury.

The analytical data for the ten soil samples indicate detectable concentrations of silver, cadmium, barium, lead, and total chromium are below their respective and most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels).

The analytical data for the ten soil samples indicate detectable concentrations of arsenic within each of the soil samples. These arsenic concentrations ranged from 2,700 ug/kg to 11,700 ug/kg, which three soil samples (G2-4, G2-6, and G2-9) are above the Statewide Default Background Value and also above the most restrictive Cleanup Criteria Requirements for Response Activity (formerly the Part 201 Generic Cleanup Criteria and Screening Levels) for arsenic. Specifically, the three elevated soil samples are above the Drinking Water Protection Criteria (DWPC) as well as the Groundwater Surface Water Interface Protection Criteria (GSIPIC) for arsenic. Additionally, soil sample G2-9 is also above the Direct Contract Criteria (DCC) for arsenic.

The ten soil gas sampling points identified as G2-1 through G2-10 were properly screened/sampled with a calibrated direct reading methane gas instrument (GEM 5000). These ten soil gas sampling events did not yield detectable concentrations of methane; therefore, no further bottle-vac sampling with subsequent analytical testing was deemed necessary. Furthermore, each of the soil borings were screened during advancement of the borings with the methane gas meter and none of the soil borings exhibited detectable concentrations of methane gas during this process.

Based on our observations, review of analytical data, and our professional experience, the subject property is adversely impacted and deemed a "facility". A "facility" is defined as any area, place, or property where a hazardous substance and/or petroleum product in excess of the unrestricted residential cleanup criteria established under Part 201 has been released, deposited, disposed of, or otherwise comes to be located.

Accordingly, a Baseline Environmental Assessment (BEA) is recommended for this real estate transfer. A BEA is for entities such as the client that will be purchasing a property that is defined as a "facility". This BEA would allow such entities to be protected from liability for the cleanup of contamination on the property (provided they did not cause the contamination). The entity should also have the BEA prepared within 45-days; disclose it to EGLE within 6 months of acquisition and disclose to subsequent purchasers and transferees of the property. These requirements are detailed in Part 201 (Environmental Remediation) and Part 213 (Leaking Underground Storage Tanks) of the Natural Resources and Environmental Protection Act, 1994 PA 451, as amended (NREPA).

Furthermore, a due care plan should be developed in accordance with Section 20107a (1) of Part 201. A person who owns or operates property that he/she has knowledge is a facility must:



1. Undertake measures as are necessary to prevent exacerbation of the existing contamination.
2. Exercise due care by undertaking response activity necessary to mitigate unacceptable exposure to hazardous substances, mitigate fire and explosion hazards due to hazardous substances, and allow for the intended use in a manner that protects the public health and safety.
3. Take reasonable precautions against the reasonably foreseeable acts or omissions of a third party and the consequences that foreseeable could result from those acts or omissions.
4. Provide notifications to the Michigan Department of Environmental Great Lakes and Energy (EGLE) and others.
5. Provide reasonable cooperation, assistance, and access to the persons that are authorized to conduct response activities at the facility, including the cooperation and access necessary for the installation, integrity, operation, and maintenance of any complete or partial response activity at the facility. Nothing in this subdivision shall be interpreted to provide any right of access not expressly authorized by law, including access authorized pursuant to a warrant or a court order, or to preclude access allowed pursuant to a voluntary agreement.
6. Comply with any land use or resource use restrictions established or relied on in connection with the response activities at the facility.
7. Not impede the effectiveness or integrity of any land use or resource use restriction employed at the facility in connection with response activities.

G2 can prepare both the BEA and Due Care Plan for RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC.

7.0 LIMITATIONS

The conclusions presented in this report are based on data obtained during the current site investigation performed by G2 Consulting Group, LLC and data provided by others. This report is intended to present a general evaluation of the environmental conditions present at the property, which is not to be construed as relating to health and safety issues directly. Should additional information become available, this information should be reviewed by G2 Consulting Group, LLC and the conclusions herein modified, as appropriate.

G2 Consulting Group, LLC is responsible to perform its services in a professional manner, consistent with the typical industry practice. The conclusions drawn as a result of this evaluation are deemed as appropriate by the consultant in the exercise of professional judgment. While little was observed which would indicate conditions existing beyond those discussed, it is possible that limitation of scope precluded recognition of contamination present at the site. We cannot be held liable for consequential damages if it is determined in the future additional contamination of some type not identified during our Phase II Site Assessment is present at the site.

This report should not be considered as a recommendation to purchase, sell or develop the subject property, and the opinions expressed are not legal opinions. To evaluate the information contained in this report, the reader must understand the limitations associated with this assessment. Specifically, the services for this project have been performed in accordance with the Scope of Services negotiated between RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC and G2 Consulting Group, LLC. Any reliance on this report by a party other than RDB Industrial Drive, LLC and S&S Holdings of Southwest Florida, LLC shall be at the party's sole risk unless that party has written authorization from G2 Consulting Group, LLC to use this document. The purpose of this restriction is to attempt to protect the interests of parties for whom the report may not be appropriately directed.

APPENDIX

General Location Plan
General Site Plan
Soil Boring and Sample Location Plan

Figure 1
Figure 2
Figure 3


Boring Logs

Log Nos. 1 through 10

Laboratory Analytical Test Results Reports

Cleanup Criteria Requirements for Response Activity (Formerly the Part 201 Generic Cleanup Criteria and Screening Levels) Tables

**General Location Plan
General Site Plan
and
Soil Boring and Sample Location Plan**

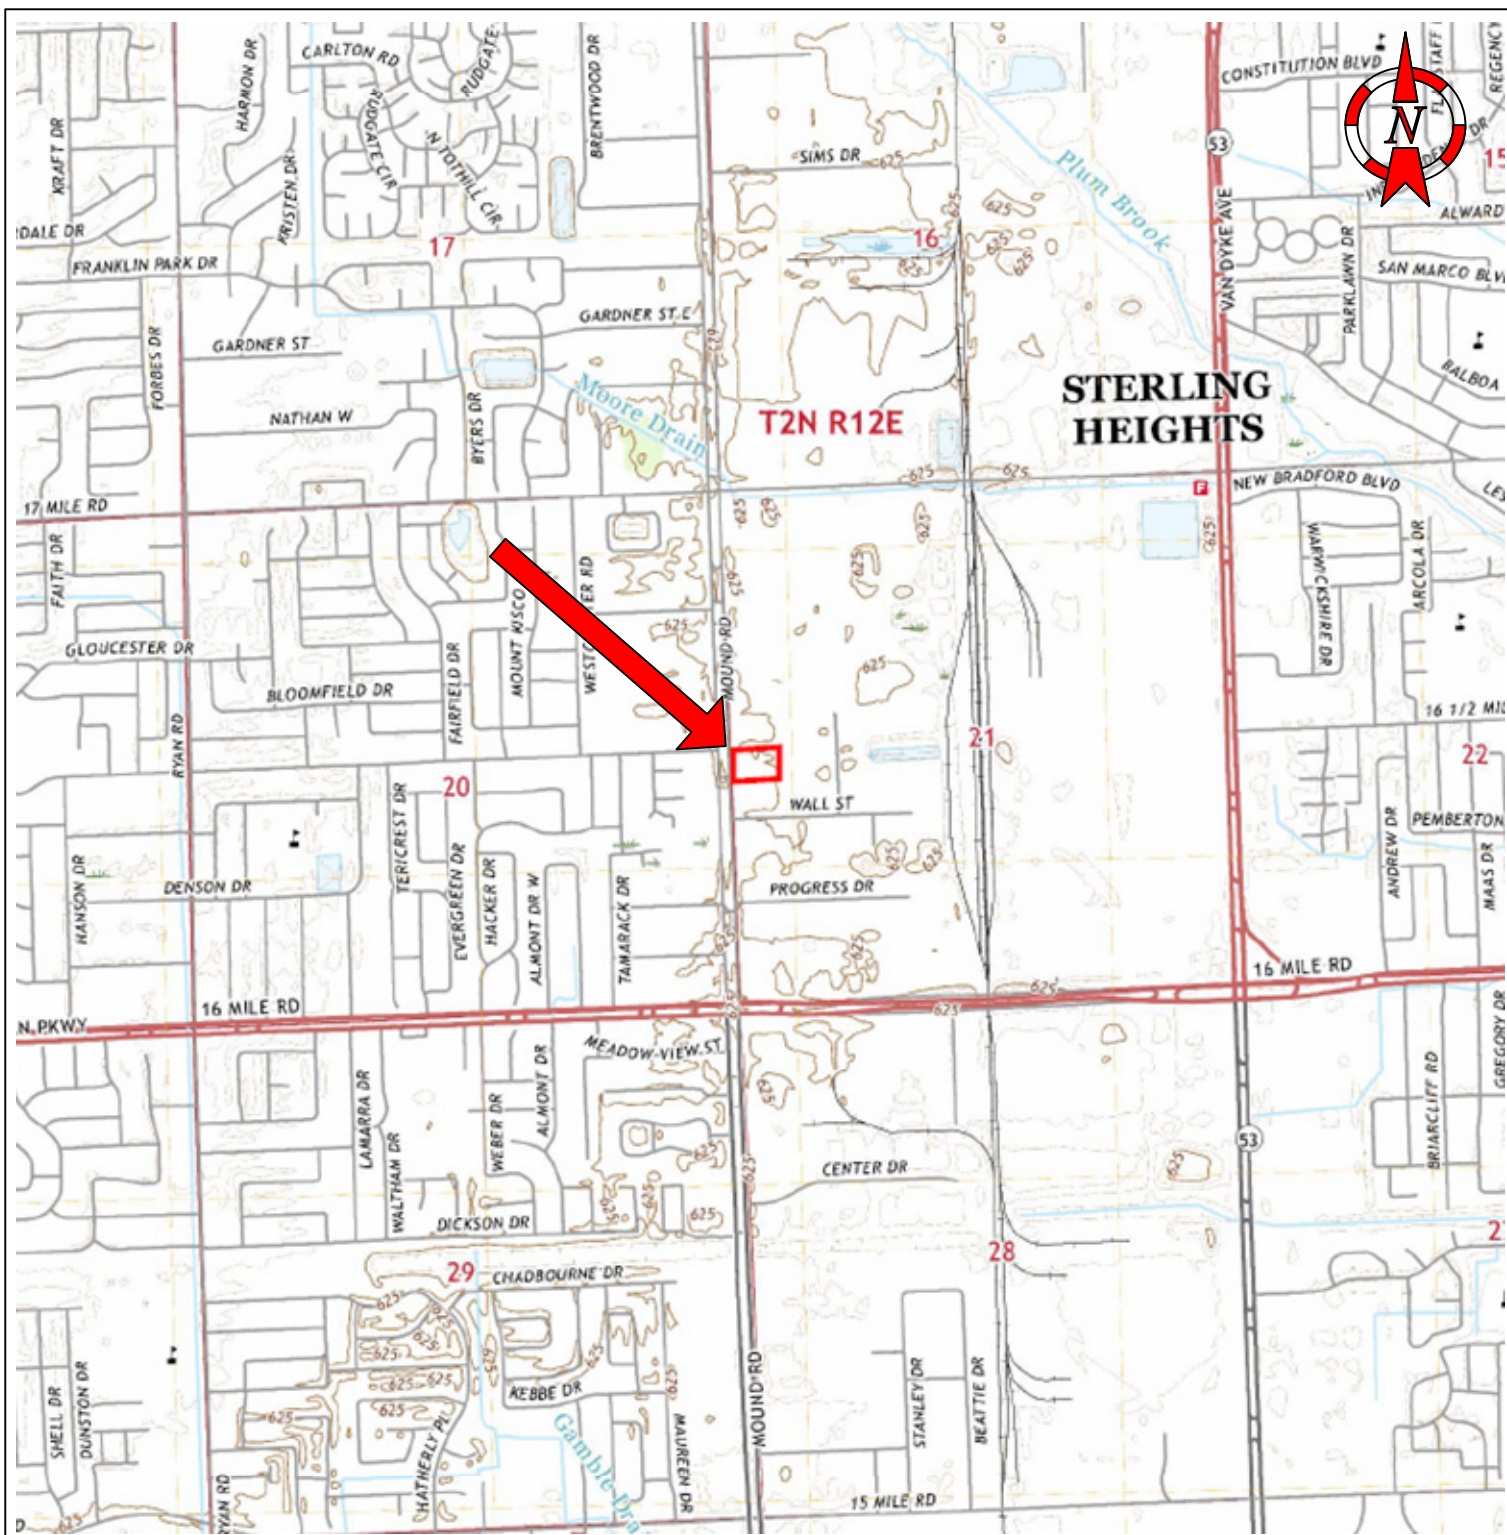

LEGEND

Indicates the
approximate subject
site location

USGS 7.5 Minute Map
Warren, Michigan
Dated 2019

General Location Plan

37900 Mound Road
Sterling Heights, Michigan



CONSULTING GROUP


Project No.: 240506

Drawn By: MLT

Date: 6/21/24

Scale: NTS

Figure
1

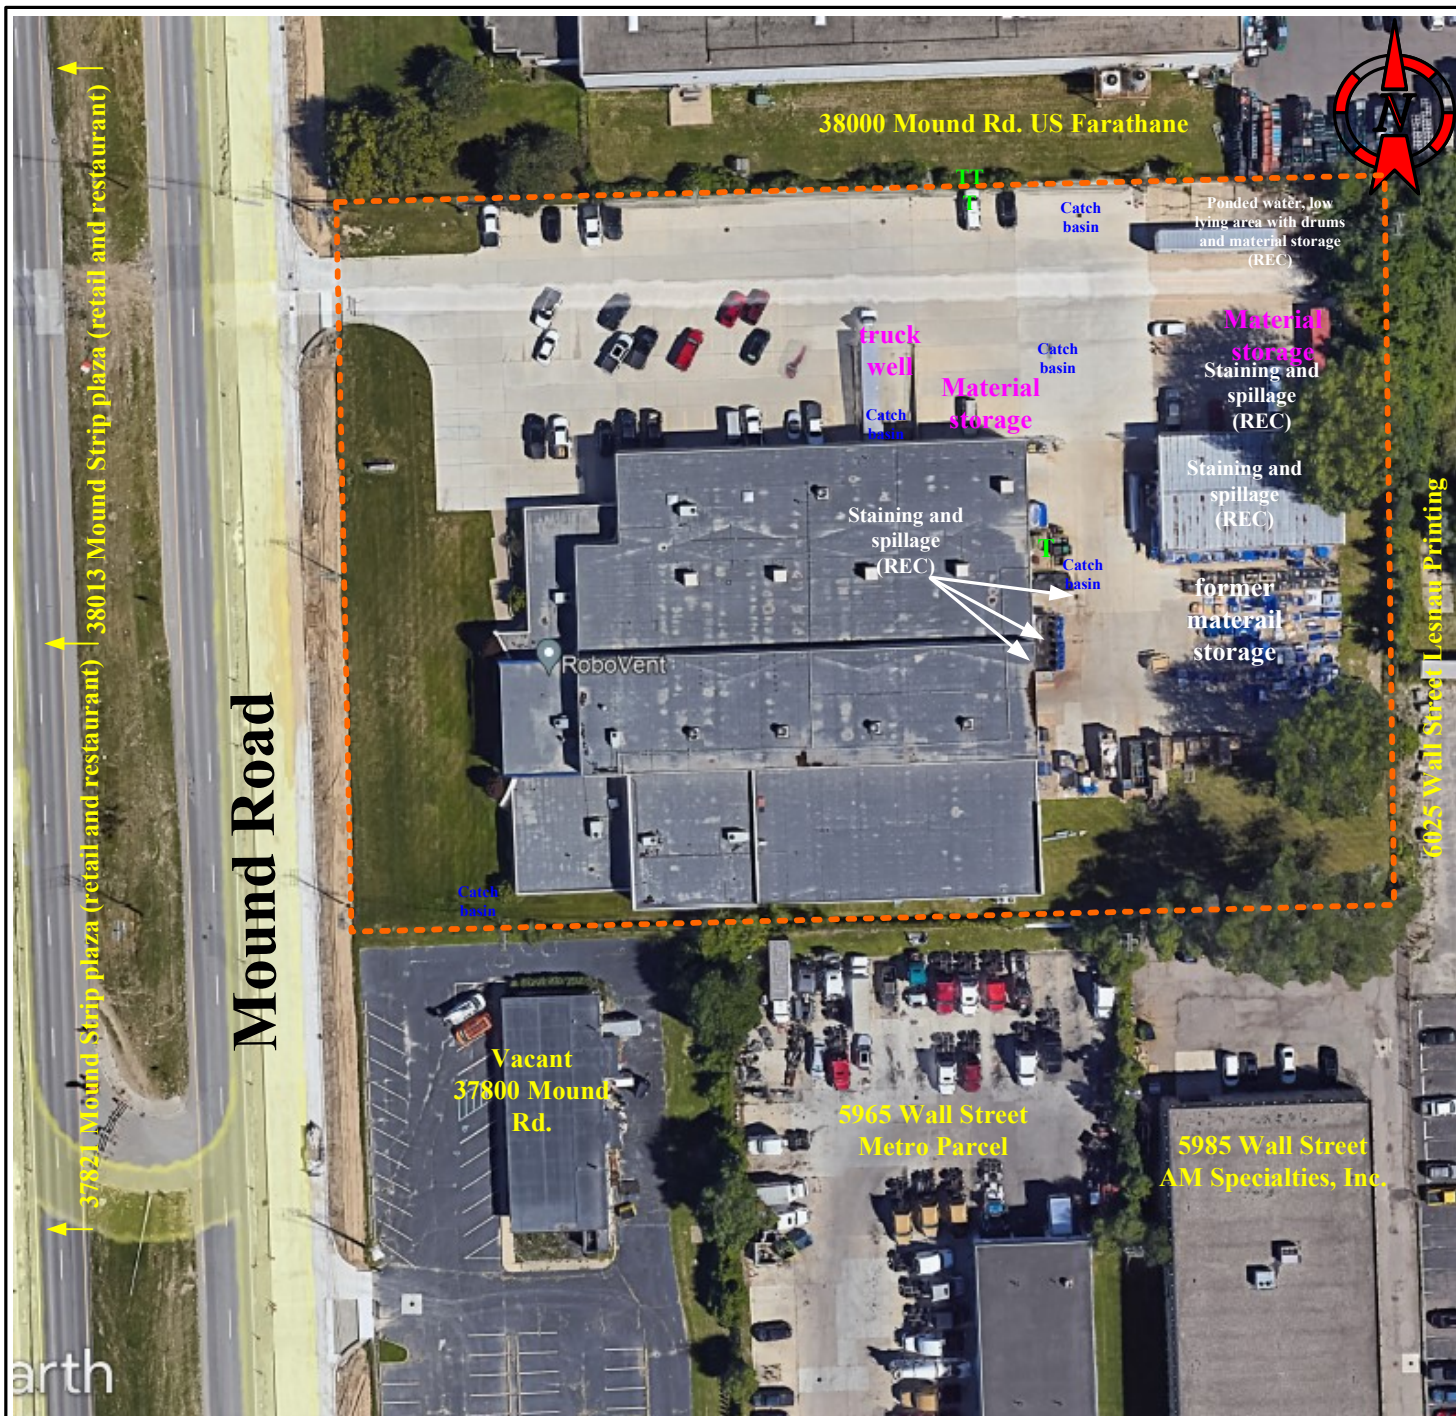

Legend



Approximate Subject Property Boundary

General Site Plan

37900 Mound Road
Sterling Heights, Michigan



CONSULTING GROUP


Project No.: 240506

Drawn By: MLT/TAM

Date: 06/21/24

Scale: NTS

Figure
2

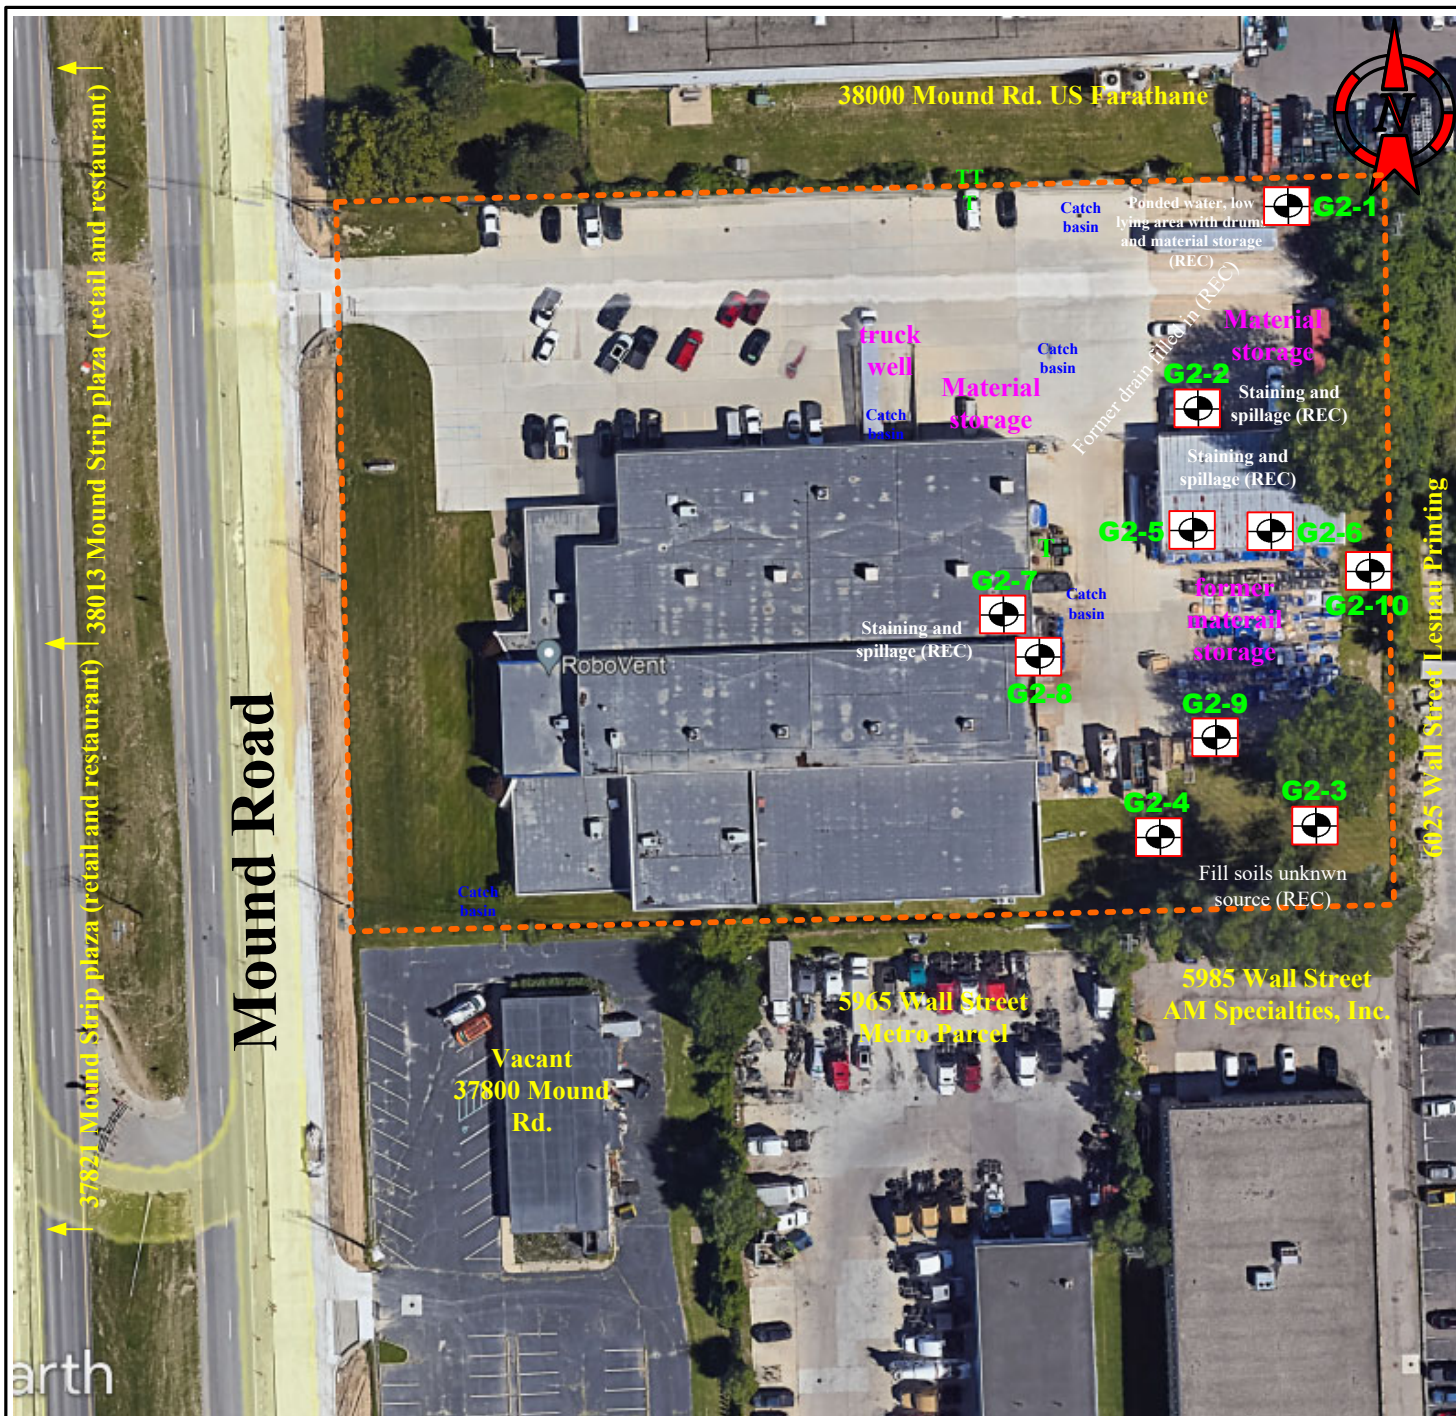

Legend

- Approximate Subject Property Boundary
- Approximate location of soil boring and representative sample collection

Soil Boring and Sampling Location Plan

37900 Mound Road
Sterling Heights, Michigan



Project No.: 240506

Drawn By: MLT/TAM

Date: 06/28/24

Scale: NTS

Figure
3

Soil Boring Logs

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 1 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-1	0.25	Concrete	-	-	-	-
	2.5	Dark brown/gray silty clay, with little sand	-	-	-	<1
	3.0	Black sandy clay, with trace gravel	G2-1	2.5	3.0	<1
	9.5	Brown/gray silty clay, trace sand	-	-	-	<1
	11.5	Brown/gray silty clay (saturated at 9')	-	-	-	<1
	12.0	Gray silty clay, trace sand	-	-	-	<1
	12.0	End of boring, set temporary well				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed in northeastern corner of property, by historic fill, material storage, cracking in pavement, and by northern adjoining property stored materials. In proximity to the RECs. Set temporary well of 1"-ID of PVC construction, 5-ft length, with tip set at 7.0-12.0-feet interval. Little recovery, well ran dry, allowed to set for a time period, little recovery again, ran dry. No water samples. Collected one soil sample (G2-1). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 2 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-2	0.25	Concrete	-	-	-	-
	4.0	Dark brown/gray silty clay, with little sand	G2-2	0.5	1.0	<1
	6.0	Gray silty clay, little sand	-	-	-	<1
	10.0	Brown/gray silty clay, trace sand	-	-	-	<1
	11.5	Brown/gray silty clay (saturated at 9.5')	-	-	-	<1
	12.0	Gray silty clay, trace sand	-	-	-	<1
	12.0	End of boring, set temporary well				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed along northern exterior wall of small building, by historic fill, material storage, cracking in pavement in proximity to the RECs. Set temporary well of 1"-ID of PVC construction, 5-ft length, with tip set at 7.0-12.0-feet interval. Little recovery, well ran dry, allowed to set for a time period, little recovery again, ran dry. No water samples. Collected one soil sample (G2-2). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

G2 Project No. 240506	G2 CONSULTING GROUP, LLC		Sheet: 3 of 10			
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-3	0.25	Dark brown sandy loam with gravel	-	-	-	<1
	6.0	Brown silty clay, with little sand and trace debris (brick, wood, and concrete)	G2-3	5.0	5.5	<1
	6.5	Brown silty sand	-	-	-	<1
	8.0	Brown clayey silt	-	-	-	<1
	16.0	Gray silty clay, trace sand	-	-	-	<1
	16.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed in southeastern corner of property, by historic fill. In proximity to the RECs. Collected one soil sample (G2-3). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

G2 Project No. 240506	G2 CONSULTING GROUP, LLC		Sheet: 4 of 10			
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-4	0.25	Dark brown sandy loam with gravel	-	-	-	<1
	6.0	Brown silty clay, with little sand and trace debris (brick, wood, and concrete)	G2-4	3.0	3.5	<1
	6.5	Brown silty sand	-	-	-	<1
	7.5	Brown clayey silt	-	-	-	<1
	16.0	Gray silty clay, trace sand	-	-	-	<1
	16.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed in southeastern corner of property, by historic fill. In proximity to the RECs. Collected one soil sample (G2-4). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 5 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-5	0.5	Concrete	-	-	-	-
	0.75	Brown silty sand, with trace gravel	-	-	-	<1
	1.5	Brown silty sand with debris (wood, asphalt, and concrete)	G2-5	1.0	1.5	<1
	2.0	Brown silty clay, with trace sand and gravel	-	-	-	<1
	2.5	Brown/gray silty clay, trace sand (refusal at 2.5')	-	-	-	<1
	2.5	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald and Kyle J. Dymowski. Set methane sampling point at 2.0-2.5-ft upon completion, with no readings of methane using GEM. Boring placed in small building by staining and cracking on concrete floor. In proximity to the RECs. Collected one soil sample (G2-5). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: Kyle Dymowski – G2 Consulting Group, LLC					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 6 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-6	0.5	Concrete	-	-	-	-
	0.75	Brown silty sand, with trace gravel	-	-	-	<1
	1.5	Brown silty sand with debris (wood, asphalt, and concrete)	G2-6	0.75	1.25	<1
	2.0	Brown silty clay, with trace sand and gravel	-	-	-	<1
	3.0	Brown/gray silty clay, trace sand (refusal at 2.5')	-	-	-	<1
	3.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald and Kyle J. Dymowski. Set methane sampling point at 2.5-3.0-ft upon completion, with no readings of methane using GEM. Boring placed in small building by staining and cracking on concrete floor. In proximity to the RECs. Collected one soil sample (G2-6). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: Kyle Dymowski – G2 Consulting Group, LLC					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 7 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-7	0.5	Concrete	-	-	-	-
	3.0	Brown silty sand, trace gravel	G2-7	2.5	3.0	<1
	3.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald and Kyle J. Dymowski. Set methane sampling point at 2.5-3.0-ft upon completion, with no readings of methane using GEM. Boring placed in main building by staining and cracked flooring. In proximity to the RECs. Collected one soil sample (G2-7). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: Kyle Dymowski – G2 Consulting Group, LLC					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 8 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-8	0.5	Concrete	-	-	-	-
	2.0	Brown silty sand, trace gravel	G2-8	1.5	2.0	<1
	3.0	Brown/gray silty clay, trace sand	-	-	-	<1
	3.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald and Kyle J. Dymowski. Set methane sampling point at 2.5-3.0-ft upon completion, with no readings of methane using GEM. Boring placed in main building compressor room, by staining and cracked flooring. In proximity to the RECs. Collected one soil sample (G2-8). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: Kyle Dymowski – G2 Consulting Group, LLC					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 9 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-9	0.25	Dark brown sandy loam with gravel	-	-	-	<1
	4.0	Brown silty sand with trace debris (brick, wood, and concrete)	G2-9	1.0	1.5	<1
	13.0	Brown silty clay, trace sand	-	-	-	<1
	16.0	Gray silty clay, trace sand	-	-	-	<1
	16.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed behind small building, by historic fill. In proximity to the RECs. Collected one soil sample (G2-9). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

G2 Project No. 240506		G2 CONSULTING GROUP, LLC		Sheet: 10 of 10		
 SOIL BORING LOG						
Soil Boring No.	PROFILE INFORMATION		Discrete Sample Information			
	Depth (ft)	Soil Description	Sample No.	Depth (ft)		PID (ppm)
				From	To	
G2-10	0.25	Dark brown sandy loam with gravel	-	-	-	<1
	3.25	Brown silty clay, with little sand and trace debris (brick, wood, and concrete)	G2-4	1.75	2.25	<1
	3.5	Brown silty sand, trace gravel	-	-	-	<1
	12.0	Brown silty clay, trace sand	-	-	-	<1
	12.0	End of boring, dry upon completion				
NOTES: Encountered soils inspected by Thomas A. McDonald. Set offset methane sampling point at 4.5-5.0-ft upon completion, with no readings of methane using GEM. Boring placed along southern edge of pavement, in grassy area, by historic fill and former storage exterior storage areas. In proximity to the RECs. Collected one soil sample (G2-10). Upon completion of sampling events boring was backfilled with spoils and hydrated bentonite.						
Borings Advanced by: John Hochstein/Taylor Hochstein – TMH Environmental					Date: 06/28/2024	

**Laboratory Analytical Test Results Reports
and Chain of Custody**

Report to

Attention: Thomas McDonald

Address: G2 Consulting Group
1866 Woodslee Street
Troy, MI 48083

Phone: 248-680-0400

FAX:

Email: TMcDonald@g2consultinggroup.com

Contacts: Brad Buswell, John Kemp

Sample Set Receipt

Invoice to

Attention: Accounts Payable

Address: G2 Consulting Group
1866 Woodslee
Troy, MI 48083

Phone: (248)-680-0400

FAX:

Email: crajala@g2consultinggroup.com

Set ID: S63724

Location: G2CONSULTING (G2 Consulting Group)

PO #: 240506

Login by: MMC

Project: 37900 Mound - Sterling Hts, MI

Backlog Note:

Submitted: 07/01/2024 14:30

Due Date: 07/17/2024

Rush: No

Collected by: Thomas McDonald

QC Level: 1

Custom Limits Present: No

Approved by:

Site:

Work Order#:

Bill to Acct:

Bill to Dept:

Sample ID	Sample Tag	Matrix	Date/Time Collected	COC Ref
S63724.01	G2-1	Soil	06/28/2024 07:00	171795
S63724.02	G2-2	Soil	06/28/2024 08:00	171795
S63724.03	G2-3	Soil	06/28/2024 09:00	171795
S63724.04	G2-4	Soil	06/28/2024 10:00	171795
S63724.05	G2-5	Soil	06/28/2024 11:00	171795
S63724.06	G2-6	Soil	06/28/2024 12:00	171795
S63724.07	G2-7	Soil	06/28/2024 13:00	171795
S63724.08	G2-8	Soil	06/28/2024 14:00	171795
S63724.09	G2-9	Soil	06/28/2024 15:00	171795
S63724.10	G2-10	Soil	06/28/2024 16:00	171795

Samples: S63724.01-10

Analysis Code	Analysis Title	Method	Units	Holding Date
\$58260	Volatile Organics 5035	SW5035A/8260C	mg/kg	07/12/2024
\$PNAPMES	Polynuclear Aromatics	SW8270D	mg/kg	08/07/2024
2115SMS	Arsenic	SW6020A	mg/kg	12/25/2024
2120SMS	Barium	SW6020A	mg/kg	12/25/2024
2135SMS	Cadmium	SW6020A	mg/kg	12/25/2024
2145SMS	Chromium	SW6020A	mg/kg	12/25/2024
2165SMS	Lead	SW6020A	mg/kg	12/25/2024
2185S	Mercury	SW7471B	mg/kg	07/26/2024
2205SMS	Selenium	SW6020A	mg/kg	12/25/2024
2215SMS	Silver	SW6020A	mg/kg	12/25/2024
4435S	Chromium VI	SW7196A	mg/kg	07/28/2024
METHEXT	5035 Methanol Extraction	SW5035A		03/24/2027
PNAEXTS	Semi Volatile Extraction	SW3546		07/12/2024
1605S	Metal Digestion	SW3050B		12/25/2024
1605HGS	Mercury Digestion	SW7471B		07/26/2024
4605	Total Solids	SM2540B	%	07/26/2024

Merit Laboratories Login Checklist

Lab Set ID:S63724

Client:G2CONSULTING (G2 Consulting Group)

Project: 37900 Mound - Sterling Hts, MI

Submitted:07/01/2024 14:30 Login User: MMC

Attention: Thomas McDonald

Address: G2 Consulting Group
1866 Woodslee Street
Troy, MI 48083

Phone: 248-680-0400

FAX:

Email: TMcDonald@g2consultinggroup.com

Selection	Description	Note
Sample Receiving		
01.	☒ Yes ☐ No ☐ N/A	Samples are received at 4C +/- 2C Thermometer # IR 2.6
02.	☒ Yes ☐ No ☐ N/A	Received on ice/ cooling process begun
03.	☐ Yes ☒ No ☐ N/A	Samples shipped
04.	☐ Yes ☒ No ☐ N/A	Samples left in 24 hr. drop box
05.	☐ Yes ☐ No ☒ N/A	Are there custody seals/tape or is the drop box locked
Chain of Custody		
06.	☒ Yes ☐ No ☐ N/A	COC adequately filled out
07.	☒ Yes ☐ No ☐ N/A	COC signed and relinquished to the lab
08.	☒ Yes ☐ No ☐ N/A	Sample tag on bottles match COC
09.	☐ Yes ☒ No ☐ N/A	Subcontracting needed? Subcontacted to:
Preservation		
10.	☒ Yes ☐ No ☐ N/A	Do sample have correct chemical preservation
11.	☐ Yes ☐ No ☒ N/A	Completed pH checks on preserved samples? (no VOAs)
12.	☐ Yes ☒ No ☐ N/A	Did any samples need to be preserved in the lab?
Bottle Conditions		
13.	☒ Yes ☐ No ☐ N/A	All bottles intact
14.	☒ Yes ☐ No ☐ N/A	Appropriate analytical bottles are used
15.	☒ Yes ☐ No ☐ N/A	Merit bottles used
16.	☒ Yes ☐ No ☐ N/A	Sufficient sample volume received
17.	☐ Yes ☒ No ☐ N/A	Samples require laboratory filtration
18.	☒ Yes ☐ No ☐ N/A	Samples submitted within holding time
19.	☐ Yes ☐ No ☒ N/A	Do water VOC, TOX, DO or Alkalinity bottles contain

Corrective action for all exceptions is to call the client and to notify the project manager.

Client Review By: _____ Date: _____

REPORT TO

CONTACT NAME		Thomas McDonald	
COMPANY		G2 Consulting Group, LLC	
ADDRESS		1866 Woodstee	
CITY		STATE	ZIP CODE
Troy		MA	01083
PHONE NO.		P.O. NO.	
248 640 4410		240506	
CELL NO.		QUOTE NO.	
—		240506	
E-MAIL ADDRESS			
fmcdonald@G2consultinggroup.com			

CHAIN OF CUSTODY RECORD

CONTACT NAME		☒ SAME	
COMPANY			
ADDRESS			
CITY		CITY	ZIP CODE
PHONE NO.	E-MAIL ADDRESS		

ANALYSIS (ATTACH LIST IF MORE SPACE IS REQUIRED)

PROJECT NO./NAME 37900 Mand-Sterling Hts, MI	SAMPLER(S) - PLEASE PRINT FULL NAME Thomas McDougall
TURNAROUND TIME REQUIRED ☐ 1 DAY ☐ 2 DAYS ☐ 3 DAYS ☒ STANDARD ☐ OTHER	
DELIVERABLES REQUIRED ☒ STD ☐ LEVEL II ☐ LEVEL III ☐ LEVEL IV ☐ EDD ☐ OTHER	

MATRIX CODE:	W=WATER	GW=GROUNDWATER	WW=WASTEWATER	S=SOIL	L=LIQUID	SD=SOLID
	SL=SLUDGE	DW=DRINKING WATER	O=OIL	WP=WIPE	A=AIR	WS=WASTE

Containers & Preservatives

[illegible]

RELINQUISHED BY: SIGNATURE/ORGANIZATION	<i>[Signature]</i>	☒ Sampler	DATE 6/28/24	TIME 6:00p
RECEIVED BY: SIGNATURE/ORGANIZATION	<i>[Signature]</i>		DATE 7/1/24	TIME 11:2
RELINQUISHED BY: SIGNATURE/ORGANIZATION	<i>[Signature]</i>		DATE 7/1/24	TIME 143
RECEIVED BY: SIGNATURE/ORGANIZATION	<i>[Signature]</i>		DATE 7/1/24	TIME 1430

RELINQUISHED BY:			DATE	TIME
SIGNATURE/ORGANIZATION				
RECEIVED BY:			DATE	TIME
SIGNATURE/ORGANIZATION				
SEAL NO.	SEAL INTACT YES ☐ NO ☐	INITIALS	NOTES:	TEMP. ON ARRIVAL
SEAL NO.	SEAL INTACT YES ☐ NO ☐	INITIALS		2.6



Analytical Laboratory Report

Report ID: S63724.01(01)
Generated on 07/12/2024

Report to
Attention: Thomas McDonald
G2 Consulting Group
1866 Woodslee Street
Troy, MI 48083

Phone: 248-680-0400 FAX:
Email: TMcDonald@g2consultinggroup.com

Additional Contacts: Brad Buswell, John Kemp

Report produced by
Merit Laboratories, Inc.
2680 East Lansing Drive
East Lansing, MI 48823

Phone: (517) 332-0167 FAX: (517) 332-6333

Contacts for report questions:
John Lavery (johnlavery@meritlabs.com)
Barbara Ball (bball@meritlabs.com)

Report Summary
Lab Sample ID(s): S63724.01-S63724.10
Project: 37900 Mound - Sterling Hts, MI
Collected Date(s): 06/28/2024
Submitted Date/Time: 07/01/2024 14:30
Sampled by: Thomas McDonald
P.O. #: 240506

Table of Contents

- Cover Page (Page 1)
- General Report Notes (Page 2)
- Report Narrative (Page 2)
- Laboratory Accreditations (Page 3)
- Qualifier Descriptions (Page 3)
- Glossary of Abbreviations (Page 3)
- Method Summary (Page 4)
- Sample Summary (Page 5)


Maya Murshak
Technical Director



Analytical Laboratory Report

General Report Notes

Analytical results relate only to the samples tested, in the condition received by the laboratory.

Methods may be modified for improved performance.

Results reported on a dry weight basis where applicable.

'Not detected' indicates that parameter was not found at a level equal to or greater than the reporting limit (RL).

When MDL results are provided, then 'Not detected' indicates that parameter was not found at a level equal to or greater than the MDL.

40 CFR Part 136 Table II Required Containers, Preservation Techniques and Holding Times for the Clean Water Act specify that samples for acrolein and acrylonitrile, and 2-chloroethylvinyl ether need to be preserved at a pH in the range of 4 to 5 or if not preserved, analyzed within 3 days of sampling.

QA/QC corresponding to this analytical report is a separate document with the same Merit ID reference and is available upon request.

Starred (*) analytes are not NY NELAP accredited.

Samples are held by the lab for 30 days from the final report date unless a written request to hold longer is provided by the client.

Report shall not be reproduced except in full, without the written approval of Merit Laboratories, Inc.

Limits for drinking water samples, are listed as the MCL Limits (Maximum Contaminant Level Concentrations)

PFAS requirement: Section 9.3.8 of U.S. EPA Method 537.1 states "If the method analyte(s) found in the Field Sample is present in the FRB at a concentration greater than 1/3 the MRL, then all samples collected with that FRB are invalid and must be recollected and reanalyzed."

Samples submitted without an accompanying FRB may not be acceptable for compliance purposes.

Wisconsin PFAs analysis: MDL = LOD; RL = LOQ. LOD and LOQ are adjusted for dilution.

All accreditations/certifications held by this laboratory are listed on page 3. Not all accreditations/certifications are applicable to this report.

For a specific list of accredited analytes, please feel free to contact the laboratory or visit <https://www.meritlabs.com/certifications>.

Report Narrative

There is no additional narrative for this analytical report

Laboratory Accreditations (For Reference Only)

Authority	Accreditation ID
Michigan DEQ	#9956
DOD ELAP & ISO/IEC 17025:2017	#69699 PJLA Testing
WBENC	#2005110032
Ohio VAP	#CL0002
Indiana DOH	#C-MI-07
New York NELAC	#11814
North Carolina DENR	#680
North Carolina DOH	#26702
Pennsylvania DEP	#68-05884
Wisconsin DNR	FID# 399147320

Qualifier Descriptions

Qualifier	Description
!	Result is outside of stated limit criteria
B	Compound also found in associated method blank
E	Concentration exceeds calibration range
F	Analysis run outside of holding time
G	Estimated result due to extraction run outside of holding time
H	Sample submitted and run outside of holding time
I	Matrix interference with internal standard
J	Estimated value less than reporting limit, but greater than MDL
L	Elevated reporting limit due to low sample amount
M	Result reported to MDL not RDL
O	Analysis performed by outside laboratory. See attached report.
R	Preliminary result
S	Surrogate recovery outside of control limits
T	No correction for total solids
X	Elevated reporting limit due to matrix interference
Y	Elevated reporting limit due to high target concentration
b	Value detected less than reporting limit, but greater than MDL
e	Reported value estimated due to interference
j	Analyte also found in associated method blank
o	Associated EIS outside of control limits
p	Benzo(b)Fluoranthene and Benzo(k)Fluoranthene integrated as one peak.
q	Qualifier ion ratio outside of control limits
x	Preserved from bulk sample

Glossary of Abbreviations

Abbreviation	Description
RL/RDL	Reporting Limit
MDL	Method Detection Limit
MS	Matrix Spike
MSD	Matrix Spike Duplicate
SW	EPA SW 846 (Soil and Wastewater) Methods
E	EPA Methods
SM	Standard Methods
LN	Linear
BR	Branched



Analytical Laboratory Report

Method Summary

Method	Version
SM2540B	Standard Method 2540 B 2015
SW3050B	SW 846 Method 3050B Revision 2 December 1996
SW3546	SW 846 Method 3546 Revision 0 February 2007
SW5035A	SW 846 Method 5035A Revision 1 July 2002
SW5035A/8260C	SW 846 Method 8260C Revision 3 August 2006 / 5035A Revision 1 July 2002
SW6020A	SW 846 Method 6020A Revision 1 February 2007
SW7196A	SW 846 Method 7196A Revision 1 July 1992/SW 846 Method 3060A Revision 1 December 1996
SW7471B	SW 846 Method 7471B Revision 2 February 2007
SW8270D	SW 846 Method 8270D Revision 4 February 2007



Analytical Laboratory Report

Sample Summary (10 samples)

Sample ID	Sample Tag	Matrix	Collected Date/Time
S63724.01	G2-1	Soil	06/28/24 07:00
S63724.02	G2-2	Soil	06/28/24 08:00
S63724.03	G2-3	Soil	06/28/24 09:00
S63724.04	G2-4	Soil	06/28/24 10:00
S63724.05	G2-5	Soil	06/28/24 11:00
S63724.06	G2-6	Soil	06/28/24 12:00
S63724.07	G2-7	Soil	06/28/24 13:00
S63724.08	G2-8	Soil	06/28/24 14:00
S63724.09	G2-9	Soil	06/28/24 15:00
S63724.10	G2-10	Soil	06/28/24 16:00



Analytical Laboratory Report

Lab Sample ID: S63724.01

Sample Tag: G2-1

Collected Date/Time: 06/28/2024 07:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	7.995/10	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	86	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:59, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	5,600		ug/kg	557	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 12:41, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	2,700	200		ug/kg	248	7440-38-2	
Barium	33,700	1,000		ug/kg	248	7440-39-3	
Cadmium	250	200		ug/kg	248	7440-43-9	
Chromium	6,920	500		ug/kg	248	7440-47-3	
Lead	3,400	300		ug/kg	248	7439-92-1	
Selenium	Not detected	400		ug/kg	248	7782-49-2	
Silver	Not detected	200		ug/kg	248	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:15, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	67	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 22:59, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	



Analytical Laboratory Report

Lab Sample ID: S63724.01 (continued)

Sample Tag: G2-1

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 22:59, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 20:27, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	300		ug/kg	80.9	60-29-7	
Acetone	Not detected	2,000		ug/kg	80.9	67-64-1	
Methyl iodide	Not detected	200		ug/kg	80.9	74-88-4	
Carbon disulfide	Not detected	400		ug/kg	80.9	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	300		ug/kg	80.9	1634-04-4	
Acrylonitrile	Not detected	200		ug/kg	80.9	107-13-1	
2-Butanone (MEK)	Not detected	1,200		ug/kg	80.9	78-93-3	
Dichlorodifluoromethane	Not detected	400		ug/kg	80.9	75-71-8	
Chloromethane	Not detected	400		ug/kg	80.9	74-87-3	
Vinyl chloride	Not detected	80		ug/kg	80.9	75-01-4	
Bromomethane	Not detected	300		ug/kg	80.9	74-83-9	
Chloroethane	Not detected	400		ug/kg	80.9	75-00-3	
Trichlorofluoromethane	Not detected	200		ug/kg	80.9	75-69-4	
1,1-Dichloroethene	Not detected	80		ug/kg	80.9	75-35-4	
Methylene chloride	Not detected	200		ug/kg	80.9	75-09-2	
trans-1,2-Dichloroethene	Not detected	80		ug/kg	80.9	156-60-5	
1,1-Dichloroethane	Not detected	80		ug/kg	80.9	75-34-3	
cis-1,2-Dichloroethene	Not detected	80		ug/kg	80.9	156-59-2	
Tetrahydrofuran*	Not detected	2,000		ug/kg	80.9	109-99-9	
Chloroform	Not detected	80		ug/kg	80.9	67-66-3	
Bromochloromethane	Not detected	200		ug/kg	80.9	74-97-5	
1,1,1-Trichloroethane	Not detected	80		ug/kg	80.9	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	4,000		ug/kg	80.9	108-10-1	
2-Hexanone	Not detected	4,000		ug/kg	80.9	591-78-6	
Carbon tetrachloride	Not detected	80		ug/kg	80.9	56-23-5	
Benzene	Not detected	80		ug/kg	80.9	71-43-2	
1,2-Dichloroethane	Not detected	80		ug/kg	80.9	107-06-2	
Trichloroethene	Not detected	80		ug/kg	80.9	79-01-6	
1,2-Dichloropropane	Not detected	80		ug/kg	80.9	78-87-5	
Bromodichloromethane	Not detected	200		ug/kg	80.9	75-27-4	
Dibromomethane	Not detected	400		ug/kg	80.9	74-95-3	
cis-1,3-Dichloropropene	Not detected	80		ug/kg	80.9	10061-01-5	
Toluene	Not detected	80		ug/kg	80.9	108-88-3	
trans-1,3-Dichloropropene	Not detected	80		ug/kg	80.9	10061-02-6	
1,1,2-Trichloroethane	Not detected	80		ug/kg	80.9	79-00-5	
Tetrachloroethene	Not detected	80		ug/kg	80.9	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	80		ug/kg	80.9	110-57-6	
Dibromochloromethane	Not detected	200		ug/kg	80.9	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.01 (continued)

Sample Tag: G2-1

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 20:27, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	30		ug/kg	80.9	106-93-4	M
Chlorobenzene	Not detected	80		ug/kg	80.9	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	200		ug/kg	80.9	630-20-6	
Ethylbenzene	Not detected	80		ug/kg	80.9	100-41-4	
p,m-Xylene	Not detected	200		ug/kg	80.9		
o-Xylene	Not detected	80		ug/kg	80.9	95-47-6	
Styrene	Not detected	80		ug/kg	80.9	100-42-5	
Isopropylbenzene	Not detected	400		ug/kg	80.9	98-82-8	
Bromoform	Not detected	200		ug/kg	80.9	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	80		ug/kg	80.9	79-34-5	
1,2,3-Trichloropropane	Not detected	200		ug/kg	80.9	96-18-4	
n-Propylbenzene	Not detected	80		ug/kg	80.9	103-65-1	
Bromobenzene	Not detected	200		ug/kg	80.9	108-86-1	
1,3,5-Trimethylbenzene	Not detected	80		ug/kg	80.9	108-67-8	
tert-Butylbenzene	Not detected	80		ug/kg	80.9	98-06-6	
1,2,4-Trimethylbenzene	Not detected	80		ug/kg	80.9	95-63-6	
sec-Butylbenzene	Not detected	80		ug/kg	80.9	135-98-8	
p-Isopropyltoluene	Not detected	200		ug/kg	80.9	99-87-6	
1,3-Dichlorobenzene	Not detected	200		ug/kg	80.9	541-73-1	
1,4-Dichlorobenzene	Not detected	200		ug/kg	80.9	106-46-7	
1,2-Dichlorobenzene	Not detected	200		ug/kg	80.9	95-50-1	
1,2,3-Trimethylbenzene	Not detected	80		ug/kg	80.9	526-73-8	
n-Butylbenzene	Not detected	80		ug/kg	80.9	104-51-8	
Hexachloroethane	Not detected	500		ug/kg	80.9	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	400		ug/kg	80.9	96-12-8	
1,2,4-Trichlorobenzene	Not detected	530		ug/kg	80.9	120-82-1	
1,2,3-Trichlorobenzene	Not detected	530		ug/kg	80.9	87-61-6	
Naphthalene	Not detected	400		ug/kg	80.9	91-20-3	
2-Methylnaphthalene	Not detected	200		ug/kg	80.9	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.02

Sample Tag: G2-2

Collected Date/Time: 06/28/2024 08:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	8.894/10	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	88	1		%	1		

Method: SW7196A, Run Date: 07/12/24 12:38, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,100		ug/kg	112	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 12:44, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	5,730	200		ug/kg	247	7440-38-2	
Barium	50,500	1,000		ug/kg	247	7440-39-3	
Cadmium	300	200		ug/kg	247	7440-43-9	
Chromium	14,100	500		ug/kg	247	7440-47-3	
Lead	17,500	300		ug/kg	247	7439-92-1	
Selenium	Not detected	400		ug/kg	247	7782-49-2	
Silver	Not detected	200		ug/kg	247	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:25, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	62	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:16, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.02 (continued)

Sample Tag: G2-2

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:16, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 20:51, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	300		ug/kg	70.7	60-29-7	
Acetone	Not detected	1,000		ug/kg	70.7	67-64-1	
Methyl iodide	Not detected	100		ug/kg	70.7	74-88-4	
Carbon disulfide	Not detected	400		ug/kg	70.7	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	300		ug/kg	70.7	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	70.7	107-13-1	
2-Butanone (MEK)	Not detected	1,100		ug/kg	70.7	78-93-3	
Dichlorodifluoromethane	Not detected	400		ug/kg	70.7	75-71-8	
Chloromethane	Not detected	400		ug/kg	70.7	74-87-3	
Vinyl chloride	Not detected	70		ug/kg	70.7	75-01-4	
Bromomethane	Not detected	300		ug/kg	70.7	74-83-9	
Chloroethane	Not detected	400		ug/kg	70.7	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	70.7	75-69-4	
1,1-Dichloroethene	Not detected	70		ug/kg	70.7	75-35-4	
Methylene chloride	Not detected	100		ug/kg	70.7	75-09-2	
trans-1,2-Dichloroethene	Not detected	70		ug/kg	70.7	156-60-5	
1,1-Dichloroethane	Not detected	70		ug/kg	70.7	75-34-3	
cis-1,2-Dichloroethene	Not detected	70		ug/kg	70.7	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	70.7	109-99-9	
Chloroform	Not detected	70		ug/kg	70.7	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	70.7	74-97-5	
1,1,1-Trichloroethane	Not detected	70		ug/kg	70.7	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	4,000		ug/kg	70.7	108-10-1	
2-Hexanone	Not detected	4,000		ug/kg	70.7	591-78-6	
Carbon tetrachloride	Not detected	70		ug/kg	70.7	56-23-5	
Benzene	Not detected	70		ug/kg	70.7	71-43-2	
1,2-Dichloroethane	Not detected	70		ug/kg	70.7	107-06-2	
Trichloroethene	Not detected	70		ug/kg	70.7	79-01-6	
1,2-Dichloropropane	Not detected	70		ug/kg	70.7	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	70.7	75-27-4	
Dibromomethane	Not detected	400		ug/kg	70.7	74-95-3	
cis-1,3-Dichloropropene	Not detected	70		ug/kg	70.7	10061-01-5	
Toluene	Not detected	70		ug/kg	70.7	108-88-3	
trans-1,3-Dichloropropene	Not detected	70		ug/kg	70.7	10061-02-6	
1,1,2-Trichloroethane	Not detected	70		ug/kg	70.7	79-00-5	
Tetrachloroethene	Not detected	70		ug/kg	70.7	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	70		ug/kg	70.7	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	70.7	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.02 (continued)

Sample Tag: G2-2

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 20:51, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	30		ug/kg	70.7	106-93-4	M
Chlorobenzene	Not detected	70		ug/kg	70.7	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	70.7	630-20-6	
Ethylbenzene	Not detected	70		ug/kg	70.7	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	70.7		
o-Xylene	Not detected	70		ug/kg	70.7	95-47-6	
Styrene	Not detected	70		ug/kg	70.7	100-42-5	
Isopropylbenzene	Not detected	400		ug/kg	70.7	98-82-8	
Bromoform	Not detected	100		ug/kg	70.7	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	70		ug/kg	70.7	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	70.7	96-18-4	
n-Propylbenzene	Not detected	70		ug/kg	70.7	103-65-1	
Bromobenzene	Not detected	100		ug/kg	70.7	108-86-1	
1,3,5-Trimethylbenzene	Not detected	70		ug/kg	70.7	108-67-8	
tert-Butylbenzene	Not detected	70		ug/kg	70.7	98-06-6	
1,2,4-Trimethylbenzene	Not detected	70		ug/kg	70.7	95-63-6	
sec-Butylbenzene	Not detected	70		ug/kg	70.7	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	70.7	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	70.7	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	70.7	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	70.7	95-50-1	
1,2,3-Trimethylbenzene	Not detected	70		ug/kg	70.7	526-73-8	
n-Butylbenzene	Not detected	70		ug/kg	70.7	104-51-8	
Hexachloroethane	Not detected	400		ug/kg	70.7	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	400		ug/kg	70.7	96-12-8	
1,2,4-Trichlorobenzene	Not detected	470		ug/kg	70.7	120-82-1	
1,2,3-Trichlorobenzene	Not detected	470		ug/kg	70.7	87-61-6	
Naphthalene	Not detected	400		ug/kg	70.7	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	70.7	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.03
Sample Tag: G2-3
Collected Date/Time: 06/28/2024 09:00
Matrix: Soil
COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	11.658/11	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	94	1		%	1		

Method: SW7196A, Run Date: 07/12/24 12:45, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,100		ug/kg	106	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 12:46, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	4,790	200		ug/kg	222	7440-38-2	
Barium	49,200	1,000		ug/kg	222	7440-39-3	
Cadmium	250	200		ug/kg	222	7440-43-9	
Chromium	17,700	500		ug/kg	222	7440-47-3	
Lead	10,300	300		ug/kg	222	7439-92-1	
Selenium	Not detected	400		ug/kg	222	7782-49-2	
Silver	Not detected	200		ug/kg	222	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:28, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	60	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:33, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.03 (continued)

Sample Tag: G2-3

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:33, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 21:15, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	53.4	60-29-7	
Acetone	Not detected	1,000		ug/kg	53.4	67-64-1	
Methyl iodide	Not detected	100		ug/kg	53.4	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	53.4	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	53.4	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	53.4	107-13-1	
2-Butanone (MEK)	Not detected	800		ug/kg	53.4	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	53.4	75-71-8	
Chloromethane	Not detected	300		ug/kg	53.4	74-87-3	
Vinyl chloride	Not detected	50		ug/kg	53.4	75-01-4	
Bromomethane	Not detected	200		ug/kg	53.4	74-83-9	
Chloroethane	Not detected	300		ug/kg	53.4	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	53.4	75-69-4	
1,1-Dichloroethene	Not detected	50		ug/kg	53.4	75-35-4	
Methylene chloride	Not detected	100		ug/kg	53.4	75-09-2	
trans-1,2-Dichloroethene	Not detected	50		ug/kg	53.4	156-60-5	
1,1-Dichloroethane	Not detected	50		ug/kg	53.4	75-34-3	
cis-1,2-Dichloroethene	Not detected	50		ug/kg	53.4	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	53.4	109-99-9	
Chloroform	Not detected	50		ug/kg	53.4	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	53.4	74-97-5	
1,1,1-Trichloroethane	Not detected	50		ug/kg	53.4	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	53.4	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	53.4	591-78-6	
Carbon tetrachloride	Not detected	50		ug/kg	53.4	56-23-5	
Benzene	Not detected	50		ug/kg	53.4	71-43-2	
1,2-Dichloroethane	Not detected	50		ug/kg	53.4	107-06-2	
Trichloroethene	Not detected	50		ug/kg	53.4	79-01-6	
1,2-Dichloropropane	Not detected	50		ug/kg	53.4	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	53.4	75-27-4	
Dibromomethane	Not detected	300		ug/kg	53.4	74-95-3	
cis-1,3-Dichloropropene	Not detected	50		ug/kg	53.4	10061-01-5	
Toluene	Not detected	50		ug/kg	53.4	108-88-3	
trans-1,3-Dichloropropene	Not detected	50		ug/kg	53.4	10061-02-6	
1,1,2-Trichloroethane	Not detected	50		ug/kg	53.4	79-00-5	
Tetrachloroethene	Not detected	50		ug/kg	53.4	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	50		ug/kg	53.4	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	53.4	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.03 (continued)

Sample Tag: G2-3

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 21:15, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	53.4	106-93-4	M
Chlorobenzene	Not detected	50		ug/kg	53.4	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	53.4	630-20-6	
Ethylbenzene	Not detected	50		ug/kg	53.4	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	53.4		
o-Xylene	Not detected	50		ug/kg	53.4	95-47-6	
Styrene	Not detected	50		ug/kg	53.4	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	53.4	98-82-8	
Bromoform	Not detected	100		ug/kg	53.4	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	50		ug/kg	53.4	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	53.4	96-18-4	
n-Propylbenzene	Not detected	50		ug/kg	53.4	103-65-1	
Bromobenzene	Not detected	100		ug/kg	53.4	108-86-1	
1,3,5-Trimethylbenzene	Not detected	50		ug/kg	53.4	108-67-8	
tert-Butylbenzene	Not detected	50		ug/kg	53.4	98-06-6	
1,2,4-Trimethylbenzene	Not detected	50		ug/kg	53.4	95-63-6	
sec-Butylbenzene	Not detected	50		ug/kg	53.4	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	53.4	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	53.4	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	53.4	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	53.4	95-50-1	
1,2,3-Trimethylbenzene	Not detected	50		ug/kg	53.4	526-73-8	
n-Butylbenzene	Not detected	50		ug/kg	53.4	104-51-8	
Hexachloroethane	Not detected	300		ug/kg	53.4	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	53.4	96-12-8	
1,2,4-Trichlorobenzene	Not detected	350		ug/kg	53.4	120-82-1	
1,2,3-Trichlorobenzene	Not detected	350		ug/kg	53.4	87-61-6	
Naphthalene	Not detected	300		ug/kg	53.4	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	53.4	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.04
Sample Tag: G2-4
Collected Date/Time: 06/28/2024 10:00
Matrix: Soil
COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	12.065/12	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	91	1		%	1		

Method: SW7196A, Run Date: 07/12/24 13:49, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,000		ug/kg	104	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 12:49, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	7,200	200		ug/kg	237	7440-38-2	
Barium	54,900	1,000		ug/kg	237	7440-39-3	
Cadmium	1,080	200		ug/kg	237	7440-43-9	
Chromium	33,400	500		ug/kg	237	7440-47-3	
Lead	12,000	300		ug/kg	237	7439-92-1	
Selenium	Not detected	400		ug/kg	237	7782-49-2	
Silver	Not detected	200		ug/kg	237	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:32, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	62	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:50, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.04 (continued)

Sample Tag: G2-4

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/09/24 23:50, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 21:39, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	59.6	60-29-7	
Acetone	Not detected	1,000		ug/kg	59.6	67-64-1	
Methyl iodide	Not detected	100		ug/kg	59.6	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	59.6	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	59.6	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	59.6	107-13-1	
2-Butanone (MEK)	Not detected	890		ug/kg	59.6	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	59.6	75-71-8	
Chloromethane	Not detected	300		ug/kg	59.6	74-87-3	
Vinyl chloride	Not detected	60		ug/kg	59.6	75-01-4	
Bromomethane	Not detected	200		ug/kg	59.6	74-83-9	
Chloroethane	Not detected	300		ug/kg	59.6	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	59.6	75-69-4	
1,1-Dichloroethene	Not detected	60		ug/kg	59.6	75-35-4	
Methylene chloride	Not detected	100		ug/kg	59.6	75-09-2	
trans-1,2-Dichloroethene	Not detected	60		ug/kg	59.6	156-60-5	
1,1-Dichloroethane	Not detected	60		ug/kg	59.6	75-34-3	
cis-1,2-Dichloroethene	Not detected	60		ug/kg	59.6	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	59.6	109-99-9	
Chloroform	Not detected	60		ug/kg	59.6	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	59.6	74-97-5	
1,1,1-Trichloroethane	Not detected	60		ug/kg	59.6	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	59.6	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	59.6	591-78-6	
Carbon tetrachloride	Not detected	60		ug/kg	59.6	56-23-5	
Benzene	Not detected	60		ug/kg	59.6	71-43-2	
1,2-Dichloroethane	Not detected	60		ug/kg	59.6	107-06-2	
Trichloroethene	Not detected	60		ug/kg	59.6	79-01-6	
1,2-Dichloropropane	Not detected	60		ug/kg	59.6	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	59.6	75-27-4	
Dibromomethane	Not detected	300		ug/kg	59.6	74-95-3	
cis-1,3-Dichloropropene	Not detected	60		ug/kg	59.6	10061-01-5	
Toluene	Not detected	60		ug/kg	59.6	108-88-3	
trans-1,3-Dichloropropene	Not detected	60		ug/kg	59.6	10061-02-6	
1,1,2-Trichloroethane	Not detected	60		ug/kg	59.6	79-00-5	
Tetrachloroethene	Not detected	60		ug/kg	59.6	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	60		ug/kg	59.6	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	59.6	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.04 (continued)

Sample Tag: G2-4

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 21:39, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	59.6	106-93-4	M
Chlorobenzene	Not detected	60		ug/kg	59.6	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	59.6	630-20-6	
Ethylbenzene	Not detected	60		ug/kg	59.6	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	59.6		
o-Xylene	Not detected	60		ug/kg	59.6	95-47-6	
Styrene	Not detected	60		ug/kg	59.6	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	59.6	98-82-8	
Bromoform	Not detected	100		ug/kg	59.6	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	60		ug/kg	59.6	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	59.6	96-18-4	
n-Propylbenzene	Not detected	60		ug/kg	59.6	103-65-1	
Bromobenzene	Not detected	100		ug/kg	59.6	108-86-1	
1,3,5-Trimethylbenzene	Not detected	60		ug/kg	59.6	108-67-8	
tert-Butylbenzene	Not detected	60		ug/kg	59.6	98-06-6	
1,2,4-Trimethylbenzene	Not detected	60		ug/kg	59.6	95-63-6	
sec-Butylbenzene	Not detected	60		ug/kg	59.6	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	59.6	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	59.6	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	59.6	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	59.6	95-50-1	
1,2,3-Trimethylbenzene	Not detected	60		ug/kg	59.6	526-73-8	
n-Butylbenzene	Not detected	60		ug/kg	59.6	104-51-8	
Hexachloroethane	Not detected	400		ug/kg	59.6	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	59.6	96-12-8	
1,2,4-Trichlorobenzene	Not detected	390		ug/kg	59.6	120-82-1	
1,2,3-Trichlorobenzene	Not detected	390		ug/kg	59.6	87-61-6	
Naphthalene	Not detected	300		ug/kg	59.6	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	59.6	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.05
Sample Tag: G2-5
Collected Date/Time: 06/28/2024 11:00
Matrix: Soil
COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	16.899/16	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	88	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:03, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,200		ug/kg	116	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:06, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	5,600	200		ug/kg	242	7440-38-2	
Barium	56,100	1,000		ug/kg	242	7440-39-3	
Cadmium	490	200		ug/kg	242	7440-43-9	
Chromium	24,200	500		ug/kg	242	7440-47-3	
Lead	17,600	300		ug/kg	242	7439-92-1	
Selenium	Not detected	400		ug/kg	242	7782-49-2	
Silver	620	200		ug/kg	242	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:35, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	62	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 03:31, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.05 (continued)

Sample Tag: G2-5

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 03:31, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 17:15, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	60.6	60-29-7	
Acetone	Not detected	1,000		ug/kg	60.6	67-64-1	
Methyl iodide	Not detected	100		ug/kg	60.6	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	60.6	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	60.6	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	60.6	107-13-1	
2-Butanone (MEK)	Not detected	910		ug/kg	60.6	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	60.6	75-71-8	
Chloromethane	Not detected	300		ug/kg	60.6	74-87-3	
Vinyl chloride	Not detected	60		ug/kg	60.6	75-01-4	
Bromomethane	Not detected	200		ug/kg	60.6	74-83-9	
Chloroethane	Not detected	300		ug/kg	60.6	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	60.6	75-69-4	
1,1-Dichloroethene	Not detected	60		ug/kg	60.6	75-35-4	
Methylene chloride	Not detected	100		ug/kg	60.6	75-09-2	
trans-1,2-Dichloroethene	Not detected	60		ug/kg	60.6	156-60-5	
1,1-Dichloroethane	Not detected	60		ug/kg	60.6	75-34-3	
cis-1,2-Dichloroethene	Not detected	60		ug/kg	60.6	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	60.6	109-99-9	
Chloroform	Not detected	60		ug/kg	60.6	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	60.6	74-97-5	
1,1,1-Trichloroethane	Not detected	60		ug/kg	60.6	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	60.6	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	60.6	591-78-6	
Carbon tetrachloride	Not detected	60		ug/kg	60.6	56-23-5	
Benzene	Not detected	60		ug/kg	60.6	71-43-2	
1,2-Dichloroethane	Not detected	60		ug/kg	60.6	107-06-2	
Trichloroethene	Not detected	60		ug/kg	60.6	79-01-6	
1,2-Dichloropropane	Not detected	60		ug/kg	60.6	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	60.6	75-27-4	
Dibromomethane	Not detected	300		ug/kg	60.6	74-95-3	
cis-1,3-Dichloropropene	Not detected	60		ug/kg	60.6	10061-01-5	
Toluene	Not detected	60		ug/kg	60.6	108-88-3	
trans-1,3-Dichloropropene	Not detected	60		ug/kg	60.6	10061-02-6	
1,1,2-Trichloroethane	Not detected	60		ug/kg	60.6	79-00-5	
Tetrachloroethene	Not detected	60		ug/kg	60.6	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	60		ug/kg	60.6	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	60.6	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.05 (continued)
Sample Tag: G2-5

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 17:15, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	60.6	106-93-4	M
Chlorobenzene	Not detected	60		ug/kg	60.6	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	60.6	630-20-6	
Ethylbenzene	Not detected	60		ug/kg	60.6	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	60.6		
o-Xylene	Not detected	60		ug/kg	60.6	95-47-6	
Styrene	Not detected	60		ug/kg	60.6	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	60.6	98-82-8	
Bromoform	Not detected	100		ug/kg	60.6	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	60		ug/kg	60.6	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	60.6	96-18-4	
n-Propylbenzene	Not detected	60		ug/kg	60.6	103-65-1	
Bromobenzene	Not detected	100		ug/kg	60.6	108-86-1	
1,3,5-Trimethylbenzene	Not detected	60		ug/kg	60.6	108-67-8	
tert-Butylbenzene	Not detected	60		ug/kg	60.6	98-06-6	
1,2,4-Trimethylbenzene	Not detected	60		ug/kg	60.6	95-63-6	
sec-Butylbenzene	Not detected	60		ug/kg	60.6	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	60.6	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	60.6	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	60.6	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	60.6	95-50-1	
1,2,3-Trimethylbenzene	Not detected	60		ug/kg	60.6	526-73-8	
n-Butylbenzene	Not detected	60		ug/kg	60.6	104-51-8	
Hexachloroethane	Not detected	400		ug/kg	60.6	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	60.6	96-12-8	
1,2,4-Trichlorobenzene	Not detected	400		ug/kg	60.6	120-82-1	
1,2,3-Trichlorobenzene	Not detected	400		ug/kg	60.6	87-61-6	
Naphthalene	Not detected	300		ug/kg	60.6	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	60.6	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.06

Sample Tag: G2-6

Collected Date/Time: 06/28/2024 12:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	14.985/14	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	91	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:10, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,100		ug/kg	111	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:08, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	6,480	200		ug/kg	235	7440-38-2	
Barium	40,900	1,000		ug/kg	235	7440-39-3	
Cadmium	370	200		ug/kg	235	7440-43-9	
Chromium	18,500	500		ug/kg	235	7440-47-3	
Lead	17,300	300		ug/kg	235	7439-92-1	
Selenium	Not detected	400		ug/kg	235	7782-49-2	
Silver	Not detected	200		ug/kg	235	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:38, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	59	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 03:49, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.06 (continued)

Sample Tag: G2-6

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 03:49, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 17:38, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	56.3	60-29-7	
Acetone	Not detected	1,000		ug/kg	56.3	67-64-1	
Methyl iodide	Not detected	100		ug/kg	56.3	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	56.3	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	56.3	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	56.3	107-13-1	
2-Butanone (MEK)	Not detected	840		ug/kg	56.3	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	56.3	75-71-8	
Chloromethane	Not detected	300		ug/kg	56.3	74-87-3	
Vinyl chloride	Not detected	60		ug/kg	56.3	75-01-4	
Bromomethane	Not detected	200		ug/kg	56.3	74-83-9	
Chloroethane	Not detected	300		ug/kg	56.3	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	56.3	75-69-4	
1,1-Dichloroethene	Not detected	60		ug/kg	56.3	75-35-4	
Methylene chloride	Not detected	100		ug/kg	56.3	75-09-2	
trans-1,2-Dichloroethene	Not detected	60		ug/kg	56.3	156-60-5	
1,1-Dichloroethane	Not detected	60		ug/kg	56.3	75-34-3	
cis-1,2-Dichloroethene	Not detected	60		ug/kg	56.3	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	56.3	109-99-9	
Chloroform	Not detected	60		ug/kg	56.3	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	56.3	74-97-5	
1,1,1-Trichloroethane	Not detected	60		ug/kg	56.3	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	56.3	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	56.3	591-78-6	
Carbon tetrachloride	Not detected	60		ug/kg	56.3	56-23-5	
Benzene	Not detected	60		ug/kg	56.3	71-43-2	
1,2-Dichloroethane	Not detected	60		ug/kg	56.3	107-06-2	
Trichloroethene	Not detected	60		ug/kg	56.3	79-01-6	
1,2-Dichloropropane	Not detected	60		ug/kg	56.3	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	56.3	75-27-4	
Dibromomethane	Not detected	300		ug/kg	56.3	74-95-3	
cis-1,3-Dichloropropene	Not detected	60		ug/kg	56.3	10061-01-5	
Toluene	Not detected	60		ug/kg	56.3	108-88-3	
trans-1,3-Dichloropropene	Not detected	60		ug/kg	56.3	10061-02-6	
1,1,2-Trichloroethane	Not detected	60		ug/kg	56.3	79-00-5	
Tetrachloroethene	Not detected	60		ug/kg	56.3	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	60		ug/kg	56.3	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	56.3	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.06 (continued)

Sample Tag: G2-6

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 17:38, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	56.3	106-93-4	M
Chlorobenzene	Not detected	60		ug/kg	56.3	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	56.3	630-20-6	
Ethylbenzene	Not detected	60		ug/kg	56.3	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	56.3		
o-Xylene	Not detected	60		ug/kg	56.3	95-47-6	
Styrene	Not detected	60		ug/kg	56.3	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	56.3	98-82-8	
Bromoform	Not detected	100		ug/kg	56.3	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	60		ug/kg	56.3	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	56.3	96-18-4	
n-Propylbenzene	Not detected	60		ug/kg	56.3	103-65-1	
Bromobenzene	Not detected	100		ug/kg	56.3	108-86-1	
1,3,5-Trimethylbenzene	Not detected	60		ug/kg	56.3	108-67-8	
tert-Butylbenzene	Not detected	60		ug/kg	56.3	98-06-6	
1,2,4-Trimethylbenzene	Not detected	60		ug/kg	56.3	95-63-6	
sec-Butylbenzene	Not detected	60		ug/kg	56.3	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	56.3	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	56.3	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	56.3	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	56.3	95-50-1	
1,2,3-Trimethylbenzene	Not detected	60		ug/kg	56.3	526-73-8	
n-Butylbenzene	Not detected	60		ug/kg	56.3	104-51-8	
Hexachloroethane	Not detected	300		ug/kg	56.3	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	56.3	96-12-8	
1,2,4-Trichlorobenzene	Not detected	370		ug/kg	56.3	120-82-1	
1,2,3-Trichlorobenzene	Not detected	370		ug/kg	56.3	87-61-6	
Naphthalene	Not detected	300		ug/kg	56.3	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	56.3	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.07

Sample Tag: G2-7

Collected Date/Time: 06/28/2024 13:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	12.974/12	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	94	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:18, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,000		ug/kg	106	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:11, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	4,410	200		ug/kg	222	7440-38-2	
Barium	26,600	1,000		ug/kg	222	7440-39-3	
Cadmium	Not detected	200		ug/kg	222	7440-43-9	
Chromium	8,430	500		ug/kg	222	7440-47-3	
Lead	12,600	300		ug/kg	222	7439-92-1	
Selenium	Not detected	400		ug/kg	222	7782-49-2	
Silver	Not detected	200		ug/kg	222	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:41, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	56	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 00:07, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.07 (continued)

Sample Tag: G2-7

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 00:07, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:02, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	52.4	60-29-7	
Acetone	Not detected	1,000		ug/kg	52.4	67-64-1	
Methyl iodide	Not detected	100		ug/kg	52.4	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	52.4	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	52.4	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	52.4	107-13-1	
2-Butanone (MEK)	Not detected	790		ug/kg	52.4	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	52.4	75-71-8	
Chloromethane	Not detected	300		ug/kg	52.4	74-87-3	
Vinyl chloride	Not detected	50		ug/kg	52.4	75-01-4	
Bromomethane	Not detected	200		ug/kg	52.4	74-83-9	
Chloroethane	Not detected	300		ug/kg	52.4	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	52.4	75-69-4	
1,1-Dichloroethene	Not detected	50		ug/kg	52.4	75-35-4	
Methylene chloride	Not detected	100		ug/kg	52.4	75-09-2	
trans-1,2-Dichloroethene	Not detected	50		ug/kg	52.4	156-60-5	
1,1-Dichloroethane	Not detected	50		ug/kg	52.4	75-34-3	
cis-1,2-Dichloroethene	Not detected	50		ug/kg	52.4	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	52.4	109-99-9	
Chloroform	Not detected	50		ug/kg	52.4	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	52.4	74-97-5	
1,1,1-Trichloroethane	Not detected	50		ug/kg	52.4	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	52.4	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	52.4	591-78-6	
Carbon tetrachloride	Not detected	50		ug/kg	52.4	56-23-5	
Benzene	Not detected	50		ug/kg	52.4	71-43-2	
1,2-Dichloroethane	Not detected	50		ug/kg	52.4	107-06-2	
Trichloroethene	Not detected	50		ug/kg	52.4	79-01-6	
1,2-Dichloropropane	Not detected	50		ug/kg	52.4	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	52.4	75-27-4	
Dibromomethane	Not detected	300		ug/kg	52.4	74-95-3	
cis-1,3-Dichloropropene	Not detected	50		ug/kg	52.4	10061-01-5	
Toluene	Not detected	50		ug/kg	52.4	108-88-3	
trans-1,3-Dichloropropene	Not detected	50		ug/kg	52.4	10061-02-6	
1,1,2-Trichloroethane	Not detected	50		ug/kg	52.4	79-00-5	
Tetrachloroethene	Not detected	50		ug/kg	52.4	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	50		ug/kg	52.4	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	52.4	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.07 (continued)

Sample Tag: G2-7

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:02, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	52.4	106-93-4	M
Chlorobenzene	Not detected	50		ug/kg	52.4	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	52.4	630-20-6	
Ethylbenzene	Not detected	50		ug/kg	52.4	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	52.4		
o-Xylene	Not detected	50		ug/kg	52.4	95-47-6	
Styrene	Not detected	50		ug/kg	52.4	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	52.4	98-82-8	
Bromoform	Not detected	100		ug/kg	52.4	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	50		ug/kg	52.4	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	52.4	96-18-4	
n-Propylbenzene	Not detected	50		ug/kg	52.4	103-65-1	
Bromobenzene	Not detected	100		ug/kg	52.4	108-86-1	
1,3,5-Trimethylbenzene	Not detected	50		ug/kg	52.4	108-67-8	
tert-Butylbenzene	Not detected	50		ug/kg	52.4	98-06-6	
1,2,4-Trimethylbenzene	Not detected	50		ug/kg	52.4	95-63-6	
sec-Butylbenzene	Not detected	50		ug/kg	52.4	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	52.4	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	52.4	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	52.4	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	52.4	95-50-1	
1,2,3-Trimethylbenzene	Not detected	50		ug/kg	52.4	526-73-8	
n-Butylbenzene	Not detected	50		ug/kg	52.4	104-51-8	
Hexachloroethane	Not detected	300		ug/kg	52.4	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	52.4	96-12-8	
1,2,4-Trichlorobenzene	Not detected	350		ug/kg	52.4	120-82-1	
1,2,3-Trichlorobenzene	Not detected	350		ug/kg	52.4	87-61-6	
Naphthalene	Not detected	300		ug/kg	52.4	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	52.4	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.08

Sample Tag: G2-8

Collected Date/Time: 06/28/2024 14:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 10:45	JWR	
Sample wt. (g) / Methanol (ml)*	11.729/11	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	94	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:43, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,000		ug/kg	103	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:13, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	3,890	200		ug/kg	226	7440-38-2	
Barium	15,300	1,000		ug/kg	226	7440-39-3	
Cadmium	Not detected	200		ug/kg	226	7440-43-9	
Chromium	4,510	500		ug/kg	226	7440-47-3	
Lead	5,400	300		ug/kg	226	7439-92-1	
Selenium	Not detected	400		ug/kg	226	7782-49-2	
Silver	Not detected	200		ug/kg	226	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:51, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	58	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 00:24, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.08 (continued)

Sample Tag: G2-8

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 00:24, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:26, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	53.1	60-29-7	
Acetone	Not detected	1,000		ug/kg	53.1	67-64-1	
Methyl iodide	Not detected	100		ug/kg	53.1	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	53.1	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	53.1	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	53.1	107-13-1	
2-Butanone (MEK)	Not detected	800		ug/kg	53.1	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	53.1	75-71-8	
Chloromethane	Not detected	300		ug/kg	53.1	74-87-3	
Vinyl chloride	Not detected	50		ug/kg	53.1	75-01-4	
Bromomethane	Not detected	200		ug/kg	53.1	74-83-9	
Chloroethane	Not detected	300		ug/kg	53.1	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	53.1	75-69-4	
1,1-Dichloroethene	Not detected	50		ug/kg	53.1	75-35-4	
Methylene chloride	Not detected	100		ug/kg	53.1	75-09-2	
trans-1,2-Dichloroethene	Not detected	50		ug/kg	53.1	156-60-5	
1,1-Dichloroethane	Not detected	50		ug/kg	53.1	75-34-3	
cis-1,2-Dichloroethene	Not detected	50		ug/kg	53.1	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	53.1	109-99-9	
Chloroform	Not detected	50		ug/kg	53.1	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	53.1	74-97-5	
1,1,1-Trichloroethane	Not detected	50		ug/kg	53.1	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	53.1	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	53.1	591-78-6	
Carbon tetrachloride	Not detected	50		ug/kg	53.1	56-23-5	
Benzene	Not detected	50		ug/kg	53.1	71-43-2	
1,2-Dichloroethane	Not detected	50		ug/kg	53.1	107-06-2	
Trichloroethene	Not detected	50		ug/kg	53.1	79-01-6	
1,2-Dichloropropane	Not detected	50		ug/kg	53.1	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	53.1	75-27-4	
Dibromomethane	Not detected	300		ug/kg	53.1	74-95-3	
cis-1,3-Dichloropropene	Not detected	50		ug/kg	53.1	10061-01-5	
Toluene	Not detected	50		ug/kg	53.1	108-88-3	
trans-1,3-Dichloropropene	Not detected	50		ug/kg	53.1	10061-02-6	
1,1,2-Trichloroethane	Not detected	50		ug/kg	53.1	79-00-5	
Tetrachloroethene	Not detected	50		ug/kg	53.1	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	50		ug/kg	53.1	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	53.1	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.08 (continued)

Sample Tag: G2-8

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:26, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	53.1	106-93-4	M
Chlorobenzene	Not detected	50		ug/kg	53.1	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	53.1	630-20-6	
Ethylbenzene	Not detected	50		ug/kg	53.1	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	53.1		
o-Xylene	Not detected	50		ug/kg	53.1	95-47-6	
Styrene	Not detected	50		ug/kg	53.1	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	53.1	98-82-8	
Bromoform	Not detected	100		ug/kg	53.1	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	50		ug/kg	53.1	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	53.1	96-18-4	
n-Propylbenzene	Not detected	50		ug/kg	53.1	103-65-1	
Bromobenzene	Not detected	100		ug/kg	53.1	108-86-1	
1,3,5-Trimethylbenzene	Not detected	50		ug/kg	53.1	108-67-8	
tert-Butylbenzene	Not detected	50		ug/kg	53.1	98-06-6	
1,2,4-Trimethylbenzene	Not detected	50		ug/kg	53.1	95-63-6	
sec-Butylbenzene	Not detected	50		ug/kg	53.1	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	53.1	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	53.1	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	53.1	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	53.1	95-50-1	
1,2,3-Trimethylbenzene	Not detected	50		ug/kg	53.1	526-73-8	
n-Butylbenzene	Not detected	50		ug/kg	53.1	104-51-8	
Hexachloroethane	Not detected	300		ug/kg	53.1	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	53.1	96-12-8	
1,2,4-Trichlorobenzene	Not detected	350		ug/kg	53.1	120-82-1	
1,2,3-Trichlorobenzene	Not detected	350		ug/kg	53.1	87-61-6	
Naphthalene	Not detected	300		ug/kg	53.1	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	53.1	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.09

Sample Tag: G2-9

Collected Date/Time: 06/28/2024 15:00

Matrix: Soil

COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 15:00	DJS	
Sample wt. (g) / Methanol (ml)*	7.995/10	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	80	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:48, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,200		ug/kg	123	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:16, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	11,700	200		ug/kg	268	7440-38-2	
Barium	34,200	1,000		ug/kg	268	7440-39-3	
Cadmium	Not detected	200		ug/kg	268	7440-43-9	
Chromium	7,790	500		ug/kg	268	7440-47-3	
Lead	6,740	300		ug/kg	268	7439-92-1	
Selenium	Not detected	400		ug/kg	268	7782-49-2	
Silver	Not detected	200		ug/kg	268	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:55, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	68	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 17:55, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	



Analytical Laboratory Report

Lab Sample ID: S63724.09 (continued)

Sample Tag: G2-9

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 17:55, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:50, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	400		ug/kg	90.7	60-29-7	
Acetone	Not detected	2,000		ug/kg	90.7	67-64-1	
Methyl iodide	Not detected	200		ug/kg	90.7	74-88-4	
Carbon disulfide	Not detected	500		ug/kg	90.7	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	400		ug/kg	90.7	1634-04-4	
Acrylonitrile	Not detected	200		ug/kg	90.7	107-13-1	
2-Butanone (MEK)	Not detected	1,400		ug/kg	90.7	78-93-3	
Dichlorodifluoromethane	Not detected	500		ug/kg	90.7	75-71-8	
Chloromethane	Not detected	500		ug/kg	90.7	74-87-3	
Vinyl chloride	Not detected	90		ug/kg	90.7	75-01-4	
Bromomethane	Not detected	400		ug/kg	90.7	74-83-9	
Chloroethane	Not detected	500		ug/kg	90.7	75-00-3	
Trichlorofluoromethane	Not detected	200		ug/kg	90.7	75-69-4	
1,1-Dichloroethene	Not detected	90		ug/kg	90.7	75-35-4	
Methylene chloride	Not detected	200		ug/kg	90.7	75-09-2	
trans-1,2-Dichloroethene	Not detected	90		ug/kg	90.7	156-60-5	
1,1-Dichloroethane	Not detected	90		ug/kg	90.7	75-34-3	
cis-1,2-Dichloroethene	Not detected	90		ug/kg	90.7	156-59-2	
Tetrahydrofuran*	Not detected	2,000		ug/kg	90.7	109-99-9	
Chloroform	Not detected	90		ug/kg	90.7	67-66-3	
Bromochloromethane	Not detected	200		ug/kg	90.7	74-97-5	
1,1,1-Trichloroethane	Not detected	90		ug/kg	90.7	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	5,000		ug/kg	90.7	108-10-1	
2-Hexanone	Not detected	5,000		ug/kg	90.7	591-78-6	
Carbon tetrachloride	Not detected	90		ug/kg	90.7	56-23-5	
Benzene	Not detected	90		ug/kg	90.7	71-43-2	
1,2-Dichloroethane	Not detected	90		ug/kg	90.7	107-06-2	
Trichloroethene	Not detected	90		ug/kg	90.7	79-01-6	
1,2-Dichloropropane	Not detected	90		ug/kg	90.7	78-87-5	
Bromodichloromethane	Not detected	200		ug/kg	90.7	75-27-4	
Dibromomethane	Not detected	500		ug/kg	90.7	74-95-3	
cis-1,3-Dichloropropene	Not detected	90		ug/kg	90.7	10061-01-5	
Toluene	Not detected	90		ug/kg	90.7	108-88-3	
trans-1,3-Dichloropropene	Not detected	90		ug/kg	90.7	10061-02-6	
1,1,2-Trichloroethane	Not detected	90		ug/kg	90.7	79-00-5	
Tetrachloroethene	Not detected	90		ug/kg	90.7	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	90		ug/kg	90.7	110-57-6	
Dibromochloromethane	Not detected	200		ug/kg	90.7	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.09 (continued)

Sample Tag: G2-9

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 18:50, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	40		ug/kg	90.7	106-93-4	M
Chlorobenzene	Not detected	90		ug/kg	90.7	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	200		ug/kg	90.7	630-20-6	
Ethylbenzene	Not detected	90		ug/kg	90.7	100-41-4	
p,m-Xylene	Not detected	200		ug/kg	90.7		
o-Xylene	Not detected	90		ug/kg	90.7	95-47-6	
Styrene	Not detected	90		ug/kg	90.7	100-42-5	
Isopropylbenzene	Not detected	500		ug/kg	90.7	98-82-8	
Bromoform	Not detected	200		ug/kg	90.7	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	90		ug/kg	90.7	79-34-5	
1,2,3-Trichloropropane	Not detected	200		ug/kg	90.7	96-18-4	
n-Propylbenzene	Not detected	90		ug/kg	90.7	103-65-1	
Bromobenzene	Not detected	200		ug/kg	90.7	108-86-1	
1,3,5-Trimethylbenzene	Not detected	90		ug/kg	90.7	108-67-8	
tert-Butylbenzene	Not detected	90		ug/kg	90.7	98-06-6	
1,2,4-Trimethylbenzene	Not detected	90		ug/kg	90.7	95-63-6	
sec-Butylbenzene	Not detected	90		ug/kg	90.7	135-98-8	
p-Isopropyltoluene	Not detected	200		ug/kg	90.7	99-87-6	
1,3-Dichlorobenzene	Not detected	200		ug/kg	90.7	541-73-1	
1,4-Dichlorobenzene	Not detected	200		ug/kg	90.7	106-46-7	
1,2-Dichlorobenzene	Not detected	200		ug/kg	90.7	95-50-1	
1,2,3-Trimethylbenzene	Not detected	90		ug/kg	90.7	526-73-8	
n-Butylbenzene	Not detected	90		ug/kg	90.7	104-51-8	
Hexachloroethane	Not detected	500		ug/kg	90.7	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	500		ug/kg	90.7	96-12-8	
1,2,4-Trichlorobenzene	Not detected	600		ug/kg	90.7	120-82-1	
1,2,3-Trichlorobenzene	Not detected	600		ug/kg	90.7	87-61-6	
Naphthalene	Not detected	500		ug/kg	90.7	91-20-3	
2-Methylnaphthalene	Not detected	200		ug/kg	90.7	91-57-6	

M-Result reported to MDL not RDL



Analytical Laboratory Report

Lab Sample ID: S63724.10
Sample Tag: G2-10
Collected Date/Time: 06/28/2024 16:00
Matrix: Soil
COC Reference: 171795

Sample Containers

#	Type	Preservative(s)	Refrigerated?	Arrival Temp. (C)	Thermometer #
1	4oz Glass	None	Yes	2.6	IR
1	40mL Glass	MeOH	Yes	2.6	IR

Extraction / Prep.

Parameter	Result	Method	Run Date	Analyst	Flags
Metal Digestion	Completed	SW3050B	07/09/24 11:40	JRH	
PNA Extraction*	Completed	SW3546	07/09/24 15:00	DJS	
Sample wt. (g) / Methanol (ml)*	17.151/17	SW5035A	07/02/24 14:23	NDK	
Mercury Digestion	Completed	SW7471B	07/02/24 11:58	CTV	

Inorganics

Method: SM2540B, Run Date: 07/02/24 13:23, Analyst: MAM

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Total Solids*	92	1		%	1		

Method: SW7196A, Run Date: 07/12/24 14:53, Analyst: MDG

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Chromium VI	Not detected	1,100		ug/kg	111	18540-29-9	

Metals

Method: SW6020A, Run Date: 07/09/24 13:19, Analyst: JRH

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Arsenic	4,460	200		ug/kg	236	7440-38-2	
Barium	42,000	1,000		ug/kg	236	7440-39-3	
Cadmium	210	200		ug/kg	236	7440-43-9	
Chromium	17,100	500		ug/kg	236	7440-47-3	
Lead	13,500	300		ug/kg	236	7439-92-1	
Selenium	Not detected	400		ug/kg	236	7782-49-2	
Silver	Not detected	200		ug/kg	236	7440-22-4	

Method: SW7471B, Run Date: 07/02/24 15:58, Analyst: CTV

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Mercury	Not detected	50		ug/kg	60	7439-97-6	

Organics - Semi-Volatiles

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 18:12, Analyst: PL

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Acenaphthene	Not detected	300		ug/kg	10	83-32-9	
Acenaphthylene	Not detected	300		ug/kg	10	208-96-8	
Anthracene	Not detected	300		ug/kg	10	120-12-7	
Benzo(a)anthracene	Not detected	300		ug/kg	10	56-55-3	
Benzo(a)pyrene	Not detected	300		ug/kg	10	50-32-8	
Benzo(b)fluoranthene	Not detected	300		ug/kg	10	205-99-2	
Benzo(k)fluoranthene	Not detected	300		ug/kg	10	207-08-9	
Benzo(ghi)perylene	Not detected	300		ug/kg	10	191-24-2	
Chrysene	Not detected	300		ug/kg	10	218-01-9	

Lab Sample ID: S63724.10 (continued)

Sample Tag: G2-10

Polynuclear Aromatics, Method: SW8270D, Run Date: 07/10/24 18:12, Analyst: PL (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Dibenzo(ah)anthracene	Not detected	300		ug/kg	10	53-70-3	
Fluoranthene	Not detected	300		ug/kg	10	206-44-0	
Fluorene	Not detected	300		ug/kg	10	86-73-7	
Indeno(1,2,3-cd)pyrene	Not detected	300		ug/kg	10	193-39-5	
Naphthalene	Not detected	300		ug/kg	10	91-20-3	
Phenanthrene	Not detected	300		ug/kg	10	85-01-8	
Pyrene	Not detected	300		ug/kg	10	129-00-0	
2-Methylnaphthalene	Not detected	300		ug/kg	10	91-57-6	

Organics - Volatiles

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 19:14, Analyst: ACK

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
Diethyl ether	Not detected	200		ug/kg	58.2	60-29-7	
Acetone	Not detected	1,000		ug/kg	58.2	67-64-1	
Methyl iodide	Not detected	100		ug/kg	58.2	74-88-4	
Carbon disulfide	Not detected	300		ug/kg	58.2	75-15-0	
tert-Methyl butyl ether (MTBE)	Not detected	200		ug/kg	58.2	1634-04-4	
Acrylonitrile	Not detected	100		ug/kg	58.2	107-13-1	
2-Butanone (MEK)	Not detected	870		ug/kg	58.2	78-93-3	
Dichlorodifluoromethane	Not detected	300		ug/kg	58.2	75-71-8	
Chloromethane	Not detected	300		ug/kg	58.2	74-87-3	
Vinyl chloride	Not detected	60		ug/kg	58.2	75-01-4	
Bromomethane	Not detected	200		ug/kg	58.2	74-83-9	
Chloroethane	Not detected	300		ug/kg	58.2	75-00-3	
Trichlorofluoromethane	Not detected	100		ug/kg	58.2	75-69-4	
1,1-Dichloroethene	Not detected	60		ug/kg	58.2	75-35-4	
Methylene chloride	Not detected	100		ug/kg	58.2	75-09-2	
trans-1,2-Dichloroethene	Not detected	60		ug/kg	58.2	156-60-5	
1,1-Dichloroethane	Not detected	60		ug/kg	58.2	75-34-3	
cis-1,2-Dichloroethene	Not detected	60		ug/kg	58.2	156-59-2	
Tetrahydrofuran*	Not detected	1,000		ug/kg	58.2	109-99-9	
Chloroform	Not detected	60		ug/kg	58.2	67-66-3	
Bromochloromethane	Not detected	100		ug/kg	58.2	74-97-5	
1,1,1-Trichloroethane	Not detected	60		ug/kg	58.2	71-55-6	
4-Methyl-2-pentanone (MIBK)	Not detected	3,000		ug/kg	58.2	108-10-1	
2-Hexanone	Not detected	3,000		ug/kg	58.2	591-78-6	
Carbon tetrachloride	Not detected	60		ug/kg	58.2	56-23-5	
Benzene	Not detected	60		ug/kg	58.2	71-43-2	
1,2-Dichloroethane	Not detected	60		ug/kg	58.2	107-06-2	
Trichloroethene	Not detected	60		ug/kg	58.2	79-01-6	
1,2-Dichloropropane	Not detected	60		ug/kg	58.2	78-87-5	
Bromodichloromethane	Not detected	100		ug/kg	58.2	75-27-4	
Dibromomethane	Not detected	300		ug/kg	58.2	74-95-3	
cis-1,3-Dichloropropene	Not detected	60		ug/kg	58.2	10061-01-5	
Toluene	Not detected	60		ug/kg	58.2	108-88-3	
trans-1,3-Dichloropropene	Not detected	60		ug/kg	58.2	10061-02-6	
1,1,2-Trichloroethane	Not detected	60		ug/kg	58.2	79-00-5	
Tetrachloroethene	Not detected	60		ug/kg	58.2	127-18-4	
trans-1,4-Dichloro-2-butene	Not detected	60		ug/kg	58.2	110-57-6	
Dibromochloromethane	Not detected	100		ug/kg	58.2	124-48-1	



Analytical Laboratory Report

Lab Sample ID: S63724.10 (continued)

Sample Tag: G2-10

Volatile Organics 5035, Method: SW5035A/8260C, Run Date: 07/02/24 19:14, Analyst: ACK (continued)

Parameter	Result	RL	MDL	Units	Dilution	CAS#	Flags
1,2-Dibromoethane	Not detected	20		ug/kg	58.2	106-93-4	M
Chlorobenzene	Not detected	60		ug/kg	58.2	108-90-7	
1,1,1,2-Tetrachloroethane	Not detected	100		ug/kg	58.2	630-20-6	
Ethylbenzene	Not detected	60		ug/kg	58.2	100-41-4	
p,m-Xylene	Not detected	100		ug/kg	58.2		
o-Xylene	Not detected	60		ug/kg	58.2	95-47-6	
Styrene	Not detected	60		ug/kg	58.2	100-42-5	
Isopropylbenzene	Not detected	300		ug/kg	58.2	98-82-8	
Bromoform	Not detected	100		ug/kg	58.2	75-25-2	
1,1,2,2-Tetrachloroethane	Not detected	60		ug/kg	58.2	79-34-5	
1,2,3-Trichloropropane	Not detected	100		ug/kg	58.2	96-18-4	
n-Propylbenzene	Not detected	60		ug/kg	58.2	103-65-1	
Bromobenzene	Not detected	100		ug/kg	58.2	108-86-1	
1,3,5-Trimethylbenzene	Not detected	60		ug/kg	58.2	108-67-8	
tert-Butylbenzene	Not detected	60		ug/kg	58.2	98-06-6	
1,2,4-Trimethylbenzene	Not detected	60		ug/kg	58.2	95-63-6	
sec-Butylbenzene	Not detected	60		ug/kg	58.2	135-98-8	
p-Isopropyltoluene	Not detected	100		ug/kg	58.2	99-87-6	
1,3-Dichlorobenzene	Not detected	100		ug/kg	58.2	541-73-1	
1,4-Dichlorobenzene	Not detected	100		ug/kg	58.2	106-46-7	
1,2-Dichlorobenzene	Not detected	100		ug/kg	58.2	95-50-1	
1,2,3-Trimethylbenzene	Not detected	60		ug/kg	58.2	526-73-8	
n-Butylbenzene	Not detected	60		ug/kg	58.2	104-51-8	
Hexachloroethane	Not detected	300		ug/kg	58.2	67-72-1	
1,2-Dibromo-3-chloropropane	Not detected	300		ug/kg	58.2	96-12-8	
1,2,4-Trichlorobenzene	Not detected	380		ug/kg	58.2	120-82-1	
1,2,3-Trichlorobenzene	Not detected	380		ug/kg	58.2	87-61-6	
Naphthalene	Not detected	300		ug/kg	58.2	91-20-3	
2-Methylnaphthalene	Not detected	100		ug/kg	58.2	91-57-6	

M-Result reported to MDL not RDL

Merit Laboratories Login Checklist

Lab Set ID:S63724

Client:G2CONSULTING (G2 Consulting Group)

Project: 37900 Mound - Sterling Hts, MI

Submitted:07/01/2024 14:30 Login User: MMC

Attention: Thomas McDonald

Address: G2 Consulting Group
1866 Woodslee Street
Troy, MI 48083

Phone: 248-680-0400

FAX:

Email: TMcDonald@g2consultinggroup.com

Selection	Description	Note
Sample Receiving		
01. ☒ Yes ☐ No ☐ N/A	Samples are received at 4C +/- 2C	Thermometer # IR 2.6
02. ☒ Yes ☐ No ☐ N/A	Received on ice/ cooling process begun	
03. ☐ Yes ☒ No ☐ N/A	Samples shipped	
04. ☐ Yes ☒ No ☐ N/A	Samples left in 24 hr. drop box	
05. ☐ Yes ☐ No ☒ N/A	Are there custody seals/tape or is the drop box locked	
Chain of Custody		
06. ☒ Yes ☐ No ☐ N/A	COC adequately filled out	
07. ☒ Yes ☐ No ☐ N/A	COC signed and relinquished to the lab	
08. ☒ Yes ☐ No ☐ N/A	Sample tag on bottles match COC	
09. ☐ Yes ☒ No ☐ N/A	Subcontracting needed? Subcontracted to:	
Preservation		
10. ☒ Yes ☐ No ☐ N/A	Do sample have correct chemical preservation	
11. ☐ Yes ☐ No ☒ N/A	Completed pH checks on preserved samples? (no VOAs)	
12. ☐ Yes ☒ No ☐ N/A	Did any samples need to be preserved in the lab?	
Bottle Conditions		
13. ☒ Yes ☐ No ☐ N/A	All bottles intact	
14. ☒ Yes ☐ No ☐ N/A	Appropriate analytical bottles are used	
15. ☒ Yes ☐ No ☐ N/A	Merit bottles used	
16. ☒ Yes ☐ No ☐ N/A	Sufficient sample volume received	
17. ☐ Yes ☒ No ☐ N/A	Samples require laboratory filtration	
18. ☒ Yes ☐ No ☐ N/A	Samples submitted within holding time	
19. ☐ Yes ☐ No ☒ N/A	Do water VOC, TOX, DO or Alkalinity bottles contain	

Corrective action for all exceptions is to call the client and to notify the project manager.

Client Review By: _____ Date: _____

Cleanup Criteria Requirements for Response Activity (Formerly the Part 201 Generic Cleanup Criteria and Screening Levels) Tables

Table 1
SUMMARY OF SOIL ANALYTICAL RESULTS
37900 Mound Road - Sterling Heights, Michigan
Sampling Dates: June 28, 2024



Sample I.D.	G2-1	G2-2	G2-3	G2-4	G2-5	G2-6	EGLE Requirements for Response Activity					
							Generic Residential Drinking Water Protection Criteria	Generic Residential Groundwater Surface Water Interface Protection Criteria	Residential Soil Volatilization to Indoor Air Pathway Screening Level	Generic Residential Infinite Source Volatile Soil Inhalation Criteria	Generic Residential Particulate Soil Inhalation Criteria	Generic Residential Direct Contact Criteria
Sample Depth	2.5-3.0'	0.5-1.0'	5.0-5.5'	3.0-3.5'	1.0-1.5'	0.75-1.25'						
VOLATILE ORGANIC COMPOUNDS (VOCs)												
All VOCs	<	<	<	<	<	<	NA	NA	NA	NA	NA	NA
POLYNUCLEAR AROMATIC HYDROCARBONS (PNA's)												
All PNA's	<	<	<	<	<	<	NA	NA	NA	NA	NA	NA
METALS												
Arsenic	2,700	5,700	4,790	7,200	5,600	6,480	5,800 (B)	5,800 (B)	NA	NLV	720,000	7,600
Barium	33,700	50,500	49,200	54,900	56,100	40,900	1,300,000	1,200,000 (1)	NA	NLV	330,000,000	37,000,000
Cadmium	250	300	250	1,080	490	370	6,000	1,200 (B)	NA	NLV	1,700,000	550,000
Chromium (total)	6,920	14,100	17,700	33,400	24,200	18,500	30,000	2,900,000,000 (1)	NA	NLV	260,000	2,500,000
Chromium VI	<	<	<	<	<	<	30,000	3,300	NA	NLV	260,000	2,500,000
Lead	3,400	17,500	10,300	12,000	17,600	17,300	700,000	2,500,000 (1)	NA	NLV	100,000,000	400,000
Mercury	<	<	<	<	<	<	1,700	130 (B)	22	52,000	20,000,000	160,000
Selenium	<	<	<	<	<	<	4,000	410 (B)	NA	NLV	130,000,000	2,600,000
Silver	<	<	<	<	620	<	4,500	1,000 (B)	NA	NLV	6,700,000	2,500,000

Notes:

1. Presented in ug/kg (ppb)
 2. < = Less than method detection limit
 3. NLV = Chemical is not likely to volatilize under most soil conditions
 4. NA = Not Available
 5. NS = Not selected for analysis
 6. NLL = Chemical is not likely to leach under most soil conditions
 7. ID = Insufficient data to develop criterion
 8. **RED** indicates value exceeds the applicable Generic Residential Criteria or Residential VIAP Screening Levels
- (B) = Background
- (1) Calculated using 150 mg CaCO₃/L for hardness

Table 1 (continued)
SUMMARY OF SOIL ANALYTICAL RESULTS
37900 Mound Road - Sterling Heights, Michigan
Sampling Dates: June 28, 2024



Sample I.D.	G2-7	G2-8	G2-9	G2-10	EGLE Requirements for Response Activity					
					Generic Residential Drinking Water Protection Criteria	Generic Residential Groundwater Surface Water Interface Protection Criteria	Residential Soil Volatilization to Indoor Air Pathway Screening Level	Generic Residential Infinite Source Volatile Soil Inhalation Criteria	Generic Residential Particulate Soil Inhalation Criteria	Generic Residential Direct Contact Criteria
Sample Depth	2.5-3.0'	1.5-2.0'	1.0-1.5'	1.75-2.25'						
VOLATILE ORGANIC COMPOUNDS (VOCs)										
All VOCs	<	<	<	<	NA	NA	NA	NA	NA	NA
POLYNUCLEAR AROMATIC HYDROCARBONS (PNAs)										
All PNAs	<	<	<	<	NA	NA	NA	NA	NA	NA
METALS										
Arsenic	4,410	3,890	11,700	4,460	5,800 (B)	5,800 (B)	NA	NLV	720,000	7,600
Barium	26,600	15,300	34,200	42,000	1,300,000	1,200,000 (1)	NA	NLV	330,000,000	37,000,000
Cadmium	<	<	<	210	6,000	1,200 (B)	NA	NLV	1,700,000	550,000
Chromium (total)	8,430	4,510	7,790	17,100	30,000	2,900,000,000 (1)	NA	NLV	260,000	2,500,000
Chromium VI	<	<	<	<	30,000	3,300	NA	NLV	260,000	2,500,000
Lead	12,600	5,400	6,740	13,500	700,000	2,500,000 (1)	NA	NLV	100,000,000	400,000
Mercury	<	<	<	<	1,700	130 (B)	22	52,000	20,000,000	160,000
Selenium	<	<	<	<	4,000	410 (B)	NA	NLV	130,000,000	2,600,000
Silver	<	<	<	<	4,500	1,000 (B)	NA	NLV	6,700,000	2,500,000

Notes:

1. Presented in ug/kg (ppb)
 2. < = Less than method detection limit
 3. NLV = Chemical is not likely to volatilize under most soil conditions
 4. NA = Not Available
 5. NS = Not selected for analysis
 6. NLL = Chemical is not likely to leach under most soil conditions
 7. ID = Insufficient data to develop criterion
 8. **RED** indicates value exceeds the applicable Generic Residential Criteria or Residential VIAP Screening Levels
- (B) = Background
(1) Calculated using 150 mg CaCO₃/L for hardness

Table 2
SUMMARY OF SOIL GAS SCREENING RESULTS
37900 Mound Road – Sterling Heights, Michigan
Sampling Date: June 28, 2024



Sample I.D.	G2-1	G2-2	G2-3	G2-4	G2-5	G2-6	G2-7	G2-8	G2-9	G2-10	EGLE Action Level for Methane
Sample Depth Tip	5'	5'	5'	5'	2.5'	3'	3'	3'	5'	5'	Percentage of Methane
Methane											
METHANE	<	<	<	<	<	<	<	<	<	<	0

Notes:

1. Presented in ug/m³

2. < = Less than method detection limit

3. NA = Not Analyzed/Not Available
4. NS = Not selected for analysis

5. RED indicates value exceeds the Residential VIAP Screening Levels