

Product Manual

Smart Eddy Monster Bash

P/N **TPP-1040**



Tangles'
Pin Parts

Document Revision – 1.0

The 'Smart Eddy – Monster Bash' (Part Number TPP-1040) board is a variant of the popular Tangles Smart Eddy designed for use on the game Monster Bash. It is a modern re-design of the original part number A-22149-1.

Replace your missing, broken or unreliable A-22149-1 boards with TPP-1040 to revive the phantom flip feature. The TPP-1040 will give a reliable long service to your MB machine.

The TPP-1040 is drop-in compatible with the original part, using the same mounting holes. The board is supplied with 4 new nylon mounting posts.

Installation is a simple matter of installing the board with the 4 original screws and connecting the 2 wire sensor cable to J1 and the 4 wire power/signal cable to J2.

The Smart Eddy boards utilise an auto calibration feature. This feature is activated each time the machine is turned on.

LED SIGNALS

When the board is powered on it should display a quick flash of the LED. The LED should come on solid for 2 to 4 seconds (calibration phase). Finally the board will give a quick blink of the LED and then go OFF.

1. Quick Flash – Sensor coil detected
2. 4 seconds on – Calibration running
3. Blink 3 times – Calibration successful
4. LED Off – Ready for game play.

TROUBLE SHOOTING

LED Does not come on

Check J2. Check fuse for unregulated 12v supply.

LED Comes on Solid (Never blinks)

This indicated the sensor has not been detected. Check connector J1. Check sensor 2 pin plug (can lose their tension and not make good contact. Check sensor inductor in the playfield routed slot.

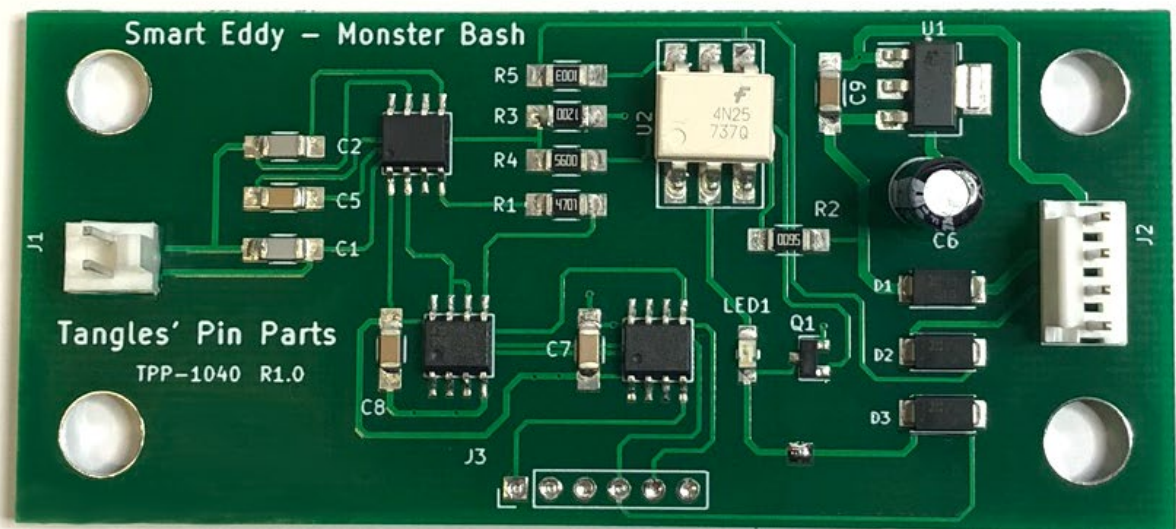


Photo 1



- 3 -