
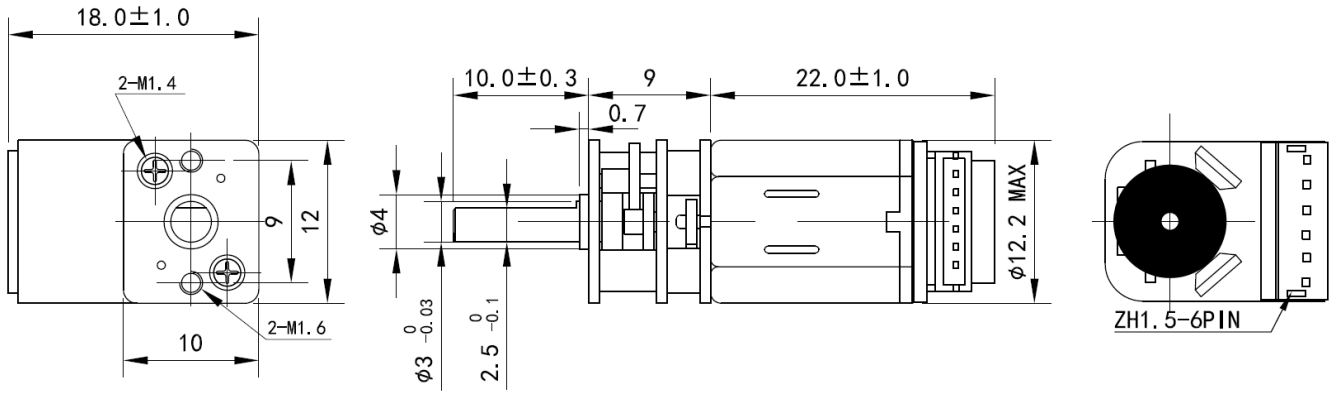


Motor connection mode

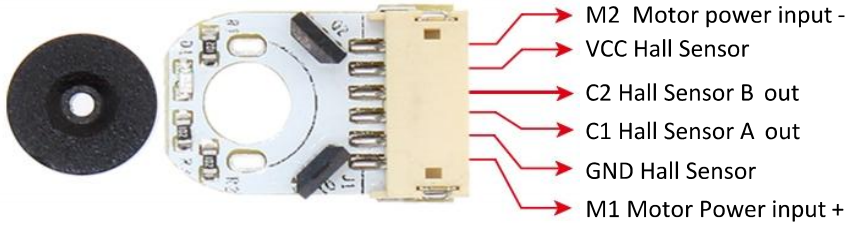

Encoders conflg

Type	AB dual phase incremental encoder
Pulse outputs of rotation	Basic pulse 7PPR×gear reduction ratio
Hall power supply voltage:	DC3.3-DC5.0V
Basic function	With the pull-up shaping resistor, the single-chip microcomputer can be used
Encoder Interface type	ZH1.5-6PIN(standard wiring)
Output signal type	Square wave AB phase
Response frequency	100KHz
Basic pulse number	7PPR
Number of trigger poles of magnetic ring	14 poles(7 pairs of poles)

PARAMETERS

1. NOMINAL: DC 6V
2. NO LOAD SPEED: 310±12% RPM
 NO LOAD CURRENT: ≤60mA
3. RATED LOAD SPEED: 180±12%RPM
 RATED LOAD TORQUE: ≥0.35Kg.cm
 RATED CURRENT: ≤170mA
4. STALL TORQUE: 0.8Kg.cm
5. STALL CURRENT: 0.6A
6. GEAR RATIO: 50:1
7. ROTATION DIRECTION: CW/CCW

CONTROL SIGNATURE:

THE INFORMATION CONTAINED IN THIS DRAWING IS CONFIDENTIAL. COPYRIGHT

REV.	EPO#	DETAILS	DATE
A		1ST ISSUE	250318

SCALE	UNIT mm		MERCURY MOTOR
	SIZE A4		
DRAWN XQ		MATERIAL	TITLE MG12A06E-060310-50
CHECKED		FINISH	SHEET 1 OF 1 REV A
APPROVED			DWG.NO. MG12A06-25#