

US012390995B2

## (12) United States Patent

Susnjara et al.

## (54) SYSTEMS AND METHODS FOR PRINTING COMPONENTS USING ADDITIVE MANUFACTURING

(71) Applicant: Thermwood Corporation, Dale, IN

(US)

(72) Inventors: Kenneth J. Susnjara, Birdseye, IN

(US); Scott G. Vaal, Jasper, IN (US); Nicolas C. Vote, Newburgh, IN (US)

(73) Assignee: **Thermwood Corporation**, Dale, IN

(US)

(\*) Notice: Subject to any disclaimer, the term of this patent is extended or adjusted under 35

U.S.C. 154(b) by 0 days.

(21) Appl. No.: 19/022,640

(22) Filed: **Jan. 15, 2025** 

(65) Prior Publication Data

US 2025/0153432 A1 May 15, 2025

## Related U.S. Application Data

(63) Continuation of application No. 18/897,887, filed on Sep. 26, 2024, now Pat. No. 12,269,213, which is a (Continued)

(51) **Int. Cl. B29C 64/227** (2017.01) **B29C 64/118** (2017.01)

(52) **U.S. Cl.**CPC ....... *B29C 64/227* (2017.08); *B29C 64/118* (2017.08); *B29C 64/209* (2017.08);

(Continued)

(Continued)

(58) Field of Classification Search

None

See application file for complete search history.

## (10) Patent No.: US 12,390,995 B2

(45) **Date of Patent:** Aug. 19, 2025

## (56) References Cited

### U.S. PATENT DOCUMENTS

5,798,077 A 8/1998 Womer et al. 5,931,578 A 8/1999 Womer et al. (Continued)

## FOREIGN PATENT DOCUMENTS

CA 2738864 A1 4/2010 CA 3036127 A1 3/2018 (Continued)

## OTHER PUBLICATIONS

3D Printing Nerd, "Dual Extrusion 3D Printing with Simplify3D and CURA on the BCN Sigma R17 and Ultimaker 3", Apr. 25, 2017, (3 pages). URL: https://www.youtube.com/watch?v=RE-ZgJ5vzXk.


(Continued)

Primary Examiner — Mohammad Ali Assistant Examiner — Kelvin Booker (74) Attorney, Agent, or Firm — Bookoff McAndrews, PLLC

## (57) ABSTRACT

A method of forming a part using additive manufacturing may include receiving, at a computer numeric controlled (CNC) machine, a computer aided design (CAD) model of the part. The method may further include dividing the CAD model into plurality of sections. The method may further include slicing each of the plurality of sections into a plurality of layers. Each section may include a distinct set of print parameters. The method may further include depositing a flowable material onto a worktable according the set of print parameters for each section of the plurality of sections to manufacture the part.

## 19 Claims, 21 Drawing Sheets

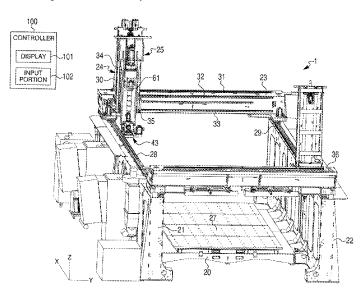

### 2014/0328884 A1 11/2014 Reyes et al. Related U.S. Application Data 2014/0328963 A1\* 11/2014 Mark ...... B33Y 50/02 continuation of application No. 18/352,882, filed on 2015/0005919 A1 1/2015 Mcgatha et al. Jul. 14, 2023, now Pat. No. 12,115,726, which is a 2015/0076739 A1 3/2015 Batchelder continuation of application No. 17/645,549, filed on 2015/0093283 A1 4/2015 Miller et al. Dec. 22, 2021, now Pat. No. 11,724,453, which is a 2015/0096426 A1 4/2015 Culver et al. continuation of application No. 17/225,769, filed on 2015/0096717 A1 4/2015 Batchelder et al. Apr. 8, 2021, now Pat. No. 11,235,524, which is a 2015/0097053 A1 4/2015 Batchelder et al. 2015/0097307 A1 4/2015 Batchelder et al. continuation of application No. 16/856,457, filed on 2015/0097308 A1 4/2015 Batchelder et al. Apr. 23, 2020, now Pat. No. 10,981,330, which is a 2015/0165691 A1\* 6/2015 Mark ...... B29C 64/118 continuation of application No. 16/186,053, filed on 700/98 Nov. 9, 2018, now Pat. No. 10,668,664. 2015/0190754 A1 7/2015 Harp et al. 2015/0251353 A1 9/2015 Rodgers et al. 2015/0314531 A1\* (51) Int. Cl. 11/2015 Mark ..... B29C 64/209 264/241 B29C 64/209 (2017.01)2016/0052208 A1\* 2/2016 Debora ...... B33Y 40/10 B33Y 10/00 (2015.01)425/166 B33Y 30/00 (2015.01)2016/0067928 A1\* 3/2016 Mark ...... B29C 70/16 (2006.01)G05B 19/41 425/150 G05B 19/414 (2006.01)2016/0068793 A1 3/2016 Maggiore et al. 2016/0075130 A1 3/2016 Landa et al. (52) U.S. Cl. 2016/0107379 A1 4/2016 Mark et al. CPC ....... G05B 19/4145 (2013.01); B33Y 10/00 2016/0122541 A1 5/2016 Jaker et al. (2014.12); *B33Y 30/00* (2014.12) 2016/0144563 A1 5/2016 Elliott et al. 2016/0151861 A1 6/2016 Soracco et al. (56)References Cited 2016/0198576 A1 7/2016 Lewis et al. 2016/0263822 A1 9/2016 Boyd, IV et al. 2016/0271875 A1 U.S. PATENT DOCUMENTS 9/2016 Brown, Jr. et al. 2016/0288424 A1 10/2016 Susnjara 2016/0311165 A1\* Mark ..... 6,059,494 A 5/2000 Susnjara 10/2016 ..... B29C 64/386 6.180.049 B1 1/2001 Jang et al. 2016/0318248 A1 11/2016 Susnjara et al. 6,254,712 B1 2016/0325501 A1 11/2016 Ready 7/2001 Enlow et al. 2016/0370791 A1 12/2016 Revanur et al. 6,296,732 B1 10/2001 Enlow et al. 2016/0374431 A1 12/2016 Tow 6,376,148 B1 4/2002 Liu et al. 2017/0014169 A1 1/2017 Dean et al. 6,401,001 B1 6/2002 Jang et al. 2017/0021455 A1 1/2017 Dallarosa et al. 6,547,912 B2 4/2003 Enlow et al. 2017/0120535 A1 Maccurdy et al. 6,773,804 B2 8/2004 5/2017 Enlow et al. 2017/0144242 A1 7,003,864 B2 2/2006 Dirscherl 5/2017 Mcqueen et al. Moore et al. 7,731,816 B2 6/2010 Oldani et al. 2017/0144370 A1 5/2017 2017/0165917 A1\* 6/2017 McKiel, Jr. ..... B29C 64/393 7,810,539 B2 10/2010 Mischler et al. 8,151,854 B2 4/2012 2017/0165920 A1 6/2017 Leavitt et al. Oldani 2017/0173886 A1 6/2017 Menchik et al. 8,534,338 B2 9/2013 Oldani et al. 8,791,192 B2 8,933,137 B2 2017/0197371 A1 7/2017 Fetfatsidis et al. 7/2014 Hironaka et al. Chaphalkar et al. 2017/0205806 A1 7/2017 1/2015 Tsutsui et al. 2017/0216915 A1 8,954,180 B2 2/2015 Oldani 8/2017 Holcomb et al. 8,974,715 B2 3/2015 2017/0217088 A1 8/2017 Boyd et al. Hopkins et al. 2017/0251713 A1 9/2017 9,174,388 B2 11/2015 Batchelder et al. Warner et al. 2017/0252966 A1 9/2017 Susnjara 9,233,506 B2 1/2016 Leavitt 2017/0259502 A1 9/2017 Chapiro et al. 9,434,108 B2 9/2016 Jin et al. 2017/0268133 A1 9/2017 Graley et al. 9,688,028 B2 6/2017 Mark et al. 2017/0282449 A1 9,694,544 B2 10/2017 Susniara et al. 7/2017 Mark et al. 2017/0282461 A1 10/2017 Susnjara et al. 9,815,268 B2 11/2017 Mark et al. 2017/0291364 A1 10/2017 Womer 9,833,986 B1 12/2017 Susnjara 2017/0312821 A1 11/201710,286,484 B1 5/2019 McCarthy et al. Defelice et al. 10,583,604 B2 3/2020 Yuyama 2017/0333980 A1 11/2017 Yang et al. 2018/0029299 A1 10,821,633 B1 11/2020 Quinonez et al. 2/2018 Aknin et al. 2001/0052385 A1 2018/0035689 A1 2/2018 Warner et al. 12/2001 Enlow et al. 2002/0007903 A1 2018/0036800 A1 2/2018 1/2002 Enlow et al. Torabi et al. 2018/0036847 A1 2/2018 2002/0062909 A1 5/2002 Susniara Jang et al. 2018/0050502 A1 2/2018 Oldani 2002/0093115 A1 7/2002 Jang et al. 2018/0056602 A1 2002/0111707 A1 8/2002 Li et al. 3/2018 Susnjara et al. 2018/0056608 A1\* 3/2018 Dunn ..... B29C 64/118 2002/0145213 A1 10/2002 Liu et al. 2018/0071949 A1 3/2018 2002/0149137 A1 10/2002 Jang et al. Giles et al. 2018/0071989 A1 3/2018 Zenou et al. 2002/0157772 A1 10/2002 Enlow et al. 2018/0207863 A1\* 7/2018 Porter ...... B29C 64/40 2004/0015932 A1 1/2004 Susniara 2018/0208706 A1 7/2018 Green et al. 2004/0209057 A1 10/2004 Enlow et al. 2005/0015175 A1 2018/0222124 A1 8/2018 Susnjara et al. 1/2005 Huang 2018/0236722 A1 8/2018 Susnjara et al. 2007/0044899 A1 3/2007 Tingley 2018/0236723 A1 8/2018 Susniara et al. 2008/0006017 A1 1/2008 Rindels 2018/0236725 A1 8/2018 Susnjara et al. 2010/0200168 A1 8/2010 Oldani et al. 2018/0237325 A1 2010/0227963 A1 9/2010 Hironaka et al. 8/2018 Li et al. 9/2018 Symeonidis et al. 2018/0250744 A1 2012/0063862 A1 3/2012 Epplin et al. 9/2013 Hironaka et al. 2018/0250747 A1 9/2018 Davidson et al. 2013/0231435 A1 2013/0289593 A1 2018/0253080 A1 9/2018 Meess et al. 10/2013 Hall et al. 2014/0048970 A1 2018/0290398 A1 10/2018 Mannella et al. 2/2014 Batchelder et al. 2018/0311891 A1 11/2018 Duty et al. 2014/0163717 A1 6/2014 Das et al.

2018/0339456 A1

11/2018 Czinger et al.

2014/0242539 A1

8/2014 Fisker et al.

## (56) References Cited

### U.S. PATENT DOCUMENTS

2018/0345573	A1	12/2018	Zinniel et al.
2018/0370114	A1	12/2018	Hopkins et al.
2018/0373227	A1	12/2018	Sadusk et al.
2019/0001580	A1	1/2019	Zenou et al.
2019/0054700	A1	2/2019	Chandar et al.
2019/0077081	A1	3/2019	Susnjara et al.
2019/0247050	A1	8/2019	Goldsmith
2019/0266795	A1	8/2019	Aluru et al.
2019/0299290	A1	10/2019	Kuhns et al.
2019/0322044	A1	10/2019	Susnjara et al.
2019/0375148	A1	12/2019	Susnjara et al.
2020/0147876	A1	5/2020	Susnjara et al.
2020/0276764		9/2020	McCarthy et al.
2021/0162732	A1	6/2021	Susniara

## FOREIGN PATENT DOCUMENTS

$\mathbf{C}\mathbf{A}$	3012920	A1		3/2019	
CN	107839225	Α	*	3/2018	 B29C 70/525
CN	208169114	U		11/2018	
CN	105833369	В		2/2020	
CN	111804910	Α		10/2020	
EP	1025982	A2		8/2000	
FR	3029926	A1		6/2016	
KR	20180044791	Α		5/2018	
RO	132300	Α		12/2017	
TW	554096	В		9/2003	
WO	WO-2015042422	A1	*	3/2015	 B29C 64/106
WO	WO-2016081496	A1	*	5/2016	 B29C 64/106
WO	2016175813	A1		11/2016	
WO	2016193742	A1		12/2016	

## OTHER PUBLICATIONS

3D Universe, "Ultimaker Cura: Adaptive Layers (3D Universe)", Apr. 6, 2018, (1 page). URL: https://www.youtube.com/watch?v=T68ILZ1aLQQ.

Coupek et al., "Reduction of support structures and building time by optimized path planning algorithms in multi-axis additive manufacturing", 2017, 11th CIRP Conference on Intelligent Computation in Manufacturing Engineering—CIRP ICME '17. (Year: 2017).

D.S. González and A.G. Álvarez, Additive Manufacturing Feasibility Study & Technology Demonstration EDAAM State of the Art & Strategic Report, Jan. 2018, European Defense Agency. (Year: 2018).

Didier Klein, "CURA 2.6: Plusieurs densités dans une même impression", YouTube, Jun. 27, 2017, (3 pages). URL: https://www.youtube.com/watch/?v=PBZ9fhBii8w.

Felix W. Baumann, and Dieter Roller, "Additive Manufacturing, Cloud-Based 3D Printing and Associated Services-Overview", Sep. 22, 2017, J. Manuf. Mater. Process. 2017, 1, 15; doi:10.3390/jmmp1020015.

Gershon, D., "The Application of Robotics to the Assembly of Flexible Parts by Sewing", Mar. 1987, Department of Textile Industries, University of Leeds. (Year: 1987).

Gunaydin et al., "Common FDM 3D Printing Defects", Apr. 2018, ITU Scientific Research Project. (Year: 2018).

Hergel et al., "Clean color: Improving multi-filament 3D prints", Eurographics 2014. (Year: 2014).

Horvath et al., "3D Printing with MatterControl", 2015, Springer Science+Business Media New York. (Year: 2015).

International Search Report and Written Opinion for International Application No. PCT/US2019/055585, dated Jan. 27, 2020, (15 pages).

Jin et al., "An optimization approach for path planning of high-quality and uniform additive manufacturing", Nov. 2016, Int J Adv Manuf Technol (2017) 92:651-662. (Year: 2016).

Lan Ren, Todd Sparks, Jianzhong Ruan, Frank Liou, "Process planning strategies for solid freeform fabrication of metal parts", Nov. 27, 2007, Journal of Manufacturing Systems 27 (2008) 158-165.

M. B Mawale; A. M. Kuthe; and S. W. Dahake, "Additive layered manufacturing: State-of-the-art applications in product innovation", Concurrent Engineering: Research and Applications 2016, vol. 24(1) 94-102. (Year: 2016).

M. Pérez; G. Medina-Sánchez; A. García-Collado; M. Gupta; and D. Carou, "Surface Quality Enhancement of Fused Deposition Modeling (FDM) Printed Samples Based on the Selection of Critical Printing Parameters", Jun. 2018, Materials 2018, 11, 1382; doi: 10.3390/ma11081382. (Year: 2018).

MatterHackers, "How to Make a Dual Extrusion 3D Print // 3D Printing Tutorial", Feb. 13, 2018, (1 page). URL:https://www.youtube.com/watch?v=wC0JLfr--08.

N.H. Harun; M.S. Kasim; M.Z.Z. Abidin; R. Izannshah; H. Attan and H.N. Ganesan, "A Study on Surface Roughness During Fused Deposition Modelling: A Review", Aug. 16, 2017, Journal of Advanced Manufacturing Technology, IDEACON 2016, eISSN: 2289-8107. (Year: 2017).

Samuel Clark Ligon, Robert Liska, Jurgen Stampfl, Matthias Gurr, and Rolf Mulhaupt, "Polymers for 3D Printing and Customized Additive Manufacturing", Aug. 9, 2017, Chem Rev., 117(15): 10212-10290.

T. Nancharaiah; D. Ranga Raju; and V. Ramachandra Raju, "An experimental investigation on surface quality and dimensional accuracy of FDM components", 2010, International Journal on Emerging Technologies 1(2): 106-111. (Year: 2010).

Takahashi et al., "Programmable Filament: Printed Filaments for Multi-material 3D Printing", Oct. 2020, UIST '20, Virtual Event, USA (Year: 2020).

Tan et al., "Extrusion-Based 3D Food Printing—Materials and Machines", Apr. 2018, Singapore Centre for 3D Printing, School of Mechanical and Aerospace Engineering, Nanyang Technological University, Singapore. (Year: 2018).

Third Party Observation for application No. EP20190794843 submitted Sep. 1, 2023 (9 pages).


Wasserfall et al., "Optical In-Situ Verification of 3D-Printed Electronic Circuits", 2019, 2019 IEEE 15th International Conference on Automation Science and Engineering (CASE). (Year: 2019).

Y. Jin; J. Du; Y. He; and G. Fu, Modeling and process planning for curved layer fused deposition", 2017, Int J Adv Manuf Technol 91:273-285 DOI 10.1007/s00170-016-9743-5. (Year: 2017). Yuan Jin, Jianke Du, Yong He, "Optimization of process planning for reducing material consumption in additive manufacturing", Oct. 31, 2016, Journal of Manufacturing Systems 44 (2017) 65-78.

Yu-an Jin, Yong He, Jian-zhong Fu, Wen-feng Gan, Zhi-wei Lin, "Optimization of tool-path generation for material extrusion-based additive manufacturing technology", Sep. 16, 2014, Additive Manufacturing 1-4 (2014) 32-47.

Yuan Jina, Yong He, Guogiang Fu, Aibing Zhang, Jianke Du, "A non-retraction path planning approach for extrusion-based additive manufacturing", Aug. 5, 2016, Robotics and Computer-Integrated Manufacturing 48 (2017) 132-144.

\* cited by examiner

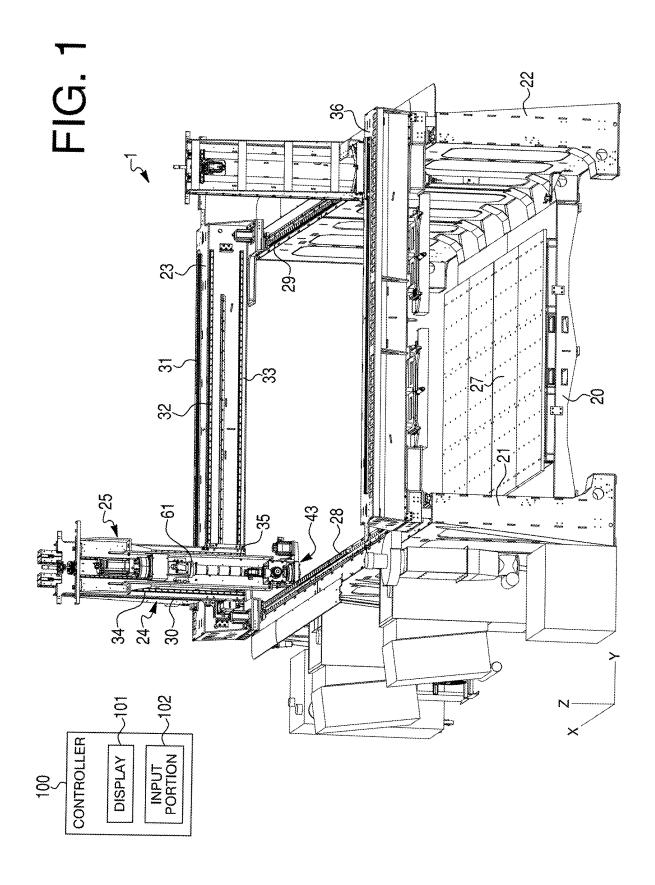

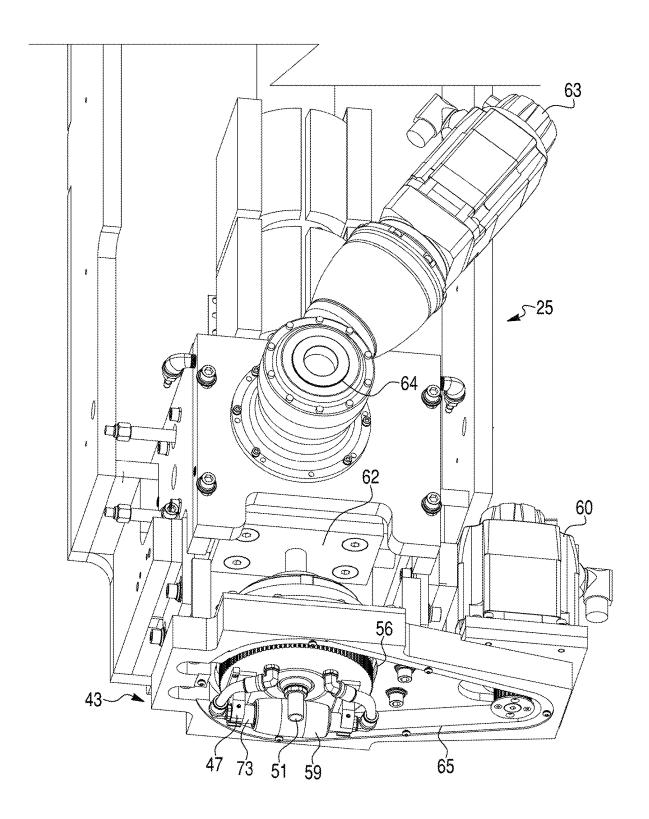


FIG. 2

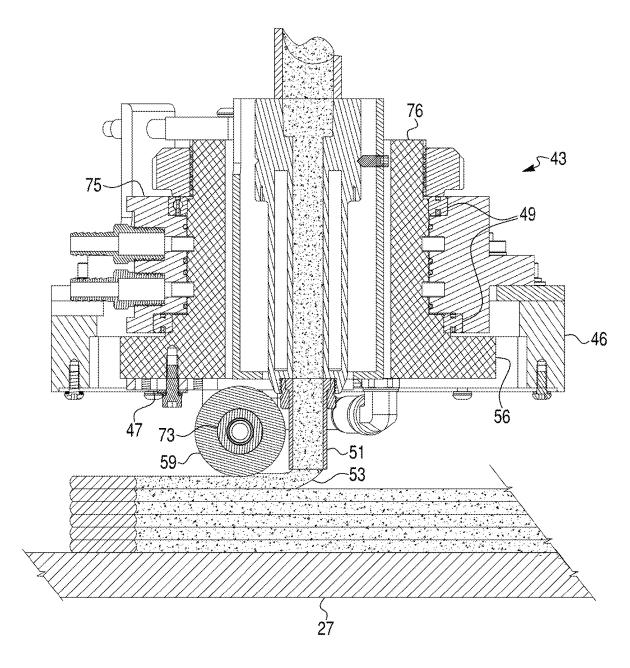


FIG. 3





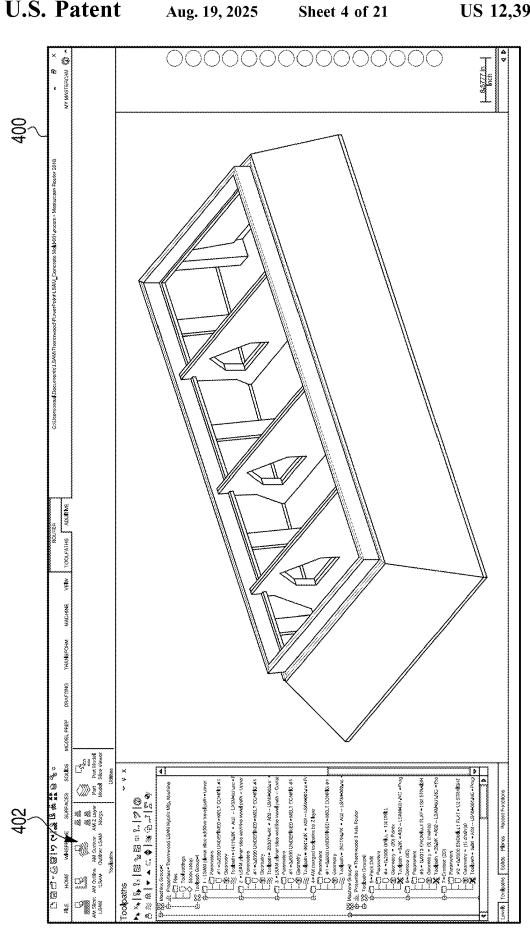



FIG. 4

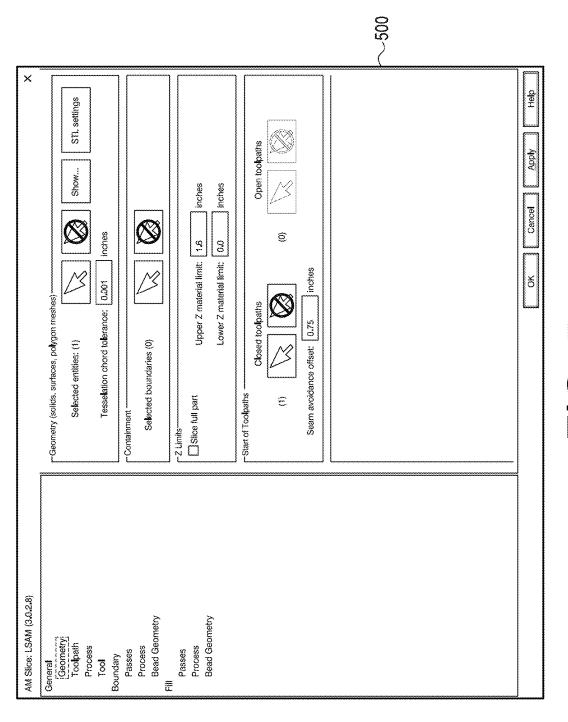

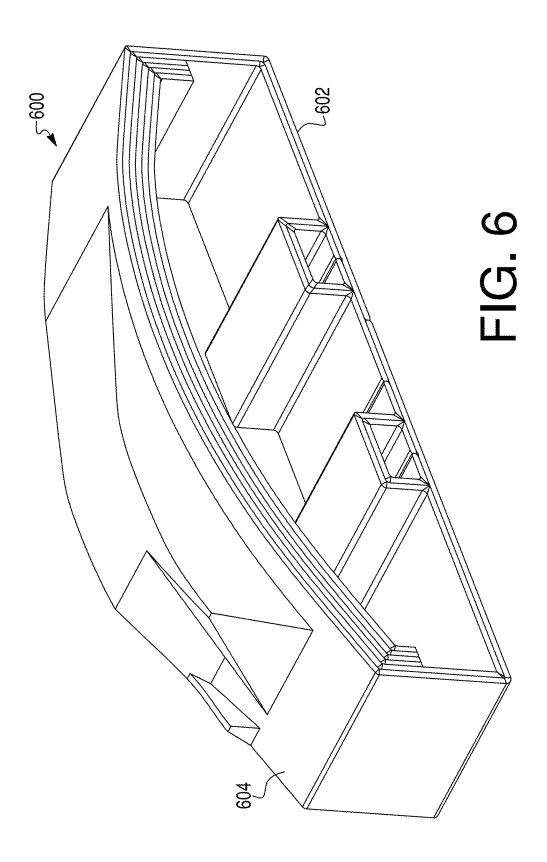


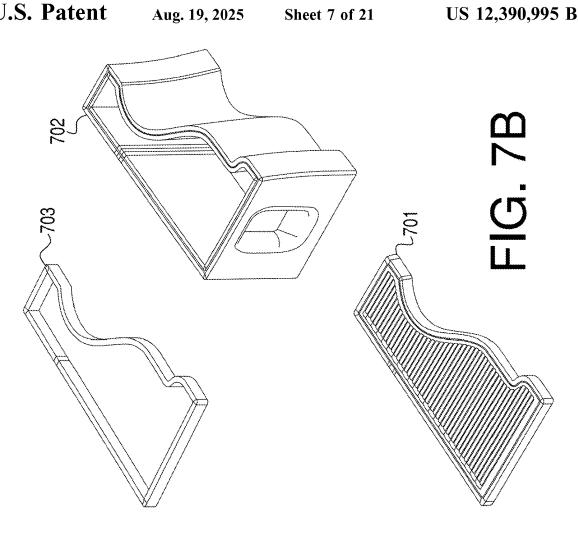


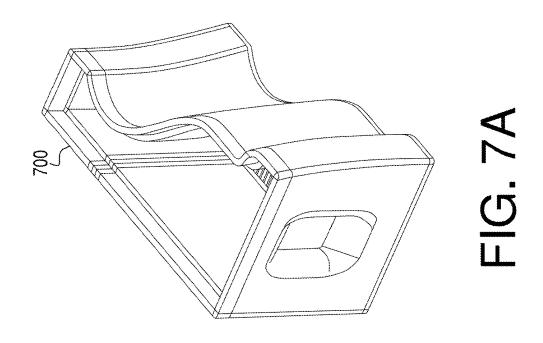


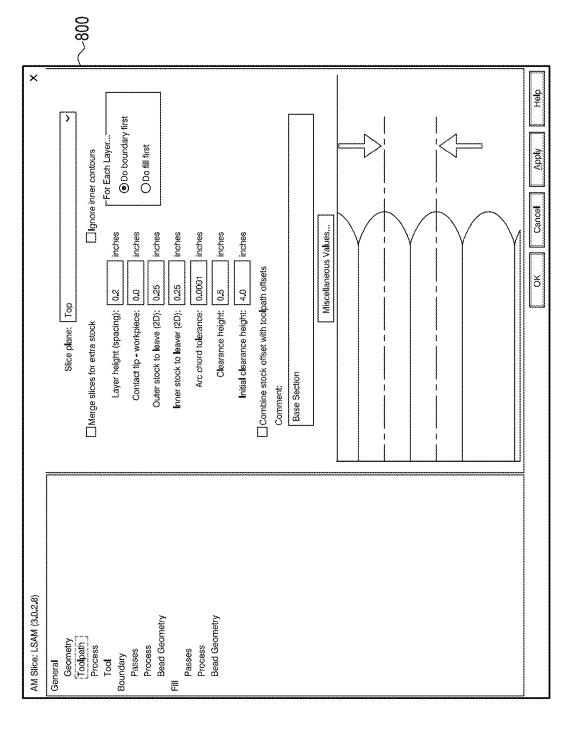


## FG. 8

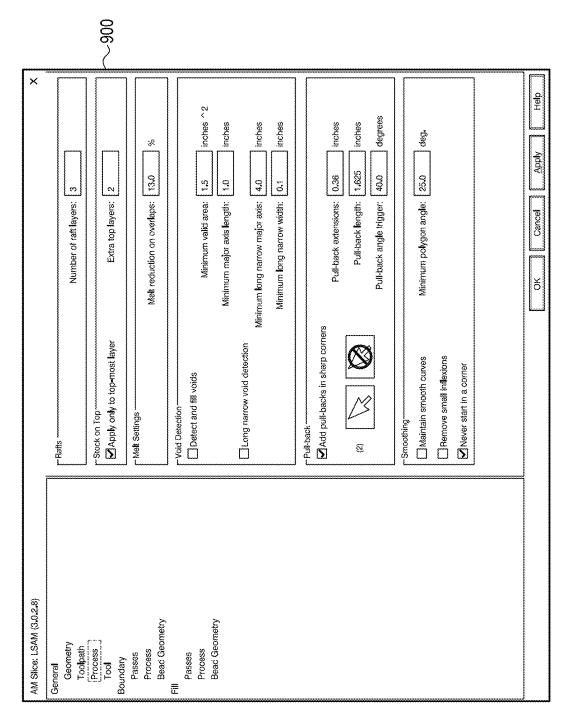

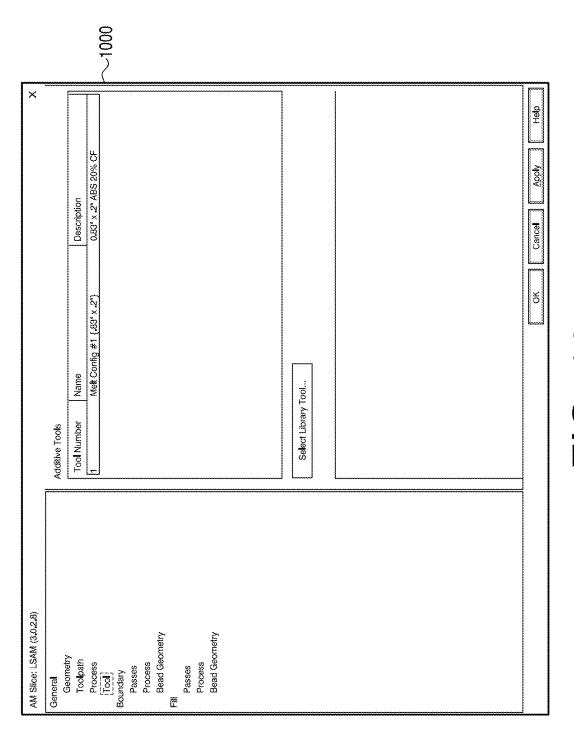

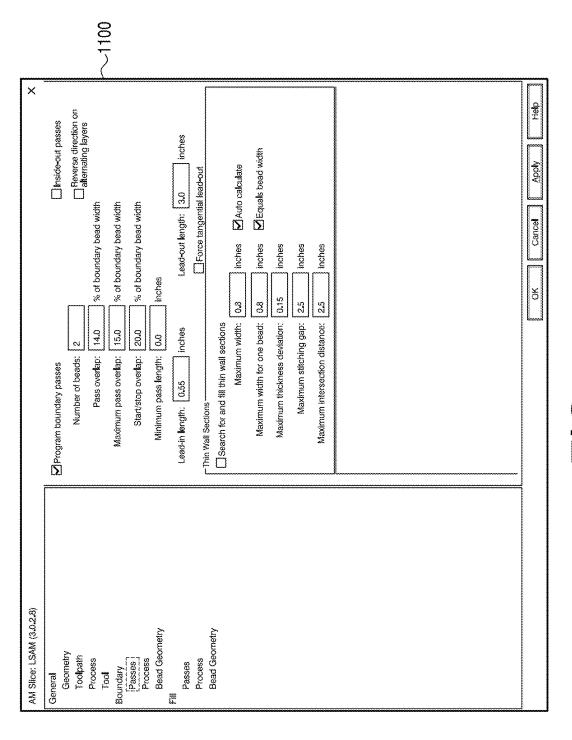

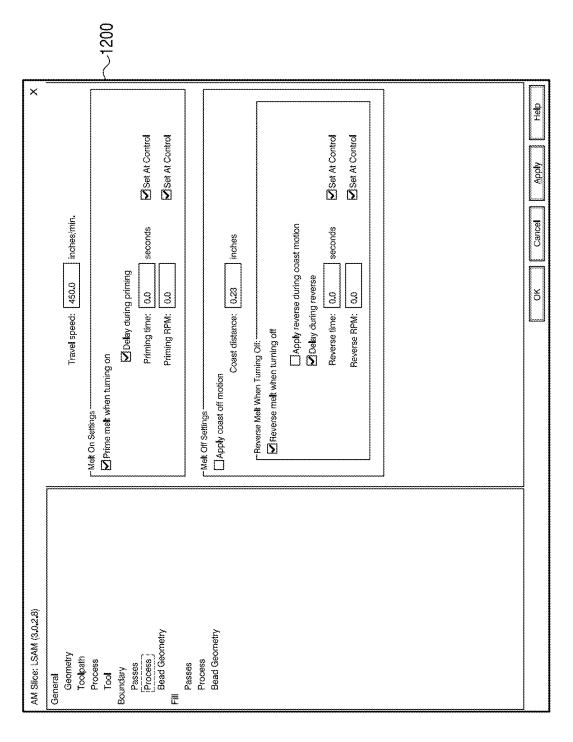

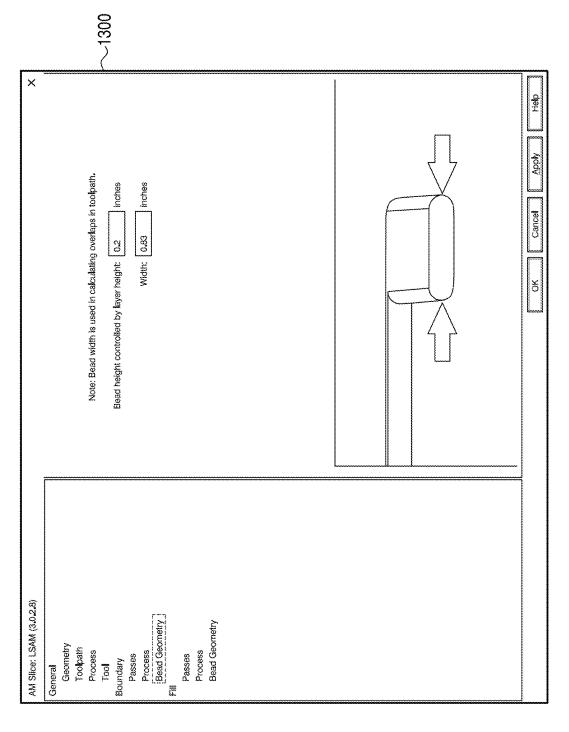


FIG. 13

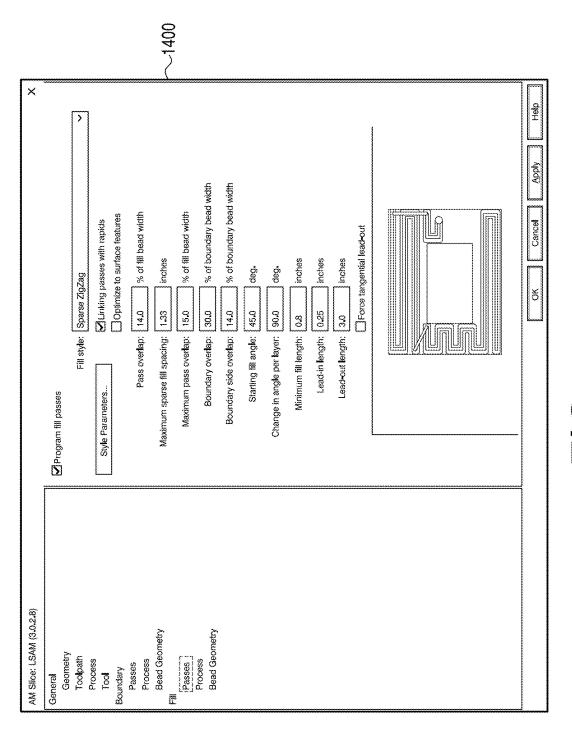


FIG. 14

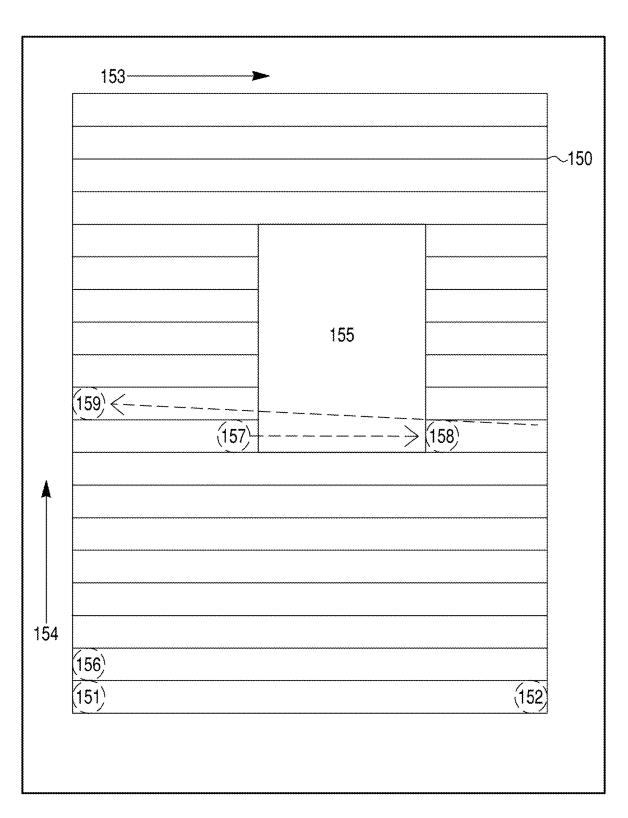


FIG. 15

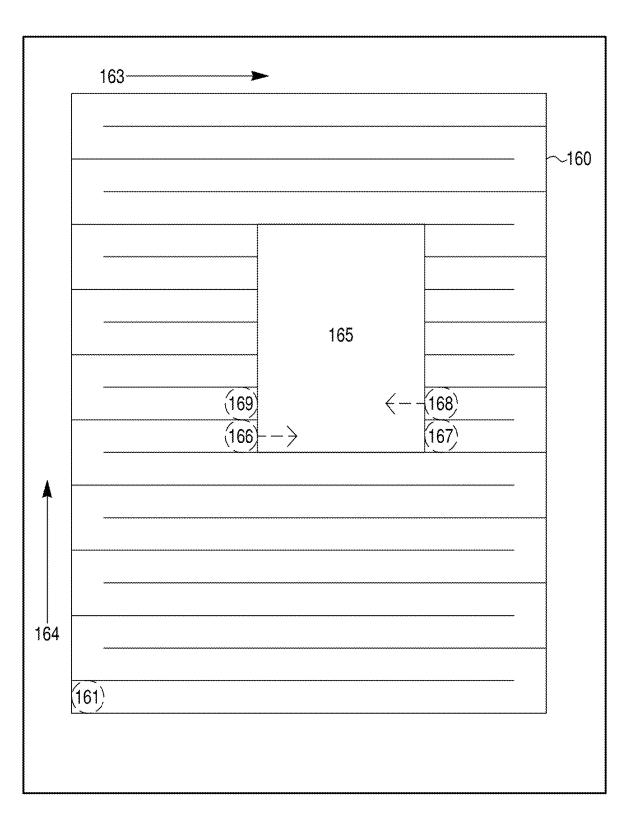


FIG. 16

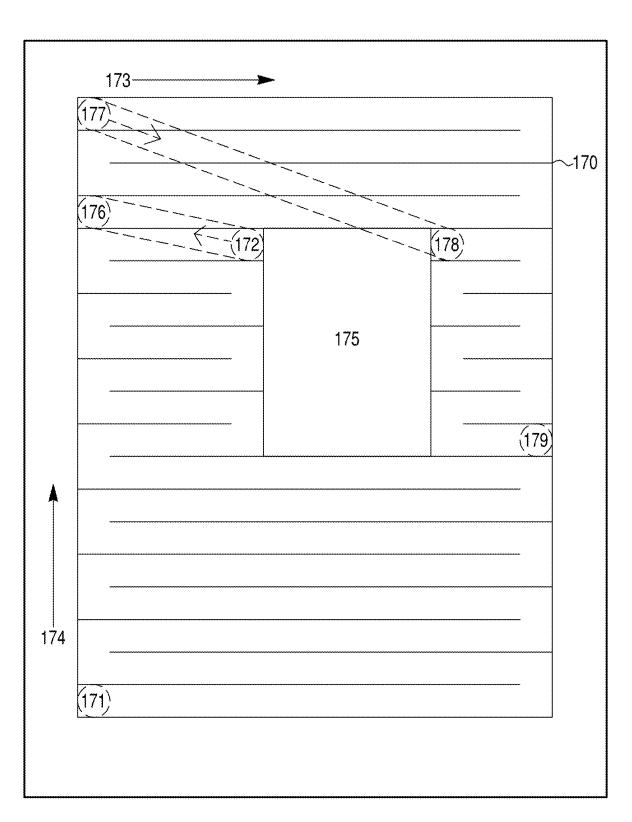
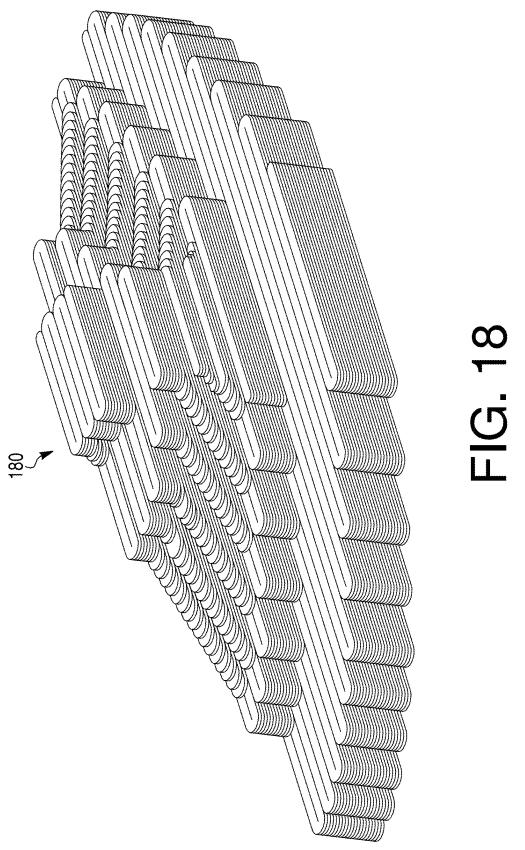


FIG. 17



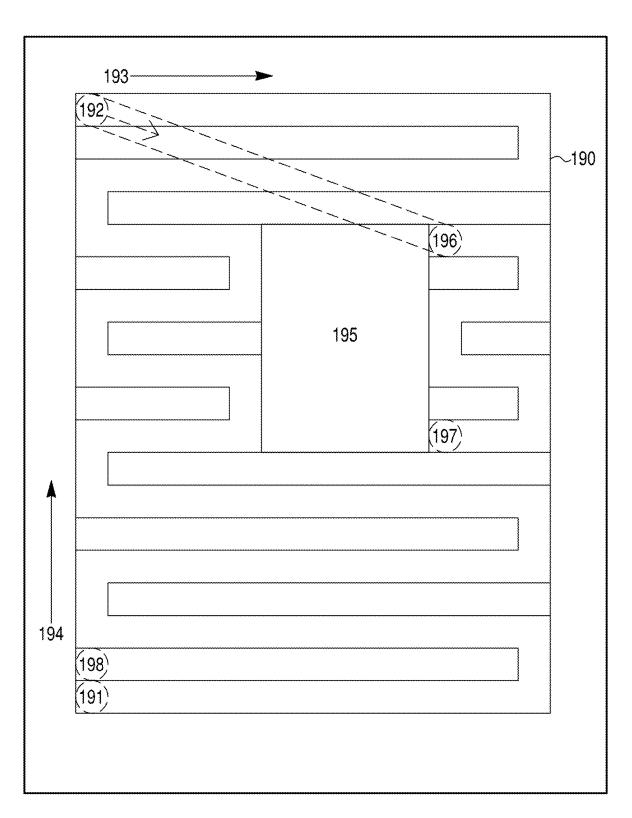


FIG. 19

Fill Style Parameters X	
Fillet radius on path corners: 0.0 0-49% of geometry	
Melt output reduction in corners: 0.0 % of fill output	
Travel speed on corners: 30.0 inches/ min.	
☑ Same as fill passes travel speed	
Fill line and Boundary Interaction (Boundary passes must be active)	
Max. end overlap distance: 0.25 inches	
Min. side overlap distance: 0.25 inches	~200
Linking turns (Boundary passes must be inactive)  Place fill turns outside part boundary	
Limit to fill line matching: 0.0 inches	
Fill line extension before turn: 0.0 inches	
Fill Tolerances	
Step tolerance: 0.0175 inches	
Angle tolerance: 5.0 degrees	

FIG. 20

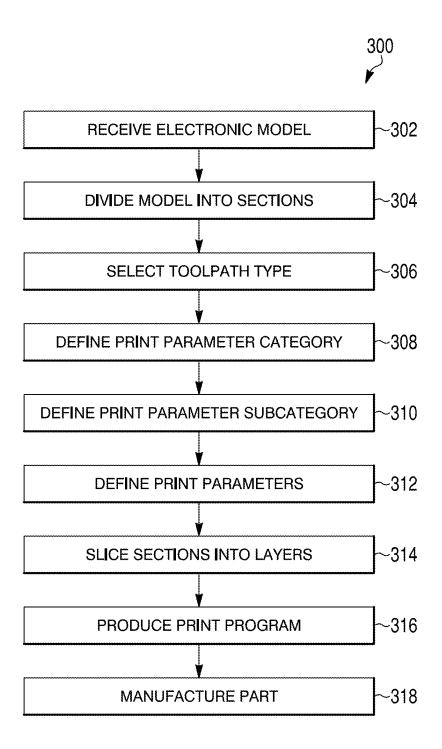


FIG. 21

## SYSTEMS AND METHODS FOR PRINTING COMPONENTS USING ADDITIVE MANUFACTURING

## CROSS-REFERENCE TO RELATED APPLICATIONS

This patent application is a continuation of and claims the benefit of priority to U.S. patent application Ser. No. 18/897, 887, filed on Sep. 26, 2024, which is a continuation of and claims the benefit of priority to U.S. patent application Ser. No. 18/352,882, filed on Jul. 14, 2023, which issued as U.S. Pat. No. 12,115,726, on Oct. 15, 2024, which is a continuation of and claims the benefit of priority to U.S. patent  $_{15}$ application Ser. No. 17/645,549, filed on Dec. 22, 2021, which issued as U.S. Pat. No. 11,724,453, on Aug. 15, 2023, which is a continuation of and claims the benefit of priority to U.S. patent application Ser. No. 17/225,769, filed on Apr. 8, 2021, which issued as U.S. Pat. No. 11,235,524, on Feb. 20 1, 2022, which is a continuation of and claims the benefit of priority to U.S. patent application Ser. No. 16/856,457, filed on Apr. 23, 2020, which issued as U.S. Pat. No. 10,981,330, on Apr. 20, 2021, which is a continuation of and claims the benefit of priority to U.S. patent application Ser. No. 16/186, 25 involve a two-step process. This two-step process, com-053, filed on Nov. 9, 2018, which issued as U.S. Pat. No. 10,668,664, on Jun. 2, 2020, the entireties of which is incorporated herein by reference.

## TECHNICAL FIELD

Aspects of the present disclosure relate to apparatus and methods for fabricating components. In some instances, aspects of the present disclosure relate to apparatus and methods for fabricating components (such as, e.g., automo-35 bile parts, medical devices, machine components, consumer products, etc.) via additive manufacturing techniques or processes, such as, e.g., three-dimensional (3D) printing.

## **BACKGROUND**

Additive manufacturing techniques and processes generally involve the buildup of one or more materials, e.g., layering, to make a net or near net shape (NNS) object, in contrast to subtractive manufacturing methods. Though 45 "additive manufacturing" is an industry standard term (ASTM F2792), additive manufacturing encompasses various manufacturing and prototyping techniques known under a variety of names, including, e.g., freeform fabrication, 3D printing, rapid prototyping/tooling, etc. Additive manufac- 50 turing techniques may be used to fabricate simple or complex components from a wide variety of materials. For example, a freestanding object may be fabricated from a computer-aided design (CAD) model.

A particular type of additive manufacturing is commonly 55 known as 3D printing. One such process commonly referred to as Fused Deposition Modeling (FDM) or Fused Layer Modeling (FLM) comprises melting a thin layer of thermoplastic material, and applying this material in layers to produce a final part. This is commonly accomplished by 60 passing a continuous thin filament of thermoplastic material through a heated nozzle, or by passing thermoplastic material into an extruder with an attached nozzle, which melts and applies the melted thermoplastic material to a structure being printed, building up the structure. The melted ther- 65 moplastic material may be applied to the existing structure in layers, melting and fusing with the existing material (e.g.,

the previously deposited layers of the melted thermoplastic material of the structure), to produce a solid finished part.

The filament used in the aforementioned process may be produced, for example, using an extruder, which may include a steel extruder screw configured to rotate inside of a heated steel barrel. Thermoplastic material in the form of small pellets may be introduced into one end of the rotating screw. Friction from the rotating screw, combined with heat from the barrel may soften the thermoplastic material, which may then be forced under pressure through a small round opening in a die that is attached to the front of the extruder barrel. In doing so, a "string" of material may be extruded, after which the extruded string of material may be cooled and coiled up for use in a 3D printer or other additive manufacturing system.

Melting a thin filament of material in order to 3D print an item may be a slow process, which may be suitable for producing relatively small items or a limited number of items. The melted filament approach to 3D printing may be too slow to manufacture large items. However, the fundamental process of 3D printing using molten thermoplastic materials may offer advantages for the manufacture of larger parts or a larger number of items.

In some instances, the process of 3D printing a part may monly referred to as near-net-shape, may begin by printing a part to a size slightly larger than needed, e.g., printing using a larger bead, then machining, milling, or routing the part to the final size and shape. The additional time required 30 to trim the part to a final size may be compensated for by the faster printing process.

A common method of additive manufacturing, or 3D printing, may include forming and extruding a bead of flowable material (e.g., molten thermoplastic), applying the bead of material in a strata of layers to form a facsimile of an article, and machining the facsimile to produce an end product. Such a process may be achieved using an extruder mounted on a computer numeric controlled (CNC) machine with controlled motion along at least the x-, y-, and z-axes. In some cases, the flowable material, such as, e.g., molten thermoplastic material, may be infused with a reinforcing material (e.g., strands of fiber or a combination of materials) to enhance the material's strength.

The flowable material, while generally hot and pliable, may be deposited upon a substrate (e.g., a mold), pressed down or otherwise flattened to some extent, and leveled to a consistent thickness, e.g., by means of a tangentially compensated roller. The roller may be mounted in or on a rotatable carriage, which may be operable to maintain the roller in an orientation tangential, e.g., perpendicular, to the deposited material (e.g., a print bead or beads). In some embodiments, the roller may be smooth and/or solid. The flattening process may aid in fusing a new layer of the flowable material to the previously deposited layer of the flowable material. The deposition process may be repeated so that each successive layer of flowable material is deposited upon an existing layer to build up and manufacture a desired component structure. In some instances, an oscillating plate may be used to flatten the bead of flowable material to a desired thickness, thus effecting fusion to the previously deposited layer of flowable material. In order to achieve proper bonding between printed layers, the temperature of the layer being printed upon must cool, and solidify sufficiently to support the pressures generated by the application of a new layer. The layer being printed upon must also be warm enough to fuse with the new layer. When executed properly, the new layer of flowable material may be depos-

ited at a temperature sufficient to allow the new layer to melt and fuse with the new layer, thus producing a solid part.

Some CNC programs may generate a print program including a tool path for each layer using a "slicing process". The slicing process may divide or "slice" a computer model 5 of the part to be printed into layers. Typically, slicing processes divide a part into layers having approximately the same print parameters. For example, the slicing process may use a constant thickness for each layer, e.g., a thickness approximately equal to the thickness of the print bead. After 10 dividing the part into layers, a tool path for each layer is generated such that the tool path guides the beads of material being deposited to reproduce the shape of each layer. That is, the tool path directs movement of a nozzle for depositing the material in a layer.

During the slicing process, a number of print parameters for each layer may be taken into account such as, e.g., a width and/or a thickness of print bead, a width of the perimeter of the part, a start location and a stop location of an applicator head including the nozzle, an infill pattern, and 20 a print speed. For example, slicing processes typically divide parts into layers having constant print parameters. Such slicing processes may be inefficient and limited. For example, by maintaining all printing parameters constant for every layer of a part, typical slicing programs cannot opti- 25 mize print parameters of different sections of a part. It may be desirable, however, to produce a part using different print parameters at separate areas of the part, e.g., printing, an outside perimeter of the part with print beads having dimensions different from the print beads used to form the internal 30 structures of the part.

## **SUMMARY**

things, methods and apparatus for fabricating components via additive manufacturing or 3D printing techniques. Each of the aspects disclosed herein may include one or more of the features described in connection with any of the other disclosed aspects. In one aspect, the present disclosure 40 relates to systems and methods for dividing a model of a part into layers, each layer including print parameters, and using additive manufacturing to create the part.

When preparing a CAD model of a part to be printed, traditional methods may include generating models of an 45 outside shape and any interior structures of the part. The models for the outside shape and the interior structures may be generated separately. Each of the models may then divided, or sliced, into a number of layers. Subsequently, tool paths may be determined for the layers to develop a 50 printing program or process to manufacture the sections of the outside shape and the interior structures. After printing, each section separately, the sections may be assembled into the part. After assembly, a final print process may be executed to complete the part.

Alternatively, according to the present disclosure, a slicing process may divide the part to be printed into multiple sections, each with its own unique print parameters, before slicing the sections into layers. Each of these sections may be configured to be printed as part of a single printing 60 process. In some examples, the sections may be processed by the slicing process so that the sections to fuse together when printed.

The print process developed from such a slicing process may begin by printing on a workpiece a first layer of a first 65 section according to one or more print parameters. Then a first layer of a second section may be printed according to

print parameters different and/or distinct from those used to print the first layer of the first section. The printing process may continue to repeat the steps of adjusting the printing parameters and printing a first layer for any subsequent sections. Upon completing the printing of the first layer of each section, the steps may be repeated for any additional layers of each section until all sections have been printed. Additionally, or alternatively, the printing process developed from the slicing process may print the layers of the first section interspersed with printing layers of the second section, e.g., one or more layers of the first section may be printed before printing a layer of the second piece.

A print position of each section of the part processed by the slicing process may be adjusted so that areas where the sections are designed to fuse together are located in sufficient proximity for the print beads of each section to overlap sufficiently to joining the sections together.

In some examples, a section processed by the slicing process may be located at a distance above the worktable instead of directly on the worktable. For example, an elevated section may be located atop a base section. In this case, the first layer of the elevated section may not be printed until a collective height of the layers that have been printed reaches the height above the worktable equal to the first layer of the elevated section. In this way, the base section (and any intervening sections) may be printed until the layers of the base section (and any intervening sections) reach the vertical location of the elevated section, and then the elevated section may be printed on top of the base section. By locating sections at varying heights above the worktable, the slicing process may increase the ability to optimize the printing process for each section.

By processing parts section-by-section the slicing process Aspects of the present disclosure relate to, among other 35 may increase the ability to utilize advanced design tools when positioning a section for printing. For example, a wall of one (e.g., a first) section may serve as a wall of a second section, thereby eliminating the requirement of positioning a wall of the first section sufficiently adjacent to a wall of the second section so that the walls mesh together.

In one embodiment of the present disclosure, a method of forming a part using additive manufacturing may include receiving, at a computer numeric controlled (CNC) machine, a computer aided design (CAD) model of the part. The method may further include dividing the CAD model into plurality of sections. The method may further include slicing each of the plurality of sections into a plurality of layers. Each section may include a distinct set of print parameters. The method may further include depositing a flowable material onto a worktable according the set of print parameters for each section of the of the plurality of sections to manufacture the part.

In an additional or alternative embodiment of the present disclosure, a method of forming a part using additive manu-55 facturing may include receiving at an electronic device, a computer aided design (CAD) model of the part. The method may further include dividing the CAD model into a first section and a second section. The method may further include selecting a first set of print parameters for the first section. The method may further include selecting a second set of print parameters for the second section. The first set of print parameters may be different from the second set of print parameters. The method may further include slicing the first section into a first set of layers and slicing the second section into a second set of layers. The method may further include depositing a flowable material onto a surface according the first set of print parameters and the second set of print

parameters. The first set of layers and the second set of layers may be deposited so as to be interspersed with one another.

In an additional or alternative embodiment of the present disclosure, a method of forming a part using additive manufacturing may include receiving at an electronic device, a computer aided design (CAD) model of the part. The method may further include dividing the CAD model into a plurality of sections. The method may further include slicing each of the plurality of sections into a plurality of layers. 10 Each layer may have a plurality of print parameters. The method may further include depositing a flowable material onto a substrate according to the plurality of print parameters for each of the plurality of layers. The plurality of sections may include a first section and a second section. The 15 first section and the second section may each include a set of layers of the plurality of layers. The print parameters of the set of layers of the first section may differ from the print parameters of the set of layers of the second section.

As used herein, the terms "comprises," "comprising," or 20 any other variation thereof, are intended to cover a non-exclusive inclusion, such as a process, method, article, or apparatus. The term "exemplary" is used in the sense of "example," rather than "ideal." As used herein, the terms "about," "generally," "substantially," and "approximately," 25 indicate a range of values within +/-5% of the stated value unless otherwise stated. As used herein, the term "part" refers to a finished product of the printing process. Each part may comprise one or more sections. As used herein the term "section" refers to a portion or division of a part. For 30 example a section may be a plurality of layers of a part, a quadrant, hemisphere, or other division of the part, an internal structure of a part, or an outside structure of a part.

It may be understood that both the foregoing general description and the following detailed description are exemplary and explanatory only and are not restrictive of the disclosure, as claimed.

## BRIEF DESCRIPTION OF THE DRAWINGS

The accompanying drawings, which are incorporated in and constitute a part of this specification, illustrate exemplary aspects of the present disclosure and together with the description, serve to explain the principles of the disclosure.

- FIG. 1 is a perspective view of an exemplary CNC 45 machine operable pursuant to an additive manufacturing process to form articles or parts, according to an aspect of the present disclosure;
- FIG. 2 is an enlarged perspective view of an exemplary carrier and applicator head assembly of the exemplary CNC 50 machine shown in FIG. 1;
- FIG. 3 is an enlarged cutaway view of an exemplary applicator head assembly shown in FIG. 2;
- FIG. 4 is an exemplary screen shot of a graphical user interface for selection of a toolpath type for use in the slicing 55 process;
- FIG. 5 is an exemplary screen shot of a graphical user interface prompting the input of print parameters of a geometry subcategory;
- FIG. **6** is a perspective view of an exemplary part manufactured using a printing process generated by the slicing process of the present disclosure;
- FIG. 7A is a perspective view of an additional exemplary part manufactured using a printing process generated by the slicing process of the present disclosure;
- FIG. 7B is an exploded view of the exemplary part of FIG. 7A, illustrating the various subsections thereof;

6

- FIG. 8 is an exemplary screen shot of a graphical user interface prompting input of print parameters of the toolpath subcategory of the general category;
- FIG. 9 is an exemplary screen shot of a graphical user interface prompting input of print parameters of the process subcategory of the general category;
- FIG. 10 is an exemplary screen shot of a graphical user interface prompting input of print parameters of the tool subcategory of the general category;
- FIG. 11 is an exemplary screen shot of a graphical user interface prompting input of print parameters of a passes subcategory of a boundary category;
- FIG. 12 is an exemplary screen shot of a graphical user interface prompting input of print parameters of a process subcategory of a boundary category;
- FIG. 13 is an exemplary screen shot of a graphical user interface prompting input of print parameters of a bead geometry subcategory of the boundary category;
- FIG. **14** is an exemplary screen shot of a graphical user interface prompting input of print parameters of the passes subcategory of a fill category;
- FIG. 15 is a top view diagram of an exemplary fill path generated using a one-way fill style;
- FIG. 16 is a top view diagram of an exemplary fill path generated using a simple zigzag fill style;
- FIG. 17 is a top view diagram of an exemplary fill path generated using a smart zigzag fill style;
- FIG. 18 is a top view diagram of an exemplary fill path generated using a smart zigzag constant overlap fill style;
- FIG. 19 is a top view diagram of an exemplary fill path generated using a sparse zigzag fill style;
- FIG. 20 is an exemplary screen shot of a graphical user interface for the input of fill style parameters; and
- FIG. 21 is a flowchart of a method of executing the slicing process and manufacturing a part.

## DETAILED DESCRIPTION

The present disclosure is drawn to, among other things, methods and apparatus for fabricating components, parts, or articles via additive manufacturing such as, e.g., 3D printing. Specifically, the methods and apparatus described herein may be drawn to a method of dividing a part into sections and layers.

For purposes of brevity, the methods and apparatus described herein will be discussed in connection with the fabrication of parts from thermoplastic materials. However, those of ordinary skill in the art will readily recognize that the disclosed apparatus and methods may be used with any flowable material suitable for additive manufacturing.

Referring to FIG. 1, there is illustrated a CNC machine 1 embodying aspects of the present disclosure. CNC machine 1 may include a controller 100 operatively connected to CNC machine 1 for displacing an applicator head 43 (see FIG. 2) along a longitudinal line of travel, or x-axis, a transverse line of travel, or a y-axis, and a vertical line of travel, or z-axis, in accordance with a program, (e.g., a print program or process) inputted or loaded into the controller 100 for performing an additive manufacturing process to form a desired component or part, as will be described in further detail below. Controller 100 may include a display 101 (e.g., screen) and an input portion 102, as schematically illustrated in FIG. 1. Optionally, input portion 102 may include one or more of a keyboard, buttons, joystick, mouse, or the like, for entry of data by a user. Optionally, display 101 may be a touch screen display in which data and/or user

selections may be directly input to controller 100. In such a case, controller 100 may not include input portion 102.

CNC machine 1 may be configured to print or otherwise build 3D parts from digital representations of the 3D parts (e.g., AMF and STL format files). For example, in an 5 extrusion-based additive manufacturing system (e.g., a 3D printing machine), a 3D part may be printed from a digital representation of the 3D part in a layer-by-layer manner by extruding a flowable material (e.g., thermoplastic material with or without reinforcements). With reference to FIG. 2, 10 the flowable material may be extruded through an extrusion tip or nozzle 51 carried by and applicator head 43 of the CNC machine 1, and the flowable material may be deposited as a sequence of beads or layers on a substrate in an x-y plane. The extruded, flowable material may fuse to a pre- 15 viously deposited layer of material and may solidify upon a drop (e.g., decrease) in temperature. The position of applicator head 43 relative to the substrate may then be incrementally advanced along a z-axis (perpendicular to the x-y plane), and the process may then be repeated to form a 3D 20 may include a housing 46 having a rotary union mounted part resembling the digital representation.

CNC machine 1, as shown in FIG. 1, includes a bed 20 provided with a pair of transversely spaced side walls 21 and 22, a printing gantry 23 and a trimming gantry 36 supported on opposing side walls 21 and 22, a carriage 24 mounted on 25 printing gantry 23, a carrier 25 mounted on carriage 24, an extruder 61 having and extruder screw (not shown), and the applicator head (also referred herein as an applicator assembly) 43 mounted on carrier 25. Located on bed 20 between side walls 21 and 22 is a worktable 27 provided with a 30 support surface. The support surface may be disposed in an x-y plane and may be fixed, or displaceable, along an x-axis and/or a y-axis. For example, in a displaceable version, worktable 27 may be displaceable along a set of rails mounted to bed 20. Displacement of worktable 27 may be 35 achieved using one or more servomotors and one or more of guide rails mounted on bed 20 and operatively connected to worktable 27. Printing gantry 23 is disposed along the y-axis, supported on side walls 21 and 22. In FIG. 1, printing which are located along a top surface of side walls 21 and

Printing gantry 23 may either be fixedly or displaceably mounted, and in some aspects, printing gantry 23 may be disposed along the x-axis. In an exemplary displaceable 45 version, one or more servomotors may control movement of printing gantry 23. For example, one or more servomotors may be mounted on printing gantry 23 and operatively connected to tracks, e.g., guide rails 28, 29, provided on the side walls 21 and 22 of bed 20.

Carriage 24 is supported on printing gantry 23 and is provided with a support member 30 mounted on and displaceable along one or more guide rails 31, 32 and 33 provided on printing gantry 23. Carriage 24 may be displaceable along a y-axis on one or more guide rails 31, 32 55 and 33 by a servomotor mounted on the printing gantry 23 and operatively connected to support member 30. Carrier 25 is mounted on one or more vertically disposed guide rails 34 and 35 supported on carriage 24 for displacement of carrier 25 relative to carriage 24 along the z-axis. Carrier 25 may be 60 displaceable along the z-axis by a servomotor mounted on carriage 24 and operatively connected to carrier 25

As best shown in FIG. 2, also fixedly mounted to the bottom of carrier 25) is a positive displacement gear pump 62 (e.g., melt pump), which may be driven by a servomotor 65 63, through a gearbox 64. Said gear pump 62 receives molten plastic from extruder 61, shown in FIG. 1. A com-

pression roller 59, rotatable about a nonrotatable (e.g., fixed) axle 73, for compressing deposited flowable material (e.g., thermoplastic material) may be mounted on a carrier bracket 47. Roller 59 may be movably mounted on carrier bracket 47, for example, rotatably or pivotably mounted. Roller 59 may be mounted so that a center portion of roller 59 is aligned with a nozzle 51 of applicator head 43, and roller 59 may be oriented tangentially to nozzle 51. Roller 59 may be mounted relative to nozzle 51 so that material, e.g., one or more beads of flowable material (such as thermoplastic resins), discharged from nozzle 51 are smoothed, flattened, leveled, and/or compressed by roller 59, as depicted in FIG. 3. One or more servomotors 60 may be configured to move, e.g., rotationally displace, carrier bracket 47 via a pulley 56 and belt 65 arrangement. In some embodiments, carrier bracket 47 may be rotationally displaced via a sprocket and drive-chain arrangement (not shown), or by any other suitable mechanism.

With continuing reference to FIG. 3, applicator head 43 therein. Such a rotary union may include an inner hub 76 rotatably mounted within and relative to an outer housing 75. For example, inner hub 76 may rotate about a longitudinal axis thereof relative to outer housing 75 via one or more roller bearings 49. Carrier bracket 47 may be mounted, e.g., fixedly mounted to inner hub 76, journaled in roller bearing 49. Roller bearing 49 may allow roller 59 to rotate about nozzle 51.

As shown in FIGS. 2-3, an oversized molten bead of a material 53 (e.g., a thermoplastic material) under pressure from a source disposed on carrier 25 (e.g., one or more of extruder 61 and an associated polymer or gear pump 62) may be flowed to applicator head 43, which may be fixedly (or removably) connected to, and in communication with nozzle 51. In use, material 53 (e.g., melted thermoplastic material) may be heated sufficiently to form a large molten bead thereof, which may be delivered through applicator nozzle 51 to form multiple rows of deposited material 53 on a surface of worktable 27. In some embodiments, beads of gantry 23 is mounted on the set of guide rails 28 and 29, 40 molten material deposited by nozzle 51 may be substantially round in shape prior to being compressed by roller 59. Exemplary large beads may range in size from approximately 0.4 inches to over 1 inch in diameter. For example, a 0.5 inch bead may be deposited by nozzle 51 and then flattened by roller 59 to a layer approximately 0.2 inches thick by approximately 0.83 inches wide. Such large beads of molten material may be flattened, leveled, smoothed, and/or fused to adjoining layers by roller 59.

> As mentioned above, CNC machine 1 may be controlled via a program, e.g. a print program to produce a part. The print program may be part of, or generated from, a slicing process.

> The slicing process may receive a CAD model (or models) of the part to be printed and slice the part into sections having a plurality of layers, each section having their own print properties, for printing. The CAD model may be a 3D or 2D representation of the part to be printed. In some examples, the CAD model may include a model of an outside shape of the part and separate models of each interior structure of the part. The slicing process may simplify the CAD model which may allow the print process to be optimized. In some aspects of the present disclosure, the part is processed by the slicing process as multiple sections, each section having unique print parameters. These sections may be printed so that the individual sections or sections join together to form the part. The slicing process may assemble the sections and/or layers into a print program or process to

manufacture the part to be printed. The slicing process may execute or transmit the print program to CNC machine 1 to print or otherwise manufacture the part.

The slicing process may be executed by a user via controller 100 of CNC machine 1 or an external computing 5 device having a controller, e.g., a processor or microprocessor. Exemplary computing devices include, but are not limited to, a desktop computer or workstation, a laptop computer, a mobile handset, a personal digital assistant ("PDA"), a smart phone, a server, or any combination of 10 these or other computing devices having a display, at least one controller (e.g. a processor or microprocessor), a memory, and one or more input devices. The user input device(s) may include any type or combination of input/output devices, such as, e.g., a keyboard, a touchpad, a 15 mouse, a touchscreen, a camera, a stylus, and/or a scanner (e.g., a laser scanner).

The disclosed slicing process may include a user viewing, inputting, or otherwise executing the slicing process via a graphical user interface ("GUI" or "interface") displayed by 20 controller 100 (e.g., via display 101) and/or another electronic device. The interface may include one or prompts and/or other elements allowing or requesting that the user to input, select, or otherwise determine parameters of the slicing process. Prompts for user input may include, but are 25 not limited to, links, buttons, images, check boxes, radio buttons, text boxes, and menus. As used herein, a print parameter referred to as "a selection" by the user may include the user selecting a value from a number of preset values, checking a check box, clicking a radio button, or 30 otherwise making a selection using one or more prompts.

Turning now to FIG. 4, an interface 400 may present the user with a part model viewer and a part model slice viewer. The part model viewer may allow the user to digitally assemble a part model of the individual sections of a part to 35 be printed, or of the whole part (e.g., including the individual sections merged together). The part model slice viewer may allow the user to view the CAD model slice-by-slice for each section or the part to be produced as a whole. Additionally, the part model slice viewer may permit the user to view a net 40 model, a print tool path, or a physical print beads model of the section or part to be printed. The user may reference the print model viewer and/or the part model slice viewer before, during, or after executing the slicing process.

Interface 400 may include a prompt, e.g., an additive 45 manufacturing toolbar 402, for a user to select a toolpath type and/or other parameters of the slicing and printing processes. The toolpath types may specify the slicing process corresponding to the CAD model(s). The toolpath types may further define how the CAD model(s) of the part to be 50 printed are divided into sections, and how each section is further divided into layers via the slicing process. Exemplary tool path types may include an AM Slice type, an AM Outline type, and an AM Surface Outline type. The AM Slice toolpath type may specify that the slicing process 55 includes dividing a CAD model of solids, surfaces, or polygonal mesh into cross sectional layers, each layer having a thickness determined in part based on the layer height (e.g., spacing) printing parameter. The AM Outline toolpath type may specify that the slicing process includes receiving 60 a 2D line drawing of the part or section to produce a layer or multiple layers that follow the path of the line drawing. Using the AM Outline toolpath type, the total number of layers and layer height produced by the slicing process may be determined based a parameter input by the user. The AM 65 Surface toolpath type may specify that the CAD model(s) include a 2D line drawing of the part or section, and that the

10

drawing is divided into a layer or multiple layers that follow the path of the solids, surfaces, or polygonal mesh. The number of layers in height produced by the AM Surface Outline toolpath type may be determined based on a height of the section or part. Interface 400 may include an AM Z Merge selection for combining toolpaths. The AM Z Layer Merge selection may combine each of the different toolpaths (and their respective print parameters) as generated by the slicing process into a single printing process for all sections and/or layers of the part to be printed. Thus, the slicing process may receive electronic models, e.g., CAD models, having multiple types of geometries, such as, e.g., solids, surfaces, polygonal mesh, and 2D drawings to produce and/or execute a printing process for manufacturing the part.

Once the toolpath type has been selected, a category of print parameters may be selected. The categories of print parameters may include, but are not limited to, general, boundary, and fill. In some examples, the selected tool path type may determine the print parameter categories that may be defined by the user. For example, the AM Outline and/or AM Surface Outline may not include a fill category.

FIG. 5 depicts a user interface 500 prompting the user to input values or otherwise specify the print parameters of a geometry subcategory within the general category. The geometry subcategory may include print parameters such as a tessellation chord tolerance parameter, a containment boundaries parameter, a Z limits parameter, a toolpath start locations parameter, and a seam avoidance offset parameter. The tessellation chord tolerance parameter is a value indicative of the accuracy with which the toolpath follows the contour of the section or part. In some examples, the tessellation chord tolerance parameter may be changed or selected so as to smooth the toolpaths, e.g., by increasing the tessellation chord tolerance parameter. The containment boundaries parameter refers to an inside surface and an outside surface of the part. The area formed between the inside surface and the outside surface may be referred to as the "fill." For example, a donut shaped section may include an inner circle corresponding to the inner surface (e.g., the hole), an outer circle circumferentially surrounding the inner circle and corresponding to the outer surface, and an area formed between the inner circle and the outer circle corresponding to the fill. In some examples, the containment boundaries may have different thicknesses in different areas. For example, with reference to FIG. 6, a part 600 may include a top side 604 having six boundary layers and a bottom side 602 including two boundary layers.

Turning back to FIG. 5, the Z Limits print parameters may include a lower Z material limit and an upper Z material limit. Additionally or alternatively, the interface may include a full part parameter which may be selected so that the lower Z material limit is set at a bottom surface of the section being printed and an upper Z material limit defined a distance from the bottom surface to a surface having the greatest height from the bottom surface. The distance between the lower Z material limit and the upper Z material limit may define a range of heights for which layers of the section may be determined by the slicing process. The Z limits print parameters may enable users to select an entire electronic model (e.g., CAD model/drawing) of a part or a section of the part defined between the lower Z material limit and the upper Z material limit for processing via the slicing process. For example, the section of the CAD model may be defined as any portion of the CAD model having a height above the worktable 27 that is 2 inches to 6 inches. Additionally or alternatively, the Z limit print parameters may be defined so that different printing parameters may be applied to separate

heights of the same section. For example a part 700 shown in FIGS. 7A and 7B includes a bottom section 701, a middle section 702, and a top section 701, each section defined by Z limits print parameters of varying heights. Further, each of the bottom section 701, the middle section 702, and the top section 703 has different print parameters, e.g., different boundary layers and fill styles. The bottom section 701 has two boundary layers with a fill between the boundary layers. The middle section 702 has two boundary layers. The top section 703 has only one boundary layer.

11

With reference again to FIG. 5, the start point location set of print parameters may include an open toolpath parameter, a close toolpath parameter, and a seam avoidance offset parameter. The open toolpath parameter and the closed toolpath parameter allow the user to select geometry to 15 define where the toolpath starts on any given layer. The seam avoidance offset parameter is a distance a start and a stop seam location are offset from one another between print layers.

In addition to the geometry subcategory, the general 20 category may include a toolpath subcategory. FIG. 8 shows an exemplary interface 800 through which a user may input values for the print parameters included in the toolpath subcategory. The toolpath subcategory may include print parameters or sets of print parameters such as, e.g., a slice 25 plane parameter, a merge slices for extra stock parameter, an ignore inner contours parameter, a layer order parameter, a layer height (spacing) parameter, a contact tip-workpiece parameter, an outer stock to leave (2D) parameter, an inner stock to leave (2D) parameter, an arc chord tolerance param- 30 eter, a clearance height parameter, an initial clear height parameter, and a combine stock offset with toolpath offsets parameter. The slice plane parameter defines a plane from which the CAD model will be sliced. The slice plane parameter may be selected from a number of preset values, 35 such as, e.g., top, side, etc. Additionally or alternatively, the slice plane parameter may be determined by controller 100 or input by the user. The merge slices for extra stock parameter may compare an outline of a slice of a layer selected by the user (the "selected layer") to an outline of a 40 layer on which the selected layer will be applied (the "previous layer") and an outline of a layer that will be applied on top of the selected layer (the "subsequent layer"). The merge slices for extra stock parameter may then select the outline having the greatest surface area among the 45 selected layer, the previous layer, and the subsequent layer for use in producing the toolpath for the current layer. The ignore inner contours parameter may be a selection of whether or not the inner contours are removed from consideration during the slicing process. The layer order set of 50 print parameters may be a selection of whether the boundary or fill of each layer is deposited first. The layer height (spacing) print parameter defines a measurement of a thickness of each layer to be produced by the slicing process. The contact tip-workpiece parameter is a distance above work- 55 table 27 at which the applicator head 43 is positioned before beginning the printing process.

With continued reference to FIG. **8**, the contact-tip work-piece parameter is measured relative to the Z limits. For example, if the lower Z material limit is defined as 2 inches, 60 a value of -2 inches may be input to define the contact tip-workpiece print parameter to position the applicator head **43** on the worktable **27**, instead of 2 inches above the worktable **27**, when beginning the print process. The outer stock to leave (2D) parameter is a distance the bead being 65 deposited is offset from an outside surface of the outside contour of the section being printed. The inner stock to leave

12

parameter is a distance the bead being deposited is offset from an inside surface of the inside contour of the section. The arc chord tolerance parameter is a distance controlling the fit of the arcs of the applicator head 43 to the toolpath. In some examples, the arc chord tolerance parameter may be adjusted or selected to smooth out the toolpath. For example, decreasing the value of the arc chord tolerance may produce arcs over the toolpath having a smoother shape. The clearance height parameter is a height above worktable 27. The applicator head 43 moves to this height between printing separate layers. The initial clearance height parameter is a height above worktable 27 to which applicator head 43 moves before initiating the printing process. The combine stock offset with toolpath offset parameter is a selection that determines whether the distances of the stock offset and the toolpath offset are combined into a single value when executing the slicing process.

FIG. 9 depicts a user interface 900 that allows the user to input values or otherwise specify print parameters included in the process subcategory of the general category. Exemplary print parameters within the process subcategory include a rafts parameter, a stock on top parameter, a melt settings parameter, a void detection parameter, a pull-back parameter, and a smoothing parameter. The rafts parameter refers to a number of layers printed before the layers of the part or section being printed are deposited. For example, if the rafts parameter is a value of 2, the applicator head 43 will deposit 2 layers before depositing the first layer of the part or section being printed. The stock on top parameter is a number of layers printed on a top layer of the part or section or part being printed. The top layer is the layer having the greatest Z axis height of the part or section. The top layer does not refer to peak areas of the part or section, e.g., an area of a layer having a height less than another layer, wherein no layers are deposited on top of the area. For example, a part may have a middle layer below the top layer. The middle layer may include a peak, e.g., a portion of the middle layer where no material is deposited. In this example, the stock on top parameter defines the number of layers deposited only on the top layer even though no layers will be deposited on the middle layer at the peak. The melt settings parameter defines the percentage by which the speed of the gear pump (measured in RPM) is reduced on overlapping beads during operation of the CNC machine 1. The melt setting print parameter may be changed to reduce buildup from depositing one bead adjacent to the next. The void detection set of print parameters refer to parameters that define the fill for any voids detected during an analysis of the layers of the part or section performed during the slicing process.

The pull-back parameters include a selection of whether or not to take a pull-back process into account when executing the slicing process, and the corresponding parameters for that pull-back process. A pull-back process may be used to avoid removing excess material from corners of the part. In some examples, if a pull-back process is not used when printing a corner of a part the roller 59 may disengage from the bead. Then, when the roller 59 reengages with the bead, the roller 59 may inadvertently push material away from the corner. The pull-back length parameter is a distance from a corner at which the pull-back process may begin. Upon reaching the distance from the corner specified by the pull-back length parameter, the roller 59 may be moved away from the corner by the distance input for the pull-back extensions parameter. In some examples, pull-back may be referred to as "corner-pull-back." The smoothing print parameters may include a maintain smooth curves param-

eter, a remove small polygons parameter, a never start in a corner parameter, and a minimum polygon angle parameter. The smoothing print parameters may alter or adjust the toolpaths of a part or section to smooth any curves.

FIG. 10 depicts a user interface 1000 that allows the user 5 to input values or otherwise specify the print parameters included in the tool subcategory under the general category. The tool subcategory may represent the melt configuration corresponding to the tool used in the printing process. For example, a melt configuration number 1 may correspond to 10 a tool number 1, where melt configuration 1 is described as using a print material comprising 20% carbon fiber filled ABS, a print bead width of 0.83 inches and a print bead thickness of 0.20 inches.

FIG. 11 depicts a user interface 1100 that allows the user 15 to input, select, or otherwise specify the values of the print parameters included in the passes subcategory under the boundary category. The passes subcategory may include print parameters or sets of print parameters such as, e.g., a program boundary passes parameter, an inside-out passes 20 parameter, a reverse direction on alternating layers parameter, a number of beads parameter, a pass overlap parameter, a maximum pass overlap parameter, a start/stop overlap parameter, a minimum pass length parameter, a lead-in length parameter, a lead-out length parameter, a force tan- 25 gential lead-out parameter, and a thin wall sections parameter. The program boundary passes parameter refers a selection of whether or not the toolpath includes boundary passes. The inside-out passes parameter is a selection of whether or not the toolpath starts with an inner-most pass, determined 30 with respect to the layer outline, and progress outwards towards the layer outline. The reverse direction on alternating layers parameter is a selection of whether or not the toolpath reverses direction for every other layer.

The number of beads parameter represents the number of 35 toolpath passes to made by the applicator head 43 along each boundary of the layer outline. The pass overlap parameter specifies a value of the lowest percentage of overlap between adjacent beads (measured as a percentage of the bead width). The maximum pass overlap parameter refers to 40 a maximum distance (measured as a percentage of the bead width) that adjacent print beads will overlap one another. The start/stop overlap parameter is a value corresponding to the percentage of overlap between the beginning and ending of the bead on boundary passes (measured as a percentage 45 of bead width). The lead-in length parameter is a distance that the bead will be deposited along a layer before starting to deposit each boundary pass. The lead-out length parameter is a distance the bead will be deposited measured from the end of each boundary pass. The force tangential lead-out 50 print parameter is a selection determining whether the bead moves tangentially to the toolpath upon completing the toolpath. The thin wall sections set of print parameters may include a maximum width parameter, a search for and fill thin wall sections parameter, a maximum width for one bead 55 parameter, a maximum thickness deviation parameter, a maximum stitching gap parameter, a maximum intersection distance parameter, an auto calculate parameter, and an equals bead width parameter. As defined herein, a thin wall is a portion of a layer of the section or part being printing 60 between two boundaries positioned close to one another. In other words, the two boundaries form a thin wall between them. The set of thin wall sections set of print parameters may be used to identify a thin wall area in a section or section and if and/or how such an area should be filled.

FIG. 12 depicts a user interface 1200 that allows the user to input values or otherwise specify print parameters

category. In some examples the process subcategory for the fill category include the same print parameters as the boundary category. The print parameters of the process subcategory may include a travel speed parameter, a melt on settings set of print parameters, and a melt off settings set of print parameters. The travel speed parameter is a maximum feed rate of the flowable material through the applicator head as it deposits material. The melt on settings set of print parameters may include a prime melt when turning on

14

included in the process subcategory under the boundary

parameters may include a primite ment when turning on parameter, a delay during priming parameter, a prime time parameter, and a priming RPM parameter. The prime melt when turning on parameter is a selection of whether or not the priming process is executed before depositing each bead. The delay during priming parameter is a selection of whether or not the bead may be deposited along the toolpath during the priming process. The priming time parameter is

during the priming process. The priming time parameter is period of time for which the priming process may be executed. The priming RPM parameter is a speed, measured in revolutions per minute, at which the extruder 61 rotates the extruder screw during the priming process.

The melt off settings set of print parameters may include

an apply coast off motion parameter, a coast distance parameter, a reverse melt when turning off parameter, an apply reverse during coast motion parameter, a delay during reverse parameter, a reverse time parameter, and a reverse RPM parameter. The melt off settings set of parameters control the extrusion and/or deposition of material during a "coast process" executed at the end of printing each bead. The apply coast off motion parameter is a selection of whether or not the extruder continues to melt the material while the applicator head 43 moves through distance specified by the coast distance parameter. The coast distance parameter a distance, measured from the end of each bead, that the applicator head 43 moves while executing the coast process. The reverse melt when turning off parameter is a selection of whether or not the to reverse the flow of material during the coasting process. The flow of material may be reversed while the applicator head 43 moves through the coast distance, or while the applicator head 43 stays in place. In some examples, the flow may be reversed by rotating the extruder screw and/or the gear pump 62 in a direction opposite to the direction of rotation for printing. Reversing the flow of material may, in some embodiments, pull material into one or more parts of CNC machine 1, e.g., the extruder 61 or the applicator head 43.

The apply reverse during coast motion parameter is a selection that controls whether the reversal of the flow of the material is reversed while the applicator head 43 moves through the coast distance. The delay during reverse parameter is a selection determining whether the reversal of the flow of the material is time bound by the reverse time parameter. The reverse time parameter is a period of time that the flow is reversed during the coasting process. The reverse RPM parameter is a speed (measured in revolutions per minute) that the extruder screw is rotated when the flow of the material is reversed. The set at control parameter is a selection of whether or not the priming time parameter, the priming RPM parameter, the reverse time parameter, or the reverse RPM parameter may be overridden by the slicing process and replaced with values received via command codes determined by the controller 100.

FIG. 13 depicts a user interface 1300 that allows the user to input values or otherwise specify the print parameters included in the bead geometry subcategory under the boundary category. In some examples, the bead geometry subcategory under the fill category may include the same print

parameters as the geometry subcategory of the boundary category. The parameters listed on this subcategory may include a bead height controlled by layer height parameter and a width parameter.

The bead height controlled by layer height parameter is a 5 thickness of each bead being deposited to form each layer of the section or part. The bead height controlled by layer height parameter may be determined based in part on the layer height parameter of the toolpath subcategory of the general category. The width parameter is a measurement of a width of the bead to be deposited. The width parameter may be used to generate the toolpath and/or simulate the printing process. As mentioned above, one or more of the print parameters may be determined based in part on the value of the width parameter.

FIG. 14 depicts a user interface that allows the user to input values or otherwise specify the print parameters included in the passes subcategory under the fill category. The passes subcategory may include print parameters such as, e.g., a program fill passes parameter, a fill style param- 20 eter, a linking passes with rapids parameter, an optimize to surface features parameter, a pass overlap parameter, a maximum sparse fill spacing parameter, a maximum pass overlap parameter, a boundary overlap parameter, a boundary side overlap parameter, a starting fill angle parameter, a 25 change in angle per layer parameter, a minimum fill length parameter, a lead-in length parameter, a lead-out length parameter. The program fill passes print parameter is a value indicating a selection of whether or not the toolpath will be determined with a fill. The fill style parameter is a selection 30 of the method of determining the toolpath for the fill. Exemplary fill styles include a simple zigzag style, a smart zigzag style, a smart zigzag constant overlap style, a variable bead regions style, a sparse zigzag style. These exemplary fill styles are illustrated in FIGS. 15 through 19, which will 35 now be described.

FIG. 15 depicts a top view diagram of the toolpath of a layer 150 produced using the one way fill style. The one way fill style may produce a toolpath having lines all oriented along the same direction. The toolpath begins by depositing 40 a bead in a first pass starting at a first point 151 moving along a first vector 153 toward a second point 152. Upon reaching point 152, the applicator head 43 stops depositing the bead, and moves to a third point 156 adjacent to the start of the first pass, at first point 151. The bead then deposits a second pass 45 from the third point, the second pass extending along the first vector 153 adjacent to the first pass. These steps are repeated to deposit additional passes, each subsequent pass being depositing along the first vector 153 adjacent to the preceding pass. Accordingly, a width of each pass of the 50 toolpath increases a width of the layer 150 along a second vector 154. If the applicator head 43 encounters a hole 155 in layer 150, e.g., at point 157, the applicator head 43 stops printing the bead and moves to a position across the hole 155 opposite of point 157, point 158. The applicator head 43 then 55 continues to deposit the printing bead along the first vector 153. Once the pass containing points 157 and 158 is completed, the applicator head 43 moves to a position 159 adjacent the start of the pass that contains points 157 and 158. The applicator head 43 continues to deposit the printing 60 bead in this manner until the layer 150 is complete.

FIG. 16 depicts a top view diagram of the toolpath of a layer 160 generated using the simple zigzag fill style prints. The simple zigzag fill style may produce a toolpath that serpentines along the layer to fill the layer. For example, the 65 toolpath may begin a first pass at a first point 161 and extend along a first vector 163. Upon reaching a boundary of the

16

layer 160, the first pass may be completed, but the bead may still be deposited as the applicator head 43 moves along a second vector 164 a distance equal to the width of the bead being deposited along the tool path. The toolpath then begins a second pass, guiding the applicator head 43 in a direction opposite the first vector 163 till it reaches another boundary of the layer. By these steps, the bead is deposited in a serpentine manner in which each subsequent pass extends adjacent to the preceding pass in a direction opposite the preceding pass. If the toolpath encounters a hole 165 in the layer 160, e.g., at a second point 166, the applicator head 43 stops depositing the bead and continues to follow the current pass direction over the hole till the applicator head 43 has completely passed over the hole, e.g., at a third point 167. The applicator head 43 then begins depositing the bead of material from the third point 167 in the same manner as the previous passes. The steps of stopping the printing of the bead and moving over the hole 165 may be repeated for any additional points where the toolpath intersects the hole 165, e.g., from a fourth point 168 to a fifth point 169.

FIG. 17 depicts a top view diagram of the toolpath of a layer 170 generated using the smart zigzag fill style. The toolpath generated using the smart zigzag fill style is generated in a manner similar to the simple zig zag fill style. For example, a first pass may begin at a first point 171 and extend along a first vector 173. The toolpath may serpentine through the layer 170 along a second vector 174 while continuously depositing material. Using the smart zigzag fill style, if the toolpath intersects a hole 175 the applicator head 43 will continue to serpentine along the second vector 174 without passing over the hole 175 until the toolpath reaches a second point 172, where the toolpath intersects the hole 175 along the pass furthest along the second vector 174. At the second point 172, the applicator head 43 may stop depositing material and move to a third point 176 adjacent to the start of the most recent pass that intersected the hole 175. After reaching an end point of the layer 170 along the second vector 174, e.g., at a fourth point 177, the applicator head 43 stops depositing material and moves to a point along the last path that intersected the hole 175. This fifth point 178 is opposite the second point 172. From the fifth point 178, the toolpath may serpentine between the hole 175 and the outline of the layer 170 in a direction opposite to the direction of the second vector 174. The toolpath continues until it reaches a sixth point 179 where the next would intersect a previously deposited pass.

FIG. 18 illustrates a part 180 manufactured using the constant overlap fill style. The constant overlap fill style produces a toolpath in the same general manner as the smart zigzag fill style. However the constant overlap fill style creates a toolpath having a constant percentage, measured with respect to the bead of material, of overlap between passes of the toolpath. In some examples, sections or parts, e.g., sections or parts without a cavity or hole therein, may be printed with a toolpath limited to the fill of the part. In further examples, sections or parts may be printed from toolpaths absent boundary beads.

FIG. 19, illustrates a top view diagram of the toolpath of a layer 190 generated using the sparse zigzag fill type. Under the sparse zigzag fill type, a first pass may begin at a first point 191 and extend along a first vector 193. The toolpath may serpentine across the layer 190 in the direction of a second vector 194. As shown, the serpentine shape of the toolpath may leave a space between curves of the toolpath. If the toolpath intersects a hole 195 the toolpath will continue to serpentine along the second vector 194 between the hole 195 and a boundary of the layer. The toolpath

continues along the layer in the direction of the second vector 194 until reaching an second point 192. Upon reaching the second point 192, the toolpath may instruct the applicator head 43 to stop depositing material and move to a space on the layer that has not yet been filled, e.g., a third 5 point 196. The toolpath may include directions to deposit material from the third point 196 and move the applicator head 43 in along a direction opposite the second vector in a serpentine manner till the toolpath reaches a fourth point 197. The fourth point 197 may be a position adjacent to a 10 bead of material that has already been deposited along the toolpath. The toolpath may further include one or more passes along any spaces or gaps between the curves of the toolpath, e.g., a pass beginning at a fifth point 198.

The variable bead regions fill style (not shown) may 15 include determining a toolpath in a similar fashion to the smart zigzag tool type, the toolpath being altered to include an extra pass to fill any voids detected between the bead of the fill and a boundary of the layer.

With reference again to FIG. 14, the linking passes with 20 rapids parameter a selection that determines whether the material is still melted, e.g., by operating the extruder 61, when the applicator head 43 moves from one fill line or pass to the next. Optimize to surface features is a selection of whether or not the toolpath is generated weighing accuracy 25 of adhering to the contours of the part over reducing overlap between beads. The pass overlap parameter is a minimum percentage that the bead being deposited will overlap adjacent beads that have already been deposited as determined as a percentage of the width of the bead of the boundary. The 30 maximum sparse fill spacing parameter is a maximum distance allowed between a center of one bead to the center of the adjacent bead when using the sparse zigzag fill style. The maximum pass overlap parameter is a maximum allowed percentage, measured with respect to the width of 35 bead of the fill, that the bead can overlap adjacent beads. The boundary overlap parameter is a percentage, measured with respect to the bead width of the boundary, that each bead of the fill near the periphery of the layer may overlap the boundary beads of the layer. The value of the boundary 40 overlap parameter may be input as a percentage of the width of the bead of the boundary. The boundary side overlap parameter is an percentage measured with respect to the bead width of the boundary, that each bead of the fill that contacts the boundary will overlap the bead of the boundary. 45 The starting fill angle parameter is an angle of the initial fill layer. The change in angle per layer parameter is angle the subsequent fill layer will be printed on with respect to the previous fill layer. The minimum fill length parameter is a minimum distance the toolpath must extend to be included 50 as a fill pass. The lead-in length parameter is a distance used to approach the start of each fill pass. The lead-out length print parameter is a distance that the bead of the fill is deposited extending from the end of each fill pass along the toolpath. The force tangential lead-out is a distance the bead 55 of the fill will extend tangentially from the last point in the

FIG. 20 depicts a user interface 200 that allows the user to input values or otherwise specify the print parameters included in the fill style print parameters subcategory. The 60 parameters listed on the fill style print parameters subcategory may include a fillet radius on path corners parameter, a melt output reduction in corners parameter, a travel speed on corners parameter, a max end overlap distance parameter, a max side overlap distance parameter, a place fill turns 65 outside section boundary parameter, a limit to fill line matching parameter, a fill line extension before turn set of

parameters, a step tolerance parameter, and an angle tolerance parameter. The fillet radius on path corners parameter is a percentage of a radius of the bead at each corner of toolpath within the fill. The melt output reduction in corners parameter is a percentage of reduction of material being output in corners. The travel speed on corners parameter is a speed the nozzle 51 travels in the corners which can be made to match the fill pass speed by checking the parameter same as fill passes travel speed. The max end overlap distance parameter is a maximum distance the end of a fill bead can cross into a boundary bead and is used in conjunction with boundary overlap. The max side overlap distance parameter is a maximum distance the side of a fill bead can cross into a boundary bead and is used in conjunction with boundary side overlap. The place fill turns outside part boundary parameter is a selection to determine whether the toolpath line extends beyond the fill boundary at turns of the toolpath. When no boundary passes are included, if the two fill lines involved in a bridge do not form a perpendicular bridge, the shorter fill line is extended to be even with the longer fill line. If the difference in the two fill line end points is greater than the limit to fill matching value, the shorter fill line will not be extended and no bridge will be formed.

18

With continued reference to FIG. 20, the fill line extension before turn option allows the ends of each fill pass to be extended by a distance beyond the part boundary. The step tolerance parameter is a distance that is referenced for scale when determining the fill of small entities at a top and a bottom of a fill surface. The angle tolerance parameter is an angle indicative of the margin of error in creating a flat surface, e.g., the top surface and bottom surface of the fill surface.

Based in part on one or more of the foregoing print parameters, the slicing process may divide an electronic model(s), e.g., a CAD model, of the part to be printed into a number of sections, each section having one or more layers, and each layer having a distinct toolpath and print parameters. The slicing process may produce a print program or process based in part on the sections and/or layers. The print program may be transmitted to CNC machine 1 to manufacture the part. FIG. 21 shows an exemplary flow diagram of a method 300 of executing the slicing process and manufacturing a part. The slicing process may include receiving an electronic model, such as, e.g., a CAD model, at an electronic device (e.g., at controller 100) at a step 302. Next, at a step 304, the model may be divided into a number of sections. Before slicing each section into layers, the parameters for printing those layers may be input, selected, adjusted, or otherwise specified by a user and/or retrieved from memory by the slicing process. To begin defining the parameters of each section, a toolpath type may be selected at a step 306. Next, at a step 308, a category of print parameters may be defined. Then, a subcategory of print parameters may be defined at a step 310. At step 312, one or more print parameters for the section may be defined. Steps 308, 310, and 312 may be repeated as desired to define print parameters under different categories or subcategories and/ or print parameters of different sections. At step 314, the slicing process may slice or divide the sections into a number of layers. At step 316, the slicing program may produce a printing program or process to be executed at the CNC machine 1. The printing program may include some or all of the layers and sections of the part to be manufactured. Then, at step 318, the slicing process may initiate manufacturing of the part. The method 300 shown in FIG. 21 is only exemplary. Some of all of the steps of method 300 may be

completed. Additionally or alternatively, the steps of method 300 may be executed in a different sequence.

The printing process to manufacture the part produced by the slicing process may print a first layer of a first section in a manner such that the first layer overlaps, contacts, and/or 5 meshes with a first layer of a second section. In some examples, the separate sections of the manufactured part may be printed by the CNC machine 1 so that the sections meld, join, or otherwise attach to one another. That is, in contrast to the formation of separate portions which are subsequently assembled to form a part, the methods described herein permit each of the separate sections of a part to be printed in a single printing process to form the part.

From the foregoing detailed description, it will be evident that there are a number of changes, adaptations and modifications of the present disclosure which come within the province of those persons having ordinary skill in the art to which the aforementioned disclosure pertains. However, it is intended that all such variations not departing from the spirit of the disclosure be considered as within the scope thereof 20 as limited by the appended claims.

What is claimed is:

1. A system for forming a part using additive manufacturing, the system comprising:

an extruder;

- an applicator assembly including a nozzle connected downstream of the extruder;
- a plurality of servomotors for positioning the applicator assembly; and

a controller configured to:

via a user interface, prompt a user to input a first set of print parameters for a first print section;

via the user interface, prompt the user to input a second set of print parameters for a second print section, wherein the first set of print parameters include priming attributes associated with a first extruder parameter, wherein the first set of print parameters includes a first toolpath parameter, wherein the first toolpath parameter is one of an open toolpath parameter, a closed toolpath parameter, and a seam avoidance offset parameter, wherein the second set of print parameters includes at least one parameter that is different from the first set of print parameters;

receive the first and second sets of print parameters; control the servomotors while the applicator assembly deposits material via the nozzle during a first additive manufacturing process based on the first set of print parameters to form the first print section; and

- control the servomotors while the applicator assembly deposits material via the nozzle during a second additive manufacturing process based on the second set of print parameters to form the second print section, such that such the first print section and the second print section are joined together to manufacture the part.
- 2. The system of claim 1, wherein the first set of print 55 parameters includes the first extruder parameter, wherein the second set of print parameters includes a second extruder parameter that is different from the first extruder parameter.
- **3**. The system of claim **2**, wherein the first extruder parameter is a speed of an extruder screw.
- **4**. The system of claim **2**, wherein the first extruder parameter is a speed of an extruder screw during priming.
- 5. The system of claim 2, wherein the first extruder parameter determines whether priming is performed with the extruder.
- **6**. The system of claim **2**, wherein the first extruder <sup>65</sup> parameter is a selection of a period of time during which priming is performed.

20

7. The system of claim 1, wherein the first set of print parameters includes a first toolpath parameter, wherein the second set of print parameters includes a second toolpath parameter that is different from the first extruder parameter.

**8**. A system for forming a part using additive manufacturing, the system comprising:

an extruder;

an applicator assembly;

controller configured to:

via a user interface, prompt a user to input a first set of print parameters for a first print section; and

via the user interface, prompt the user to input a second set of print parameters, wherein the first set of print parameters include priming attributes associated with a first extruder parameter, wherein the first set of print parameters includes a first toolpath parameter, wherein the first toolpath parameter, wherein the first toolpath parameter is one of an open toolpath parameter, a closed toolpath parameter, and a seam avoidance offset parameter, wherein the second set of print parameters includes at least one parameter that is different from the first set of print parameters;

receive, from the user interface, the first and second sent of print parameters;

control the applicator assembly to deposit material via the extruder based on the first set of print parameters to form the first print section; and

control the application assembly to deposit material via the extruder based on the second set of print parameters to form the second print section, such the first print section and the second print section are joined together to manufacture the part.

**9**. The system of claim **8**, wherein the first set of print parameters includes a first toolpath parameter, wherein the second set of print parameters includes a second toolpath parameter that is different from the first toolpath parameter.

10. The system of claim 8, wherein the first set of print parameters includes a seam offset parameter.

11. The system of claim 8, wherein the first set of print parameters includes a first geometry parameter, wherein the second set of print parameters includes a second geometry parameter that is different from the first geometry parameter.

12. The system of claim 8, wherein the first set of print parameters includes the first extruder parameter, wherein the second set of print parameters includes a second extruder parameter that is different from the first extruder parameter.

13. A method for forming a part using additive manufacturing, the method comprising:

receiving, from a user via a graphical interface of an additive manufacturing device, a first set of print parameters for forming a first print section, wherein the first set of print parameters include priming attributes associated with a first extruder parameter, wherein the first set of print parameters includes a first toolpath parameter, wherein the first toolpath parameter is one of an open toolpath parameter, a closed toolpath parameter, and a seam avoidance offset parameter;

receiving, from the user via the graphical interface of the additive manufacturing device, a second set of print parameters for forming a second print section, wherein the second set of print parameters includes at least one parameter that is different from the first set of print parameters;

transmitting, from the graphical interface to a controller, the first and second sets of print parameters;

controlling, with the controller, an applicator assembly to deposit material via an extruder based on the first set of print parameters to form the first print section;

controlling, with the controller, the applicator assembly to deposit material via the extruder based on the second set of print parameters to form the second print section; and

joining the first print second and the second print section together to form the part.

- 14. The method of claim 13, wherein the first set of print parameters includes a first boundary parameter, wherein the second set of print parameters includes a second boundary parameter that is different from the first boundary parameter.
- 15. The method of claim 13, further comprising prompting, with the graphical interface, the user to input the first set of print parameters for forming the first print section.
- 16. The method of claim 13, wherein the first set of print parameters includes a seam offset parameter.
- 17. The method of claim 13, wherein the first set of print parameters includes a first geometry parameter, wherein the second set of print parameters includes a second geometry parameter that is different from the first geometry parameter.
- 18. The method of claim 13, wherein the first set of print 15 parameters includes the first extruder parameter, wherein the second set of print parameters includes a second extruder parameter that is different from the first extruder parameter.
- 19. The method of claim 13, wherein the first set of print parameters includes a first toolpath parameter, wherein the second set of print parameters includes a second toolpath parameter that is different from the first toolpath parameter.

\* \* \* \* \*