
MODEL 463 as of model year 2013 /model refinement package 2012

N70 Overhead control panel control unit



P82.20-4006-06

XX	Remove/install		
(3)	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Detach ground line from battery		AR54.10-P-0003GW
(1)	Notes on battery		AH54.10-P-0001-01A
2	Pry side covers (arrows) out of overhead control panel control unit (N70)	8	*110589035900
3	Unclip overhead control panel control unit (N70) in direction of vehicle interior		
4	Disconnect electrical connectors at overhead control panel control unit (N70)		
5	Install in the reverse order		
6	Check all functions of the overhead control panel control unit (N70)		
7	Read out and erase the fault memory using Star Diagnosis		AD00.00-P-2000-04A

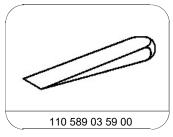

Mounting wedge