

MODEL 463 (except 463.202) as of model year 2013 /model refinement package 2012


- 1 Cover
- 3 Molding



P77.20-2358-01

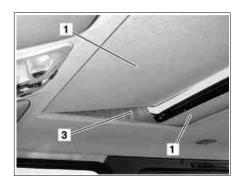

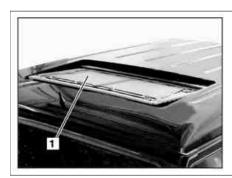


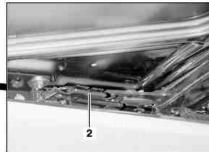

P77.20-2360-07

1 Cover 2 Sliders

Ξ	Removing		
1	Open tilting/sliding roof		
2	Pry paneling (1) off of tilting/sliding roof	3	*110589035900
3	Pull paneling (1) out of vehicle toward front		
X	Install		
4	Position sliders (2) horizontally at tilting brackets		
5	Insert paneling (1) into roof cutout		
6	Slide guide sleeve at rear part of paneling (1) onto guide pins on roof cutout		
7	Slide paneling (1) toward rear to stop	© Carefully slide paneling (1). The side moldings (3) can stick in the sliders (2) and be damaged.	
8	Clip paneling (1) into titling/sliding roof	i Replace damaged clip bottom sections.	
9	Position tilting/sliding roof half way to pop-up position	Carefully move tilting/sliding roof to popup position. The side moldings (3) can stick and moldings (3) can be damaged during the tilting procedure. I It should be possible to retract or extend the side moldings (3) without resistance.	
4	Checking		
10	Check tilting/sliding roof for proper function		

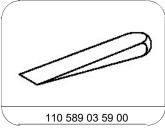

Mounting wedge