



Aegis AeroAssure®

QUARTERLY BUSINESS REVIEW

AS9100D quality program

Meridian Aerostructures

Quarter ending 2026-12-31

Review date: 2026-10-08

Prepared for: V. Singh (QD), Plant GM

Prepared by: Aegis AeroAssure

CONFIDENTIAL - This document contains proprietary quality management information. Distribution is restricted to authorized personnel only.

Prepared for Meridian Aerostructures. Contains proprietary methodology of Aegis Technologies Inc.; licensed for the recipient's internal use only. Not to be reproduced, shared outside the recipient's organisation, used to train or prompt AI systems, or used to develop competing products.

Quarterly Business Review

Meridian Aerostructures · Quarter ending 2026-12-31 · 2026-10-08


61 issues ranked for action from the records; 10 groups of them share one cause.

The AS9100D compliance score is 23. 144 findings open across audits, nonconformances and self-assessment; 4 CAPAs past their due date; 32 measuring instruments past calibration; 15 people with an expired qualification.

QMS snapshot


Every number below is a key figure counted from the registers on 2026-10-08; section 2 says what each measures.

Headline figures

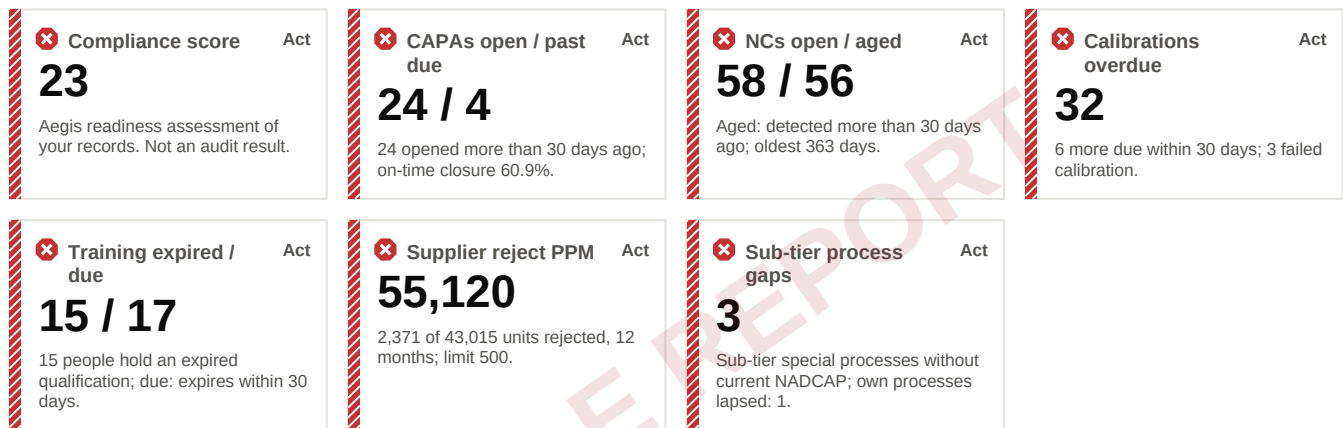

Compliance score: 23 (act, Aegis readiness assessment of your records. Not an audit result.); CAPAs open / past due: 24 / 4 (act, 24 opened more than 30 days ago; on-time closure 60.9%.); NCs open / aged: 58 / 56 (act, Aged: detected more than 30 days ago; oldest 363 days.); Calibrations overdue: 32 (act, 6 more due within 30 days; 3 failed calibration.); Training expired / due: 15 / 17 (act, 15 people hold an expired qualification; due: expires within 30 days.); Supplier reject PPM: 55,120 (act, 2,371 of 43,015 units rejected, 12 months; limit 500.); Sub-tier process gaps: 3 (act, Sub-tier special processes without current NADCAP; own processes lapsed: 1.).

Clause scores

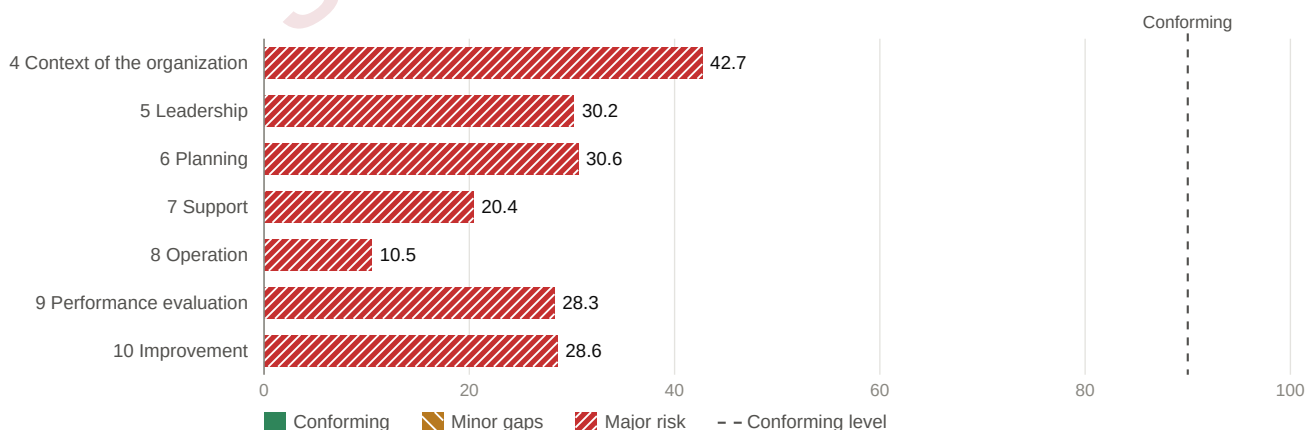

Top-level AS9100D clause scores: Aegis's proprietary assessment of the documents, evidence and open findings recorded against each clause. Not an audit result, and not a certification decision.

Clause scores: 4 42.7, 5 30.2, 6 30.6, 7 20.4, 8 10.5, 9 28.3, 10 28.6. Major risk: 4 (42.7), 5 (30.2), 6 (30.6), 7 (20.4), 8 (10.5), 9 (28.3), 10 (28.6).

Every QMS element at a glance

	Current	⚠ Due in 30 days	✖ Overdue	✖ Missing
Documents	23	3	5	7
Records	115	n/a	n/a	11
Training	35	17	15	5
Calibration	83	6	32	0
CAPA	7	13	4	0
Nonconformances	7	10	41	0
Suppliers	0	0	12	13
Sub-tier and special processes	13	1	2	2
First article (AS9102)	0	4	11	3
Internal audits	8	0	0	0
Risk and PFMEA	4	6	0	15
Management review	2	0	0	0


Count: 0 1 to 115, darker is more

Each QMS element's records by state on the report date. Current: in date, or not yet due. n/a: the state does not apply to that element, or its records were not read.

Documents: 23 current, 3 due in 30 days, 5 overdue, 7 missing; Records: 115 current, 11 missing; Training: 35 current, 17 due in 30 days, 15 overdue, 5 missing; Calibration: 83 current, 6 due in 30 days, 32 overdue, 0 missing; CAPA: 7 current, 13 due in 30 days, 4 overdue, 0 missing; Nonconformances: 7 current, 10 due in 30 days, 41 overdue, 0 missing; Suppliers: 0 current, 0 due in 30 days, 12 overdue, 13 missing; Sub-tier and special processes: 13 current, 1 due in 30 days, 2 overdue, 2 missing; First article (AS9102): 0 current, 4 due in 30 days, 11 overdue, 3 missing; Internal audits: 8 current, 0 due in 30 days, 0 overdue, 0 missing; Risk and PFMEA: 4 current, 6 due in 30 days, 0 overdue, 15 missing; Management review: 2 current, 0 due in 30 days, 0 overdue, 0 missing.

Documents: In force and approved, review date more than 30 days off; review due within 30 days; review date passed; not approved or no review date. Records: Closed records naming where their evidence is kept; those naming none are missing. Training: Qualifications current; expiring within 30 days; expired; assigned and not started. Calibration: Gauges in service due after 30 days; due within 30; past due; no due date. CAPA: Open CAPAs by due date: more than 30 days off; within 30; past due; no due date. Nonconformances: Open nonconformances by due date, as CAPAs. Suppliers: Re-audited within a year; re-audit due within 30 days; past due or under watch (probation, conditional, suspended); never audited. Sub-tier and special processes: Own processes and sub-tier scope: current; approval expiring within 30 days; expired or lapsed; no NADCAP accreditation. First article (AS9102): Signed, or not yet due; unsigned and due within 30 days; unsigned past due; recorded Accepted with no signatory. Internal audits: Internal audits completed or scheduled more than 30 days off; scheduled within 30 days; scheduled date passed, not completed; no date. Risk and PFMEA: Open risks by due date; missing counts high-priority failure modes no control plan names. Management review: Reviews held in the last year; scheduled within 30 days; one missing when none was held in the year.

KPI trend

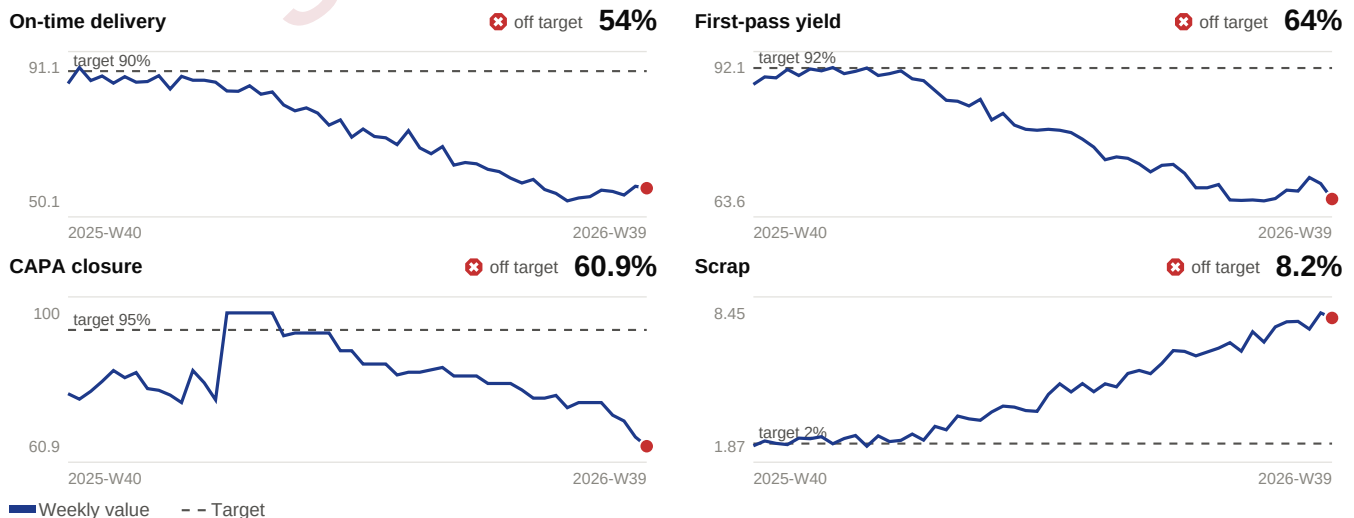

Weekly KPI trend, each on its own scale. Dashed: the scorecard target. The latest week is printed and called on or off target.

On-time delivery 54% in 2026-W39 against a target of 90%, off target; First-pass yield 64% in 2026-W39 against a target of 92%, off target; CAPA closure 60.9% in 2026-W39 against a target of 95%, off target; Scrap 8.2% in 2026-W39 against a target of 2%, off target.

1. Decisions needed at this review

Decision	Why it is needed	Who decides
Accept or reject Wichita Heat Treating conditional status for production use	Linked: SUP-MER-04, RISK-MER-03	V. Singh (QD)
Continue or stop composite layup pending autoclave thermocouple recalibration	Linked: CAPA-MER-005, CAL-MER-09	S. Petrov

2. Where we stand

Key figures

Measure	Value	What it measures
AS9100D compliance score	23	Aegis readiness score: a proprietary assessment of the documents, evidence and open findings recorded against each AS9100D clause. Not an audit result, and not a certification decision.
Open findings, all sources	144 (12 audit findings, 58 nonconformances, 74 assessment nonconformities)	Open audit findings, open nonconformances and nonconforming self-assessment answers, together.
Open CAPAs	24	CAPAs not closed or cancelled.
Open CAPAs past their due date	4	Open CAPAs whose due date is before the report date.
Closed CAPAs	46 (37 effectiveness verified, 9 effectiveness not yet verified)	CAPAs closed, with or without effectiveness verified.
CAPA on-time closure (%)	60.9	28 of 46 closed CAPAs with a due date were closed on or before it.
Open nonconformances	58	Nonconformances not yet closed, at any stage from open to verification.
Oldest open nonconformance (days since detected)	363	Days from the detected date of the oldest open nonconformance to the report date.
Measuring equipment past calibration due date	32	Equipment whose next calibration date has passed.
Equipment that failed calibration	3	Calibration failures with an impact evaluation raised.
People with an expired qualification	15	Distinct people holding at least one expired qualification.
First article reports lacking signatures	18 (15 unsigned, 3 recorded Accepted with no signatory)	AS9102 reports without a reviewer and an approver signature recorded: those not signed, and those the client's log records as Accepted with no signatory.
Own special processes without a current approval	1	The organisation's own Nadcap-accredited processes whose accreditation is not current, and customer-approved processes whose approval has expired. Sub-tier suppliers' processes are counted separately.

Measure	Value	What it measures
Sub-tier special processes without a current NADCAP accreditation	3	Special processes a supplier's sub-tier performs with an expired NADCAP accreditation or none for that process, from the sub-tier map.
Customer requirements not flowed down	9	Accepted customer requirements with nothing recorded as flowed to the supplier or the internal process they apply to (no mapping, or only a gap).
Customer requirements only partly flowed down	4	Accepted customer requirements recorded as partly flowed: started, not complete. Counted apart from those flowed down and those not flowed down at all.
Suppliers on probation, conditional or disqualified	12	Suppliers whose status is probation, conditional, disqualified or suspended.

Scorecard against target

Lane	KPI	Target	Actual	Last review	Status
Program Pacing	On-Time Delivery	90%	54%	First review	Off target
Program Pacing	Customer Escalations Open	0	6	First review	Off target
Quality & Scrap	First Pass Yield	92%	64%	First review	Off target
Quality & Scrap	Scrap Rate	2%	8.2%	First review	Off target
Quality & Scrap	Heat Treat NADCAP Status	Current	Conditional	First review	Off target
MRB/Approvals	CAPA On-Time Closure	95%	61%	First review	Off target
MRB/Approvals	Open CAPAs >30d	8	24	First review	Off target
FAI/Config Readiness	Calibration Overdue	0	32	First review	Off target
FAI/Config Readiness	Operator Cert Current	98%	65%	First review	Off target
Supply Chain Stability	Supplier OTD	90%	72%	First review	Off target

Scorecard checked against the records

The scorecard is what the client reported. Each KPI the registers or the weekly trend also measure is checked against them at the scorecard's own precision: 10 agree, 0 differ; 1 cannot be checked from the records (Customer Escalations Open). Where they differ, the key figures above use the records.

KPI	Scorecard	Checked against	Result
On-Time Delivery	54%	Weekly trend	Agrees: Weekly trend 2026-W39 OTD: 54
Customer Escalations Open	6	-	Not checked: None of the registers or the weekly trend measures this; it is the client's own figure, not checked.
First Pass Yield	64%	Weekly trend	Agrees: Weekly trend 2026-W39 FPY: 64
Scrap Rate	8.2%	Weekly trend	Agrees: Weekly trend 2026-W39 Scrap: 8.2
Heat Treat NADCAP Status	Conditional	Registers	Agrees: Special-process register: Conditional (Heat Treat — Solution & Age (Ti-6Al-4V); Heat Treat — Stress Relief (Aluminum))

KPI	Scorecard	Checked against	Result
CAPA On-Time Closure	61%	Registers	Agrees: CAPA on-time closure (%): 60.9
CAPA On-Time Closure	61%	Weekly trend	Agrees: Weekly trend 2026-W39 CAPA Closure: 60.9
Open CAPAs >30d	24	Registers	Agrees: Open CAPAs opened more than 30 days ago: 24
Calibration Overdue	32	Registers	Agrees: Measuring equipment past calibration due date: 32
Operator Cert Current	65%	Registers	Agrees: Training assignment completion (%): 65.3
Supplier OTD	72%	Registers	Agrees: Supplier on-time delivery, from receipts (%): 71.9

10 of 10 KPIs are off target: On-Time Delivery 54% against 90%; Customer Escalations Open 6 against 0; First Pass Yield 64% against 92%; Scrap Rate 8.2% against 2%; Heat Treat NADCAP Status Conditional against Current; CAPA On-Time Closure 61% against 95%; Open CAPAs >30d 24 against 8; Calibration Overdue 32 against 0; Operator Cert Current 65% against 98%; Supplier OTD 72% against 90%.

3. What changed since the last review

This is the first review on record for this client, so there is no previous quarter to compare against. The figures above are the baseline for the next review.

4. What we recommend, in priority order

Most pressing first, in the order of Aegis's proprietary prioritisation of your findings. The same records always give the same order.

#	Action	Why now	Owner	Clause
1	Supplier Great Plains Titanium (4 findings) - Quarantine the material in counterfeit case CF-MER-003, trace where it went, and notify the customers whose parts share the route - Require Great Plains Titanium to send nondestructive testing to a NADCAP-accredited source instead of Wichita Heat Treating Inc, or show Wichita Heat Treating Inc's current accreditation, before accepting more parts - Flow down FLD-MER-01 (Boeing) to Great Plains Titanium, and record the supplier's acknowledgement - Confirm with Great Plains Titanium that Central NDT Services renews NADCAP NAD-NDT-11042 for nondestructive testing before 2026-10-15	Supplier Great Plains Titanium appears in 4 separate findings across flow-down, special processes, traceability. These sit in different registers and read as unrelated; together they describe one source that is not under control, and addressing them as one supplier action closes all 4.	Not assigned	8.1.4, 8.4.2, 8.4.3

#	Action	Why now	Owner	Clause
2	Part MER-3101 (5 findings) • Complete the open PPAP elements and sign the part submission warrant for MER-3101 (PPAP-MER-3101) • Qualify the measurement system (Gage R&R) before relying on the capability result: Bore diameter on MER-3101 measured with BG-14 • Qualify the measurement system (Gage R&R) before relying on the capability result: Flange thickness on MER-3101 measured with MIC-7015 • Add the High-priority failure modes on MER-3101 (PFMEA-MER-3101) to the control plan, each with a control method and reaction plan • Complete the reviewer and approver signatures on the first article report for MER-3101 (FAI-MER-101)	Part MER-3101 carries 5 findings across APQP, capability, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 5 independent lapses.	Not assigned	7.1.5.2, 8.1.1, 8.5.1.3
3	Supplier Aero Fastener Brokers (3 findings) • Quarantine the material in counterfeit case CF-MER-001, trace where it went, and notify the customers whose parts share the route • Quarantine the material in counterfeit case CF-MER-002, trace where it went, and notify the customers whose parts share the route • Complete the flow-down of FLD-MER-16 (Boeing) to Aero Fastener Brokers, and record the evidence	Supplier Aero Fastener Brokers appears in 3 separate findings across flow-down, traceability. These sit in different registers and read as unrelated; together they describe one source that is not under control, and addressing them as one supplier action closes all 3.	Not assigned	8.1.4, 8.4.3
4	Part MER-3102 (3 findings) • Complete the open PPAP elements and sign the part submission warrant for MER-3102 (PPAP-MER-3102) • Add the High-priority failure modes on MER-3102 (PFMEA-MER-3102) to the control plan, each with a control method and reaction plan • Complete the reviewer and approver signatures on the first article report for MER-3102 (FAI-MER-102)	Part MER-3102 carries 3 findings across APQP, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 3 independent lapses.	Not assigned	8.1.1, 8.5.1.3
5	Part MER-3103 (3 findings) • Complete the open PPAP elements and sign the part submission warrant for MER-3103 (PPAP-MER-3103) • Add the High-priority failure modes on MER-3103 (PFMEA-MER-3103) to the control plan, each with a control method and reaction plan • Complete the reviewer and approver signatures on the first article report for MER-3103 (FAI-MER-103)	Part MER-3103 carries 3 findings across APQP, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 3 independent lapses.	Not assigned	8.1.1, 8.5.1.3

#	Action	Why now	Owner	Clause
6	Supplier Great Bend Machining (2 findings) - Require Great Bend Machining to send coatings to a NADCAP-accredited source instead of Plains Surface Technologies, or show Plains Surface Technologies's current accreditation, before accepting more parts - Flow down FLD-MER-13 (Spirit) to Great Bend Machining, and record the supplier's acknowledgement	Supplier Great Bend Machining appears in 2 separate findings across flow-down, special processes. These sit in different registers and read as unrelated; together they describe one source that is not under control, and addressing them as one supplier action closes both.	Not assigned	8.4.2, 8.4.3
7	Part MER-3104 (3 findings) - Complete the open PPAP elements and sign the part submission warrant for MER-3104 (PPAP-MER-3104) - Add the High-priority failure modes on MER-3104 (PFMEA-MER-3104) to the control plan, each with a control method and reaction plan - Record who reviewed and approved the accepted first article report for MER-3104 (FAI-MER-104)	Part MER-3104 carries 3 findings across APQP, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 3 independent lapses.	Not assigned	8.1.1, 8.5.1.3
8	Part MER-3106 (3 findings) - Add the High-priority failure modes on MER-3106 (PFMEA-MER-3106) to the control plan, each with a control method and reaction plan - Complete the reviewer and approver signatures on the first article report for MER-3106 (FAI-MER-106) - Complete the open PPAP elements and sign the part submission warrant for MER-3106 (PPAP-MER-3106)	Part MER-3106 carries 3 findings across APQP, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 3 independent lapses.	Not assigned	8.1.1, 8.5.1.3
9	Part MER-3105 (3 findings) - Add the High-priority failure modes on MER-3105 (PFMEA-MER-3105) to the control plan, each with a control method and reaction plan - Complete the open PPAP elements and sign the part submission warrant for MER-3105 (PPAP-MER-3105) - Record who reviewed and approved the accepted first article report for MER-3105 (FAI-MER-105)	Part MER-3105 carries 3 findings across APQP, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 3 independent lapses.	Not assigned	8.1.1, 8.5.1.3
10	Part MER-3107 (2 findings) - Qualify the measurement system (Gage R&R) before relying on the capability result: Hardness HRC on MER-3107 measured with HT-2205 - Complete the reviewer and approver signatures on the first article report for MER-3107 (FAI-MER-107)	Part MER-3107 carries 2 findings across capability, first article inspection. A single part accumulating issues in several controls usually means the process was released before it was ready, rather than 2 independent lapses.	Not assigned	7.1.5.2, 8.5.1.3

#	Action	Why now	Owner	Clause
11	Stop releasing work through NDT — Radiographic Inspection until its approval is current, or move it to an approved source	NDT — Radiographic Inspection is performed without current NADCAP accreditation (PRI, expiry 2026-09-14). A special process is one whose result cannot be verified by inspection afterwards, which is precisely why the approval is the control.	Not assigned	8.5.1.2
12	Require Heartland Aluminum Corp to send chemical processing to a NADCAP-accredited source instead of Flint Chemical Processing, or show Flint Chemical Processing's current accreditation, before accepting more parts	Flint Chemical Processing, a sub-tier of Heartland Aluminum Corp, performs chemical processing on accreditation NAD-CP-30911, which expired 2026-08-31. Parts that pass through it reach this plant through Heartland Aluminum Corp, so the control lapses here as well.	Not assigned	8.4.2
13	Finish the impact evaluation for Wilson Rockwell Hardness Tester (CAL-MER-02), Fluke 1586A Super-DAQ Pyrometer (CAL-MER-03), Bore Gauge 12mm (cell 4) (CAL-MER-121): identify product accepted on its measurements since the last good calibration and disposition it	3 records; for example: Wilson Rockwell Hardness Tester (CAL-MER-02) failed calibration and the impact evaluation is not complete. Every measurement taken with it since its last passing calibration is in doubt. Product accepted on those measurements has not been dispositioned.	Not assigned	7.1.5.2
14	Implement FLD-MER-02 (Boeing) in Receiving Inspection, FLD-MER-03 (Airbus) in Heat Treat, FLD-MER-04 (Airbus) in Inspection, FLD-MER-05 (GE) in Heat Treat + Inspection, FLD-MER-12 (Airbus) in FAI, and record the evidence	5 records; for example: GE requirement FLD-MER-05 — Product acceptance — hardness verification per AMS 6415 — is not recorded as in place in Heat Treat + Inspection: Hardness tester overdue on calibration (CAL-MER-02). A requirement the organisation took on and did not put in place is a requirement nobody is meeting.	Not assigned	7.1.5.1, 8.5.1, 8.5.2, 8.6
15	Flow down FLD-MER-11 (Airbus) to Titan Bar & Billet, FLD-MER-15 (GE) to Emporia Anodizing Co, and record the supplier's acknowledgement	2 records; for example: Airbus requirement FLD-MER-11 — Key characteristic flowdown — is not recorded as flowed to Titan Bar & Billet: Key characteristics not identified on POs to Titan Bar & Billet. A requirement the organisation took on and did not pass on is a requirement nobody is meeting.	Not assigned	8.4.3
16	Re-plan or escalate CAPA-MER-029, CAPA-MER-042, CAPA-MER-052, CAPA-MER-019: past due and still open	4 records; the most overdue: CAPA-MER-029 (Missing inspection stamp — MER-3105) is 287 days past its due date and still open. An overdue corrective action is the finding an auditor uses to question whether the system corrects anything.	T. Nakamura, R. Vasquez, P. Green	10.2
17	Complete the reviewer and approver signatures on the first article report for MER-3108 (FAI-MER-108), MER-3110 (FAI-MER-110), MER-3111 (FAI-MER-111), MER-3112 (FAI-MER-112), MER-3113 (FAI-MER-113), MER-3114 (FAI-MER-114), MER-3115 (FAI-MER-115), MER-3116 (FAI-MER-116), MER-3117 (FAI-MER-117), MER-3118 (FAI-MER-118)	10 records; for example: The FAIR FAI-MER-117 for MER-3117 has no completed reviewer and approver signature. Production process verification is not complete until both are recorded, and they cannot be the same person.	Not assigned	8.5.1.3

#	Action	Why now	Owner	Clause
18	Complete the flow-down of FLD-MER-09 (Airbus) in Heat Treat, FLD-MER-10 (GE) in All special processes, FLD-MER-18 (Airbus) in Calibration, and record the evidence	3 records; for example: Airbus requirement FLD-MER-18 — Gauge calibration traceable to national standards — is recorded as only partly flowed in Calibration. Part of a requirement passed on is the rest of it not met.	Not assigned	8.1
19	Record who reviewed and approved the accepted first article report for MER-3109 (FAI-MER-109)	The FAIR FAI-MER-109 for MER-3109 is recorded as accepted, but no reviewer or approver is recorded against it. An auditor will ask who signed it.	Not assigned	8.5.1.3

SAMPLE REPORT

Why these are one problem

Shared cause	What closes it	Areas
Supplier Great Plains Titanium (4 findings)	- Quarantine the material in counterfeit case CF-MER-003, trace where it went, and notify the customers whose parts share the route - Require Great Plains Titanium to send nondestructive testing to a NADCAP-accredited source instead of Wichita Heat Treating Inc, or show Wichita Heat Treating Inc's current accreditation, before accepting more parts - Flow down FLD-MER-01 (Boeing) to Great Plains Titanium, and record the supplier's acknowledgement - Confirm with Great Plains Titanium that Central NDT Services renews NADCAP NAD-NDT-11042 for nondestructive testing before 2026-10-15	Flow-down, special processes, traceability
Part MER-3101 (5 findings)	- Complete the open PPAP elements and sign the part submission warrant for MER-3101 (PPAP-MER-3101) - Qualify the measurement system (Gage R&R) before relying on the capability result: Bore diameter on MER-3101 measured with BG-14 - Qualify the measurement system (Gage R&R) before relying on the capability result: Flange thickness on MER-3101 measured with MIC-7015 - Add the High-priority failure modes on MER-3101 (PFMEA-MER-3101) to the control plan, each with a control method and reaction plan - Complete the reviewer and approver signatures on the first article report for MER-3101 (FAI-MER-101)	APQP, capability, first article inspection
Supplier Aero Fastener Brokers (3 findings)	- Quarantine the material in counterfeit case CF-MER-001, trace where it went, and notify the customers whose parts share the route - Quarantine the material in counterfeit case CF-MER-002, trace where it went, and notify the customers whose parts share the route - Complete the flow-down of FLD-MER-16 (Boeing) to Aero Fastener Brokers, and record the evidence	Flow-down, traceability
Part MER-3102 (3 findings)	- Complete the open PPAP elements and sign the part submission warrant for MER-3102 (PPAP-MER-3102) - Add the High-priority failure modes on MER-3102 (PFMEA-MER-3102) to the control plan, each with a control method and reaction plan - Complete the reviewer and approver signatures on the first article report for MER-3102 (FAI-MER-102)	APQP, first article inspection
Part MER-3103 (3 findings)	- Complete the open PPAP elements and sign the part submission warrant for MER-3103 (PPAP-MER-3103) - Add the High-priority failure modes on MER-3103 (PFMEA-MER-3103) to the control plan, each with a control method and reaction plan - Complete the reviewer and approver signatures on the first article report for MER-3103 (FAI-MER-103)	APQP, first article inspection
Supplier Great Bend Machining (2 findings)	- Require Great Bend Machining to send coatings to a NADCAP-accredited source instead of Plains Surface Technologies, or show Plains Surface Technologies's current accreditation, before accepting more parts - Flow down FLD-MER-13 (Spirit) to Great Bend Machining, and record the supplier's acknowledgement	Flow-down, special processes
Part MER-3104 (3 findings)	- Complete the open PPAP elements and sign the part submission warrant for MER-3104 (PPAP-MER-3104) - Add the High-priority failure modes on MER-3104 (PFMEA-MER-3104) to the control plan, each with a control method and reaction plan - Record who reviewed and approved the accepted first article report for MER-3104 (FAI-MER-104)	APQP, first article inspection

Shared cause	What closes it	Areas
Part MER-3106 (3 findings)	• Add the High-priority failure modes on MER-3106 (PFMEA-MER-3106) to the control plan, each with a control method and reaction plan • Complete the reviewer and approver signatures on the first article report for MER-3106 (FAI-MER-106) • Complete the open PPAP elements and sign the part submission warrant for MER-3106 (PPAP-MER-3106)	APQP, first article inspection
Part MER-3105 (3 findings)	• Add the High-priority failure modes on MER-3105 (PFMEA-MER-3105) to the control plan, each with a control method and reaction plan • Complete the open PPAP elements and sign the part submission warrant for MER-3105 (PPAP-MER-3105) • Record who reviewed and approved the accepted first article report for MER-3105 (FAI-MER-105)	APQP, first article inspection
Part MER-3107 (2 findings)	• Qualify the measurement system (Gage R&R) before relying on the capability result: Hardness HRC on MER-3107 measured with HT-2205 • Complete the reviewer and approver signatures on the first article report for MER-3107 (FAI-MER-107)	Capability, first article inspection

SAMPLE REPORT

5. Action plan

13 open of 13 on the action register; 13 past their due date.

Action	Owner	Due	Priority	Done when	State
[ACT-MER-001] Establish daily recovery war room — 7 AM standup with all lane owners — linked: All CAPAs	Recovery Lead	2026-09-26	High	Not defined	Overdue 12d
[ACT-MER-005] Escalate titanium traceability issue to Boeing SQR — request containment guidance — linked: CAPA-MER-001, RISK-MER-04	R. Vasquez	2026-09-26	Critical	Not defined	Overdue 12d
[ACT-MER-004] Quarantine all product accepted with overdue calibration instruments — linked: CAL-MER-01 through 05	M. Okonkwo	2026-09-27	High	Not defined	Overdue 11d
[ACT-MER-002] Complete CAPA triage — rank all 24 open CAPAs by risk score and customer impact — linked: CAPA-MER-001 through 015	V. Singh (QD)	2026-09-28	High	Not defined	Overdue 10d
[ACT-MER-013] Schedule Boeing and Airbus weekly recovery briefing cadence — linked: RISK-MER-02, RISK-MER-04	T. Nakamura	2026-09-28	Medium	Not defined	Overdue 10d
[ACT-MER-003] Mobilize emergency calibration vendor — prioritize CMM, hardness tester, pyrometer — linked: CAPA-MER-007, RISK-MER-06	L. Tran	2026-09-29	High	Not defined	Overdue 9d
[ACT-MER-012] Build KPI scorecard baseline in Aegis AeroAssure® — establish truth dashboard — linked: KPI Scorecard	Recovery Lead	2026-09-29	Medium	Not defined	Overdue 9d
[ACT-MER-014] Escalate NADCAP radiographic inspection expiry — identify interim outsource capacity — linked: SP-MER-05, SUP-MER-05	M. Okonkwo	2026-09-29	Critical	Not defined	Overdue 9d
[ACT-MER-009] Escalate Airbus OTD recovery plan — request Level 3 review extension — linked: CAPA-MER-003, RISK-MER-02	T. Nakamura	2026-09-30	Critical	Not defined	Overdue 8d
[ACT-MER-007] Launch accelerated requalification program for 12 expired operator certifications — linked: CAPA-MER-008, RISK-MER-07	D. Kowalski	2026-10-02	High	Not defined	Overdue 6d

Action	Owner	Due	Priority	Done when	State
[ACT-MER-015] Map all open NCRs to root CAPAs and verify containment status — linked: MRB-MER-307 through 312	A. Chen	2026-10-02	Medium	Not defined	Overdue 6d
[ACT-MER-008] Prepare CB surveillance audit gap analysis — identify top 10 nonconformance risks — linked: RISK-MER-01	V. Singh (QD)	2026-10-04	High	Not defined	Overdue 4d
[ACT-MER-010] Establish pyrometry record restoration for Furnace #3 — 6-month gap closure — linked: CAPA-MER-002, SP-MER-01	G. Hoffman	2026-10-06	High	Not defined	Overdue 2d


13 open actions have no completion criterion. An action without one cannot be shown to be done; agree it at this review.

6. Escalation

No escalation triggers are defined, so nothing escalates automatically when a KPI or action slips. Agree the thresholds and who they notify at this review.


7. The QMS, element by element

Corrective action (CAPA)

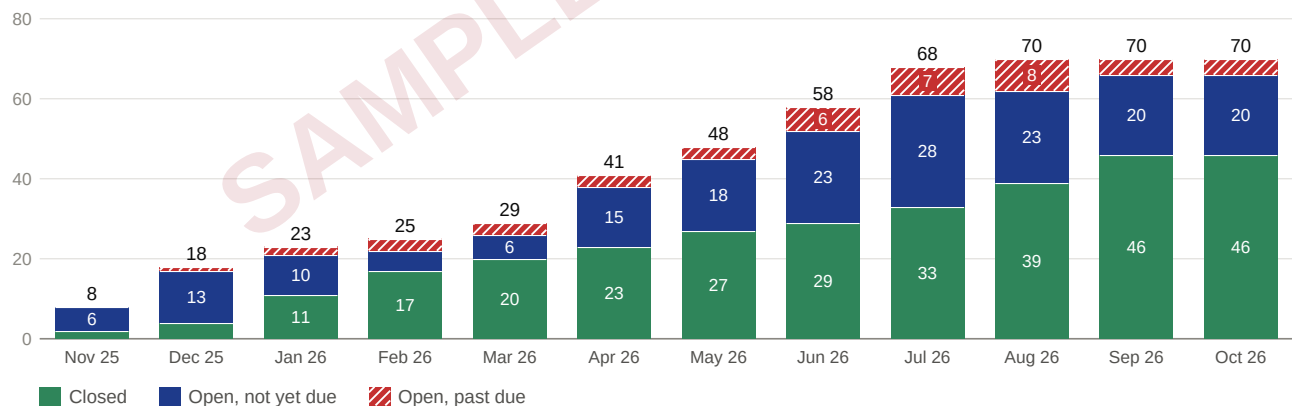

The CAPA register at each month end, from its opened, closed and due dates; the last month ends on the report date.


CAPAs at Oct 26 (report date): 46 closed, 20 open and not yet due, 4 past due; at Nov 25: 2 closed, 6 open, 0 past due.

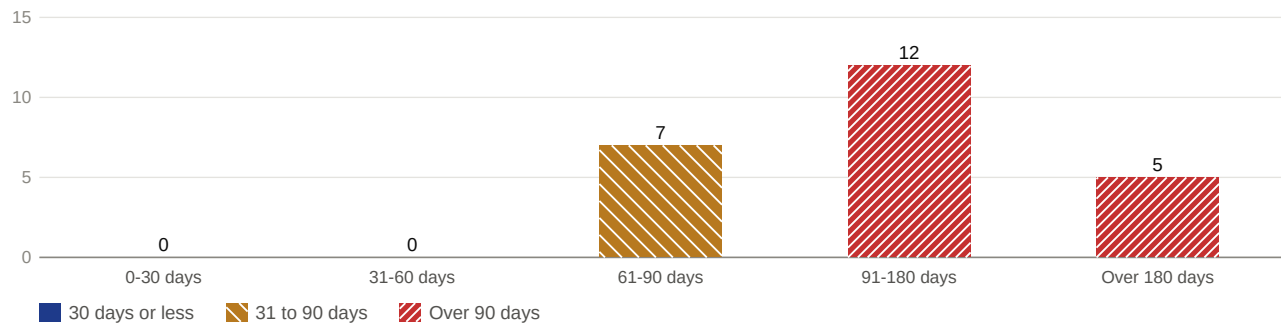

Open CAPAs by days since opened.


24 open CAPAs by age: 0 0-30 days, 0 31-60 days, 7 61-90 days, 12 91-180 days, 5 Over 180 days.

Nonconformances

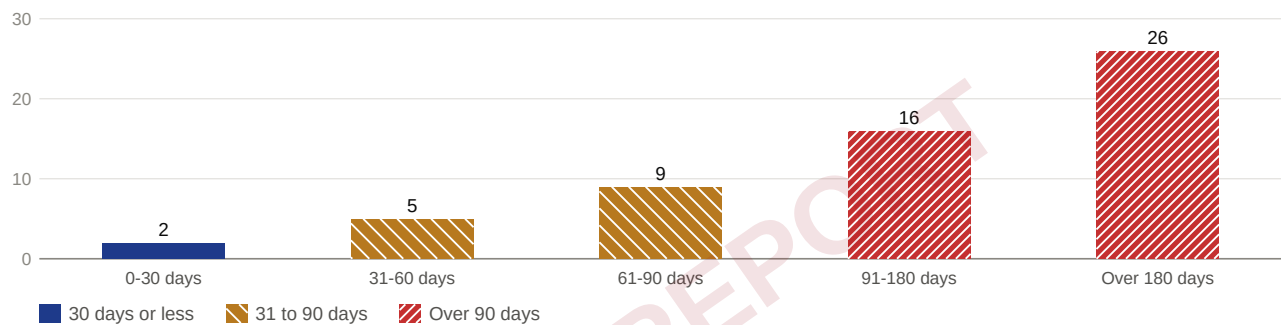

Open nonconformances by days since detected.


58 open nonconformances by age: 2 0-30 days, 5 31-60 days, 9 61-90 days, 16 91-180 days, 26 Over 180 days.

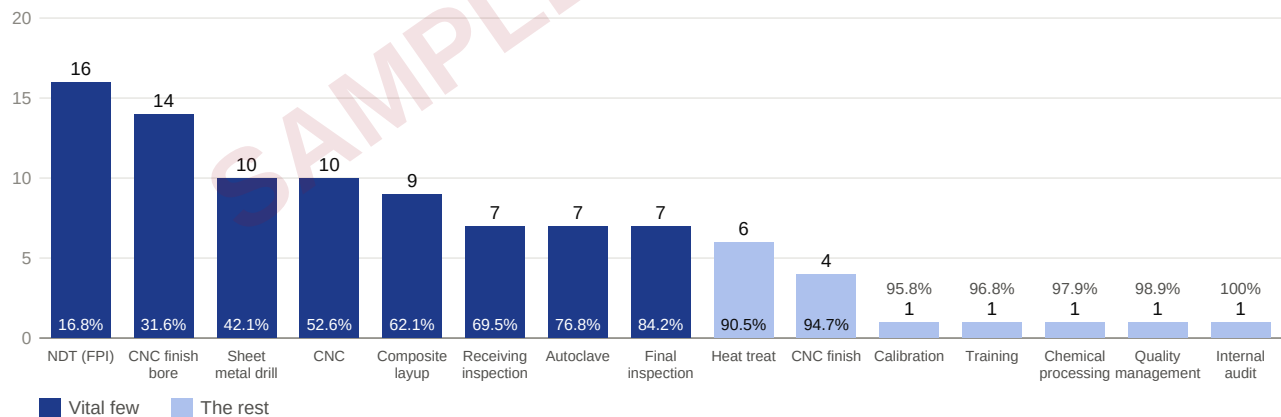

95 nonconformances. Dark bars are the vital few (together 80%); the percentage in each bar is the cumulative share, largest first.


95 nonconformances: 8 of 15 account for 84.2%: NDT (FPI) (16), CNC finish bore (14), Sheet metal drill (10), CNC (10), Composite layup (9), Receiving inspection (7), Autoclave (7), Final inspection (7).

Calibration

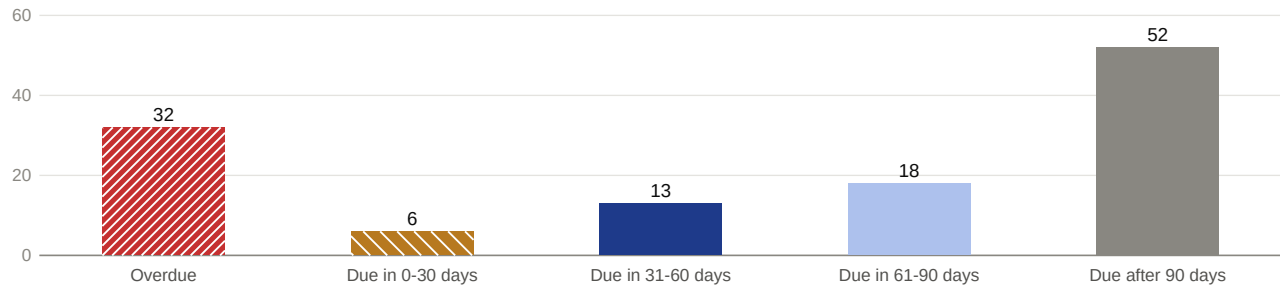

Measuring equipment in service by when its next calibration falls due from the report date. Overdue is as your calibration register records it.


121 gauges in service: 32 overdue, 6 due in 0-30 days, 13 due in 31-60 days, 18 due in 61-90 days, 52 due after 90 days.

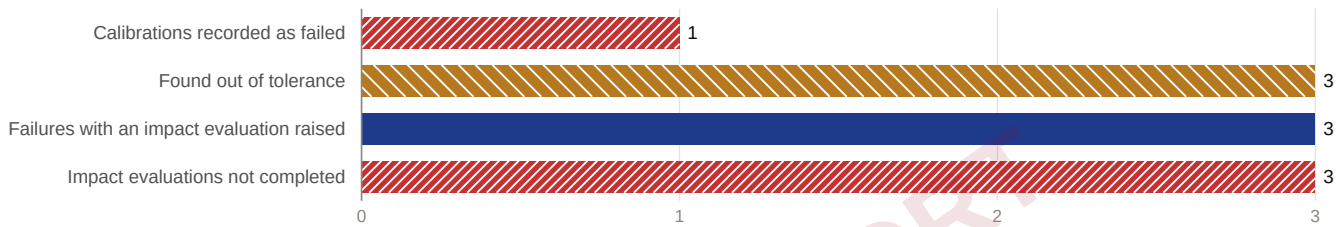

From 111 calibrations recorded in the 12 months to the report date, and the impact evaluations raised for failures.

111 calibrations in 12 months: 1 failed, 3 found out of tolerance; 3 impact evaluations raised, 3 not completed.


Training and qualification

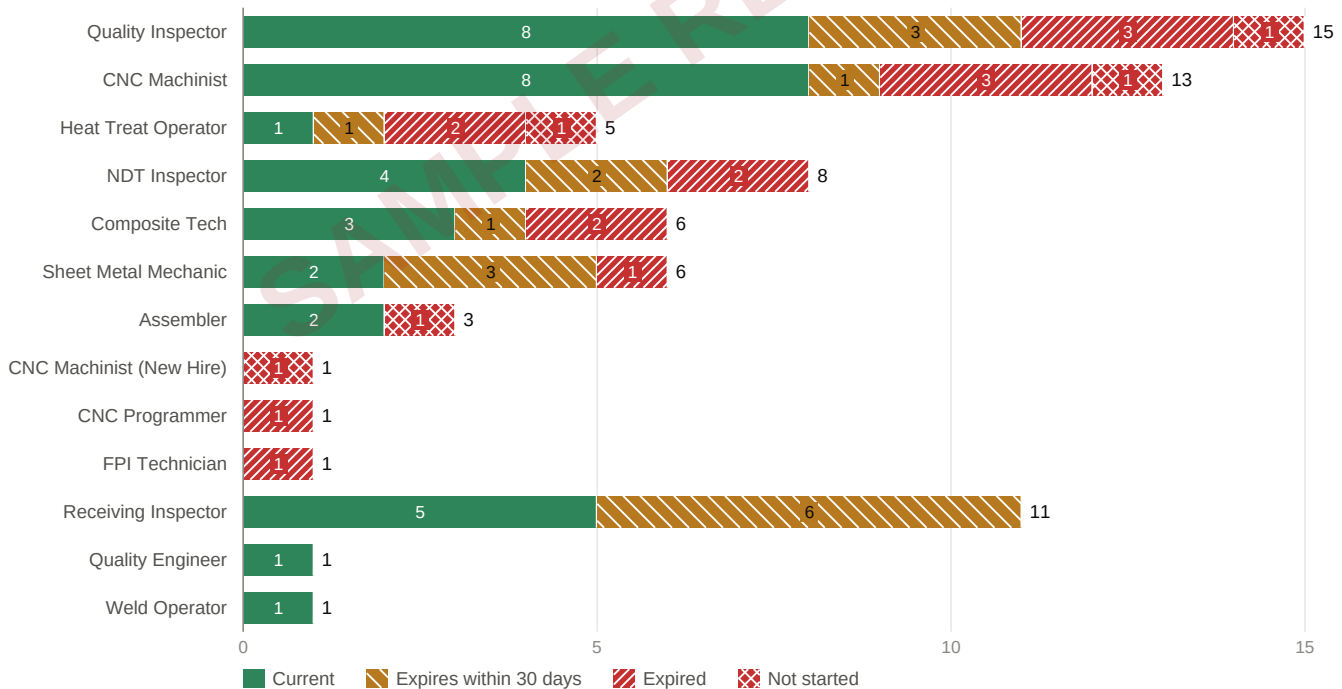

Qualifications held, by the holder's role in the training matrix, on the report date. Not started: assigned and not yet begun.

Quality Inspector: 8 current, 3 expires within 30 days, 3 expired, 1 not started; CNC Machinist: 8 current, 1 expires within 30 days, 3 expired, 1 not started; Heat Treat Operator: 1 current, 1 expires within 30 days, 2 expired, 1 not started; NDT Inspector: 4 current, 2 expires within 30 days, 2 expired; Composite Tech: 3 current, 1 expires within 30 days, 2 expired; Sheet Metal Mechanic: 2 current, 3 expires within 30 days, 1 expired; Assembler: 2 current, 1 not started; CNC Machinist (New Hire): 1 not started; CNC Programmer: 1 expired; FPI Technician: 1 expired; Receiving Inspector: 5 current, 6 expires within 30 days; Quality Engineer: 1 current; Weld Operator: 1 current.


Suppliers

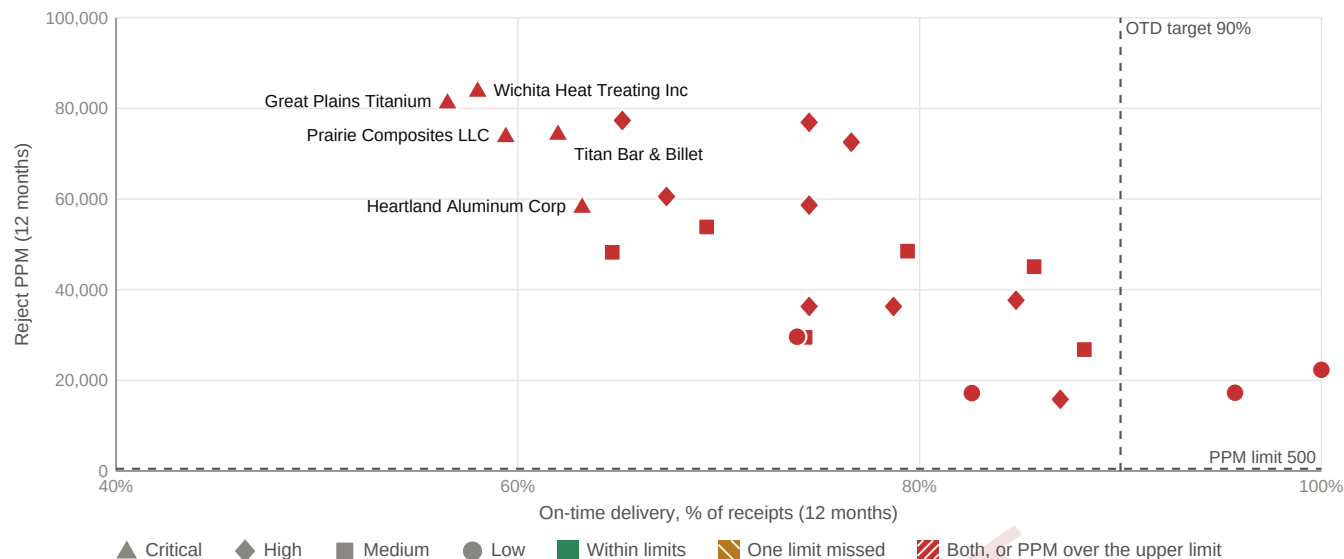

Each supplier with receipts: delivery and rejects from its receipts. Marker shape is the criticality on the supplier list; the furthest out are named.


24 suppliers with receipts, 24 missing a limit. Furthest out: Great Plains Titanium 56.5% on time, 81,391 PPM (critical); Wichita Heat Treating Inc 58% on time, 83,974 PPM (critical); Prairie Composites LLC 59.4% on time, 73,973 PPM (critical); Titan Bar & Billet 62% on time, 74,483 PPM (critical); Flint Chemical Processing 65.2% on time, 77,333 PPM (high); Heartland Aluminum Corp 63.2% on time, 58,378 PPM (critical).

Internal audits

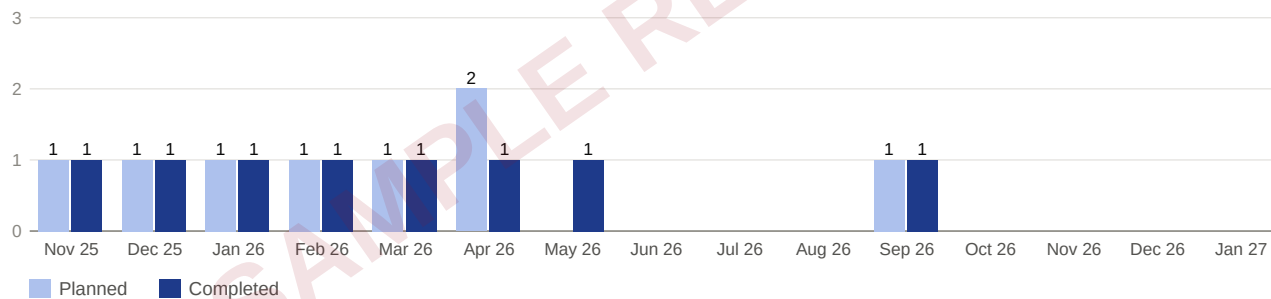

Internal audit programme: audits scheduled in each month and audits completed in it, twelve months back and three ahead.


8 internal audits scheduled and 8 completed from Nov 25 to Jan 27.

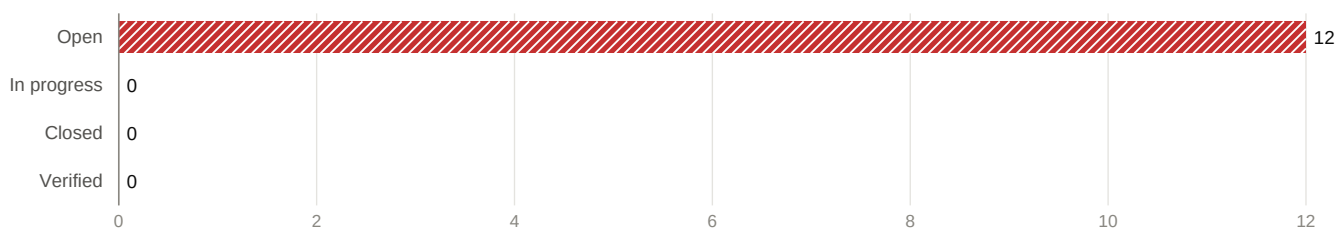

Audit findings by status, internal, external and customer.

12 audit findings: 12 open, 0 in progress, 0 closed, 0 verified.


First article inspection

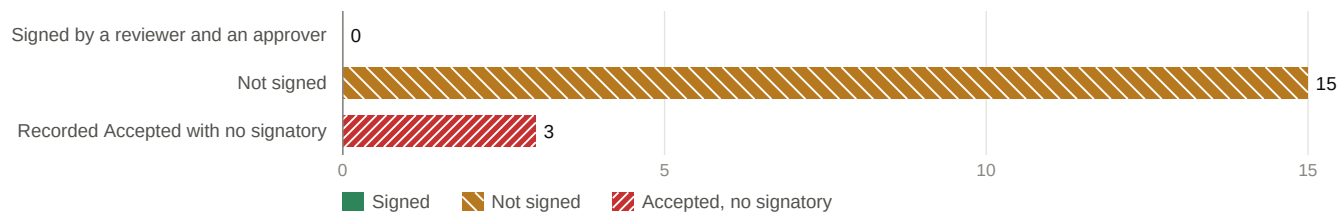

First article reports by signature state, from the FAI log. Accepted with no signatory is a records gap: the report was accepted but who reviewed and approved it is not on record.

18 first article reports: 0 signed, 15 not signed, 3 recorded Accepted with no signatory.

Counterfeit and suspect parts

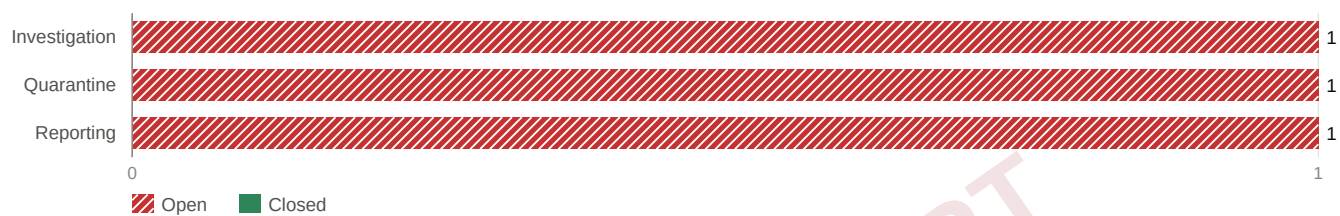

Counterfeit and suspect-part cases by stage, from the traceability register. Open stages are hatched.

3 counterfeit or suspect-part cases, 3 open: investigation 1, quarantine 1, reporting 1.

Customer requirement flow-down




Accepted customer requirements by whether they reached the supplier or the process they apply to, from the flow-down register.

18 customer requirements: 5 flowed down, 4 only partly, 9 not flowed down.

8. The floor, material review and the supply base

The floor, hour by hour

30 hour-by-hour boards: 1985 made against a plan of 2320 for the hours recorded (85.6% attainment); 126 hours missed and 49 escalations.

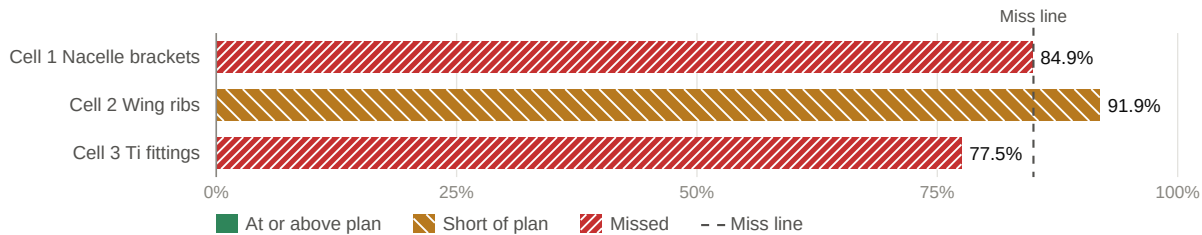

Actual as a share of plan for the hours recorded, every shift. Dashed: the miss line.

Attainment to plan: Cell 1 Nacelle brackets 84.9%, Cell 2 Wing ribs 91.9%, Cell 3 Ti fittings 77.5%.

Cell	09-21	09-22	09-23	09-24	09-25	Week	No reason written	Missed twice running
Cell 1 Nacelle brackets	84%	84%	91%	82%	83%	84.9%	6	10
Cell 2 Wing ribs	89%	93%	94%	90%	93%	91.9%	5	2
Cell 3 Ti fittings	79%	72%	83%	76%	77%	77.5%	14	12


Every escalation, by hour, is on the Floor board page and in the Audit Defense Pack's 13_Operations workbook; 49 escalations this period.

Shift handover: issues still open

Cell	Logged	Shift	Type	Issue	Assigned to	Days open
Cell 3 Ti fittings	2026-09-22	1st	quality	Two MER-3102 forgings back from Wichita Heat Treating at 29 HRC; quarantined and MRB requested	Quality engineering	16
Cell 1 Nacelle brackets	2026-09-23	2nd	equipment	HMC-02 spindle alarm three times this shift; running at reduced feed	Maintenance	15
Cell 2 Wing ribs	2026-09-24	1st	material	Heartland plate lot 44718 short 6 sheets; Tuesday's ribs moved to Thursday	Purchasing	14
Cell 1 Nacelle brackets	2026-09-25	1st	quality	Bore gauge BG-14 read 0.004 mm high against the master; parts since 06:00 on hold for re-measure	Metrology	13


Where the scrap comes from

88 parts scrapped over 46 entries. 4 of 6 reasons make up 87.5%: Hardness below spec after heat treat (31), Bore oversize (26), Burr / edge break (11), Chatter marks (9).

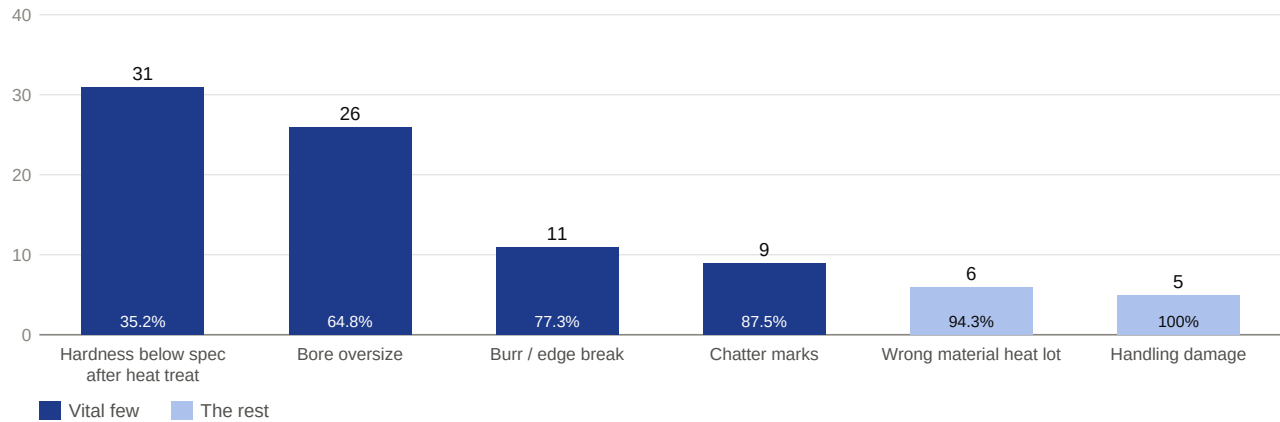

88 parts scrapped, by reason. Dark bars are the vital few (together 80%); the percentage in each bar is the cumulative share, largest first.

88 parts scrapped, by reason: 4 of 6 account for 87.5%: Hardness below spec after heat treat (31), Bore oversize (26), Burr / edge break (11), Chatter marks (9).

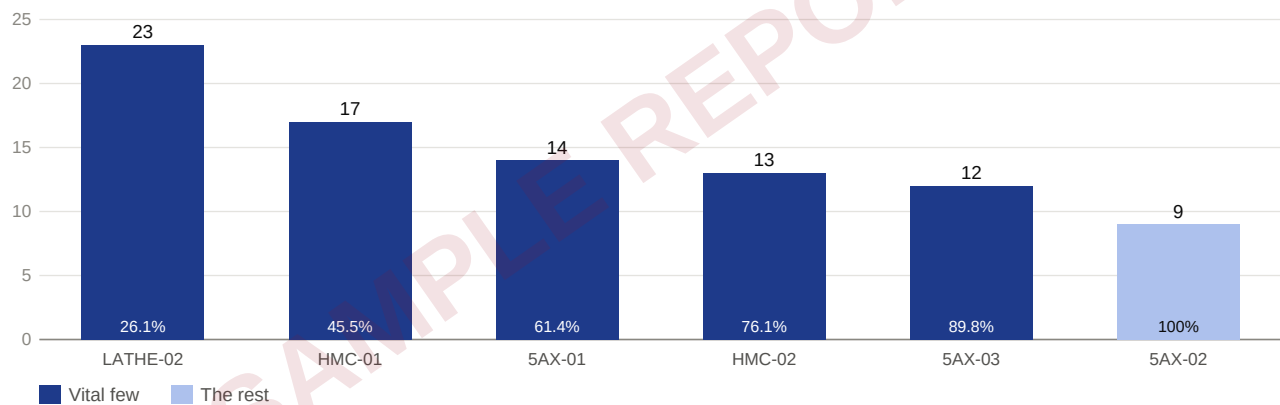


88 parts scrapped, by machine. Dark bars are the vital few (together 80%); the percentage in each bar is the cumulative share, largest first.

88 parts scrapped, by machine: 5 of 6 account for 89.8%: LATHE-02 (23), HMC-01 (17), 5AX-01 (14), HMC-02 (13), 5AX-03 (12).

Reason	Parts	Share	Cumulative	By machine
Hardness below spec after heat treat	31	35.2%	35.2%	HMC-02 8, HMC-01 7, 5AX-01 6, LATHE-02 6, 5AX-02 4
Bore oversize	26	29.5%	64.8%	HMC-01 7, LATHE-02 7, 5AX-03 6, 5AX-01 4, 5AX-02 2
Burr / edge break	11	12.5%	77.3%	LATHE-02 6, HMC-02 3, 5AX-03 2
Chatter marks	9	10.2%	87.5%	LATHE-02 4, 5AX-02 2, HMC-01 2, 5AX-03 1
Wrong material heat lot	6	6.8%	94.3%	5AX-03 3, 5AX-01 2, 5AX-02 1
Handling damage	5	5.7%	100%	5AX-01 2, HMC-02 2, HMC-01 1


MRB: cost and approvals

36 dispositions with \$1,098,100 of cost impact recorded; 6 awaiting a board decision.

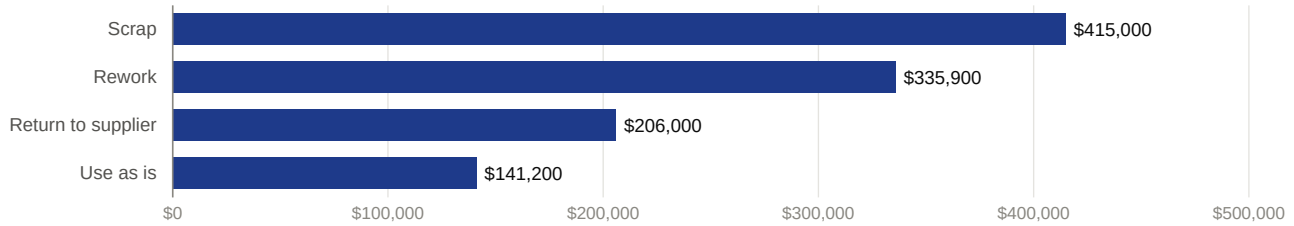

Cost impact recorded on the dispositions, by disposition.

MRB cost impact \$1,098,100: Scrap \$415,000, Rework \$335,900, Return to supplier \$206,000, Use as is \$141,200.

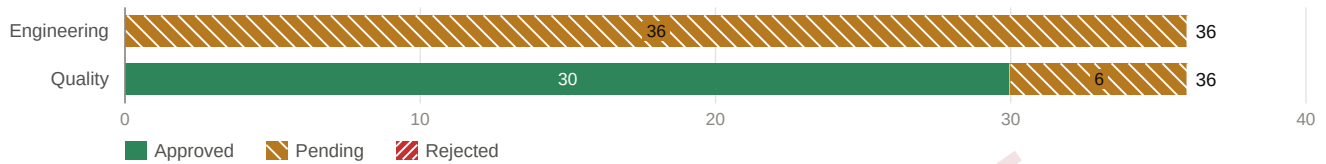

Dispositions by reviewer and decision. Customer counts only dispositions that need it.

MRB approvals: Engineering 0 approved, 36 pending, 0 rejected; Quality 30 approved, 6 pending, 0 rejected.

Disposition	Part	Type	Qty	Cost impact	Eng	Quality	Customer
NCR-MER-087	MER-3101	Rework	15	\$18,500	pending	pending	n/a
NCR-MER-088	MER-3108	Use as is	3	\$1,200	pending	pending	n/a
NCR-MER-089	MER-3102	Rework	7	\$29,000	pending	pending	n/a
NCR-MER-090	MER-3110	Scrap	3	\$52,000	pending	pending	n/a
NCR-MER-091	MER-3104	Return to supplier	10	\$14,000	pending	pending	n/a
NCR-MER-092	MER-3109	Return to supplier	18	\$27,000	pending	pending	n/a

Supplier onboarding




Supplier intakes by stage, from link sent to decision.

3 supplier intakes: 1 invited, 0 in progress, 1 submitted, 1 approved, 0 rejected.

Supplier	Stage	Red flags found	Decided by
Sunflower NDT Services	approved	None	V. Singh (QD)
Kansas Precision Plating	submitted	Special process 'chemical processing' offered without NADCAP accreditation for it; Special process 'coatings' offered without NADCAP accreditation for it; 1 root-cause analyses not closed: CAR-221; MER-3106: 40 good + 4 scrapped exceeds the 40 issued; Stated on-time delivery 98% but the imported data shows 50%	-
Salina Anodize & Plate	invited	None	-

Sub-tier special processes (NADCAP)

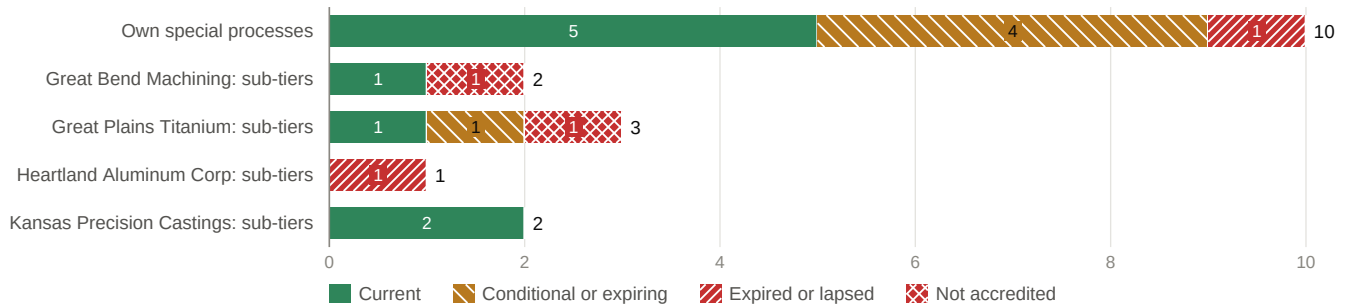

Special processes performed by each supplier's sub-tiers, and the organisation's own, by NADCAP or customer approval state, from the sub-tier map and the special-process register.

Own special processes: 5 current, 4 conditional or expiring, 1 expired or lapsed; Great Bend Machining: sub-tiers: 1 current, 1 not accredited; Great Plains Titanium: sub-tiers: 1 current, 1 conditional or expiring, 1 not accredited; Heartland Aluminum Corp: sub-tiers: 1 expired or lapsed; Kansas Precision Castings: sub-tiers: 2 current. 4 without a current approval.


Supplier	Sub-tier	Process	Status	Certificate	Expires
Great Bend Machining	Plains Surface Technologies	coatings	Not accredited	—	—
Great Plains Titanium	Central NDT Services	nondestructive testing	Expiring	NAD-NDT-11042	2026-10-15
Great Plains Titanium	Wichita Heat Treating Inc	nondestructive testing	Not accredited	—	—
Heartland Aluminum Corp	Flint Chemical Processing	chemical processing	Expired	NAD-CP-30911	2026-08-31

9. Risks

Risk	Score	Mitigation	Owner	Status	Due
RISK-MER-01 — CB surveillance audit failure leading to AS9100D suspension	25	Pre-audit readiness blitz — gap closure plan in 14 days	V. Singh (QD)	Identified	2026-11-04
RISK-MER-02 — Airbus de-source action on A320neo nacelle bracket program	20	Weekly recovery brief + dedicated expediting cell	T. Nakamura	Identified	2026-11-09
RISK-MER-03 — NADCAP heat treatment accreditation revoked	20	Pyrometry record restoration + furnace requalification	G. Hoffman	Identified	2026-10-25
RISK-MER-04 — Boeing contract termination for chronic SCAR non-closure	20	SCAR response team + root cause sprint	R. Vasquez	Identified	2026-11-02
RISK-MER-06 — Measurement system integrity — 32 overdue calibrations invalidate acceptance data	20	Emergency calibration vendor mobilization	L. Tran	Identified	2026-10-23
RISK-MER-05 — Titanium raw material traceability gaps expose latent field escapes	16	Lot-by-lot containment review + supplier CoC reconciliation	K. Williams	Identified	2026-11-06

Risk	Score	Mitigation	Owner	Status	Due
RISK-MER-07 — Workforce competency — 12 expired operator certs on active production lines	16	Accelerated requalification program + interim supervision	D. Kowalski	Identified	2026-10-29
RISK-MER-09 — GE Aviation engine mount bracket field return — hardness failure	15	Lot containment + heat treat parameter revalidation	R. Vasquez	Identified	2026-11-12
RISK-MER-08 — Spirit AeroSystems quality escalation — second-tier customer ripple effect	12	Proactive communication + shared corrective action visibility	T. Nakamura	Identified	2026-11-15
RISK-MER-10 — Insurance/liability exposure from uncontrolled product release	12	Legal review + product containment verification	V. Singh (QD)	Identified	2026-11-24

Process failure modes by severity and occurrence (PFMEA)

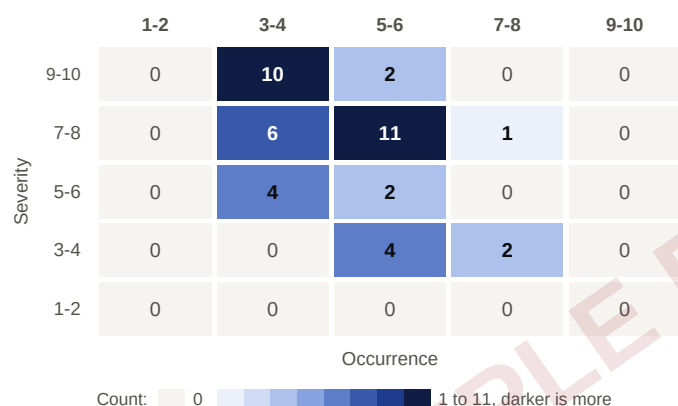

42 process failure modes by severity and occurrence band, from the PFMEA registers. Severity 9-10 is the top row.

42 failure modes; 30 with severity 7 or above; 1 with severity and occurrence both 7 or above.

10. Next steps

Next review: not yet scheduled — set the date on this QBR record.

Owners reporting progress at the next review: A. Chen, D. Kowalski, G. Hoffman, L. Tran, M. Okonkwo, R. Vasquez, Recovery Lead, T. Nakamura, V. Singh (QD).

Actions are tracked on the action register between reviews; an action past its due date is reported in section 5 and, where a trigger is defined, escalates as section 6 shows.

Findings behind this review

Finding and action	Severity	Clause	Timing	Owner
Quarantine the material in counterfeit case CF-MER-001, trace where it went, and notify the customers whose parts share the route	Safety	8.1.4	-	Not assigned
Quarantine the material in counterfeit case CF-MER-002, trace where it went, and notify the customers whose parts share the route	Safety	8.1.4	-	Not assigned
Quarantine the material in counterfeit case CF-MER-003, trace where it went, and notify the customers whose parts share the route	Safety	8.1.4	-	Not assigned
Stop releasing work through NDT — Radiographic Inspection until its approval is current, or move it to an approved source	Safety	8.5.1.2	-	Not assigned
Require Heartland Aluminum Corp to send chemical processing to a NADCAP-accredited source instead of Flint Chemical Processing, or show Flint Chemical Processing's current accreditation, before accepting more parts	Safety	8.4.2	-	Not assigned
Require Great Bend Machining to send coatings to a NADCAP-accredited source instead of Plains Surface Technologies, or show Plains Surface Technologies's current accreditation, before accepting more parts	Safety	8.4.2	-	Not assigned
Require Great Plains Titanium to send nondestructive testing to a NADCAP-accredited source instead of Wichita Heat Treating Inc, or show Wichita Heat Treating Inc's current accreditation, before accepting more parts	Safety	8.4.2	-	Not assigned
Finish the impact evaluation for Wilson Rockwell Hardness Tester (CAL-MER-02): identify product accepted on its measurements since the last good calibration and disposition it	Escape	7.1.5.2	-	Not assigned
Finish the impact evaluation for Fluke 1586A Super-DAQ Pyrometer (CAL-MER-03): identify product accepted on its measurements since the last good calibration and disposition it	Escape	7.1.5.2	-	Not assigned
Finish the impact evaluation for Bore Gauge 12mm (cell 4) (CAL-MER-121): identify product accepted on its measurements since the last good calibration and disposition it	Escape	7.1.5.2	-	Not assigned
Complete the open PPAP elements and sign the part submission warrant for MER-3102 (PPAP-MER-3102)	Escape	8.5.1.3	27 days over	Not assigned
Complete the open PPAP elements and sign the part submission warrant for MER-3103 (PPAP-MER-3103)	Escape	8.5.1.3	25 days over	Not assigned
Complete the open PPAP elements and sign the part submission warrant for MER-3104 (PPAP-MER-3104)	Escape	8.5.1.3	34 days over	Not assigned
Complete the open PPAP elements and sign the part submission warrant for MER-3101 (PPAP-MER-3101)	Escape	8.5.1.3	5 days over	Not assigned
Implement FLD-MER-05 (GE) in Heat Treat + Inspection, and record the evidence	Systemic	8.6	-	Not assigned
Flow down FLD-MER-13 (Spirit) to Great Bend Machining, and record the supplier's acknowledgement	Systemic	8.4.3	-	Not assigned

Finding and action	Severity	Clause	Timing	Owner
Implement FLD-MER-03 (Airbus) in Heat Treat, and record the evidence	Systemic	8.5.1	-	Not assigned
Implement FLD-MER-02 (Boeing) in Receiving Inspection, and record the evidence	Systemic	8.5.2	-	Not assigned
Flow down FLD-MER-11 (Airbus) to Titan Bar & Billet, and record the supplier's acknowledgement	Systemic	8.4.3	-	Not assigned
Flow down FLD-MER-01 (Boeing) to Great Plains Titanium, and record the supplier's acknowledgement	Systemic	8.4.3	-	Not assigned
Flow down FLD-MER-15 (GE) to Emporia Anodizing Co, and record the supplier's acknowledgement	Systemic	8.4.3	-	Not assigned
Implement FLD-MER-04 (Airbus) in Inspection, and record the evidence	Systemic	7.1.5.1	-	Not assigned
Implement FLD-MER-12 (Airbus) in FAI, and record the evidence	Systemic	8.5.1	-	Not assigned
Qualify the measurement system (Gage R&R) before relying on the capability result: Hardness HRC on MER-3107 measured with HT-2205	Systemic	7.1.5.2	-	Not assigned
Qualify the measurement system (Gage R&R) before relying on the capability result: Bore diameter on MER-3101 measured with BG-14	Systemic	7.1.5.2	-	Not assigned
Qualify the measurement system (Gage R&R) before relying on the capability result: Flange thickness on MER-3101 measured with MIC-7015	Systemic	7.1.5.2	-	Not assigned
Add the High-priority failure modes on MER-3104 (PFMEA-MER-3104) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Add the High-priority failure modes on MER-3103 (PFMEA-MER-3103) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Add the High-priority failure modes on MER-3101 (PFMEA-MER-3101) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Add the High-priority failure modes on MER-3105 (PFMEA-MER-3105) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Add the High-priority failure modes on MER-3106 (PFMEA-MER-3106) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Add the High-priority failure modes on MER-3102 (PFMEA-MER-3102) to the control plan, each with a control method and reaction plan	Systemic	8.1.1	-	Not assigned
Re-plan or escalate CAPA-MER-019: past due and still open	Systemic	10.2	89 days over	R. Vasquez
Re-plan or escalate CAPA-MER-052: past due and still open	Systemic	10.2	92 days over	P. Green
Re-plan or escalate CAPA-MER-029: past due and still open	Systemic	10.2	287 days over	T. Nakamura

Finding and action	Severity	Clause	Timing	Owner
Re-plan or escalate CAPA-MER-042: past due and still open	Systemic	10.2	221 days over	R. Vasquez
Confirm with Great Plains Titanium that Central NDT Services renews NADCAP NAD-NDT-11042 for nondestructive testing before 2026-10-15	Systemic	8.4.2	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3117 (FAI-MER-117)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3118 (FAI-MER-118)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3101 (FAI-MER-101)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3115 (FAI-MER-115)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3112 (FAI-MER-112)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3106 (FAI-MER-106)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3102 (FAI-MER-102)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3107 (FAI-MER-107)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3103 (FAI-MER-103)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3116 (FAI-MER-116)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3114 (FAI-MER-114)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3110 (FAI-MER-110)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3108 (FAI-MER-108)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3111 (FAI-MER-111)	Systemic	8.5.1.3	-	Not assigned
Complete the reviewer and approver signatures on the first article report for MER-3113 (FAI-MER-113)	Systemic	8.5.1.3	-	Not assigned
Complete the flow-down of FLD-MER-18 (Airbus) in Calibration, and record the evidence	Systemic	8.1	-	Not assigned
Complete the flow-down of FLD-MER-10 (GE) in All special processes, and record the evidence	Systemic	8.1	-	Not assigned
Complete the flow-down of FLD-MER-16 (Boeing) to Aero Fastener Brokers, and record the evidence	Systemic	8.4.3	-	Not assigned
Complete the flow-down of FLD-MER-09 (Airbus) in Heat Treat, and record the evidence	Systemic	8.1	-	Not assigned

Finding and action	Severity	Clause	Timing	Owner
Complete the open PPAP elements and sign the part submission warrant for MER-3105 (PPAP-MER-3105)	Systemic	8.5.1.3	Due in 19 days	Not assigned
Complete the open PPAP elements and sign the part submission warrant for MER-3106 (PPAP-MER-3106)	Systemic	8.5.1.3	Due in 41 days	Not assigned
Record who reviewed and approved the accepted first article report for MER-3104 (FAI-MER-104)	Internal	8.5.1.3	-	Not assigned
Record who reviewed and approved the accepted first article report for MER-3109 (FAI-MER-109)	Internal	8.5.1.3	-	Not assigned
Record who reviewed and approved the accepted first article report for MER-3105 (FAI-MER-105)	Internal	8.5.1.3	-	Not assigned

Attendees

V. Singh (QD), Plant GM

Every figure and citation is drawn from your records; the priority order is Aegis's assessment.

SAMPLE REPORT